

# **ANILAM**

## **5000M CNC Programming and Operations Manual**

## Warranty

ANILAM warrants its products to be free from defects in material and workmanship for one (1) year from date of installation. At our option, we will repair or replace any defective product upon prepaid return to our factory.

This warranty applies to all products when used in a normal industrial environment. Any unauthorized tampering, misuse or neglect will make this warranty null and void.

Under no circumstances will ANILAM, any affiliate, or related company assume any liability for loss of use or for any direct or consequential damages.

The foregoing warranties are in lieu of all other warranties expressed or implied, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose.

The information in this manual has been thoroughly reviewed and is believed to be accurate. ANILAM reserves the right to make changes to improve reliability, function or design without notice. ANILAM assumes no liability arising out of the application or use of the product described herein. All rights reserved. Subject to change without notice.

Copyright 2005 ACU-RITE Companies, Inc.

**Section 1 - Introduction**

Effectivity Notation .....	1-1
Getting Started .....	1-2
Programming Concepts.....	1-3
Programs.....	1-3
Axis Descriptions.....	1-3
X Axis .....	1-3
Y Axis .....	1-4
Z Axis .....	1-4
Defining Positions .....	1-4
Polar Coordinates.....	1-5
Absolute Positioning.....	1-5
Incremental Positioning .....	1-6
Angle Measurement .....	1-6
Plane Selection .....	1-7
Arc Direction.....	1-8

**Section 2 - CNC Console and Software Basics**

The Console.....	2-1
Keypad .....	2-2
Alphanumeric Keys.....	2-2
Editing Keys .....	2-5
CNC Keyboard (Option) .....	2-5
Soft Keys (F1) to (F10).....	2-6
Manual Panel .....	2-6
Software Basics .....	2-6
Pop-Up Menus.....	2-6
Screen Saver.....	2-6
Clearing Entries.....	2-6
Operator Prompts.....	2-7
Cursor.....	2-7
Typing Over and Inserting Text .....	2-7
Deleting Text .....	2-7
Messages/Error Messages.....	2-8

**Section 3 - Manual Operation and Machine Setup**

Powering On the CNC.....	3-1
Shutting Down the CNC .....	3-1
Emergency Stop (E-STOP) .....	3-1
Activating/Resetting the Servos .....	3-2
Manual Panel .....	3-2
Manual Panel Keys.....	3-3
Manual Panel LEDs.....	3-4
Manual Mode Screen .....	3-5
Machine Status Display Area Labels .....	3-6
Program Area Labels.....	3-6
Manual Mode Settings .....	3-7
Activating Manual Mode Rapid or Feed.....	3-9
Adjusting Rapid Move Speed .....	3-9
Absolute Mode.....	3-9
Jog Moves.....	3-10
Changing the Jog Mode .....	3-10

Selecting an Axis .....	3-10
Jogging the Machine (Incremental Moves) .....	3-11
Jogging the Machine (Continuous Moves) .....	3-11
Manual Data Input Mode .....	3-11
Using Manual Data Input Mode .....	3-12
Operating the Handwheel (Optional) .....	3-12

### Section 4 - Preparatory Functions: G-Codes

Rapid Traverse (G0) .....	4-2
Linear Interpolation (G1) .....	4-3
Angular Motion Programming Example .....	4-4
Circular Interpolation (G2 and G3) .....	4-5
Examples of Circular Interpolation .....	4-6
Dwell (G4) .....	4-9
Programming Non-modal Exact Stop Check (G9) .....	4-10
Plane Selection (G17, G18, G19) .....	4-10
Setting Software Limits (G22) .....	4-12
Returning to Reference Point (Machine Home) (G28) .....	4-14
Automatic Return from Reference Point (G29) .....	4-15
Probe Move (G31) .....	4-15
Fixture Offsets (Work Coordinate System Select), (G53) .....	4-16
Fixture Offset Table .....	4-16
Activating the Fixture Offset Table .....	4-16
Changing Fixture Offsets in the Table .....	4-17
Adjusting Fixture Offsets in the Table .....	4-17
Changing Fixture Offsets Using Calibrate Soft Keys .....	4-17
G53 Programming Examples .....	4-17
Modal Corner Rounding/Chamfering (G59, G60) .....	4-18
In-Position Mode (Exact Stop Check) (G61) .....	4-20
Automatic Feedrate Override for Arcs (G62, G63) .....	4-20
Contouring Mode (Cutting Mode) (G64) .....	4-21
User Macros (G65, G66, G67) .....	4-21
Axis Rotation (G68) .....	4-24
Activating Inch (G70) or MM (G71) Mode .....	4-28
Axis Scaling (G72) .....	4-29
Activating Absolute (G90) or Incremental (G91) Mode .....	4-29
Absolute Zero Point Programming (G92) .....	4-30
Feed in IPM (G94) .....	4-30
Feed Per Revolution (G95) .....	4-30
Adjusting Feedrate .....	4-31

### Section 5 - Ellipses, Spirals, Canned Cycles, and Subprograms

Ellipses (G5) .....	5-1
Spiral (G6) .....	5-3
Canned Cycles .....	5-5
Drilling, Tapping, and Boring Canned Cycles (G81 to G89) .....	5-5
Cancel Drill, Tap, or Bore Cycle (G80) .....	5-6
Spot Drilling (G81) .....	5-6
Counterboring (G82) .....	5-6
Peck Drilling (G83) .....	5-7
Tapping (G84) .....	5-8
Boring, Bi-directional (G85) .....	5-9
Boring, Unidirectional (G86) .....	5-9

---

Chip Breaker Peck Cycle (G87).....	5-10
Flat Bottom Bi-Directional Boring (G89) .....	5-11
Drilling Example.....	5-11
Pattern Drill Cycles .....	5-13
Bolt Hole Circle (G79).....	5-13
Hole Pattern (G179) .....	5-14
Pocket Cycles .....	5-16
Draft Angle Pocket Cycle (G73).....	5-17
Frame Pocket Milling (G75).....	5-19
Hole Milling (G76).....	5-21
Circular Pocket Milling (G77).....	5-23
Rectangular Pocket Milling (G78).....	5-25
Area Clearance (Irregular) Pocket Milling (G169).....	5-27
Pockets with Islands (G162).....	5-29
Irregular Pocket Examples .....	5-32
Facing Cycle (G170).....	5-34
Circular Profile Cycle (G171).....	5-36
Rectangular Profile Cycle (G172).....	5-38
Thread Mill Cycle (G181).....	5-40
Plunge Circular Pocket Milling (G177).....	5-44
Plunge Rectangular Pocket Milling (G178).....	5-46
Mold Rotation (G45) .....	5-47
Elbow Milling Cycle (G49) .....	5-58
Subprograms.....	5-63
Subprogram Addresses.....	5-63
Repetition of Subprogram (Loop) .....	5-64
Calling a Subprogram from a Subprogram .....	5-64
End of Subprogram (M99) with a P-Code.....	5-67
Subprogram for Multiple Parts Programming.....	5-67
Loop and Repeat Function .....	5-68
Probing Cycles.....	5-71
Tool Probe Cycles .....	5-71
Spindle Probe Cycles .....	5-86

## Section 6 - Program Editor

Activating the Program Editor.....	6-1
Activating Edit Mode from the Manual Screen.....	6-1
Activating Edit Mode from the Program Directory.....	6-1
Activating Edit Mode from Draw Graphics .....	6-1
Editing Soft Keys.....	6-2
Marking Programming Blocks .....	6-3
Unmarking Program Blocks.....	6-3
Saving Edits .....	6-4
Canceling Unsaved Edits .....	6-4
Deleting a Character .....	6-4
Deleting a Program Block.....	6-4
Undeleting a Block .....	6-5
Canceling Edits to a Program Block.....	6-5
Inserting Text without Overwriting Previous Text .....	6-5
Inserting Text and Overwriting Previous Text.....	6-6
Advancing to the Beginning or End of a Block .....	6-6
Advancing to the First or Last Block of a Program .....	6-6
Searching the Program Listing for Selected Text .....	6-6

---

Going to a Block of the Program Listing .....	6-7
Replacing Typed Text with New Text .....	6-8
Scrolling Through the Program .....	6-9
Paging Through the Program .....	6-9
Inserting a Blank Line .....	6-9
Abbreviating Statements .....	6-9
Copying Program Blocks .....	6-11
Pasting Blocks within a Program .....	6-12
Recording Keystrokes .....	6-12
Retrieving Recorded Keystrokes .....	6-12
Repeating a Command or Key .....	6-13
(Re)numbering Program Blocks .....	6-13
Printing the Entire Program .....	6-14
Printing a Portion of a Program .....	6-14
Accessing the Most Recently Used Programs .....	6-15
Opening Another Program from the Program Listing .....	6-15
Copying Blocks to Another Program .....	6-16
Copying an Entire Program into Another Program .....	6-16
Including Comments in a Program Listing .....	6-17

### Section 7 - Edit Help

Main Edit Help Menu .....	7-3
Help Template Menu .....	7-4
Help Graphic Screens .....	7-6
Edit Help Soft Keys .....	7-7
Edit Help Menu .....	7-8
Using Help Graphic Screens to Enter Program Blocks .....	7-10
Line Moves .....	7-12
Endpoint and Angle Calculation .....	7-13
Arcs .....	7-15
Multiple Move Commands .....	7-21
Modal G-Code Box .....	7-31
G-Code Listing .....	7-32
Entering a G-Code .....	7-32
Entry Fields .....	7-33
M-Code Listing .....	7-34
Entering an M-Code .....	7-35
Typing in Address Words .....	7-35
Typing in M-Codes .....	7-36

### Section 8 - Viewing Programs with Draw

Starting Draw .....	8-1
Draw Screen Description .....	8-2
Putting Draw in Hold .....	8-3
Canceling Draw .....	8-3
Draw Parameters .....	8-4
Tool On or Off .....	8-4
Drawing Compensated Moves .....	8-5
Showing Rapid Moves .....	8-5
Setting Grid Line Type .....	8-6
Setting Grid Size .....	8-6
Putting Draw in Motion, S.Step, or Auto Mode .....	8-6
Automatic Draw Restart .....	8-7

---

Erasing the Draw Display .....	8-8
Running Draw for Selected Blocks.....	8-8
Starting Draw at a Specific Block .....	8-8
Ending Draw at a Specific Block.....	8-9
Adjusting Draw Display .....	8-9
Fitting the Display to the Viewing Window.....	8-10
Scaling the Display by a Factor.....	8-10
Using the Window Zoom .....	8-11
Halving Display Size .....	8-12
Doubling Display Size .....	8-12
Changing the Viewing Area without Changing the Scale .....	8-12
Erasing Display .....	8-13

## Section 9 - Tool Page and Tool Management

Activating the Tool Page .....	9-1
Using the Tool Page.....	9-2
Finding Tools by Number .....	9-3
Changing Tool Page Values .....	9-3
Clearing a Tool (Whole Row).....	9-3
Clearing a Single Value .....	9-3
Adjusting a Single Value.....	9-4
Tool Page Soft Keys and Secondary Soft Keys .....	9-4
T-Codes and Tool Activation .....	9-5
Tool Definition Blocks .....	9-5
Tool-Length Offsets.....	9-6
Entering Offsets in the Tool Page.....	9-7
Setting Tool-Length Offsets .....	9-8
Entering the Z Position Manually.....	9-9
Diameter Offset in Tool Page .....	9-9
Tool Path Compensation (G41, G42) .....	9-10
Using Tool Diameter Compensation and Length Offsets with Ball-End Mills.....	9-14
Compensation (G40, G41, G42) .....	9-14
Cancel Mode in Tool Compensation: G40 .....	9-14
Change of Tool Compensation Direction .....	9-15
Startup and Movement in Z-axis.....	9-15
Temporary Change of Tool Diameter .....	9-16
Motion of Tool During Tool Compensation .....	9-17
Compensation Around Acute Angles.....	9-19
Change of Offset Direction .....	9-20
General Precautions.....	9-21
G41 Programming Example .....	9-22
G42 Program Example .....	9-23
Activating Offsets via the Program .....	9-25
Setting RefProg Offset .....	9-26

## Section 10 - Program Management

Changing the Program Directory.....	10-2
Viewing All Programs of All Formats .....	10-2
Creating a New Part Program .....	10-3
Choosing Program Names .....	10-3
Loading a Program for Running.....	10-3
Selecting a Program for Editing and Utilities .....	10-3
Maximizing Program Storage Space.....	10-4

---

Displaying Program Blocks .....	10-5
Deleting a Program .....	10-5
Logging On to Other Drives.....	10-6
Marking and Unmarking Programs.....	10-6
Marking Programs .....	10-6
Unmarking Marked Programs.....	10-7
Marking All Programs .....	10-7
Unmarking All Marked Programs.....	10-7
Deleting Groups of Programs.....	10-8
Restoring Programs .....	10-8
Copying Programs to Floppy Disks .....	10-9
Renaming Programs .....	10-9
Printing Programs .....	10-9
Checking Disks for Lost Program Fragments.....	10-10
Displaying System Information.....	10-10
Using Wildcards to Find Programs.....	10-11
Copying Programs from/to Other Directories .....	10-12
Renaming Programs from/to Another Directory .....	10-13
Printing Programs from Another Drive/Directory .....	10-13
Creating Subdirectories.....	10-14
Deleting Programs on Another Drive.....	10-14
Listing a Program in Another Drive/Directory .....	10-14
Editing a Program in Another Directory.....	10-15
Optimizing Your Hard Disk.....	10-15
Accessing the Disk Optimizer.....	10-15

### Section 11 - Running Programs

Running a Program One Step at a Time .....	11-1
Switching Between Motion and Single-Step Mode .....	11-2
Holding or Canceling a Single-Step Run .....	11-2
Single-Step Execution of Selected Program Blocks .....	11-3
Position Display Modes.....	11-4
Automatic Program Execution.....	11-4
Holding or Canceling an Auto Run .....	11-5
Starting at a Specific Block.....	11-5
Clearing a Halted Program.....	11-5
Using Draw while Running Programs.....	11-6
Setting the CNC to Display an Enlarged Position Display.....	11-7
Teach Mode.....	11-7
Initiating Teach Mode .....	11-8
Teach Mode Soft Keys .....	11-8
Inputting Data with Teach Mode.....	11-9
Using Teach Mode .....	11-10
Exiting Teach Mode.....	11-10
Parts Counter and Program Timer .....	11-11
Jog/Return.....	11-12
Initiating Jog/Return.....	11-12
Operations Allowed While “In” Jog/Return.....	11-12
Jog/Return Soft Keys.....	11-13
EXAMPLES:.....	11-15
Notes on Jog/Return.....	11-17



**Section 12 - S and M Functions**

Speed Spindle Control (S-Function).....	12-1
Miscellaneous Functions (M-Code).....	12-2
Control M-Codes .....	12-2
Order of Execution .....	12-4

**Section 13 - Communication and DNC**

Communication .....	13-1
Installing the RS-232 Cable.....	13-1
Accessing the Communication Software.....	13-2
Setting Communication Parameters.....	13-3
Selecting the Communication Port .....	13-3
Setting the Baud .....	13-3
Setting Parity .....	13-3
Setting Data Bits.....	13-4
Setting Stop Bits.....	13-4
Software Setting .....	13-4
Setting Data Type.....	13-5
Testing the Data Link .....	13-5
Activating the Test Link Screen.....	13-6
Setting Test Link Display Modes .....	13-6
Testing the Link .....	13-7
Clearing the Receive Area.....	13-7
Clearing the Transmit Area.....	13-7
Sending a Program .....	13-7
Receiving a Program.....	13-7
Setting the Transmission and Receiving Display.....	13-8
Holding Transmission/Receiving Operations.....	13-8
Using Data Control (DC) Codes .....	13-8
Using DC Codes in Receive Mode .....	13-9
Using DC Codes in Send Mode.....	13-9
Running in DNC .....	13-9
Accessing DNC .....	13-10

**Section 14 - Machine Software and Peripherals Installation**

Machine Software Installation .....	14-1
Software Option Kit Installation .....	14-1
Printer Installation .....	14-2
Keyboard Installation (Option).....	14-2
Keypad Equivalent Keyboard Keys .....	14-2

**Section 15 - Off-line Software**

Introduction .....	15-1
Passwords.....	15-1
Exiting the Software .....	15-1
Windows Off-line Software Installation.....	15-2
Running Off-line Software from Windows.....	15-2
System Settings .....	15-2
Maximum Memory Allocated .....	15-2
Disabled Features .....	15-3

### Section 16 - Four- and Five-Axis Programming

Axis Types.....	16-1
Rotary Axis Programming Conventions.....	16-2
Non-Synchronous or Synchronous Auxiliary Axis .....	16-2
Programming Examples .....	16-3
Example 1: Drill (Sync-Off) .....	16-4
Example 2: Mill (Sync-On).....	16-5
Example 3: Mill (Sync-On).....	16-6

### Section 17 - DXF Converter Feature

Requirements.....	17-1
Off-line Software.....	17-1
Machine Software.....	17-1
Entry to the DXF Converter .....	17-2
Creating Shapes.....	17-2
Contours.....	17-3
Drilling .....	17-3
CNC Code.....	17-3
Mouse Operations.....	17-4
DXF Hot Keys .....	17-5
Toggle Entity Endpoints (ALT + F) .....	17-5
DXF Soft Keys.....	17-6
Miscellaneous DXF Soft Key, F6.....	17-7
Output Menu Options .....	17-8
Shift X, Shift Y Descriptions.....	17-8
Convert Polyline Description.....	17-9
Display Menu Options .....	17-9
DXF Entities Supported.....	17-10
Drawing Entities Not Supported.....	17-10
Files Created.....	17-11
DXF Examples .....	17-11
Unedited Conversational Program Listing .....	17-13
Unedited G-code Program Listing .....	17-14
Edited Conversational Program Listing .....	17-15
Edited G-code Tool Path .....	17-16
Edited G-code Program Listing.....	17-17
Using DXF for Pockets with Islands (G162) .....	17-18
Creating CAM Shapes.....	17-21

### Section 18 - CAM Programming

CAM Mode .....	18-1
CAM Mode Soft Keys.....	18-2
Shape (F2) Soft Keys .....	18-3
Shape Edit Menu .....	18-4
Rev Arc .....	18-6
Delete.....	18-6
Project.....	18-6
Join .....	18-7
Import.....	18-7
View (F4).....	18-7
MOTION (F7) .....	18-8
Del Move (F8) .....	18-8
Contour .....	18-8

---

Pocket .....	18-15
Pocket Menus Soft Keys .....	18-21
Pockets with Islands (G162).....	18-21
Drill .....	18-21
Edit .....	18-24
Delete .....	18-24
POST (F8).....	18-25
SETUP (F9).....	18-25
Shapes .....	18-26
Paths .....	18-27
Geometry.....	18-27
Post .....	18-27
Posting Output Automatic Tool Changes.....	18-30
Exit (F10).....	18-31
Hot Keys.....	18-31
Using the Shape Cursor .....	18-32
Selecting Editing Tools.....	18-32
Line Tools.....	18-33
Arc Tools.....	18-36
Corner Radius .....	18-37
Chamfering Corners .....	18-37
Shape Edit Soft Keys .....	18-37
Reversing an Arc's Direction .....	18-38
Deleting a Shape .....	18-38
Projecting Line Segments (Restoring Sharp Corners).....	18-38
Joining Line Segments .....	18-39
Importing Shapes from Other Programs .....	18-39
Deleting a Segment.....	18-39
Changing the CAM Mode View.....	18-40
Viewing a Listing of Shape Segment Details .....	18-40
Using Construction Geometry .....	18-42
Accessing Geometry Tools .....	18-42
Point Tools .....	18-43
Line Tools.....	18-44
Circle Tools .....	18-45
Notes on Geometry .....	18-45
Chaining Geometry Elements to Create a Shape .....	18-46
Viewing a Listing of Geometry Elements.....	18-46
Deleting Geometry Elements .....	18-47
Deleting All Geometry Elements .....	18-47
Managing Shape Files.....	18-47
Using Shapes in G-code Programs.....	18-48
Sample Programs .....	18-48
Example #1 Machining an Outside Profile with Contour.....	18-48
Example #2 Machining a Slot using Contour.....	18-52
Example #3 Machining an Outside Profile using Contour.....	18-55
Example #4 Machining a Contour with Many Unknown Intersections .....	18-59
Example #5 Contour with Many Unknown Intersections - All Tangent Arcs .....	18-61
Example #6 Pocket Milled into Workpiece.....	18-65
Example #7 Milled Pocket - X0 Y0 at Center of Radius.....	18-67
Example #8 Pocket Milled into Workpiece - X0 Y0 at Lower Left Corner .....	18-70
Example #9 Milled Pocket - X0 Y0 at the Center of the Large Radius.....	18-73
Example #10 Series of Holes using Drill.....	18-75
Example #11 Pocket, Contour, and Drill.....	18-77

---

---

Example #12 Using CAM for Pockets with Islands (G162).....	18-82
Additional Drawings for Practice.....	18-85

**Section 19 - Advanced Programming Features**

Modifiers.....	19-1
Block Separators.....	19-1
Tool Offset Modification .....	19-2
Expressions and Functions .....	19-4
Examples.....	19-5
System Variables .....	19-6
User Variables.....	19-7
Variable Programming (Parametric Programming).....	19-8
User Macros (G65, G66, G67) .....	19-14
Macro Body Structure.....	19-14
Setting and Passing Parameters .....	19-15
Probe Move (G31).....	19-22
Conditional Statements .....	19-23
Unconditional LOOP Repeat .....	19-25
Short Form Addressing .....	19-25
Logical and Comparative Terms .....	19-26
Logical Terms.....	19-26
Comparative Terms .....	19-26
File Inclusion .....	19-27
<b>Index</b> .....	<b>Index-1</b>


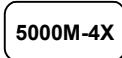
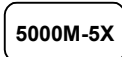
## Section 1 - Introduction

This manual describes the concepts, programming commands, and CNC programming formats used to program ANILAM 5000M CNC products. Use the Contents and Index to locate topics of interest. In general, topics are presented in order of complexity. For example, “Section 1” describes basic CNC topics while later sections describe CAM programming and special programming features that require a firm grasp of CNC programming.

### Effectivity Notation

Some sections of this manual apply only to specific configurations of the 5000M CNCs. In these sections, icons in the left margin identify the configurations to which the information applies. **Table 1-1** lists the icons for each CNC configuration and the number of axes supported by each.

**Table 1-1, CNC Effectivity Icon Description**

Icon	Product	Axes Supported
	5000M Three Axes System	3
	5000M Four Axes System	4
	5000M Five Axes System	5

**NOTE:** All systems also support one spindle axis.

The main difference between the configurations is the number of axes supported. Generally, this manual describes the 5000M three axes configurations. The four and five axes configurations operate exactly as the three axes configuration except for features that include the additional axes.

## Getting Started

Before you start to write a program, determine the work-holding device and the location of Part Zero (the point to which all movement is referenced). Since absolute positions are defined from Part Zero, try to select a location that directly corresponds to dimensions provided on the part print, such as the lower left corner of the work. Then, you can develop a program using a procedure similar to the one that follows:

1. To enter the Program Directory from the Manual screen, press **PROGRAM (F2)**. Create a program name for the part.
2. Enter the Program Editor (**Edit F8**) to open the new program and start writing blocks.
3. The first block of any program is usually a safe start position and tool-change position (a position away from the work where the axes can return for safe tool changing). The first block is normally also used to specify the units of measurement (Inch/MM), mode of operation (Absolute), and move type (Rapid) and to cancel all auxiliary functions (Tool Offsets, Spindle, and Coolant).

Typical first block:      G70 G90 G0 X0 Z0 T0 M5

4. Subsequent blocks in the program set Spindle information, call Tool number, turn on Coolant, and make the initial move toward the work.
5. The remaining blocks in the program describe the required moves, Canned Cycles, and Tool changes to complete the machining.
6. The next to the last block in the program returns the axes to the Tool change position, turning off any auxiliary functions (Tool Offsets, Spindle, and Coolant). The last block (M2) ends the program.

Typical final blocks:    M5  
                              G0 T0 X0 Y0 Z0 M9  
                              M2

7. After you write a program, verify it. Run it in Draw Graphics Mode to troubleshoot for errors. Verify that all programmed moves are safe and accurate to the part print dimensions.
8. Now, load the stock material into the selected work-holding device.
9. Set the Tool Offsets for each tool in the Tool Page.
10. Before running the part in the Auto Mode, run it in Single-Step Mode to verify that both the program and the setting of Tool Offsets have been correctly completed. Single-Step Mode allows you to execute the program block-by-block.
11. After you test the program, make any necessary corrections.
12. When the finished program is ready for production, back it up on a floppy disk.

## Programming Concepts

This section contains programming concepts for the beginning programmer. You must master these concepts and be familiar with the terminology in order to write programs.

## Programs

A program is the set of instructions that the CNC uses to direct the machine movements. Each line of instructions is called a block. Each block runs independently, thus allowing the program to be stepped along, one block at a time.


## Axis Descriptions

The machine moves along its axes of motion. All movements along an axis are either in a positive or negative direction. Not all machines use the same system to identify axes. The descriptions used in this manual are commonly used to identify 3-axis mills.

**NOTE:** To visualize machine movements correctly, imagine tool motion rather than table motion.

### X Axis

Table movement along the X-axis is to the left and right. Positive motion is table movement to the left; negative motion is table movement to the right. Refer to **Figure 1-1**.

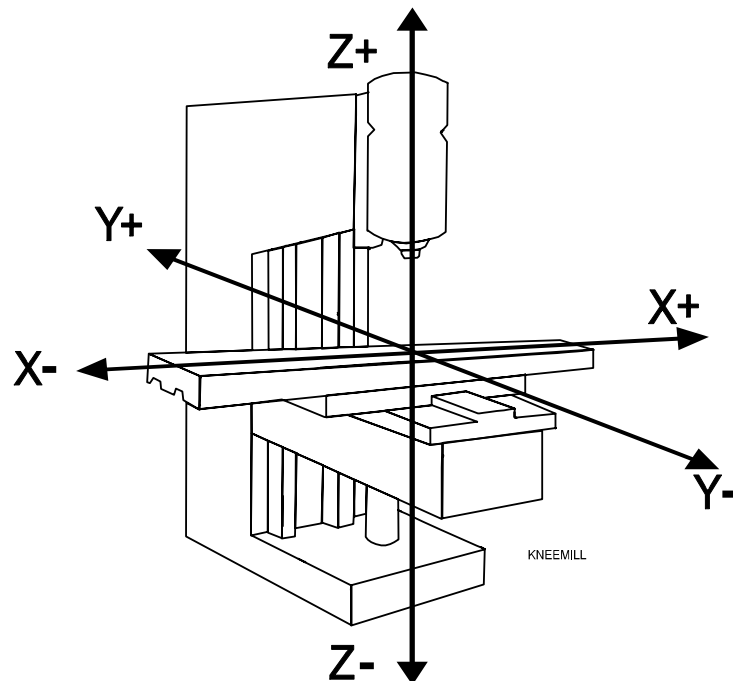

**Figure 1-1, Mill Axes of Motion**

## Y Axis

Table movement along the Y-axis is inward and outward. Positive motion is table movement outward; negative motion is table movement inward.


## Z Axis

Spindle movement along the Z-axis is upward and downward. Positive motion is tool movement upward (away from the workpiece); negative motion is tool movement downward (into the workpiece).

## Defining Positions

The intersection of the X-, Y-, and Z-axes is the reference point from which to define most positions. Refer to **Figure 1-2**. This point is the X0, Y0, and Z0 position.

Most positions are identified by their X, Y, and Z coordinates. A position two inches left, three inches back, and four inches up has an X coordinate of X -2.0, a Y coordinate of Y3.0, and a Z coordinate of Z4.0.

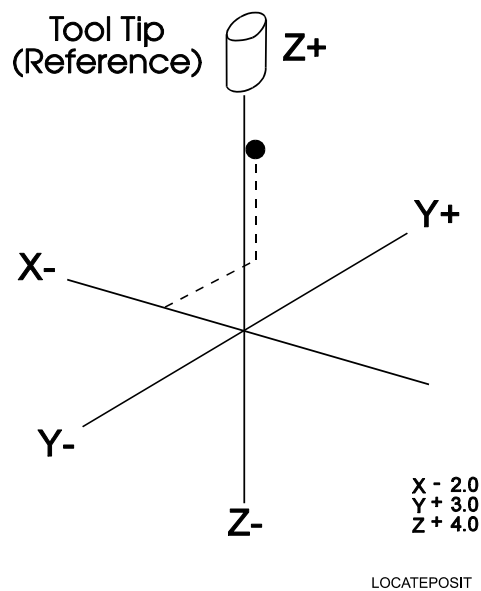


**Figure 1-2, Locating Positions**



## Polar Coordinates


Polar Coordinates define points that lie only on a single plane. Polar coordinates use the distance from the origin and an angle to locate points. Refer to **Figure 1-3**.

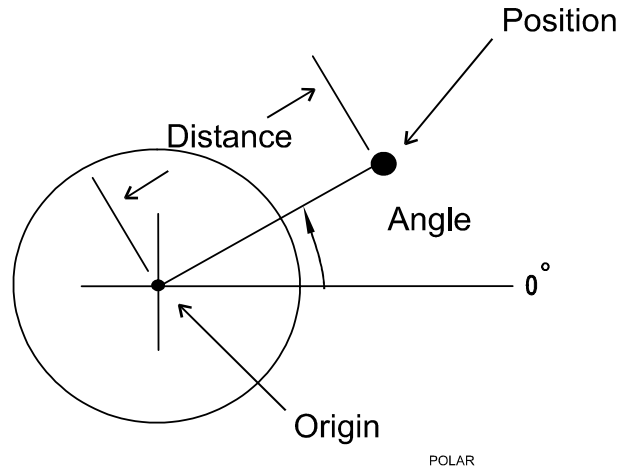

**Figure 1-3, Polar Coordinate System**

## Absolute Positioning

In Absolute Mode, all positions are measured from Absolute Zero. Absolute Zero is not a fixed position on the machine. It is a selected point. Refer to **Figure 1-4**.

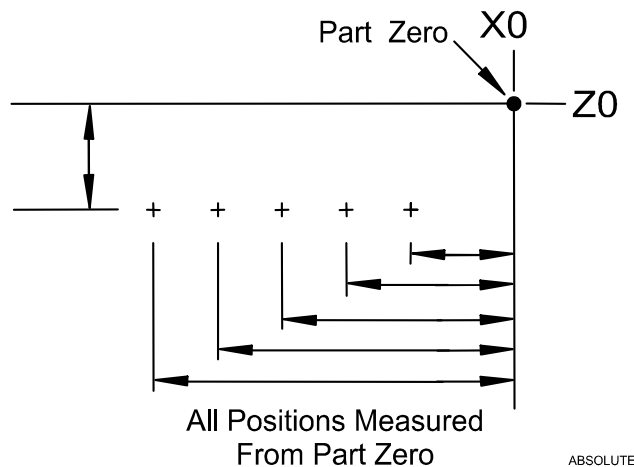

**Figure 1-4, Absolute Positioning**


You can set Absolute Zero (X0, Y0) anywhere. Usually, it is set at a position that enables you to use the dimensions specified on the blueprint. This is also called setting the Part Zero.

The Absolute Zero (Part Zero) can be moved as often as necessary, either manually or in a program.

### Incremental Positioning

Incremental positions are measured from one point to another, or from the machines present position. This is convenient for performing an operation at regular intervals. Incremental positions are measured from the tool's present position. Refer to **Figure 1-5**.


**NOTE:** An incremental 0 inch (0 mm) move will not make a position change because you are located at the 0 reference point (current position).

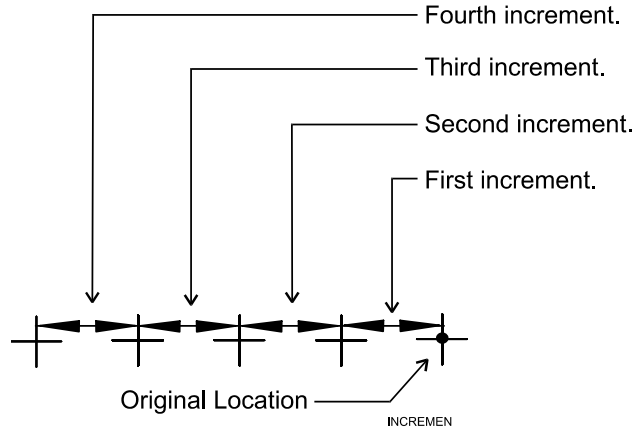

**Figure 1-5, Incremental Positioning**

### Angle Measurement

Angles are measured with the 3 o'clock position as the Zero Degree Reference. Positive angles rotate counter-clockwise; negative angles rotate clockwise. Refer to **Figure 1-6**.

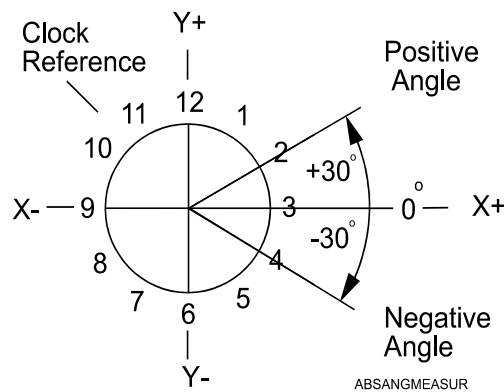


**Figure 1-6, Absolute Angle Measurement**

## Plane Selection

Circular moves and tool diameter compensation are confined to the plane you select. Three planes are available: the XY plane (G17), the XZ plane (G18), and the YZ plane (G19). It is important to view a plane correctly when you plan a circular move. If a plane is viewed from the wrong side, arc directions, angle references, and axis signs to appear reversed.


The standard rule is to view a plane looking in the negative direction along the unused axis. Refer to **Figure 1-7**.

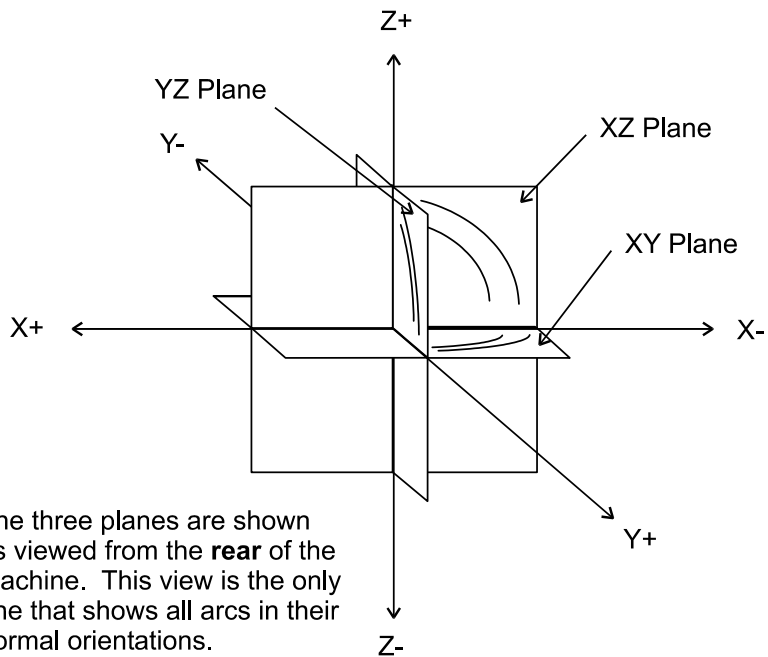

**Figure 1-7, Plane Identification**

## Arc Direction

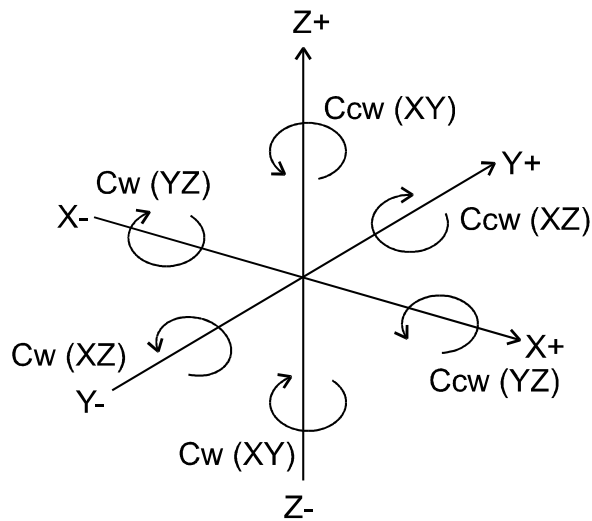The standard rule is to view arc direction for a plane from the positive towards the negative direction along the unused axis. From this viewpoint clockwise (Cw) and counterclockwise (Ccw) arc directions can be determined. For example, in the XY plane, you view along the Z-axis, from Z+ toward Z-, to determine Cw/Ccw directions. The Cw/Ccw arc directions for each plane are shown in **Figure 1-8**.




ARCDIR

**Figure 1-8, Clockwise and Counterclockwise Arc Directions**

## Section 2 - CNC Console and Software Basics

### The Console

The CNC console consists of a 12.1" color, flat-panel Liquid Crystal Display (LCD), a keypad to the right of the LCD, soft keys under the LCD and the manual panel. In some configurations, the manual panel section is separate from the LCD and keypad. Refer to **Figure 2-1**.

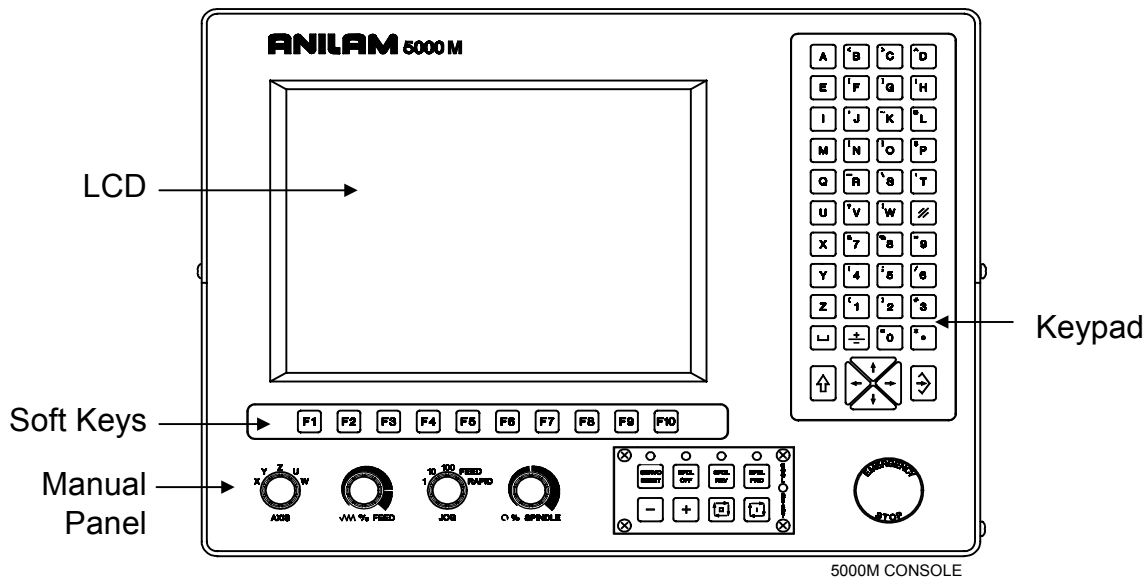


**Figure 2-1, CNC Console**

### Keypad

Refer to **Figure 2-2**. The keypad to the right of the LCD has the following areas:

**Alphanumeric Keys:** This area consists of the letters of the alphabet listed sequentially from **A** to **W**, and also includes the **CLEAR** key (lower right), the numerical keypad (**0** through **9**) and the **SPACE** key (lower-left).

**Edit Keys:** This area contains the **SHIFT** (left), **ENTER** (right) and the cursor control keys (**ARROWS**).

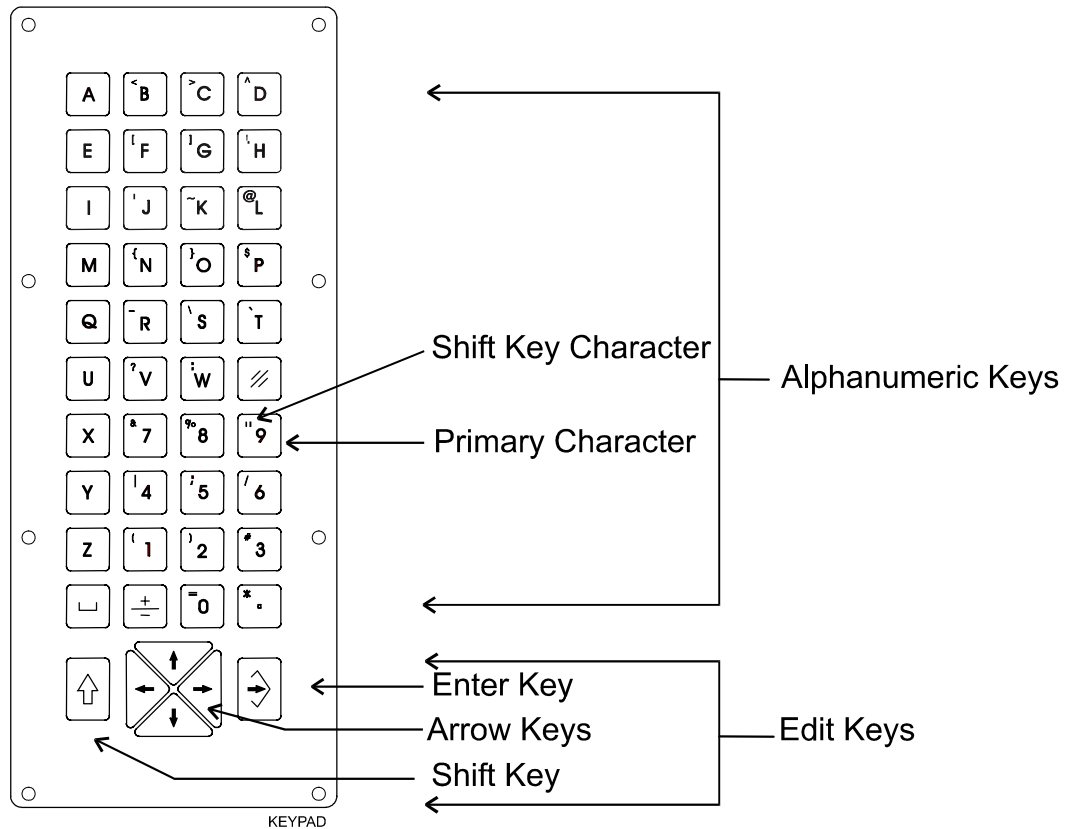

**Figure 2-2, Keypad**

### Alphanumeric Keys

Alphanumeric keys allow you to enter position coordinates (XYZ moves) and program G, M, S, and T codes. Some keyfaces have two characters, a large one in the middle of the key and a smaller one in the upper-left corner. The large characters are Primary characters. The smaller characters are **SHIFT** key characters.

To type a primary character, press the key that contains that character.  
 To type a **SHIFT** key character:




 














 

1. Press **SHIFT**. You do not need to hold down the key, it remains on until you press the next key.
2. Press the key that displays the required character in the upper-left corner. Refer to **Table 2-1**.

**Table 2-1, Alphanumeric Keys**

Key Face	Primary Function	SHIFT Function
	Letter A	None
	Letter B	Less Than Symbol
	Letter C	Greater Than Symbol
	Letter D	Caret
	Letter E	None
	Letter F/Feedrate	Left Bracket
	Letter G/G Codes	Right Bracket
	Letter H	Exclamation Point
	Letter I	None
	Letter J	Apostrophe
	Letter K	Tilde Symbol
	Letter L	“At” Symbol
	Letter M Miscellaneous Functions	None
	Letter N	Left Curly Bracket
	Letter O Program Number Designator	Right Curly Bracket

*(Continued...)*


 


**Table 2-1, Alphanumeric Keys (Continued)**

Key Face	Primary Function	SHIFT Function
	Letter P	Dollar Sign
	Letter Q	None
	Letter R	Underscore
	Letter S/Spindle Speed Designator	Backslash
	Letter T/Tool words	Single Quote
	Letter U	None
	Letter V	Question Mark
	Letter W	Colon
	Letter X/X Axis Coordinate	None
	Letter Y/Y Axis Coordinate	None
	Letter Z/Z Axis Coordinate	None
	Number One	Left Parenthesis
	Number Two	Right Parenthesis
	Number Three	Pound or Number Sign
	Number Four	Vertical Bar: used to separate parts of a blueprint-programming block for angles/chamfers/radii.
	Number Five	Semi-Colon
	Number Six	Slash
	Number Seven	Ampersand
	Number Eight	Percent Symbol
	Number Nine	Inch Symbol

*(Continued...)*

 



 

Table 2-1, Alphanumeric Keys (Continued)

Key Face	Primary Function	SHIFT Function
	Number 0	Equal Sign
	Minus Sign/Dash	Plus Sign
	Period/Decimal Sign	Asterisk: used to “comment out” all or part of a block (characters to the right of the asterisk are ignored). The CNC ignores these blocks.
	Space Key	Blank Space

### Editing Keys

Use the Editing Keys to edit programs and move around the screen. Refer to **Table 2-2**.

Table 2-2, Editing Keys

Label or Name	Key Face	Purpose
SHIFT		Displays additional options on the soft key menu. Allows access to additional soft keys.
CLEAR		Clears selected messages, values, commands and program blocks.
ARROW		Allows you to move highlight bars and cursor around the screen.
ENTER		Activates menu selections, activates alphanumeric entry, creates new line.

Use Editing Keys to control machine movements manually. Refer to [“Section 3 - Manual Operation and Machine Setup”](#) for a detailed description of the Manual Panel.

### CNC Keyboard (Option)

The CNC supports most standard PC keyboards. Refer to [“Section 14 - Machine Software and Peripherals Installation.”](#) All keypad inputs except **E-STOP** and **SERVO RESET** have assigned keyboard equivalents.

### Soft Keys (F1) to (F10)

Labeled soft keys **F1** to **F10**, also called function keys, are located just below the monitor. Soft key functions are not hardwired; their functions change with changes in mode. Labels indicate the function of each soft key. Unlabeled soft keys are inactive.


### Manual Panel

Refer to "[Section 3 - Manual Operation and Machine Setup](#)" for information on the manual panel and the optional handwheel.

### Software Basics

#### Pop-Up Menus

Pop-up menus are temporary menus that allow you to make additional selections. Each pop-up menu contains a highlight bar. The **ARROWS** move the highlight bar up and down the menu. Press **ENTER** to activate a highlighted selection. Press the soft key again or press **CLEAR** to deactivate the function. Refer to **Figure 2-3**.

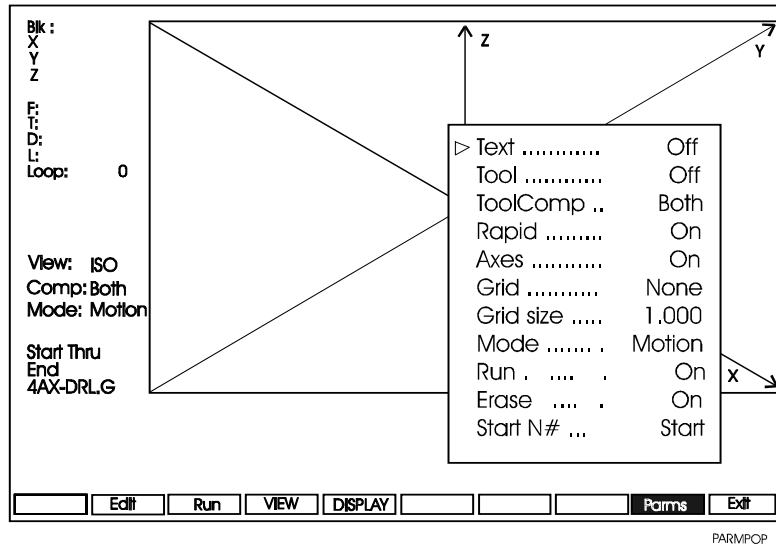

**Figure 2-3, Pop-Up Menu**

#### Screen Saver

After a set period of inactivity, the CNC dims to preserve the LCD. The CNC prompts you to press any key to restore its ready status.

#### Clearing Entries

Press **CLEAR** to clear an entry in an entry field, a line from a program, or a message on the message line.

**Operator Prompts**

The CNC sometimes prompts for required information. Enter numbers from the keypad.

**Cursor**

The CNC uses either a cursor or highlight to mark an item for selection or editing. The highlight is displayed in the Edit Mode, Program Directory, and Manual Mode. Use the **ARROWS** to move the highlight. The software highlights a selected item in a menu or window. Selected items can be activated or changed.

For instance, highlight a program block in Edit Mode to edit it. Highlight an entry field label in a graphic menu to enter a value or toggle between the available selections.

The cursor is displayed when the Tool Page activates. The cursor is a white underline that indicates where letters and numbers will be inserted.

**Typing Over and Inserting Text**

The Editor has two text-entry modes, **Typeover** and **Insert** [Default: **Typeover**]. In the Typeover mode, new characters replace characters marked by the cursor.

In the Insert Mode, new characters appear at the cursor and existing characters move to the right. When the Insert Mode is active, **Ins (F3)** highlights. To put the CNC in the Insert mode:

1. When the CNC prompts for a name, press **Ins (F3)**. The CNC Highlights **Ins (F3)**.


**Deleting Text**

To delete text:

1. Move the cursor to underline the text to be deleted.
2. Press **Del (F4)** to delete the selected text.

### Messages/Error Messages

The CNC displays Messages it generates in the Message Area, present in all program-running modes. When the CNC generates more than one message, it displays the message with the highest priority in the Message Area. Lower-priority messages remain in memory. Refer to **Figure 2-4**.

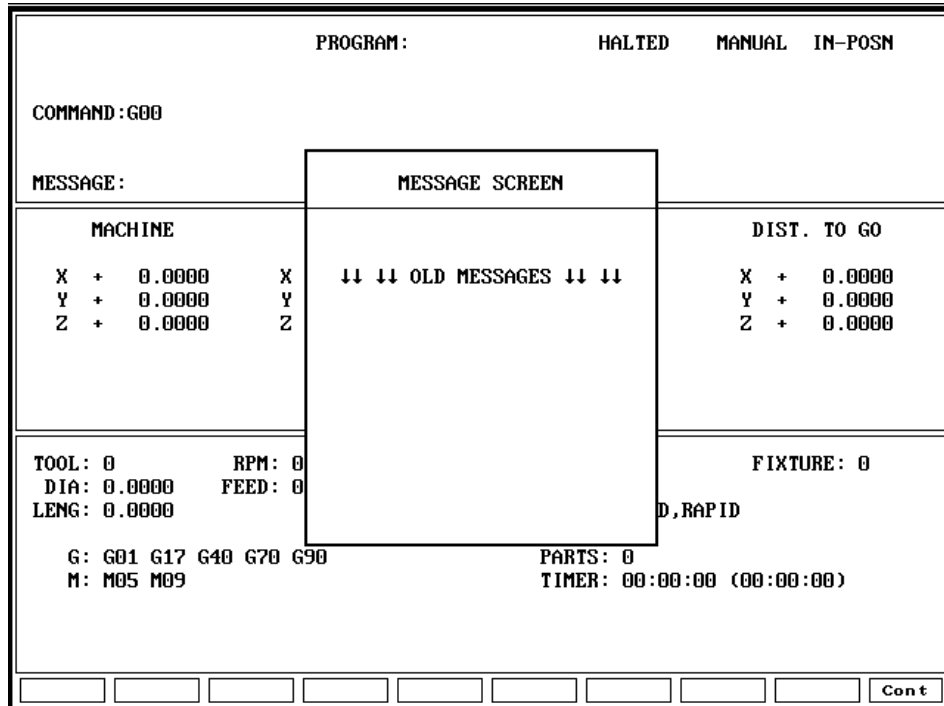

**Figure 2-4, Messages Display**

The on-screen **MESSAGE** label highlights when pending messages remain in memory. You can review pending messages as follows:

- ❑ Press **CLEAR** to clear the current message and display the next message.
- ❑ From the Manual screen, press **MESSAGE (SHIFT + F1)** to display messages in the center of the screen.

Some messages are advisory, while others hold CNC operation. For messages that halt operation, you must put the CNC in the Manual Mode to correct the problem and clear the message.

## Section 3 - Manual Operation and Machine Setup

### Powering On the CNC

**NOTE:** When you power-on the CNC, ensure that the **E-STOP** switch is in the in position.

1. Turn on the CNC according to the builder's instructions. When the power switch is turned on, the CNC completely resets.
2. Turn the power switch ON. The startup screen activates and prompts you to **Press F10 to continue**.
3. Press (**F10**). The CNC displays the Software Options menu.
4. Highlight **1. CNC Control** and press **ENTER** to activate Manual Mode.

### Shutting Down the CNC

1. Press **E-STOP** to disengage the servos and revert to Manual Mode.
2. Press **EXIT (SHIFT+F10)** to display the Software Options menu.
3. Follow the builder's instructions for turning off the CNC.

### Emergency Stop (E-STOP)

Press **E-STOP** to take all axes and spindle servos offline. This ends all machine movement.

To reset **E-STOP**, pull out and turn the rotary switch clockwise in the direction of the arrows. The switch makes a clicking sound when it resets.

Resetting **E-STOP** does not automatically reactivate the servos. The servos must be reset to move the machine. Press **SERVO RESET** to reset the servos.

### Activating/Resetting the Servos

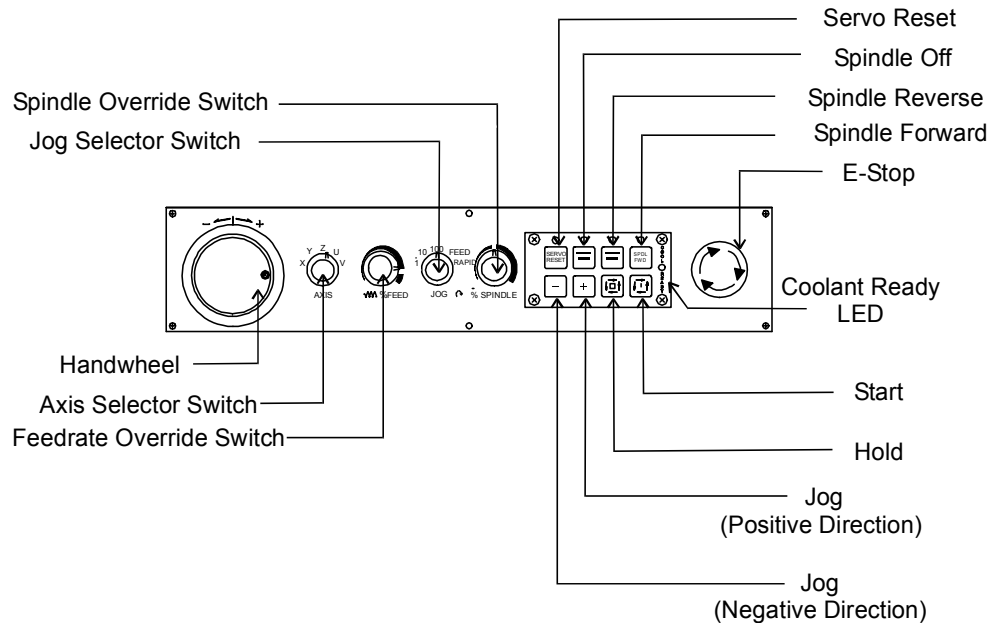
For safety reasons, the CNC powers up with the servo motors disengaged. While the servos are off, the CNC cannot move the machine. The CNC displays the message **SERVO OFF!** when the servos are disengaged. The servos are also disengaged when you press **E-STOP**, or if the machine attempts to travel beyond a limit switch.

Reset the servos as follows:

1. If a limit switch disengaged the servos, manually reposition the machine inside its normal range of travel.
2. Press **E-STOP** to display **MESSAGE: E-STOP IN-SERVO OFF!**
3. Rotate the **E-STOP** switch in the direction of the arrows to reset it. The **E-STOP** switch makes a clicking sound when it resets.
4. Press **SERVO RESET** to display **MESSAGE: SERVO DELAY, PLEASE WAIT...** while the CNC resets the servos. The message disappears when the servos reset.

### Manual Panel

Use the keys on the manual panel to move the machine manually. Refer to **Figure 3-1**.












MANPAN

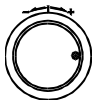  **Figure 3-1, Manual Panel**

## Manual Panel Keys


 



Manual panel keys allow you to control machine movements manually. These keys are located on the Manual Panel. Refer to **Table 3-1**.

**Table 3-1, Manual Operation Keys**

Label/Name	Key Face	Purpose
<b>Handwheel</b>		Moves the selected controlled axis while in the Manual Mode. Jog must be set to 1, 10, or 100. Optional.
<b>Axis Select</b>		In Manual Mode, selects the axis to be jogged.
<b>JOG</b>		Cycles the CNC through manual movement modes ( <b>FEED, RAPID, 100, 10, 1</b> ). The machine builder sets Default rapid and feed rates at setup.  <b>NOTE:</b> The machine builder determines the actual speed of the machine during a move.
<b>SPINDLE OVERRIDE</b>		Overrides the programmed spindle RPM rate. It is a 13-position rotary switch that ranges from 40 to 160 percent. (Each increment adjusts the spindle override by 10%.) This feature can be used only on machines with programmable spindles.
<b>FEEDRATE OVERRIDE</b>		Overrides the feed and/or rapid rate of the axes in Manual, Auto, and Single Step modes. It is a 13-position rotary switch, which ranges from 0 to 120 percent. (Each increment adjusts the feedback override by 10%.)  <b>NOTE:</b> The override range for rapid rate is 100%. The CNC will not exceed the maximum rapid rate.
<b>SERVO RESET</b>		Activates the servo motors.
<b>SPINDLE FORWARD</b>		Starts the spindle in a forward direction.  <b>NOTE:</b> On some machines, you must provide the gear range and RPM before you activate this key.
<b>SPINDLE REVERSE</b>		Starts the spindle in a reverse direction.  <b>NOTE:</b> On some machines, you must provide gear range and RPM before you activate this key.
<b>SPINDLE OFF</b>		Stops the spindle.

(Continued...)

**Table 3-1, Manual Operation Keys (Continued)**

Label/Name	Key Face	Purpose
START		Starts all machine moves except jog.
JOG +		Moves the selected axis in the positive direction. Available in all modes. Feedrate specified by the machine builder.
JOG -		Moves the selected axis in a negative direction. Available in all modes. Feedrate is specified by the machine builder.
HOLD		Halts any running program or programmed move. Press <b>START</b> to continue.
E-STOP		Press <b>E-STOP</b> to halt all axes and machine-related functions. When you activate <b>E-STOP</b> , the servo motors and any programming operations shut down. The CNC defaults to Manual Mode.  Use <b>E-STOP</b> for emergency shutdown or intentional servo shutdown.

### Manual Panel LEDs

The following keys have LEDs located directly above them on the Manual Panel. When any of the keys is activated, the corresponding LED lights up. Refer to [Figure 3-1, Manual Panel](#).


- Servo Reset
- Spindle Off
- Spindle Forward
- Spindle Reverse

The Coolant Ready LED is also located on the Manual Panel. Some CNCs have a coolant ready M-function. For these CNCs, the Coolant Ready LED lights when the coolant is ready. The coolant is programmed to come on when the machine receives a **SPINDLE ON** command.



## Manual Mode Screen

In Manual Mode, the CNC displays the Manual screen. The Manual screen is the basic operating screen and is displayed when the CNC is turned on. All other operating screens are similar in appearance and selected from the Manual screen soft keys. When the Manual Mode is active, the **Manual (F4)** soft key label highlights. Refer to **Figure 3-2**.

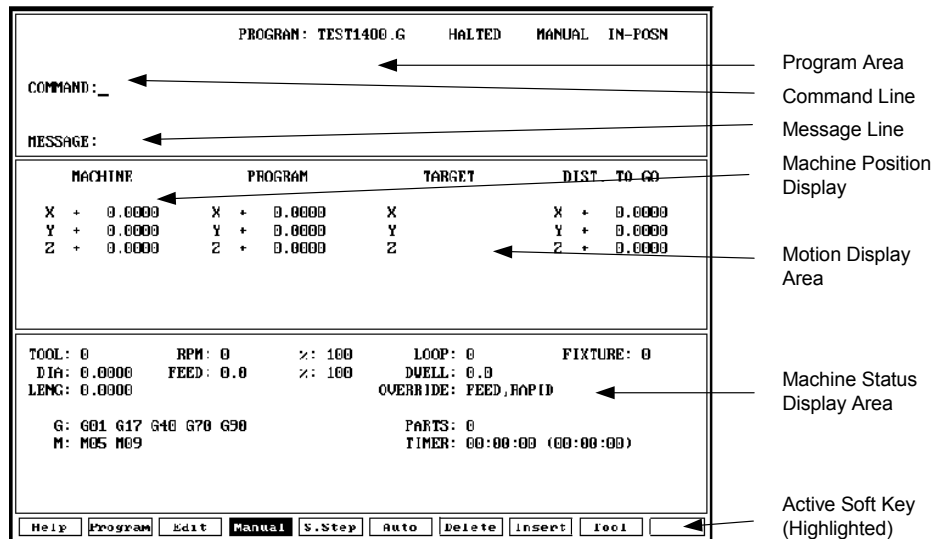

**Figure 3-2, Manual Screen**

The Manual screen is divided into the following areas.

**Program Area** Displays the working program name, running status, mode of operation, in-position check, and command line.

**Command Line** Allows you to enter commands manually.

**Message Line** Displays messages, prompts and reminders.

**Machine Position Display** Displays machine's X, Y, and Z position coordinates in reference to Machine Home.

**Motion Display Area** Displays machine's X, Y, and Z position coordinates in reference to:

- Part Zero
- Target
- Distance To Go

**Machine Status Display Area** Displays operating information.

**Active Soft Key** Identifies the function of the soft key. Soft key functions change from screen to screen. A highlighted label indicates an active mode.

### Machine Status Display Area Labels

**TOOL:** Active tool.  
**DIA:** Active tool diameter.  
**LENG:** Z-Axis Tool-Length Offset for active tool.  
**G:** Active G-Codes.  
**M:** Active M-Codes.  
**RPM:** Current spindle speed in revolutions per minute.  
**FEED:** Current feed rate (in inch/mm per minute).  
**% RPM:** Spindle override setting (40% to 160%).  
**% Feed:** Feedrate override setting (0% to 120% for Feed moves and 0% to 100% for Rapid moves).  
**LOOP:** Loop counter. Counts subprogram repetitions.  
**DWELL:** Seconds remaining in a dwell.  
**OVERRIDE:** Indicates whether the feedrate override setting applies to both feed and rapid moves or only to feed moves.  
**PARTS:** Number of parts. Resets to zero when you enter Auto or Single Step mode.  
**TIMER:** Indicates the amount of time per part and accumulated amount of time (in parentheses) for all parts. Resets to zero when you enter Auto or Single Step mode.  
**FIXTURE:** Displays active fixture (G53).

### Program Area Labels

**Bik:** Block number (is displayed in S. Step or Auto Mode only).  
**PROGRAM:** Name of loaded program.  
**HALTED/\*HALTED/RUNNING:**  
No asterisk: Machine is in a programmed hold or has completed its program.  
With asterisk: External hold has been activated by an event or **HOLD** was pressed.  
**RUNNING:** Program is running.  
**MANUAL/AUTO/S.STEP:**  
Current operating mode.  
**IN-POSN:** Is displayed if the machine has reached a programmed endpoint.  
**COMMAND:** Enters commands in Manual Mode.

## Manual Mode Settings

Features (or settings) that remain active for more than one operation are said to be modal. Modal features remain active until you change or cancel them. Most CNC functions are modal.

For example, if the CNC is in Rapid Mode, it executes all moves at the rapid rate until you initiate Feed Mode. The CNC can be in several modes, as long as the modes do not conflict.

Before making a manual move, make any necessary mode settings. Modes set from the Manual screen remain active if the CNC is put in a program mode (Auto, S.Step) until the program or operator changes the mode.

Set the following modes from the Manual screen:

- Position Mode: Absolute or Incremental Mode
- Move Mode: Rapid or Feed Mode
- The Active tool: Active tool, tool-length offsets, and tool-nose radius compensation
- Measurement Mode: Inch or MM Mode

The Manual screen determines the following:

- The location of Machine Home position
- The location of Part Zero

Manual Mode provides the following types of moves:

- Jog (Conventional)
- Jog (Continuous)
- Manual Data Input (MDI)
- Handwheel (optional)

Table 3-2 describes the active soft keys in Manual Mode.

**Table 3-2, Manual Mode Soft Keys**

<b>Label</b>	<b>Soft Key</b>	<b>Function</b>
<b>Help</b>	F1	Activates the Help Mode.
<b>Program</b>	F2	Lists the user programs.
<b>Edit</b>	F3	Activates the Edit Mode. A program must first be selected.
<b>Manual</b>	F4	Activates Manual Mode from Auto and S.Step.
<b>S.Step</b>	F5	Changes to Single Step Mode
<b>Auto</b>	F6	Changes to Auto Mode. Use to run part programs for production.
<b>Delete</b>	F7	Deletes a character from the command line in Manual Mode.
<b>Insert</b>	F8	Puts the cursor in Insert Mode. Typed text is inserted without overwriting the existing text.
<b>Tool</b>	F9	Displays the Tool Page. The Tool Page stores tool diameter, length offsets, and wear factors.
<b>Handwheel</b>	F10	Activates or deactivates Handwheel Mode. Use to jog any controlled axis in Manual Mode.
<b>Exit</b>	SHIFT + F10	Exits the Control Software and returns to the Software options screen.
<b>Message</b>	F1	Displays the last 10 messages, both old (already read) and new (not yet read).
<b>Teach</b>	F5	Captures a display readout of axis positions and saves it in a program.
<b>Home</b>	F7	Executes the machine homing function.
<b>EXIT</b>	F10	Quits the screen and returns to the Software Startup menu.

## Activating Manual Mode Rapid or Feed

Turn the **JOG** rotary switch to cycle through all available Jog Modes. Choose **Rapid** or **Feed** mode. The CNC displays the active Feed or Rapid Mode in the Machine Status Display Area.

**NOTE:** In Manual Mode, press **R** then press **ENTER** to toggle the override setting between the following selections:

FEED and RAPID rate override (**FEED, RAPID**)

FEED rate override (**FEED**)

Toggle the setting to apply the current override selection to the programmed rates.


## Adjusting Rapid Move Speed

The **FEEDRATE OVERRIDE** rotary switch also adjusts the speed of Rapid moves. If FEED, RAPID is set, every click of the **FEEDRATE OVERRIDE** rotary switch adjusts the rapid rate by 10% of the default speed. The switch provides a range of 0% to 100%. Set the switch to 100 to set the rapid rate. The maximum override rate for rapid speeds is 100%.

**NOTE:** The machine builder determines the default rapid rate at setup.

## Absolute Mode

In Absolute Mode, all positions are measured from Absolute Zero. Absolute Zero is X0, Y0, and Z0 when the Absolute Mode is active. You can move Absolute Zero to any convenient location. All absolute XYZ positions are measured from this point. Refer to **G53** and **G92** in "[Section 4 - Preparatory Functions: G-Codes](#)" for more information on setting absolute zero. Setting Absolute Zero to a location on the part is referred to as setting Part Zero. Refer to **Figure 3-3**.

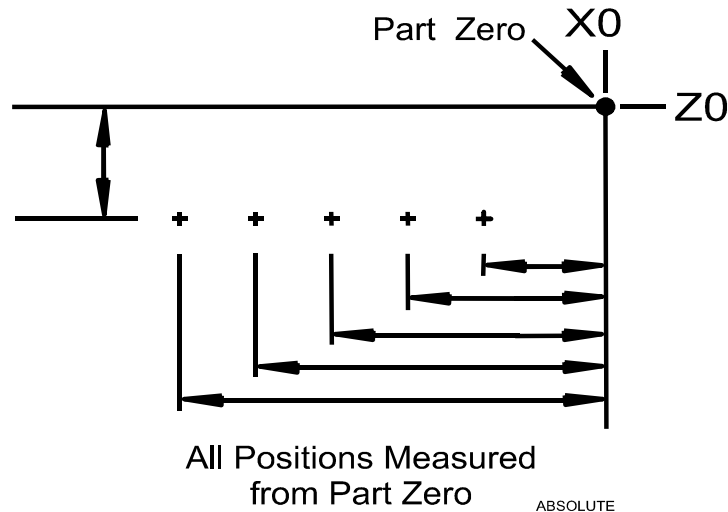

**Figure 3-3, Absolute Positioning**

**NOTE:** To determine the Z-axis location of Part Zero, set tool length offsets for each tool.

**NOTE:** The location of Absolute Zero can be restored after a shutdown if the machine has the Home function installed.

**CAUTION:** If Part Zero is not correctly located, the CNC will not position correctly in Absolute Mode.

### Jog Moves

You can make or change jog moves when:

- The CNC is in Manual Mode, the Teach Mode, or the Tool Page; and
- The servos are on.

The actual rate for each mode is determined at machine setup. Use the JOG rotary switch to cycle the CNC through the Jog Mode choices. Refer to **Table 3-3** for the available Jog Modes.

**Table 3-3, Jog Moves**

Mode	Description
<b>Rapid</b>	Default rapid speed for continuous jogs. Actual speed determined at machine setup.
<b>Feed</b>	Continuous jog at feedrate determined at machine setup.
<b>Jog: 100</b>	Conventional Jog Mode, increment set to 100 times machine resolution.
<b>Jog: 10</b>	Conventional Jog Mode, increment set to 10 times machine resolution.
<b>Jog: 1</b>	Conventional Jog Mode, increment set to actual machine resolution.

You can change the Jog Mode any time the CNC is in Manual Mode.

### Changing the Jog Mode

**NOTE:** Jog move modes, with the exception of Jog Rapid Mode, are performed in Feed Mode.

To change the Jog Mode:

1. In Manual Mode, turn the JOG switch to select a jog feed rate.

### Selecting an Axis

To select an axis in the Manual Mode:

1. Use the **AXIS SELECT** rotary switch to cycle through the available axes. Turn the switch until the indicator points to the required axis.

### Jogging the Machine (Incremental Moves)

In Manual Mode, position the machine with jog increments. To make a jog increment move:

1. Use **AXIS SELECT** to select an axis.
2. Use **JOG** to cycle through the move mode choices and choose a Jog Mode.
3. Press **JOG+** or **JOG-** to choose a direction. Do not hold down the key. Each time the key is pressed, the machine jogs along the selected axis by the selected increment.

### Jogging the Machine (Continuous Moves)

From the Manual screen, move the machine at feedrate or at the Jog Rapid Rate. The machine builder determines the effective jog and feed rates at setup.

1. In Manual Mode with the Manual screen active, use the **AXIS SELECT** to select an axis.
2. Use **JOG** to select a Continuous Jog Mode (Feed or Rapid).
3. Press and hold down **+** or **-** to jog the machine in the desired direction. The machine jogs along the selected axis. To stop the machine, release the key.

### Manual Data Input Mode

Manual Data Input (MDI) Mode allows you to command moves without creating a part program. MDI also is a quick way to program one move, or a series of moves that will be used only one time.

To execute a command, type an instruction on the **COMMAND:** line of the Program Area, and press **START**. (In Manual Mode, the cursor rests on the command line.)

More than one command can be programmed at a time. Use a semicolon (;) to separate the commands.

Press **HOLD** to pause one-shot moves.

Press **START** to continue. Press **Manual (F4)** to cancel. MDI moves are executed only once. To recall a previously commanded block, press **UP ARROW**.

<b>CAUTION: You must know the location of the Absolute Zero before making Absolute Mode moves.</b>
----------------------------------------------------------------------------------------------------

### Using Manual Data Input Mode

To use Manual Data Input Mode:

1. In Manual Mode, type the command block(s) at the **COMMAND:** line.
2. Press **START** to execute the typed commands.

Most functions that can be commanded in a part program can also be commanded in MDI Mode. These include:

- ❑ G00, G01, G02, G03 moves
- ❑ M-Codes, T-Codes (tool activation), S-Codes (spindle speed)
- ❑ Modal commands (G90, G91, G70, G71, etc.)
- ❑ G-Codes (G92, G28, G53, etc.)

The following example demonstrates how MDI Mode might be used to activate the spindle.

COMMAND: M43; G97 S600; M3

M43	Activates Gear Range defined by M43 in setup
G97 S600	Activates Specified Spindle Speed
M3	Activates Spindle Forward


### Operating the Handwheel (Optional)

**NOTE:** The handwheel operation described here assumes that the handwheel has been properly installed and configured in the Setup Utility. The handwheel soft key will not display unless the Setup Utility has been configured for handwheel use.

The CNC supports an option that allows you to move a selected axis via a remote handwheel.

The resolution of the handwheel depends on the Jog Mode. Refer to [Figure 3-4, Handwheel Operation](#).



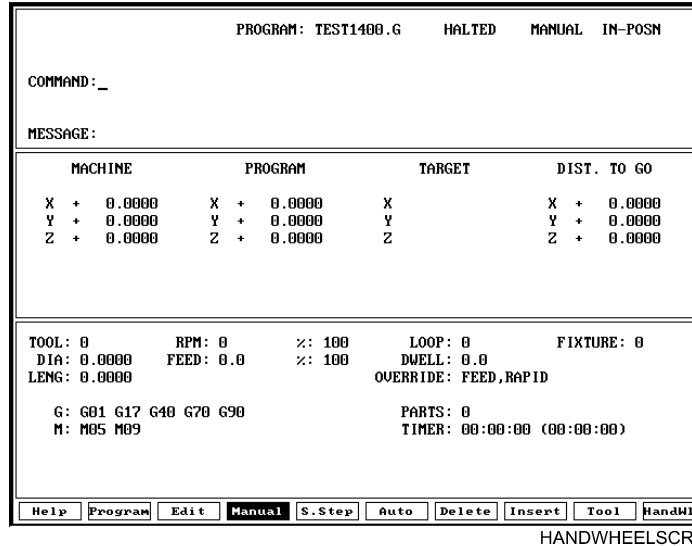

**Figure 3-4, Handwheel Operation**

To select a Jog Mode:

1. Turn the rotary switch to select an axis.
2. Select a conventional Jog Mode (100, 10, or 1).
3. Press - or + to move in a negative or positive direction, respectively.

To operate the handwheel:

1. From the Manual screen, press **HANDWHL (F10)**. The soft key highlights and the other soft keys are blank.
2. On the Manual Panel, select the axis that will be moved using the remote handwheel. Press **ENTER**. The selected axis can now be moved using the remote handwheel.
3. On the Manual Panel, select a Jog Mode (100, 10, 1). [Table 3-4, Handwheel Jog Mode Resolution Setting](#) lists the Jog Mode resolution settings. The axis will move 100, 10, or 1 times the machine resolution, respectively, per click of the handwheel.

**Table 3-4, Handwheel Jog Mode Resolution Setting**

<b>Jog Mode Setting</b>	<b>Handwheel Resolution</b>
<b>FEED</b>	Not Available
<b>RAPID</b>	Not Available
<b>100</b>	100 times Machine Resolution
<b>10</b>	10 times Machine Resolution
<b>1</b>	Machine Resolution

4. Move the handwheel clockwise to move the selected axis in a positive direction or counterclockwise to move the axis in a negative direction.

**NOTE:** If the axis does not move in the commanded direction, the handwheel settings may need to be reconfigured in the Setup Utility. Refer to the [5000M CNC Setup Utility Manual, P/N 70000509](#), for details.

## Section 4 - Preparatory Functions: G-Codes

G-codes initiate motion commands, canned cycles and various machine and CNC functions. More than one G-code may be specified per block. If a block contains conflicting G-codes, an Error message will appear.

**Table 4-1** lists non-modal and modal G-codes. Modal G-codes remain in effect until canceled by the appropriate code. Non-modal G-codes affect only the block in which they are programmed.

Edit Help provides graphic menus and labeled entry fields to aid those unfamiliar with G-code programming. Refer to [“Section 7 - Edit Help”](#) for information.

**Table 4-1, G-Codes**

Modal		Non-Modal	
G-Code	Function	G-Code	Function
<b>G0</b>	Positioning-Rapid Traverse	<b>G4</b>	Dwell
<b>G1</b>	Linear Interpolation-Feed	<b>G5</b>	Ellipse
<b>G2</b>	Circular Interpolation-CW	<b>G9</b>	Exact Stop Check
<b>G3</b>	Circular Interpolation-CCW	<b>G28</b>	Return to Machine Home
<b>G22</b>	Stored Stroke Limit ON	<b>G29</b>	Return from Machine Home
<b>G40</b>	Tool Radius Compensation, Cancel	<b>G31</b>	Probe Move
<b>G41</b>	Tool Radius Compensation (Left)	<b>G45</b>	Mold Rotation
<b>G42</b>	Tool Radius Compensation (Right)	<b>G49</b>	Elbow Milling
<b>G53</b>	Work Coordinate System	<b>G62</b>	Automatic Feed Override for Arcs
<b>G59</b>	Modal Corner Rounding	<b>G63</b>	Automatic Feed Override for Arcs Cancel
<b>G60</b>	Modal Corner Rounding Off	<b>G65</b>	User Macro Single Call
<b>G61</b>	Exact Stop Check Mode	<b>G66</b>	User Macro Modal Call
<b>G64</b>	Cutting Mode (Continuous Path ON)	<b>G67</b>	User Macro Modal Call Cancel
<b>G66</b>	User Macro Modal Call	<b>G68</b>	Coordinate System Rotation
<b>G67</b>	User Macro Modal Call Cancel	<b>G73</b>	Draft Pocket Milling Cycle
<b>G68</b>	Coordinate System Rotation	<b>G75</b>	Frame Milling
<b>G70</b>	Inch Programming	<b>G76</b>	Hole Milling Cycle
<b>G71</b>	MM Programming	<b>G77</b>	Circular Pocket Cycle
<b>G72</b>	Axis Scaling	<b>G78</b>	Rectangular Pocket Cycle
<b>G90</b>	Absolute Programming	<b>G79</b>	Bolt Hole Circle Cycle
<b>G91</b>	Incremental Programming	<b>G80</b>	Cancel Modal Drilling

(Continued...)

**Table 4-1, G-Codes (Continued)**

Modal		Non-Modal	
G-Code	Function	G-Code	Function
<b>G94</b>	Per Minute Feed	<b>G169</b>	Area Clearance
<b>G95</b>	Per Revolution Feed	<b>G170</b>	Facing Cycle
<b>G81</b>	Basic Drilling Cycle	<b>G171</b>	Circular Profile Cycle
<b>G82</b>	Counterbore Drilling Cycle	<b>G172</b>	Rectangular Profile Cycle
<b>G83</b>	Basic Peck Cycle	<b>G177</b>	Plunge Circular Pocket
<b>G84</b>	Tapping Cycle	<b>G178</b>	Plunge Rectangular Pocket
<b>G85</b>	Basic Bore Cycle	<b>G179</b>	Hole Pattern Drilling
<b>G86</b>	Uni-directional Boring Cycle	<b>G181</b>	Thread Mill Cycle
<b>G87</b>	Chip Break Drilling Cycle		
<b>G89</b>	Flat Bottom Bore Cycle		
<b>G92</b>	Absolute Zero Preset		


### Rapid Traverse (G0)

**Format:** G0

G0 initiates rapid traverse. The actual rapid rate is set by the machine builder in the Setup Utility. Use rapid to position the tool prior to or after a cut. Do not use rapid to cut a part. Refer to **Figure 4-1**.

One to five axes can be included on a block with G0. X, Y and Z will reach target simultaneously.

G0 is modal and remains in effect until canceled or changed.

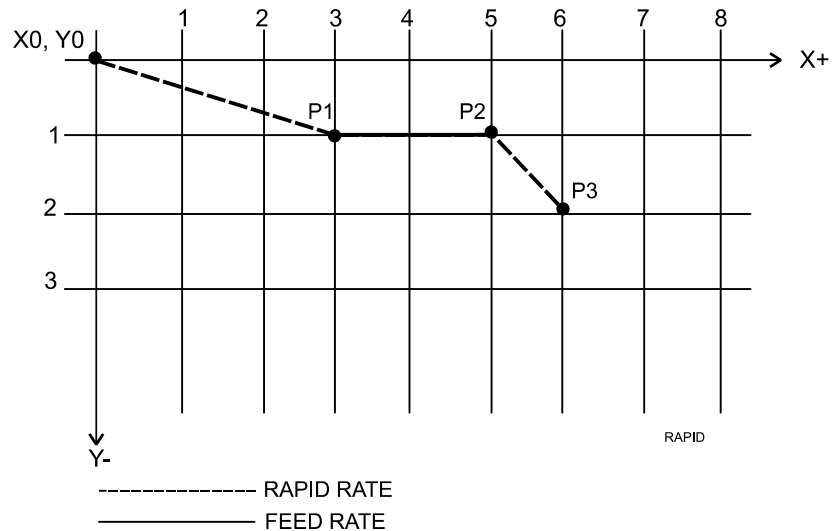

**Figure 4-1, Rapid Traverse**

**Table 4-2** lists the program blocks required to complete the moves illustrated in [Figure 4-1, Rapid Traverse](#).

**Table 4-2, Rapid Traverse**

N1	G90 G0 X3 Y -1	Rapid move to X3, Y-1 (P1) in Absolute Mode.
N2	G1 X5.0	X axis feeds to X5 (P2).
N3	G0 X6 Y-2	XY rapid to X6, Y-2 (P3).

**NOTE:** To override rapid, use the **FEEDRATE OVERRIDE**. For more information on using **FEEDRATE OVERRIDE**, refer to "[Section 3 - Manual Operation and Machine Setup](#)."


### Linear Interpolation (G1)

**Format:** G1

Linear Interpolation (G1) initiates straight-line feed motion and is used to cut a part. Straight-line motion occurs in one or more axes. The block may contain any combination of available axes. G1 moves can be straight-line or angular moves.

G1 is modal and remains in effect until changed. Specify the feedrate on or prior to the G1 block.

In **Figure 4-2** and [Table 4-3, Straight-Line Programming Example](#), MM equivalents are in parentheses following the Inch measurements.

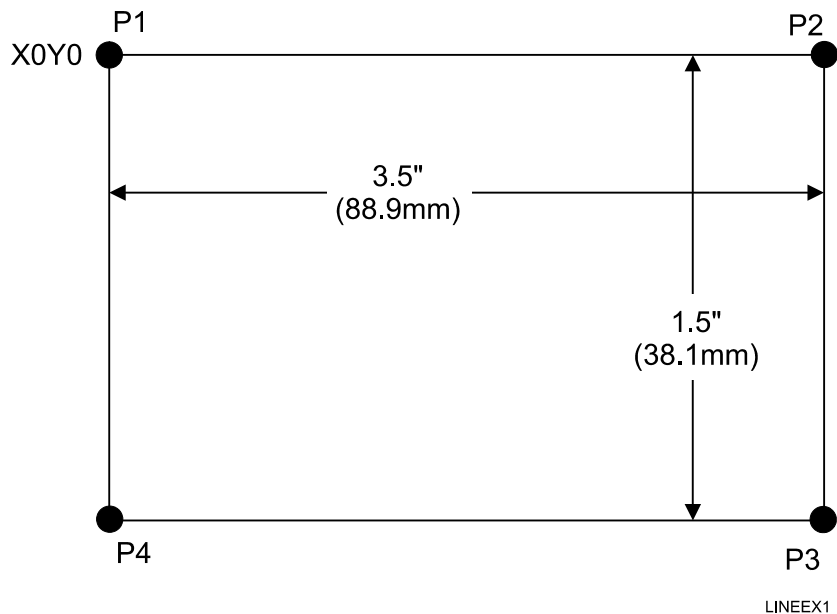

**Figure 4-2, Linear Motion**

**Table 4-3, Straight-Line Programming Example**

N1	G90 G70 (G71) G1 X0 Y0 Z0	Feed to starting position.
N2	G1 F10 (254) X3.5 (88.9)	Feed to P2.
N3	Y-1.5 (-38.1)	Feed to P3.
N4	Z-1.5 (-38.1)	Move Z down.
N5	X0 (X0)	Feed to P4.
N6	Y0 (Y0)	Feed to P1.
N7	M2	End program, return to N1.


### Angular Motion Programming Example

Angular moves involve motion in two or more axes. In Absolute Mode, all dimensions are referenced to Part Zero (X0, Y0). In Incremental Mode, all dimensions are referenced to the current tool position. Refer to **Table 4-4**.

**Table 4-4, Angular Programming Example, Absolute/Inch Mode**

N1	G70 G90 G0 X0 Y0	Feed to starting position (X0, Y0).
N2	G1 F10 X3	Absolute, Inch Mode feed to P2.
N3	Y-2	Feed to P3.
N4	X0 Y-3	Feed to P4 (angular move).
N5	Y0	Feed to P1.
N6	M2	End program, return to N1.

In **Figure 4-3**, MM equivalents are in parentheses following the Inch measurements.

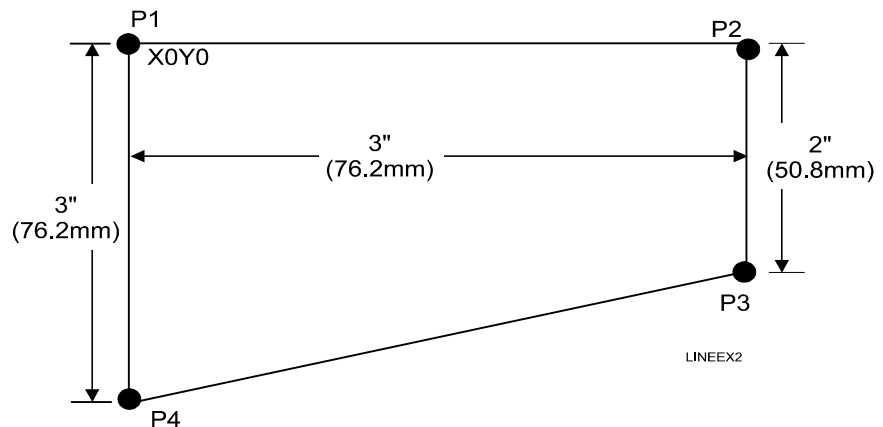

**Figure 4-3, Angular Motion**

## Circular Interpolation (G2 and G3)

Circular interpolation initiates circular moves, including arcs. G2 commands a clockwise motion. G3 commands a counterclockwise motion.

**Arc input Format:** G2 Xx Yy Zz Ii Jj Kk

**Arc input Format:** G3 Xx Yy Zz Ii Jj Kk

**Radius Format:** G02 Xx Yy Rr

**Radius Format:** G03 Xx Yy Rr

Refer to **Table 4-5** for parameter descriptions.

**NOTE:** For circular interpolation in another plane, make the plane change prior to the G2 or G3 block. Refer to "[Plane Selection \(G17, G18, G19\)](#)" for information on planes. Arc examples use the most common plane, G17 (XY).

**NOTE:** If the value of X, Y, Z, I, J, or K is zero, omit it.


**Table 4-5, Parameters for Circular Interpolation**

Parameter	Description
<b>G2</b>	CW (clockwise) motion.
<b>G3</b>	CCW (counterclockwise) motion.
<b>XYZ</b>	Endpoint of arc motion in Absolute or Incremental Mode.
<b>I (X)</b> <b>J (Y)</b> <b>K (Z)</b>	Distance from the tool location to the arc center. I = X center, J = Y center, and K = Z center. <b>NOTE:</b> Arc centers are incremental by default. This is set up in the Setup Utility.
<b>R</b>	Arc Radius. <b>NOTE:</b> If Arc is greater than 180°, enter the R value as a negative value (For example, <b>R-.5</b> ).

### Examples of Circular Interpolation

#### Partial Arcs (XYIJ)

Figure 4-4 illustrates an arc move between P2 and P3.

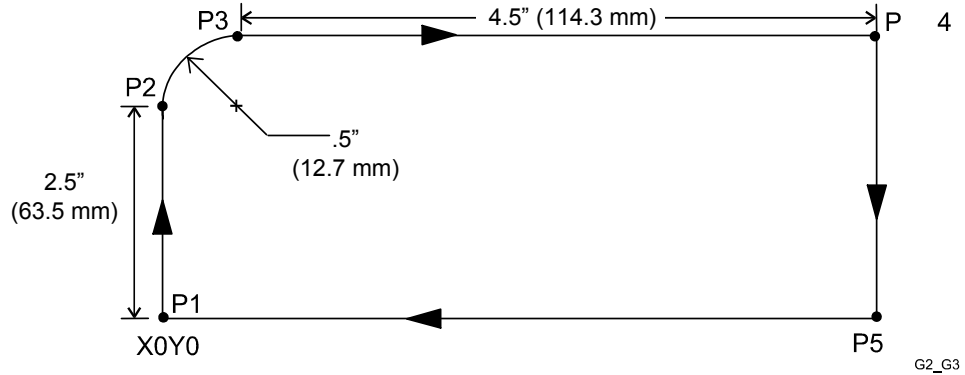

**Figure 4-4, Circular Interpolation**

**Absolute Mode:** Refer to Table 4-6.

**Table 4-6, Circular Interpolation in Absolute Mode, Inches**

Address Word	Format	Description
N1	G70 G90 G17 G1 Y2.5 F3	Activate Inch and Absolute Mode and set feedrate to IPR. Activate plane. Feed to P2.
N2	G2 X.5 Y3.0 I.5 J0	Arc move to P3.
N3	G1 X5	Feed to P4.
N4	Y0	Feed to P5.
N5	X0	Feed to P1.
N6	M2	End Program.

**Incremental Mode:** Refer to Table 4-7.


**Table 4-7, Circular Interpolation in Incremental Mode, Inches**

Address Word	Format	Description
N1	G70 G91 G17 G1 Y2.5 F3	Activate Inch and Absolute Mode and set feedrate to IPR. Activate plane. Feed to P2.
N2	G2 X.5 Y.5 I.5 J0	Arc move to P3.
N3	G1 X4.5	Feed to P4.
N4	Y-3	Feed to P5.
N5	X-5	Feed to P1.
N6	M2	End Program.



Any arc of less than 360 degrees is a partial arc. Use Address Words X, Y, I, J together.

To program a move from P1 to P2, calculate arc centers (I and J) and endpoints (X and Y). Refer to **Figure 4-5**.

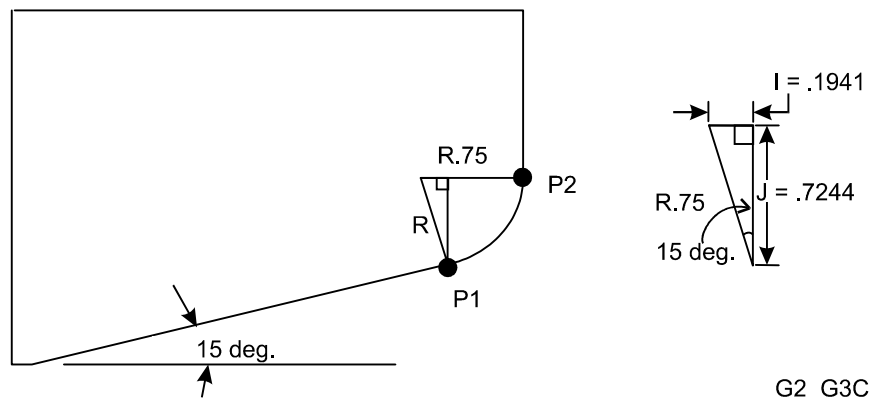

**Figure 4-5, Partial Arc Sample**

From P1 to P2, the block format is: **G91 G3 X.5559 Y.7244 I-.1941 J.7244.**

Construct a triangle at a right angle to the given angle (15 deg.). Using the given angle (15) and the hypotenuse (.75, radius), calculate the lengths of the unknown sides I (opposite side) and J (adjacent side).

A. Sine (15 deg.) times hypotenuse = I

$$.2588 \times .75 = .1941$$

Since I is in an X minus direction, **I (X arc center) = -.1941**

B. Cosine (15 deg.) times hypotenuse = J

$$.9659 \times .75 = .7244$$

Since J is in a Y positive direction, **J (Y arc center) = .7244**

C. Radius - I = X

$$.750 - .1941 = .5559$$

X moves in a positive direction. **X (endpoint) = .5559**

D. Y (endpoint) = J (Y arc center)

$$\mathbf{Y = J = .7244}$$


**NOTE:** If the endpoint (P2) does not lie along the arc path, the CNC displays an error message.

### Circles

Since the endpoint and starting point of a circle are the same, you do not need to program an endpoint for a circle. Position the tool at the required starting point before you execute the arc move. Refer to **Figure 4-6**.

**Format:** G91 G3 J.5

Since X, Y, and I equal 0, omit these parameters.

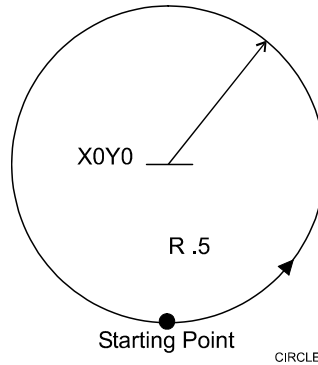

**Figure 4-6, Circle Sample**

### Helical Interpolation (XYZIJK)

**Format:** G17 G2 Xn Yn Zn In Jn Ln

Helical interpolation adds a third dimension to G2 or G3 moves.

For the XY plane (G17), the tool will move in a circular motion in the XY axes and linearly in Z, simultaneously.

The added Z parameter provides the Z endpoint. L is the number of complete plus partial revolutions, referenced from the start point.

You can use helical interpolation for threading and rough boring applications. Additional linear or rotary axes (U,W) can also be specified. Refer to **Table 4-8**.

**Table 4-8, Helical Interpolation Program**

Block	Description
N5 G17 G90 G70 G0 X0 Y0 Z0	Sets XY plane, Absolute, Inch, Rapid Modes. Moves axes to zero.
N6 G02 X2.0 Y0 Z-.5 I1.0 J0 L1 F20	Programs CW helical move to X2 Y0 Z-.5, with center point at I1J0 and 0 complete turns. The tool will execute a half turn at feedrate F20. If L2 were programmed, the tool would make 1-1/2 turns.
N7 G01	Next block.

**Dwell (G4)**

Dwell (G4) can be used to program a delay between blocks. A Timed Dwell is a timed stop. An Infinite Dwell is a stop that can be canceled only by pressing **START**. With a dwell activated, the CNC halts motion on all axes, but other functions (coolant on/off, spindle control) remain active. Do not program any other commands on a G4 block. T is the time in seconds that the machine will remain at the current location. The range of T is .1 to 9999.9 seconds.

Timed **Dwell** Format: **G4 Tx.x (timed)**

Infinite **Dwell** Format: **G4 T0 (infinite)**

**Example:** N20 G4 T2.1

Block 20 commands a timed dwell with a duration of 2.1 seconds.

**Example:** N21 G4 T0

Block 21 commands an infinite dwell.

The time countdown is displayed in the Machine Status Area of the Manual screen.

<p><b>NOTE:</b> ANILAM recommends that you use the Programmed Stop M-function (M00) instead of an infinite dwell.</p>
-----------------------------------------------------------------------------------------------------------------------

### Programming Non-modal Exact Stop Check (G9)

With the In-Position Mode activated, the CNC approaches target and performs an in-position check before it executes the next move. The CNC comes to a complete stop at the end of every block. This could cause witness marks to appear on the work, but prevents the CNC from rounding off sharp corners. Refer to **Table 4-9**.

**Format:** G9

**NOTE:** Rapid moves are always performed in In-Position Mode.

**Table 4-9, Exact Stop Check G-Codes**

Code	Format	Action
<b>G9</b>	G9 Xx.x Yx.x	Activates non-modal In-Position Mode. Complete stop only in this block.
<b>G61</b>	G61 Xx.x Yx.x	Activates Modal In-Position Mode. The CNC stops to verify location for each targeted position. In-Position Mode remains active until changed.
<b>G64</b>	G64	Cancels G61 and activates the Contouring Mode (also called Continuous Path Mode).

**NOTE:** In-Position and Continuous Path Tolerances are defined in the Setup Utility. The In-Position Tolerance should be closer to target than the Continuous Path Tolerance.


The In-Position Mode will be active only for the block containing the G9 command. Use G61 to initiate modal Exact Stop Check (In-Position Mode).

### Plane Selection (G17, G18, G19)

Make plane changes prior to circular interpolation (G02, G03) blocks. Refer to **Table 4-10** for the G-codes that activate different planes. XY (G17) is the default plane at power-on. Refer to [Figure 4-7, Plane Selection](#).


**Table 4-10, Plane Selection G-codes**

G-Code	Cutting Plane
<b>G17</b>	XY plane
<b>G18</b>	XZ plane
<b>G19</b>	YZ plane

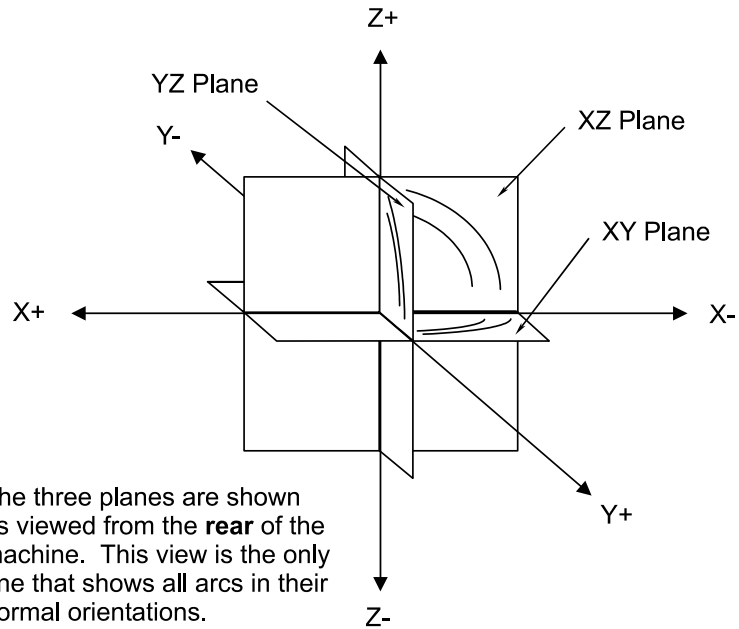

**Figure 4-7, Plane Selection**

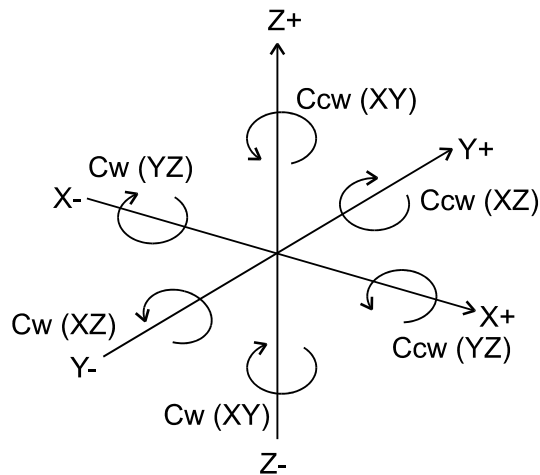To determine arc direction, look toward the negative direction of the non-used axis. Refer to **Figure 4-8**. (Example: for XY plane, look along Z-.)



ARCDIR

**Figure 4-8, Arc Direction**

### Setting Software Limits (G22)

The G22 Xn Yn Zn In Jn Kn format (activate software limits) is modal. Use G22 (alone) to cancel software limits. Refer to **Table 4-11**.

**Format:** G22 Xn Yn Zn In Jn Kn  
 Activates software limits.


**Format:** G22  
 Cancels software limits and enables free movement within the machine limits.

**Table 4-11, G22 Address Words**

Address Word	Format	Description
<b>G22</b>	---	Stored Stroke Limit (Programmable Travel Limits)
<b>X</b>	xxx.xxxx	X positive software limit.
<b>Y</b>	xxx.xxxx	Y positive software limit.
<b>Z</b>	xxx.xxxx	Z positive software limit.
<b>I</b>	xxx.xxxx	X negative software limit.
<b>J</b>	xxx.xxxx	Y negative software limit.
<b>K</b>	xxx.xxxx	Z negative software limit.

The software limits feature creates an envelope that limits the tool's range of travel. It is also called the Stored Stroke Limit feature. The X, Y, and Z limits represent the extreme distance the tool can travel in the positive X, Y, and Z directions. The I, J, and K limits represent the extreme distance the tool can travel in the negative X, Y, and Z directions. Refer to **Figure 4-9**.

Software limits are referenced to Absolute Zero (Machine Home). The values of the positive and negative limits depend on where you locate Machine Home.

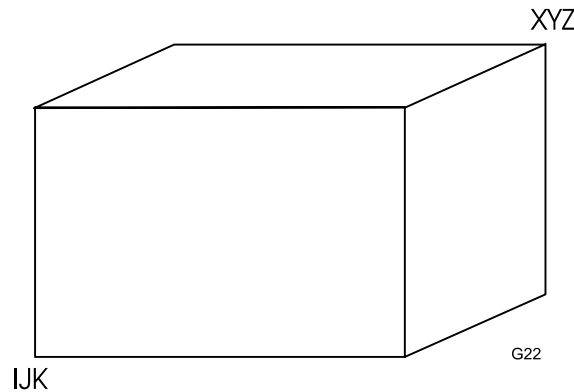

**Figure 4-9, Software Limits Envelope Parameters**

To set software limits:

1. Make sure the tool is within the envelope defined by the software limits (XYZIJK).
2. In Edit Mode or Manual Mode, type the G22 command in the proper format (G22 Xn Yn Zn In Jn Kn). All the Address Words must be accompanied by the appropriate values or the CNC will not activate software limits.

In Edit Mode, make sure the appropriate Program Listing is displayed. Type the G22 command into any program block.

In the Manual Mode, type the G22 command next to the command line. Press **START**.

### Returning to Reference Point (Machine Home) (G28)

With the G28 XYZ format, the Machine Home command (G28) returns the CNC to a permanent reference position and sets the Absolute Zero Reference at that point. The G28 command is used to zero the machine after a shut-down. Refer to **Table 4-12**.

**Format:** G28 XYZ

Returns the machine directly to its X, Y, and Z reference point (Machine Home). The axes display will zero when the reference point is reached.

**Format:** G28 Xn Yn Zn

n = coordinates X, Y, and Z of intermediate point. Return to reference point (Machine Home) through an intermediate point.

**Table 4-12, Return to Reference Point, Address Words**

Address Word	Format	Description
<b>G28</b>	---	Return to Reference point, directly or through an intermediate point
<b>Xn</b>	xxx.xxxx	Intermediate point in X, if used
<b>Yn</b>	xxx.xxxx	Intermediate point in Y, if used
<b>Zn</b>	xxx.xxxx	Intermediate point in Z, if used

**NOTE:** At least one axis must be specified or no motion will occur.

The order in which the axes return to the reference point is determined at setup by the machine builder. With the G28 Xx Yy Zz format, the machine rapids to the intermediate point and then feeds to Machine Home. The intermediate point is always in reference to Machine Home.

**NOTE:** All homing motion will be at a rate set by parameter.

Be sure to cancel Tool Diameter Compensation (G41 and G42) before commanding G28. Tool Length Offsets are automatically canceled by G28 XYZ.



## Automatic Return from Reference Point (G29)

Automatic Return from Reference Point (Machine Home) (G29) is used in conjunction with Machine Home (G28). G29 returns the CNC to the intermediary point programmed in G28, then to the coordinates programmed in the G29 block. It can be used to return from the reference point to a program start position. Refer to **Table 4-13**.

**Format:** G29 Xx Yy Zn

n = coordinates X, Y, and Z of G29 move. The CNC commands a move from Machine Home to an intermediate point (specified in G28 command), then to the G29 coordinates.

**Table 4-13, G 29 Address Words**

Address Word	Description
<b>G29</b>	Return from Machine Home, through an intermediate point specified in the G28 command, to the G29 programmed coordinates.
<b>X</b>	G29 move in X
<b>Y</b>	G29 move in Y
<b>Z</b>	G29 move in Z

**NOTE:** If the G28 move is to Machine Home, type the command as follows: G28 X0 Y0 Z0 or G28 XYZ. The axes address words must be specified or the CNC will not home the omitted axis. Refer to **Table 4-14**.

**Table 4-14, G29 Program List**

Block	Format	Description of Variables
N1	G28 Xn1 Yn1 Zn1	n1 = coordinates of intermediary point. The CNC rapids to the programmed coordinates (n1), then feeds to Machine Home.
N2	G29 Xn2 Yn2 Zn2	n2 = coordinates of point to which CNC will return after reaching the intermediary point. The machine feeds to the G28 intermediate point (n1), then to the programmed coordinates (n2).

## Probe Move (G31)

Refer to [“Section 19 - Advanced Programming Features,” “Probe Move \(G31\).”](#)

### Fixture Offsets (Work Coordinate System Select), (G53)

**Format:** G53 Oxx Xn Yn Zn Un Wn C

Use the work coordinate system (G53), commonly known as fixture offsets, to shift Absolute Zero to a preset dimension. G53 dimensions are referenced to Machine Zero.

G53 cancels Mirror Image (M100), Axis Rotation (G68) and Scaling (G72).

99 offsets (zero shifts) are available. Offsets are stored in a table. To activate the Fixture Offset Table in Manual Mode, press F9 (Tool) + F1 (Offsets). You can update this table through the program. If you use a G53 command to change the offsets in the table, the CNC will overwrite the values in the Fixture Offset Table.

The letter O followed by the Fixture Offset Table number (1 to 99) defines an offset.

#### Fixture Offset Table

The Fixture Offset Table, accessed via the Manual screen, contains the entered values for Fixture Offsets 1 to 99.

#### Activating the Fixture Offset Table

To activate the Fixture Offset Table:

1. In Manual Mode, press **F9 (Tool)** + **F1 (Offsets)**. The Fixture Offset Table activates. Refer to **Figure 4-10**.

<b>MACHINE</b> X + 0.0000 Y + 0.0000 Z + 0.0000		<b>PROGRAM</b> X + 0.0000 Y + 0.0000 Z + 0.0000		<b>TOOL: 0</b> <b>FIXTURE: 0</b> <b>RPM: 0</b> <b>#: 100</b> <b>FEED: 0.0</b> <b>#: 100</b>		
				<b>G: G01 G17 G40 G70 G90</b> <b>M: M05 M09</b>		
No.	Diameter	G53 Offset			ear	Type
1	0.0000	X	Y	Z		
2	0.0000	1.▶ 0.0000	0.0000	0.0000		
3	0.0000	2. 0.0000	0.0000	0.0000		
4	0.0000	3. 0.0000	0.0000	0.0000		
5	0.0000	4. 0.0000	0.0000	0.0000		
6	0.0000	5. 0.0000	0.0000	0.0000		
7	0.0000	6. 0.0000	0.0000	0.0000		
8	0.0000	7. 0.0000	0.0000	0.0000		
9	0.0000	8. 0.0000	0.0000	0.0000		
10	0.0000	9. 0.0000	0.0000	0.0000		
11	0.0000	10. 0.0000	0.0000	0.0000		
12	0.0000	11. 0.0000	0.0000	0.0000		
13	0.0000	12. 0.0000	0.0000	0.0000		
14	0.0000	13. 0.0000	0.0000	0.0000		
15	0.0000					
1	0.0000					

**Figure 4-10, Fixture Offset Table**

### Changing Fixture Offsets in the Table

To change a fixture offset to a manually entered coordinate:

1. Highlight a Fixture Offset (row 1 to 99) in the Fixture Offset Table.
2. Press an axis key (X, Y, or Z).
3. Type a value. Press **ENTER**. The CNC stores the value in the table.

### Adjusting Fixture Offsets in the Table

To adjust an existing fixture offset:

1. Highlight a Fixture Offset (row 1 to 99) in the Fixture Offset Table.
2. Press the letter **A** key to display the message, "Enter axis and adjustment value."
3. Type the axis to adjust (**X**, **Y**, or **Z**) and the amount of the adjustment. The adjustment value may be positive or negative.
4. Press **ENTER** to adjust the value, and display the adjusted value in the table.

### Changing Fixture Offsets Using Calibrate Soft Keys

To change a fixture offset using the Calibrate soft keys, **CalibX (F5)**, **CalibY (F6)**, or **CalibZ (F7)**:

1. Move the machine table to the desired zero position (using either a manual move, jog, handwheel, or MDI).
2. Press the arrow key to highlight the fixture offset in the Fixture Offset Table.
3. Press the Calibrate soft key(s) for the desired coordinate(s).

### G53 Programming Examples

G53 examples #1 to #3 below will clear any active G92.

1. Use offset number three from preset table: G53 O3  
Activates a zero point previously entered in the table.
2. Clear any active offset: G53 O0

Use to clear any offset of G53 or G92. It resets the current zero to Machine Home.

3. Update offset table, shift coordinates:  
G53 On Xn Yn Zn Un Vn Wn C

The C word tells the CNC to update the table. Use as an immediate command to shift Absolute Zero and save values in the offset table.

4. Update offset table, but do not activate the shift: G53 On Xn Yn Zn Un Vn Wn is used when offsets are defined at the beginning of a program. It is strictly to set up the offset table.

G92 can be used in reference to (after) any G53 active, or without any G53 active (G53 O0). G53 is modal, and G53 O0 (use none) is active at power-up.

**NOTE:** Use G40 to cancel G41/G42 before programming G53.

### Modal Corner Rounding/Chamfering (G59, G60)

Use G59 to program modal corner rounding or chamfering. The corner rounding format blends the intersection of two moves. The chamfer format chamfers the intersection of two moves. You can use G59 at the intersection of non-tangent line-line, line-arc, arc-line, and arc-arc moves (provided a blend radius or chamfer is possible). You cannot blend radii at the intersection of a line tangent to an arc.

G59 can be used to blend inside or outside radii. Tool diameter compensation can be active during modal corner rounding. When you blend inside radii with diameter compensation active, the blend radius must be greater than the tool radius.

R defines the radius value for corner rounding. E defines a chamfer size. Refer to **Table 4-15**. G59 is modal. It will stay active until canceled with a G60 code. The CNC activates linear interpolation (G1) with G59. You do not have to program G01 prior to the G59 block.

**Corner Rounding Format:** G59 Rn

**Chamfer Format:** G59 En

**Cancel G59:** G60 (Cancels G59 immediately.)

**Cancel G59:** G60 Xn Yn Zn (Cancels G59 after move.)


**Table 4-15, G59 Address Words**

Address Word	Description
R	Corner radius
E	Chamfer distance

G60 cancels G59 immediately. G60 Xn Yn Zn cancels G59 at the end of the move it contains (as in N13). For example, if G60 was programmed on a block prior to the X0 move, the lower-left corner would not be rounded.

You can change the blend radii or chamfer value between moves. To change the radius to .25 for the bottom two corners, insert **G59 R.25** between Blocks N10 and N11. The new radius would apply on the next move (after Block N10).

In the example in **Figure 4-11**, G59 is used to command modal corner rounding. Whenever the CNC encounters an intersection between line-line, arc-arc, or line-arc moves, it will round off the intersection to the specified radius.

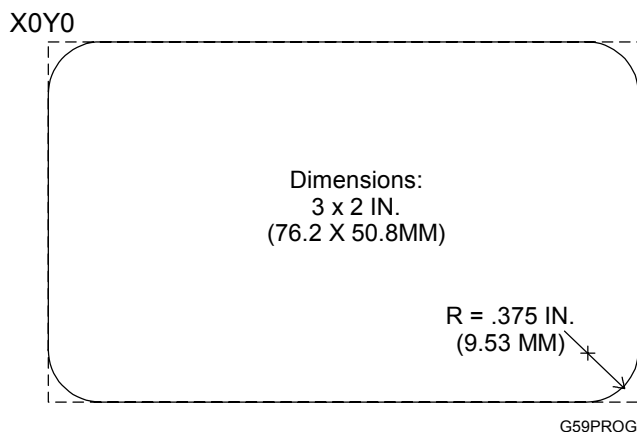

**Figure 4-11, G59 Programming Example**

Table 4-16 describes the required program blocks.

**Table 4-16 G59 Programming Example, Inch**

Blk. #	Block	Description
N4	G17 G90	* Set plane and absolute
N5	G0 X-.5 Y-.5	* Move to point
N6	Z-.25	* Lower Z axis
N7	G1 X0 F20	* Move to X0 and set feedrate
N8	G59 R.375	* Set G59 and radius value
N9	Y0	* Move to Y0
N10	X3	* Move to X3
N11	Y-2	* Move
N12	X0	* Move
N13	G60 Y.5	* Move to Y.5, then deactivate modal corner rounding
N14	G0 Z.1	* Raise Z axis

### In-Position Mode (Exact Stop Check) (G61)

While the In-Position Mode (G61) is active, the CNC approaches target and performs an in-position check before the next move is executed. Refer to **Table 4-17**. The CNC comes to a complete stop at the completion of each command. This could cause tool dwell marks to appear on the work, but prevents the CNC from rounding off sharp corners.

**Table 4-17, G61 and Associated G-Code Formats**

Code	Format	Action
<b>G9</b>	G9 Xx.x Yx.x	Activates Non-modal In-Position Mode. Complete stop only in this block.
<b>G61</b>	G61 Xx.x Yx.x	Activates Modal In-Position Mode. CNC stops to verify location of each endpoint.
<b>G64</b>	G64	Cancels G61 and activates the Contouring Mode (Continuous Path Mode).

**NOTE:** Rapid moves are always performed in In-Position Mode.

G61 is modal and remains in effect until canceled. Use Contouring Mode (G64) to cancel the G61. Non-modal In-Position Mode (G9) remains active only for a single block.

**NOTE:** The In-Position and Continuous Path Tolerances are defined in the Setup Utility. The In-Position Tolerance should be closer to target than the Continuous Path Tolerance.

### Automatic Feedrate Override for Arcs (G62, G63)

G62 commands an automatic feedrate override for arcs. It slows down or speeds up the programmed feedrate, based on the cutter compensation code active (G41 or G42) the tool type and the arc radius. G62 keeps the edge of the tool that contacts the work cutting at the programmed feedrate.

**Format:** G62

**Cancel Format:** G63

**Example:** While milling a 90-degree CCW inside corner using G41, the feedrate is overridden (slowed down), in order to keep the cutting edge of the tool moving at the programmed feedrate. The opposite would apply on an outside corner using G42.

**NOTE:** You can default this feature to ON or OFF using the Setup Utility.

## Contouring Mode (Cutting Mode) (G64)

The Contouring Mode (G64), also known as Continuous Path Mode or Cutting Mode, is active at power on. Refer to **Table 4-18**. It is used for feed moves. With the Contouring Mode activated, the CNC approaches target and comes within the Continuous Path Tolerance of the target position. No in-position check is made before the next move is executed. This enables the smooth contouring of a profile or surface.

**Format:** G64

**Table 4-18, G64 and Associated G-Code Formats**

Code	Format	Action
<b>G9</b>	G9 Xx.x Yx.x	Activates Non-modal In-Position Mode. Complete stop only in this block.
<b>G61</b>	G61 Xx.x Yx.x	Activates Modal In-Position Mode. CNC stops to verify location of each endpoint.
<b>G64</b>	G64	Cancels G61 and activates the Contouring Mode (Continuous Path Mode).

**NOTE:** Rapid moves are always performed in In-Position Mode.

**NOTE:** The In-Position and Continuous Path Tolerances are defined in the Setup Utility by the machine builder.

G64 is modal and remains in effect until canceled. Use Exact Stop Check (G61) to cancel the Contouring Mode. G64 initiates linear interpolation (G1).

## User Macros (G65, G66, G67)

**NOTE:** Before using macros, you must understand how variables and parameters are used in a program or subprogram. Refer to [“Section 19 - Advanced Programming Features”](#) for an explanation of these features.

**NOTE:** G65 or G66 codes always contain some letter variable(s) (Pn, An, Bn, etc.) to be passed to the macro (subprogram).

A macro is a group of instructions stored in memory and called by the main program when needed. Think of macros as sophisticated, flexible subprograms, which can be modal (G66) or Non-modal (G65). Refer to **Table 4-19**.

Macros might consist of:

- ❑ Customized canned cycles to simplify the programming of a particular part or entire programs for similar part production.
- ❑ Parameters (Pn, An, Bn, etc.) passed to the subprogram by letter address, similar to canned cycles.
- ❑ Automatic measuring sequences using sensors, such as probes, for feedback to the CNC.

**Table 4-19, Macro G-Codes**

Format	M/NM	Action
G65 Pn Ln G65 Pn G65 Pn, An, Bn, etc.	Non-modal	Executes Non-modal Macro (Pn), with optional repeat loop, at current location. Macro is repeated number of times specified in command (Ln). If the L address word is omitted, the macro will be executed only once. Pn = macro number (O). Ln = optional loop. Specify number of times the macro should repeat (n).
G66 Pn G66 Pn, An, Bn, etc	Modal	Executes called macro (Pn) after each programmed move until canceled with a G67 command. Pn = called macro.
G67	Cancel	Cancels Modal Macro (G66).

**Table 4-20** lists and describes the Address Words and M-codes used with macros.

**Table 4-20, Macro Address Words**

Address Word	Format	Description
Pn	Pxxxx	Used in G65 and G66 commands. Lists macro number (O) to be called.
Ln	Lxxxx	Used only in G66. Optional repeat command. Specify number of times macro should repeat (1 to 9999).
On	N(block Number) Oxxxx	Macro number that occurs in the first line of the macro; for identification.
M99	M99	End macro (subprogram) and return to line following G65 or G66 in main program.

A subprogram consists of fixed dimensions, but a macro contains variables and parameters that can change every time the macro is used. The CNC can pass values to variables in the G65 or G66 command.



Macros can be stored in the same file as the main program or in a separate file. Use the File Inclusion feature to call Macros stored in a separate file.

Refer to “[Section 19 - Advanced Programming Features](#)” for a more detailed explanation of Parameter Passing and Variables and File Inclusion.

Macros stored in the same file as the main program are defined in the same way as a subprogram; with the O address word followed by a label number. The macro is terminated with the M99 code and entered into the Program Listing after the main program. Refer to **Table 4-21**.

If the command contains an L address word, the macro is repeated the specified number of times before the CNC returns to the main program.

**Table 4-21, Macro Program List**

Program Block	Description
N200 M2	End main program
N210 O201	Macro number assigned
N220 [Enter macro here]	Macro program
N230	
N240	
N250	
N260 M99	End macro, return to next line of main program. The CNC returns to the line following the Macro call (G65 or G66) in the main program.

Use the G65 Macro call to call a macro into the main body of the program. Refer to **Table 4-22**.

**Table 4-22, Macro Call in Main Program**

Program Block	Description
N40	
N50 G65 P201	CNC executes Macro O201 once, at present location.
N60	After executing the macro (M99 encountered), the CNC returns to the main program and performs the next programmed command.

The CNC executes the macro (201) at block 50, with or without repeated loops, as programmed. When the CNC detects the M99 (End Macro) Code, it returns to the next line of the main program (N60).

### Axis Rotation (G68)

G68 is modal and remains active until canceled. Refer to **Table 4-23**. The CNC automatically cancels rotation if you program S and L. Use only the listed codes.


**Activate Format:** G68 In Jn Sn Cn Pn Ln

**Cancel Format:** G68

**Table 4-23, G68 Address Words**

Address Word	Description
I	Center of rotation (polar origin) in X axis. Optional.
J	Center of rotation (polar origin) in Y axis. Optional.
S	Start angle (referenced original programmed angular position). This variable is used only if L and P are programmed. Optional.
C	Angle of Rotation. Required.
P	Subprogram number to call. Optional.
L	Number of loops. Number of times C will increment, and subprogram P will be called. Optional

Patterns commanded by the program can be rotated using polar coordinates. Any angle can be described as positive or negative, depending on how it is referenced. CCW from 0 degrees is positive. CW from 0 degrees is negative. Refer to **Figure 4-12**.

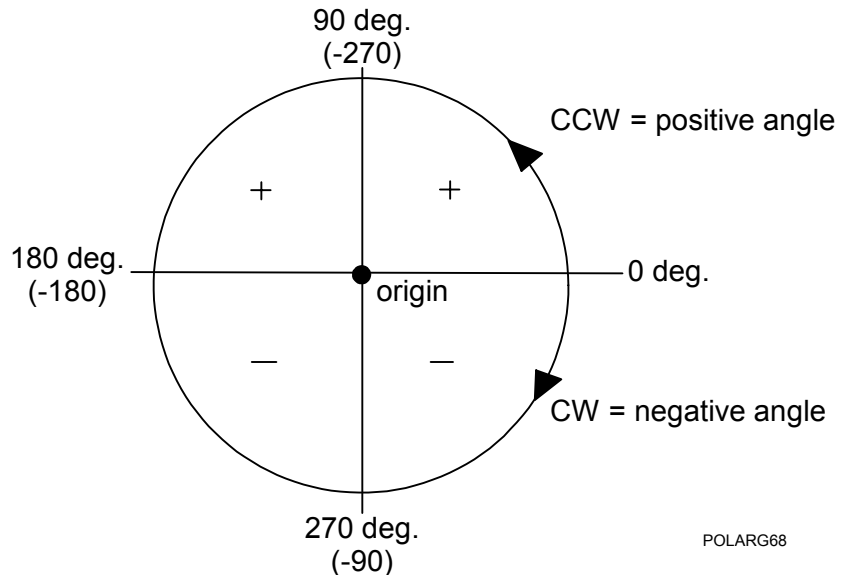


**Figure 4-12, G68 Angle Rotation Guide**

Minimum data entry for G68 rotation is: G68 Cn. If I and J are not given, the current position is used. S angle is referenced to the original programmed position. For example: If a slot is programmed at the 90 degree position, S is referenced from 90 degrees. S should be used only if L and P are programmed. C must be programmed. P and L are optional. They enable a loop to be executed, so the subprogram will be called at each angle increment. G17, G18, or G19 must be commanded prior to programming G68.

**G68 Programming Examples**

**Example 1:** Refer to **Figure 4-13** and **Table 4-24**.

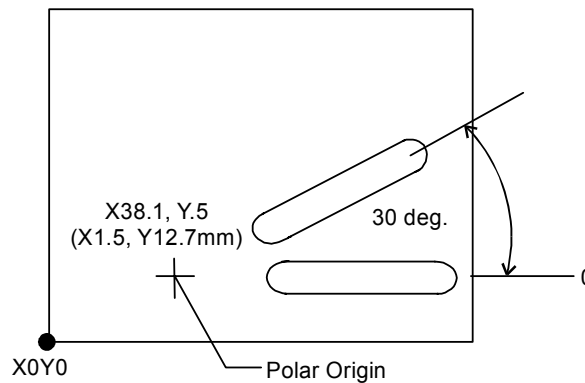

**Figure 4-13, G68 Programming Example 1**


**Table 4-24, G68 Programming Example 1**

Blk. #	Block	Description
N21	G17 G90	* Set plane and absolute
N22	G68 I1.5 J.5 C30	* Activate rotation to values
N23	M98 P1001	* Execute subprogram
N24	G68	* Cancel rotation
Required Subprogram:		
O1001		
G90 G0 X2.5 Y.375		
G1 Z-.125 F5		
X3.5		
G3 Y.625 J.125		
G1 X2.5		
G3 Y.375 J-.125		
G0 Z.1		
M99		

Example 1 does not use S, C, P, or L. (No loop is required.)

N21 sets the XY plane and Absolute Mode. N22 enables rotation angle of 30 degrees, the origin is X1.5 Y.5. N23 executes sub 1001 at the rotated position. The sub is programmed at the 3 o'clock position. N24 cancels polar rotation.

**Example 2:** Refer to **Figure 4-14** and **Table 4-25**.

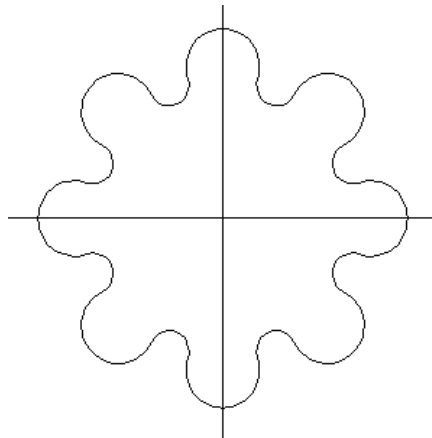

**Figure 4-14, G68 Programming Example 2**

**Table 4-25, G68 Programming Example 2**

Blk. #	Block
N1	O688 * G68-2
N2	G90 G70 G17 G0 T0 Z0
N3	X0 Y0
N4	T1 * .25 MILL
N5	Y2.5 Z.1
N6	G1 Z-.125 F5
N7	G41 Y1.875 F14
N8	G68 I0 J0 S0 C-45 P1 L8
N9	G40 G90 G1 Y2.5
N10	G0 T0 Z0
N11	X0 Y0
N12	M2
N13	
N14	
N15	
N16	O1 * 45 DEG. SECTION
N17	G91 G2 X.3542 Y-.4981 I0 J-.375
N18	G3 X.3689 Y-.1528 I.1889 J-.0656
N19	G2 X.6027 Y.1017 I.3376 J-.1634
N20	M99

Example 2 uses all variable words of the G68 function. Only the path from the 12 o'clock position (90 deg.) to the 1:30 position (45 deg.) is programmed in the subprogram. The G68 loop increments the angle and recalls the subprogram to complete the shape.

N1 through N4 set program number, modals, position and tool activation.

N5 and N6 move the tool to the starting position.

N7 initiates tool compensation during a move to the 12 o'clock position.

N8 calls the G68 rotation function: origin (I,J) at X0 Y0, starting angle (S) of zero degrees (First call of subprogram will not be rotated), angle increment (C) of -45 deg. (CW is negative), call subprogram (P) 1, and loop count (L) equals eight.

N9 Cancels compensation during the move back to the starting position.

N10 to N12 cancel tool, move to position and end the program.

N16 to N20 define the 45 degree section for the shape, from 12 o'clock position to 1:30 position.

**NOTE:** If you are using S and L format, you do not need to cancel G68.

**NOTE:** Select the plane prior to G68 (default is G17). Program dimensions for both axes of the active plane.

The CNC interprets IJKABC values in the current Absolute/Incremental Mode. If C is absolute, the 3 o'clock position is 0 degrees. If C is incremental (G91), the current angle is 0 degrees. It is better to use incremental (G91) dimensions.

**Activating Inch (G70) or MM (G71) Mode****Inch Mode Format:** G70**MM Mode Format:** G71

Change the unit of measurement displayed by the CNC by using Inch Mode (G70) or MM Mode (G71). Refer to **Table 4-26**. The Inch/MM Mode is usually specified at the start of a program.

**Table 4-26, Activating the Inch/MM Mode**

<b>Block</b>	<b>Format</b>	<b>Description</b>
N2	<b>G70</b> G90 G0	Activates <b>Inch</b> Mode.
N2	<b>G71</b> G90 G0	Activates <b>MM</b> Mode.

<b>NOTE:</b> The display resolution (number of decimal places shown) is set up in the Setup Utility. The default resolution is four decimal places for Inch Mode; three decimal places for MM Mode.
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

## Axis Scaling (G72)

Use Axis Scaling (G72) to enlarge or reduce patterns commanded by the program. Refer to **Table 4-27**. G72 is modal. If a variable word is not given, it is assumed to be x1 factor. Axes for circular motion must have the same factor.

**Activating Format:** G72 Xn Yn Zn Un Wn

**Table 4-27, Cancel Format:** G72

Address Word	Description
<b>X</b>	Scaling factor for X axis
<b>Y</b>	Scaling factor for Y axis
<b>Z</b>	Scaling factor for Z axis
<b>U</b>	Scaling factor for U axis
<b>W</b>	Scaling factor for W axis

Tool length offsets, diameter offsets, tool wear factors, and cutter compensation are not affected by G72. No other codes are allowed on a G72 block.

**WARNING:** Never program a T-code (T0, T1) while in G72.

Activate the Tn command before G72, then deactivate G72 before deactivating the Tn command. This applies to all tools (T0 to T99).

**Example:** G72 X2 Y2 Z1

The CNC will scale all X and Y moves to twice their programmed size. Z moves will not be scaled (times 1). Z could have been omitted.

## Activating Absolute (G90) or Incremental (G91) Mode

You can change the program mode to G90 or G91. Specify Absolute or Incremental Mode at the start of a program. Refer to **Table 4-28**.

**Absolute Mode Format:** G90

**Incremental Mode Format:** G91

**Table 4-28, Activating the Absolute/Incremental Mode**

Block	Format	Description
N2	G70 G90 G0	Activates the Absolute Mode.
N2	G70 G91 G0	Activates the Incremental Mode.

### Absolute Zero Point Programming (G92)

The G92 code is used to set axes to zero (reset) or to new coordinates (preset). It is sometimes used to set Part Zero. You can use G92 to set Part Zero on a vise or a fixture. Anilam recommends using G53 (Fixture Offset) instead of G92.

G92 cancels Mirror Image (M100), Axis Rotation (G68), and Axis Scaling (G72).

### Feed in IPM (G94)

Feedrates for Inch Mode (G70) are programmed as inch per minute (IPM). F1 = 1.0 IPM

Feedrates for Metric Mode (G71) in mm per minute. F1 = 1 mm/min

There are several ways to determine the feedrate. One method is to multiply (RPM of the cutter) times (feed per revolution).

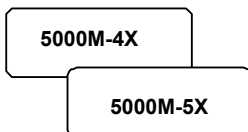
#### Example:

A four-flute .7500" endmill is used to finish mild steel at 508 RPM. The feed per tooth (fpt) is .003".  $fpt \times \#t \times RPM = \text{in/min}$

$$.003 \times 4 \times 508 = 6.1 \text{ in/min (approx.)}$$

Program the feedrate at 6.1 in/min.

If the machine has a rotary axis, give the feed in degrees per minute (dpm), whether for Inch Mode (G70) or Metric Mode (G71).



FU1 = 1 dpm

FW1 = 1 dpm

The choice of U or W is at the discretion of the machine builder.

### Feed Per Revolution (G95)

#### Format:

G95 F.0080 feed .0080" per revolution if in G70 (inch) mode.

G95 F.02 feed .02 mm per revolution if in G71 (mm) mode.

If you use feed per revolution (G95), your machine must be equipped with an encoder on the spindle for feedback.

The calculated rate in in/min or mm/min must not exceed the maximum feedrate allowed.



## Adjusting Feedrate

You can run the CNC at a percentage of the programmed feedrate by adjusting the **FEEDRATE OVERRIDE** switch. Each click of **the FEEDRATE OVERRIDE** adjusts the feedrate by an increment of ten percent; the range is 0 to 120%. Set **FEEDRATE OVERRIDE** to 100 to set the feedrate to 100% of the programmed feedrate.

**CAUTION: If the CNC is shut down, the setup file will reload a default feedrate at the next power-on.**

## Section 5 - Ellipses, Spirals, Canned Cycles, and Subprograms

### Ellipses (G5)

**Format:** G5 Xn Yn In Jn An Bn Ln


Use G5 to program a full or partial ellipse. You must know the following variables and program them after the G5 code. Refer to **Table 5-1** and **Figure 5-1**.

Program the starting point prior to G5. It must lie along the ellipse.

**Table 5-1, G5 Address Words**

Address Word	Description
<b>X</b>	Incremental X end point (or distance from start to end)
<b>Y</b>	Incremental Y end point (or distance from start to end)
<b>I</b>	Incremental X center point (or distance from start to center)
<b>J</b>	Incremental Y center point (or distance from start to center)
<b>A</b>	Half-length of ellipse in X-axis *
<b>B</b>	Half-width of ellipse in Y-axis *
<b>L</b>	Direction of tool travel: 1 is CCW; -1 is CW

\*Half-length is the dimension of a quadrant of the ellipse. For a full ellipse, it is half the X length (for A variable), and half the Y width (for B variable). A and B are always positive.

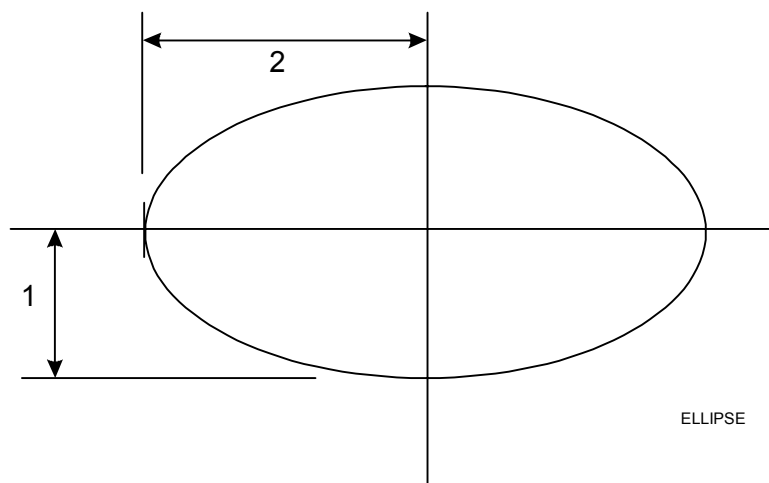

**Figure 5-1, Ellipse Programming Example**

G5 X0 Y0 I2 J0 A2 B1 L-1

The block will cut a full CW ellipse, 4 x 2 in size, beginning at X0 Y0, in Absolute Mode (G90).

**NOTE:** G5 is plane dependent (word groups: XYZ, IJK, AB, L).

G41 and G42 are not allowed with G5. However, you can compensate ellipses by programming a special variable. This variable is #1040. Set #1040 to one of the following values:

#1040 = 0 : Sets the ellipse compensation to OFF.

#1040 = 1 : Sets the ellipse compensation to ON, OUTSIDE.

#1040 = 2 : Sets the ellipse compensation to ON, INSIDE.

You must offset the tool from the edge of the ellipse (by the amount of the tool radius). The ellipse values (length, width, etc.) should be programmed as if the centerline of the tool is directly over the edge of the ellipse (value of uncompensated ellipse should be programmed).

#1040 remains active at the programmed value. You do not have to program it more than once to compensate more than one ellipse.

## Spiral (G6)

**Format:** G6 Xn Yn Zn In Jn Ln

Use G6 to cut a spiral. Certain variables must accompany the G-code. You cannot use Cutter compensation (**G40** to **G42**) with **G6**. Refer to **Table 5-2**.

**Table 5-2, G6 Address Words**

Address Word	Description
<b>X</b>	Incremental X end point (or distance from start to end if G91)
<b>Y</b>	Incremental Y end point (or distance from start to end if G91)
<b>Z</b>	Incremental Z end point (or distance from start to end if G91)
<b>I</b>	Incremental X center point (or distance from start to center if G91)
<b>J</b>	Incremental Y center point (or distance from start to center if G91)
<b>L</b>	Number of complete revolutions and direction of tool travel: + is CCW; - is CW

**NOTE:** Do not use a spiral to cut a tapered bore.

**NOTE:** XYIJ values define the center of the spiral. Z defines the Z depth. These values are Absolute or Incremental as configured in the Setup Utility under the **Circle centers** parameter. The default is Incremental. ANILAM recommends that you do not change this parameter. Refer to the Setup Utility manual for details.

The tool start position is the 'counting' position for the number of revolutions. Example: If a spiral does not make a complete revolution, L = -.1 or .1. For a spiral that makes ten complete revolutions, L = 10 or -10. For a spiral that makes six and one half turns, L = 6 or -6.


This block will cut a CCW spiral 1 in. deep, using five revolutions, starting at X1.5 Y0, using Absolute (G90) Mode. Refer to [Figure 5-2, XY View Spiral](#) and [Figure 5-3, Isometric View Spiral](#).

The spiral will not work into a radius of 0, nor will it start with a radius of 0; 0.001" (0.01 mm) is the minimum radius.


**G6** is plane dependent (word groups: XYZ, IJK, L).

**Example:**

```
G0 X1.5 Y0 Z0
G6 X-.5 Y0 Z-1 I-1.5 J0 L5
```

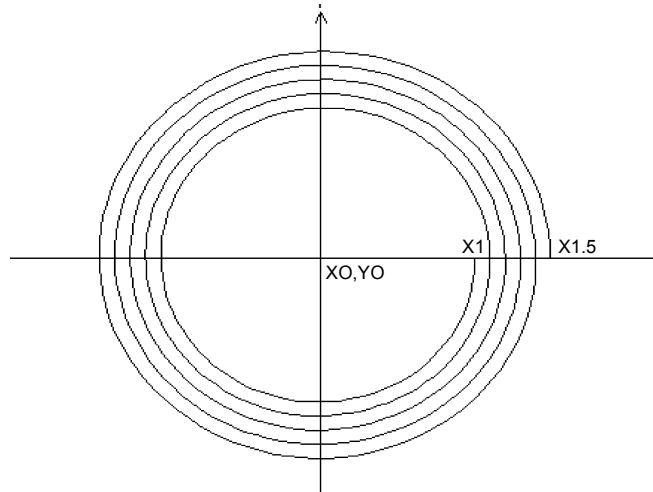

**Figure 5-2, XY View Spiral**

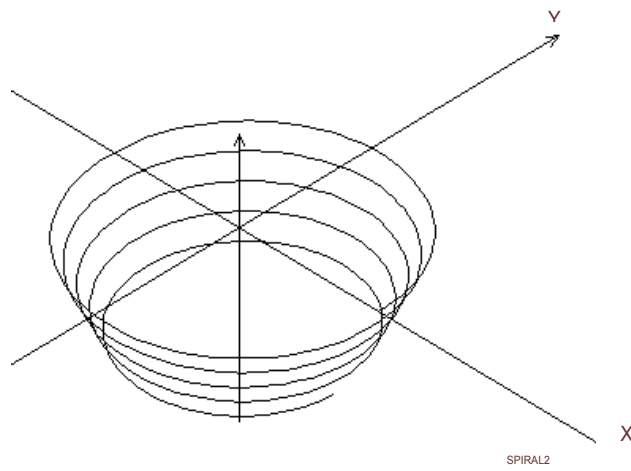

**Figure 5-3, Isometric View Spiral**

## Canned Cycles

A canned cycle is a preset sequence of events initiated by a single block of data. Canned cycles are part of the CNC software and cannot be altered. They simplify the programming of complicated cycles. One block of data can instruct the CNC to perform the necessary moves to drill a hole, mill a pocket, or cut a spiral or ellipse.

A canned cycle consists of a G-Code and variable words. The variable words describe parameters, such as peck distance, retract height, pocket depth and tool stepover. Each canned cycle has its own set of variable words.

The variable words in a canned cycle allow you to customize the cycle to include the necessary dimensions, feedrates, etc.

Canned cycles greatly reduce program blocks. Use them whenever applicable.

Canned cycles are usually entered into the part program from the Main Edit Help Menu. Edit Help contains graphics and labeled entry fields to make programming canned cycles quick and easy. Refer to "Section 7 - Edit Help" for details.

## Drilling, Tapping, and Boring Canned Cycles (G81 to G89)

When you activate a drilling cycle, it executes after each programmed position, until you cancel it.

**NOTE:** The P entry (return height) is optional, and you do not need to provide it. If you do not specify P, the CNC will set it to R.

Keep the following in mind for drill cycles:

- ❑ P dimension is optional. If it is not given, the retract height will be the same as the Z start height (R dimension).
- ❑ F feedrate is optional. If it is not given, the current feedrate is used.
- ❑ All start and finish heights (R and P) as well as Z dimensions are absolute dimensions.
- ❑ P must be less than R, or an alarm will be given.
- ❑ For all peck drill cycles (G83 and G87), R (start height) must be 0.1" (or 2 mm) above the work surface.
- ❑ G84 (Tapping) uses S word for Spindle Yes/No. Your machine must be equipped with spindle M-functions to use G84.
- ❑ Z-axis depth can be changed by placing a new Z depth on the same line as the X- and/or Y-axis location of the hole you want the new depth applied. A Z address on a line of its own will cause the control to drill the new depth at the current location.

### Cancel Drill, Tap, or Bore Cycle (G80)

**Format:** G80

Modal cycles remain active until canceled. Use G80 to cancel drill, tap, and bore canned cycles (G81 to G89). G80 can be included with other commands on a block.

### Spot Drilling (G81)

**Format:** G81 Zn Rn Fn Pn

G81 is a spot drilling cycle, generally used for center drilling or hole drilling that does not require a pecking motion. It feeds from the start height (R) to the specified hole depth (Z) at a given feedrate (F), then rapids to the return height (P). Refer to **Table 5-3**.

**Table 5-3, G81 Address Words**

Address Word	Description
Z	Absolute hole depth. Required.
R	Initial Z start point, in rapid. Required.
F	Feedrate.
P	Z return point after hole depth, in rapid. P must be higher than R.

### Counterboring (G82)

**Format:** G82 Zn Rn Fn Dn Pn

G82 is the counter bore cycle, generally used for counterboring. It feeds from the R-plane to Z depth, dwells for specified time, then rapids to the return point. Refer to **Table 5-4**.

**Table 5-4, G82 Address Words**

Address Word	Description
Z	Absolute hole depth. Required.
R	Initial Z start point, in rapid. Required.
F	Feedrate
D	Dwell time (in seconds). Required.
P	Z return point after hole depth, in rapid. P must be higher than R.

**Peck Drilling (G83)****Format:** G83 Zn Rn Fn In Pn

G83 is the peck drilling cycle, generally used for peck drilling relatively shallow holes. G83 feeds from the R-plane to the first peck depth (calculated so that all pecks are equal and do not exceed the maximum peck distance programmed in I word). Then rapid retracts to R-plane (to clear chip), rapids down to previous depth less .02", and continues this loop until it reaches the final hole depth. It then rapid retracts to the P dimension. Refer to **Table 5-5**.

**Table 5-5, G83 Address Words**

<b>Address Word</b>	<b>Description</b>
<b>Z</b>	Absolute hole depth. Required.
<b>R</b>	Initial Z start point, in rapid. Required.
<b>F</b>	Feedrate.
<b>I</b>	Maximum peck distance (positive dimension). Required.
<b>P</b>	Z return point after hole depth, in rapid. P must be higher than R.



### Tapping (G84)

**Format:** G84 Zn Rn Fn Sn Pn

**NOTE:** The machine must be equipped with spindle M-functions (FWD, REV, OFF) to use this cycle. Do not use G84 if the machine does not have spindle commands available.

G84 is the tapping canned cycle, used for tapping holes. During a G84 cycle: the tool feeds from the R-plane to Z depth; the spindle stops and reverses; the tool feeds to the retract plane; and the spindle stops and reverses again. Refer to **Table 5-6**.

**F (TPI/Lead):** Enter Threads Per Inch when in Inch mode. Enter Lead when in MM (G71) mode. Lead is the distance from one thread to the next. You must program a spindle RPM. The Feedrate is calculated based on the spindle RPM and the TPI or Lead specified.

**S (Spindle sync):** To enable Spindle sync, enter a value of 1. The machine must have direct spindle control to use this feature. The spindle rotation and Z-axis movement will be synched together, as in a threading cycle.

**D (Dwell):** A dwell time value in seconds can be entered. You may require this feature because of the time required to stop and reverse the spindle.

**NOTE:** If S=0, the programmed Dwell (D) will be active when the spindle reverses at the bottom and top of each hole.  
If S=1, the programmed Dwell (D) will be at the top of each hole.

**Table 5-6, G84 Address Words**

Address Word	Description
<b>Z</b>	Absolute hole depth. Required.
<b>R</b>	Initial Z start point, in rapid. Required.
<b>F</b>	Threads per Inch (TPI) in Inch mode, or Lead (Distance between threads) in MM mode.
<b>S</b>	Spindle, No (0), or Yes (1).
<b>P</b>	Z retract height after hole depth, in feed.
<b>D</b>	Dwell time.

**Boring, Bi-directional (G85)****Format:** G85 Zn Rn Fn Pn

G85 is a boring cycle, generally used to make a pass in each direction on a bore or to tap with a self-reversing tapping head. It feeds from the R-plane to Z depth, and then feeds back to the retract height. Refer to **Table 5-7**.

**Table 5-7, G85 Address Words**

Address Word	Description
<b>Z</b>	Absolute hole depth. Required.
<b>R</b>	Initial Z start point, in rapid. Required.
<b>F</b>	Feedrate.
<b>P</b>	Z return point after hole depth, in feed.

**Boring, Unidirectional (G86)****Format:** G86 Zn Rn Fn In Dn Pn Cn

G86 is a boring cycle that allows the X-axis to back off the bore surface after the spindle has stopped and oriented itself. The cycle will feed from the R-plane to Z depth, dwell for the specified time, stop and orient the spindle to the specified angle C, back off in X, rapid retract in Z, re-position in X, and restart the spindle. Refer to **Table 5-8**.

**NOTE:** Your machine must be equipped with spindle M-functions (FWD, REV, OFF) and spindle orientation (M19) to use this cycle. Do not use the G86 cycle if the machine does not have the spindle commands and spindle orientation.

**Table 5-8, G86 Address Words**

Address Word	Description
<b>Z</b>	Absolute hole depth. Required.
<b>R</b>	Initial Z start point, in rapid. Required.
<b>F</b>	Feedrate.
<b>I</b>	X-axis incremental backoff distance in X (positive or negative dimension).
<b>D</b>	Dwell time (in seconds).
<b>P</b>	Z return point after hole depth, in rapid.
<b>C</b>	M19 index angle. If no angle is given, the angle in "Tool Management Setup" is used.

**Chip Breaker Peck Cycle (G87)****Format:** G87 Zn Rn Fn In Jn Kn Wn Un Pn

G87 is the chip-breaker peck-drilling cycle, generally used to peck-drill medium to deep holes. The cycle feeds from the R-plane to the first peck depth in Z, rapid retracts the chip-break increment (W), feeds to the next calculated peck depth (initial peck less J), and continues this sequence until it reaches a U depth, or until final hole depth is reached. The peck distance will never be more than I or less than K. Refer to **Table 5-9**.

This cycle enables optimum drilling conditions for holes. For maximum efficiency in deep hole drilling, set parameters to accommodate the material and tool types used. Generally, the deeper the hole, the smaller the peck distance (J). This prevents the binding of chips, tool, and workpiece. Set U to retract the drill completely at set depth intervals.

**Table 5-9, G87 Address Words**

<b>Address Word</b>	<b>Description</b>
<b>Z</b>	Absolute hole depth. Required.
<b>R</b>	Initial Z start point, in rapid. Required.
<b>F</b>	Feedrate.
<b>I</b>	First peck distance (positive dimension). Required.
<b>J</b>	Amount to subtract from previous peck (positive dimension). Required.
<b>K</b>	Minimum peck distance (positive dimension). Required.
<b>W</b>	Chip break increment (positive dimension).
<b>U</b>	Incremental depth between full retracts (positive dimension).
<b>P</b>	Z return point after hole depth, in rapid. P must be higher than R.

**Flat Bottom Bi-Directional Boring (G89)**

**Format:** G89 Zn Rn Fn Dn Pn


G89 is a boring cycle, generally used to program a pass in each direction with a dwell at the bottom. The tool feeds from the R-plane to Z depth, dwells for specified time, then feeds to the retract (P) dimension. Refer to **Table 5-10**.

**Table 5-10, G89 Address Words**

Address Word	Description
<b>Z</b>	Absolute hole depth. Required.
<b>R</b>	Initial Z start point (0.1 in. or 2 mm), in rapid. Required.
<b>F</b>	Feedrate.
<b>D</b>	Dwell time (in seconds). Required.
<b>P</b>	Z return point after hole depth, in feed.

**Drilling Example**

The following example assumes that the machine has no automatic tool changer (ATC). If your machine has an ATC, check your machine manual for proper tool changer programming procedures. Refer to **Figure 5-4** and [Table 5-11, Drilling Example, Inch \(Metric\)](#).

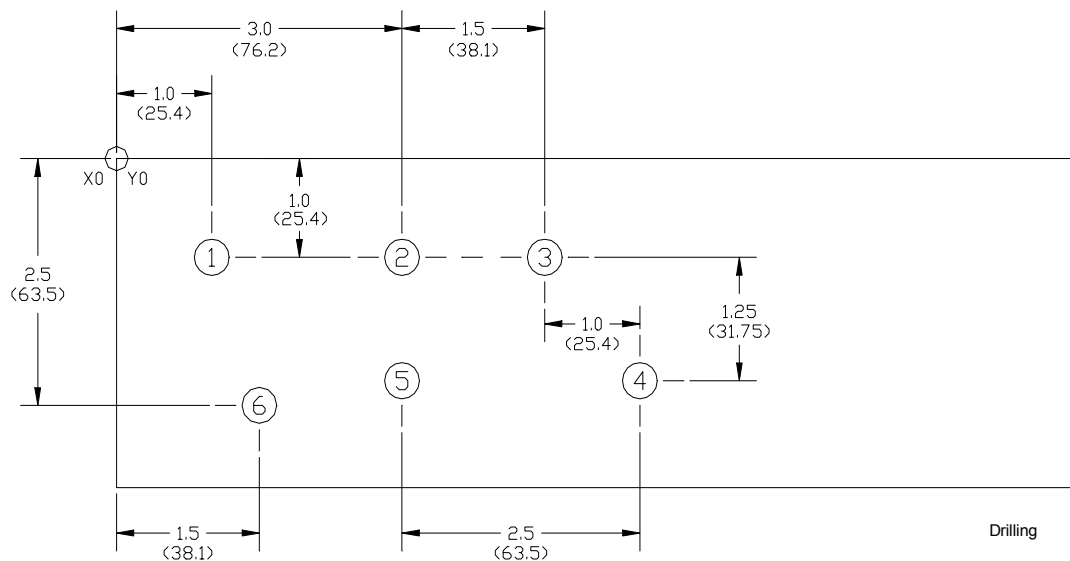

**Figure 5-4, Drilling Example**

**Table 5-11, Drilling Example, Inch (Metric)**

<b>Blk #</b>	<b>Block</b>	<b>Description</b>
N1	O1 * DRIL-X1	Program number (1) and name (DRILL-EX1).
N2	G90 G70 (G71) G0 T0 Z0	Sets absolute dimensions (G90), inch input (G70), rapid (G0), cancel any active tool (T0), and bring Z to zero (Z0).
N3	X-3.0 (X-75) Y1.0 (Y25)	Move to X-3 Y1.
N4	T01 * 1/4" DRILL (6.35 DRILL)	Activate Tool #1 length offset.
N5	G83 Z-.55 (Z-14) R.1 (R2) F12 (F300) I.08 (I2) P.1 (P2)	Initiates peck drill cycle G83: Z = hole depth, R = start height, F = feedrate, I = maximum peck, P = return height.
N6	X1.0 (X25.4) Y-1.0 (Y-25.4)	Hole location #1 (Rapid and Absolute).
N7	X3.0 (X76.2)	Hole #2.
N8	G91 X1.5 (X38.1)	Hole #3 (moves from #2 to #3 in incremental: G91).
N9	X1.0 (X25.4) Y -1.25 (Y-31.75)	Hole #4 (Incremental).
N10	X-2.5 (X-63.5)	Hole #5 (Incremental).
N11	G90 X1.5 (X38.1) Y -2.5 (Y-63.5)	Hole #6 (Absolute).
N12	G80 T0 Z0	Cancel drill cycle (G80), cancel tool (T0), and rapid Z to zero (Z0).
N13	X-3.0 (X-75) Y1.0 (Y25)	Move to X-3 Y1 for part change.
N14	M02	End Program.

## Pattern Drill Cycles


Use the automatic bolt hole circle (G79) to drill a partial or full bolt circle. A drill cycle (G81 to G89) must be programmed prior to G79. You can move around the pattern clockwise or counterclockwise, either point to point or along a radius. G79 calculates the hole locations. The cycle uses the Polar Coordinate System for dimensions. Refer to **Table 5-12** and **Figure 5-5**. When the G79 cycle is completed, you must cancel the cycle (G80).

### Bolt Hole Circle (G79)

**Format:** G79 Xn Yn Cn An Bn Hn Dn R

**Table 5-12, G79 Address Words**

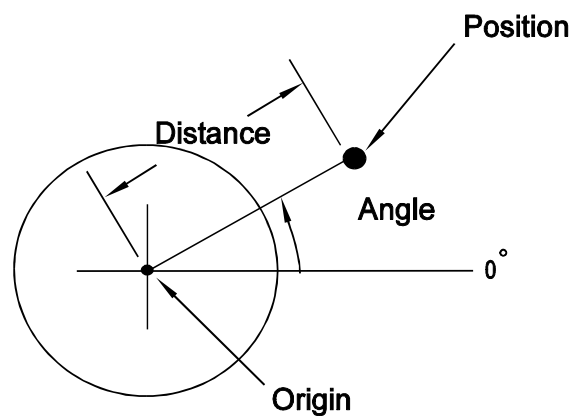Address Word	Description
<b>X</b>	Absolute X center of the bolt-circle. Defaults to current position.
<b>Y</b>	Absolute Y center of the bolt-circle. Defaults to current position.
<b>C</b>	Rotates the Polar Coordinate System by entered angle. Default: 0 degrees (3 o'clock). CCW = positive, CW = negative.
<b>A</b>	Angle of the first hole. Required.
<b>B</b>	Angle of the last hole. If there is no B value, the CNC will execute a full bolt hole circle.
<b>H</b>	Number of holes in full bolt circle. Required.
<b>D</b>	Diameter of bolt circle. Tool will normally move from hole to hole in a CCW (positive) direction. For CW direction, D = negative. Required.
<b>R</b>	Move from hole to hole on a radius. Set to 1.0 to activate. Defaults to point-to-point and hole-to-hole.



POLAR

**Figure 5-5, Polar Coordinates**

### Hole Pattern (G179)

**Format:** G179 Xn Yn Cn An Bn Dn En Un Vn Wn


**NOTE:** Do not program G68 with G179.

Use the automatic hole pattern canned cycle (G179) to program partial or full pattern hole grids. You can use G179 for a corner pattern when holes are required only on four corners. It calculates the hole locations from the entered variables. You can also rotate the pattern around the starting hole location. A drill cycle (G81-G89) must be programmed prior to G179. You must cancel the cycle (G80) after the pattern is completed. Refer to **Table 5-13**.

You can use [A and D] or [U and V], but not both combinations. Positive and negative values are allowed in all variable words except: B, E, and W.

**Table 5-13, G179 Address Words**

Address Word	Description
<b>X</b>	Absolute X position of start hole.
<b>Y</b>	Absolute Y position of start hole.
<b>C</b>	Angle to rotate the hole pattern. Default is 0 degrees (3 o'clock position).
<b>A</b>	Length of pattern in X-axis. If used, U cannot be given.
<b>B</b>	Number of holes in X-axis. Required.
<b>D</b>	Width of pattern in Y-axis. If used, V cannot be given.
<b>E</b>	Number of holes in Y-axis. Required.
<b>U</b>	Increment between holes in X-axis. Can be used instead of A.
<b>V</b>	Increment between holes in Y-axis. Can be used instead of D.
<b>W</b>	Pattern or Square. If W is 0, then a matrix pattern will be drilled. If W is 1, then a perimeter pattern (edges only) will be drilled. Refer to <b>Figure 5-6</b> .

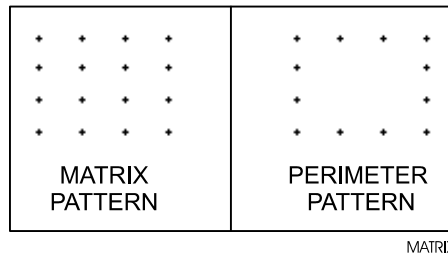

**Figure 5-6, Matrix vs. Perimeter Pattern**


**Example:**

G81 Z-.1 R.1 F15

G179 X2 Y1 C30 B6 E4 U.5 V.375 W0

G80

These blocks rotate a bolt hole pattern 30 degrees counterclockwise.  
Refer to **Figure 5-7**.

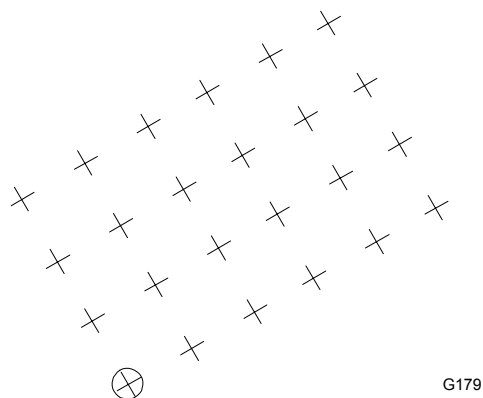

**Figure 5-7, G179 Programming Example**



### Pocket Cycles

Pocketing cycles eliminate extensive programming. One block of programming will mill out the described pocket. Activate a tool before programming a pocket cycle. All pockets use the current tool diameter from the Tool Page.

XY positioning may be necessary prior to programming a pocket cycle.

Programmer is responsible for all Z moves in Hole Mill (G76) cycle.

Cutting direction is reversible in the pocketing cycles.

Always check that tool-to-corner radii do not conflict.

**Z** and **P** dimensions are absolute.

On all cycles with variable **A** (tool stepover), **A** must be less than the tool diameter. In G78 and G178, **A** must be 70% or less of tool diameter.

Alarm messages will occur if the CNC detects program errors.

G41 and G42 are not permitted during pocket cycles. Pocket cycles use "built-in" cutter compensation.

Stock variable #1030 is not permitted and will be ignored.

**WARNING: When you cut one pocket inside another, make sure to set P above the highest pocket. At the end of each pocket, the tool will rapid to P, then rapid to the start position.**

For plunge pockets (G177, G178), drill a start hole prior to activating the pocket; position the axes over the start hole prior to G177 or G178.

**Draft Angle Pocket Cycle (G73)**

**Format:** G73 Xn Yn Hn Zn An Bn Cn Dn En In Vn Sn Qn Rn Wn


Use the draft angle pocket cycle (G73) to machine a draft angle on a pocket. The tool must be at the center point of the lower-left corner radius. This is where the machining begins. You can use G78 to mill out an initial pocket prior to the G73 block. Refer to **Table 5-14**.

**Table 5-14, G73 Address Words**

Address Word	Description
<b>X</b>	X length at the bottom of the pocket. Required.
<b>Y</b>	Y width at the bottom of the pocket. Required.
<b>H</b>	Z absolute rapid start height (must be 0.1" or 2 mm above surface). Required.
<b>Z</b>	Z absolute pocket depth. Required.
<b>A</b>	Lower-left corner radius. Cannot be less than tool radius. Required.
<b>B</b>	Lower-right corner radius. Cannot be less than tool radius. Optional.
<b>C</b>	Upper-right corner radius. Cannot be less than tool radius. Optional.
<b>D</b>	Upper-left corner radius. Cannot be less than tool radius. Optional.
<b>E</b>	Draft angle to be machined on vertical walls of pocket. Required.
<b>I</b>	Z-axis roughing step-down. Required.
<b>J</b>	Roughing feedrate (does not appear in Help Menu).
<b>V</b>	Maximum XY tool stepover. Used if angle is so great that the amount of XY step per Z step exceeds 70 % of the tool diameter. Optional.
<b>S</b>	XY finish stock amount, sides only. Optional.
<b>Q</b>	Z-axis finishing step-down. Optional.
<b>R</b>	Finish-pass feedrate. Optional.
<b>W</b>	Flat end mill = 0. Ball end mill = 1. Optional. Default is flat end mill.

### Example:

This program will cut the draft pocket shown in the figure. The drawing does not show the finish pass. Assume an existing rectangular pocket (4 inch long x 2 inch wide x 1 inch deep) with a theoretical sharp lower-left corner at X2 Y2. The following program will machine a draft angle onto the existing pocket. Refer to **Figure 5-8** and **Table 5-15**.

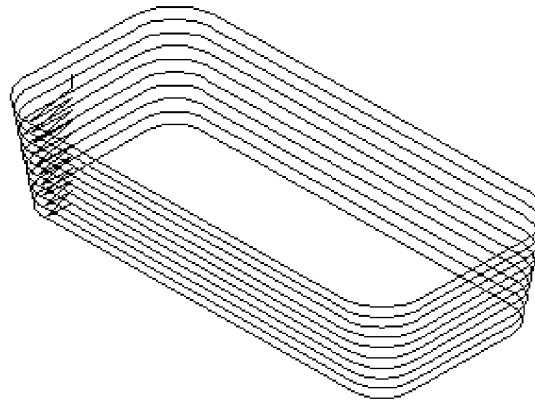

**Figure 5-8, G73 Programming Example**

**Table 5-15, G73 Programming Example**

T1 M3 S2000 ***** 1/2" FLAT END MILL
G90 G0 X2.5 Y2.5 F30 ***** 4" x 2" x 1" DP RCT. PKT ALREADY EXISTS
G73 X4 Y2 H.1 Z-1 A.5 E10 I.1 S.01 Q.02 R35
G0 T0 Z0 M5
X0 Y0 M2

Position the tool above the center of the lower-left corner radius. The tool path starts and ends at the center of the lower-left corner radius (after each perimeter pass) for all roughing passes. During finish passes, the tool will step down the draft angle and make passes around the perimeter.

If a ball-end mill is programmed ( $W=1$ ), the following points must be considered: If  $W=1$ , the length (X) and width (Y) at the bottom of the pocket is measured at the tangency point of the ball radius and the draft angle. If  $W=1$ , the start height (H) must be set to  $(.1 + \text{ball radius})$  above surface to be cut. If  $W=1$ , set the tool-length offset so that the ball is buried up to its centerline when at the part surface (touch off the tip and add the ball radius, or touch off tip and use a negative length wear equal to the ball radius).

**Frame Pocket Milling (G75)**

**Format:** G75 Xn Yn Mn Wn Hn Zn An Bn In Jn Un Vn Cn Sn Kn Pn

Frame milling (G75) will mill a frame or trough around an island of material. You must position the XY axes at the lower-left (theoretical sharp) corner of the island before you program G75. Refer to **Table 5-16**.

Prior to G75, activate a tool so that the CNC will consider the tool diameter. The relation of the outside corner radius to the frame width must be geometrically possible or an Error Message will appear.


**Table 5-16, G75 Address Words**

<b>Address Word</b>	<b>Description</b>
<b>X</b>	Center of island in X-axis. Default: Current position.
<b>Y</b>	Center of island in Y-axis. Default: Current position.
<b>M</b>	Length of island in X-axis. Required.
<b>W</b>	Width of island in Y-axis. Required.
<b>H</b>	Z absolute starting (rapid) height (must be 0.1 in. or 2 mm above surface to be cut into). Required.
<b>Z</b>	Absolute depth of frame. Required.
<b>A</b>	Maximum tool stepover (must be less than tool diameter). +A dimension = climb (CCW). -A dimension = conventional (CW). Defaults to half tool diameter.
<b>B</b>	Maximum Z depth per pass (For example, if Z is programmed to be -1, and B to be 0.5, the frame will be roughed out in two levels.) B is programmed as a positive dimension. Defaults to tool diameter (depth) less finish stock.
<b>I</b>	Ramp in feed: The tool will ramp into the first depth of cut with a YZ move from the I.D. of the frame to the O.D. of the frame. Defaults to last programmed feedrate.
<b>J</b>	After the ramp-in move described above, the tool will rough-mill the frame, at feedrate J. Defaults to last programmed feedrate.
<b>U</b>	Inside corner radius of frame (corner radius of island). Required.
<b>V</b>	Outside corner radius of frame. Defaults to value of U. Must be equal to or greater than tool radius.
<b>C</b>	Frame width. Required.
<b>S</b>	Finish stock amount per side (including bottom). If you enter a negative value, stock will be left, but no finish pass will occur. If you do not enter a value, finish stock will not be left.
<b>K</b>	Finish-pass feedrate. Defaults to last programmed feedrate.
<b>P</b>	Z-axis absolute (rapid) retract height (must be equal to or above H). Defaults to H value.

**Example:**

G75 M3 W1.125 H.1 Z-.375 A.25 B.36 I5 J18 U.25 V.5 C1 S.015 K30 P.1

**Figure 5-9** illustrates the moves output by the CNC to mill the frame.

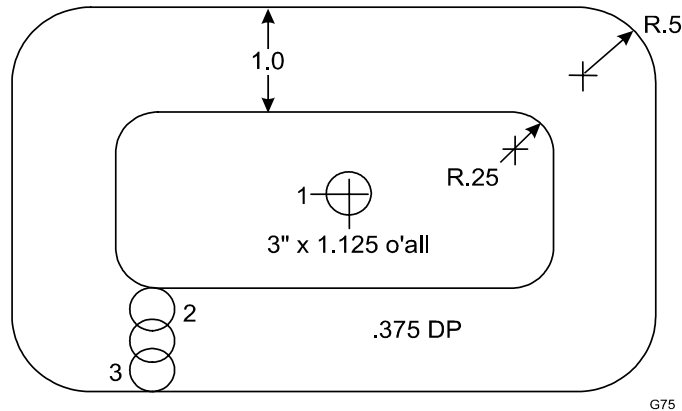

**Figure 5-9, G75 Programming Example**

The tool will perform the following operations:

**NOTE:** If X and Y are not provided, position the tool at the center of the island prior to G75.

1. Tool will rapid from position 1 to position 2: X is the center of the inside corner radius (U), and Y is the corner radius plus tool radius plus finish stock.
2. Tool will feed  $-.1$  (or 2 mm) in Z to the part surface.
3. Tool performs a ramp-in move to O.D. of frame minus tool radius minus finish stock (position 3).
4. Tool then moves 360 degrees CCW around frame back to position 3.
5. Tool then steps over calculated amount, and mills CW until position 2 is reached again at depth.
6. Tool then mills 360 degrees CW (climb-milling) around the island.

**NOTE:** The number of times the tool repeats Steps 3 through 6 depends on the Z and B dimensions.

7. When the frame is completed, the tool rapids first to the P dimension, then to the center of the island.

## Hole Milling (G76)

**Format:** G76 Xn Yn Dn Zn Bn Hn Sn Jn Kn

Use the hole milling cycle (G76) to machine through holes or counter-bores. You can position the tool at the hole center prior to the G76 block. Activate a tool prior to G76 so that the CNC knows the tool diameter. Refer to **Table 5-17**.

If you do not provide Z and H, program a separate Z move to raise the tool out of the hole after the cycle.

**Table 5-17, G76 Address Words**

Address Word	Description
<b>X</b>	X coordinate of the center. Default: pocket centers at present position. Optional.
<b>Y</b>	Y coordinate of the center. If no coordinate is provided, default is set to present position. Optional.
<b>Z</b>	The absolute depth of the finished pocket. Optional.
<b>B</b>	Z-axis increment used for each pass. Optional.
<b>H</b>	Absolute Z position to which the CNC rapids before feeding into the workpiece. Optional.
<b>D</b>	Diameter of hole. Negative D = CW direction. The direction CCW (climb milling) is reversible: +D dimension = climb (CCW). -D dimension = conventional (CW). Required.
<b>J</b>	Rough-pass feedrate. Defaults to last programmed feedrate.
<b>S</b>	Finish-stock amount per side. If you enter a negative value, stock will be left, but no finish pass will occur. If you do not enter a value, no finish stock will be left.
<b>K</b>	Finish-pass feedrate. Defaults to last programmed feedrate.


### Example:

G76 D2.5 J12 S.01 K20

In [Figure 5-10, G76 Programming Example](#), the tool will perform the following operations:

1. Tool moves from position 1 to a position 45 degrees from center, at half the radius (position 2).
2. Tool then arcs onto the O.D. tangential (CCW) (position 3).
3. Tool mills O.D. CCW (position 4).
4. Tool leaves O.D. tangentially to a point 135 degrees from the center at half the radius. CCW (position 5).

5. Tool returns to center (position 6).
6. If you have programmed a finish pass, the process repeats at the finish dimensions.

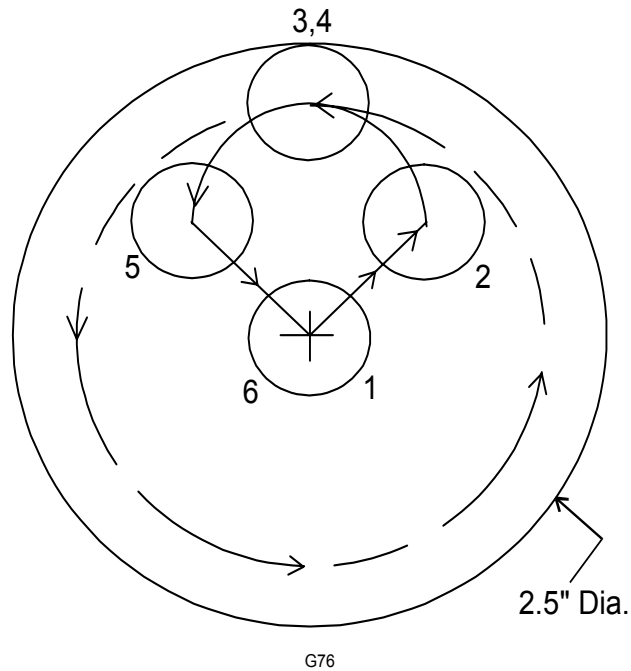

**Figure 5-10, G76 Programming Example**

**Circular Pocket Milling (G77)**

**Format:** G77 Xn Yn Hn Zn Dn An Bn In Sn Kn Pn

Use the circular pocket canned cycle (G77) to mill round pockets. You do not have to place the tool at the center of the pocket, since the cycle has variable words for X and Y center. If X and Y variable words are not programmed, the CNC will use the current position as the pocket center. Refer to **Table 5-18**.

Activate a tool prior to programming G77 so that the CNC will know the cutter diameter. You can position the tool at the pocket center and omit the XY words. By default, the CNC will use the current position as the pocket center.

**Table 5-18, G77 Address Words**

<b>Address Word</b>	<b>Description</b>
<b>X</b>	Center of the pocket in X-axis. Defaults to current position.
<b>Y</b>	Center of the pocket in Y-axis. Defaults to current position.
<b>H</b>	Z absolute starting height (0.1 in. or 2 mm above surface). Required. Executed in rapid.
<b>Z</b>	Absolute depth of pocket. Required.
<b>D</b>	Diameter of pocket. The direction CCW (climb milling) is reversible: +D dimension = climb (CCW). -D dimension = conventional (CW). Required.
<b>A</b>	Maximum tool stepover (must be less than tool diameter). If +A dimension = outward spiral. If -A dimension = inward spiral. On inward spirals, the tool moves to O.D. at 0 degrees, and begins the roughing process there (3 o'clock). Defaults to tool radius.
<b>B</b>	Maximum Z depth per pass (Example: If Z is programmed to be -1, and B to be .5, the pocket will be roughed out in two levels.) B is programmed as a positive dimension. Defaults to tool diameter (depth), less finish stock.
<b>I</b>	Ramp in/rough feed: The tool will ramp into the first depth of cut with a spiral move from the I.D. of the pocket to the O.D. of the pocket. The feedrate for this move is programmed as I. After the ramp-in move, the tool will rough-mill the pocket, at feedrate I. Defaults to last programmed feedrate.
<b>S</b>	Finish-stock amount per side (including bottom). If you enter a negative value, stock will be left, but no finish pass will occur. If not programmed, no finish stock is left.
<b>K</b>	Finish-pass feedrate. Defaults to last programmed feedrate.
<b>P</b>	Z-axis absolute-retract height (must be equal to or above H). Executed in rapid. Defaults to H dimension (start height).




**Example:**

G77 X2 Y2 H.1 Z-.25 D3 A.35 B.25 I12 S.01 K20 P.1

In **Figure 5-11**, the tool will perform the following operations:

**NOTE:** Figure 5-11 shows only the tool path.

1. Tool will move to X2 Y2 (position 1) in current modes: G0/1, G90/91, G70/71 (position 1).
2. Tool will feed 0.1 in. (2 mm) down in Z-axis.
3. Tool will move to O.D. (less finish stock) in a 3-axis spiral motion (position 2).
4. Tool will make a full circle (position 2).
5. Tool then spirals inward to complete the roughing cycle, at the first level.
6. If you have specified a finish pass, repeat steps 3 through 5 at the finish feedrate.
7. Tool rapids to P dimension, then to the original XY location.

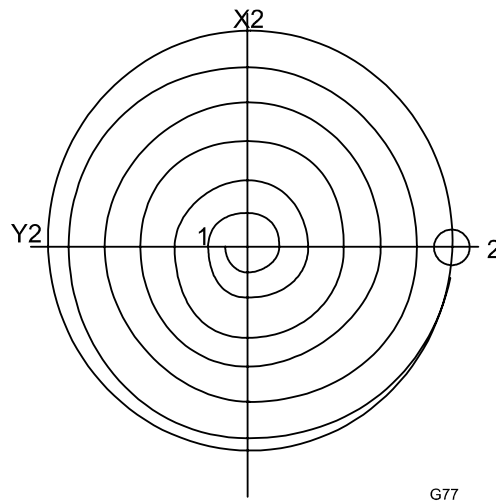

**Figure 5-11, G77 Programming Example**

**Rectangular Pocket Milling (G78)**

**Format:** G78 Xn Yn Hn Zn Un An Bn In Jn Sn Kn Pn

Use the rectangular pocket cycle (G78) to mill square or rectangular pockets. You must position the tool directly over the center of the pocket prior to the G78 block, or use the X Y words. Refer to **Table 5-19**.

Activate a tool prior to programming G78, so cutter diameter is known.

**Table 5-19, G78 Address Words**

<b>Address Word</b>	<b>Description</b>
<b>X</b>	X coordinate of the center. Default: pocket centers at present position. Optional.
<b>Y</b>	Y coordinate of the center. If no coordinate is provided, default is set to present position. Optional.
<b>M</b>	Length of pocket in X-axis. Required.
<b>W</b>	Width of pocket in Y-axis. Required.
<b>H</b>	Z absolute starting height (must be 0.1 in. or 2 mm above surface to be cut). Executed in rapid. Required.
<b>Z</b>	Absolute depth of pocket. Required.
<b>U</b>	Actual corner radius of pocket (all four corners will be same). Must be equal to or greater than tool radius. Defaults to tool radius.
<b>A</b>	Maximum tool stepover (must be 70% or less of tool diameter). +A dimension = climb (CCW). -A dimension = conventional (CW). Defaults to half tool diameter.
<b>B</b>	Maximum Z depth per pass (Example: if you program Z to be -1, and B to be .5, the CNC will rough out the pocket in two levels.) B is programmed as a positive dimension. Defaults to tool diameter (depth), less finish stock.
<b>I</b>	Ramp in feed: The tool will ramp into the first depth of cut with an XYZ move from the centerline of the lower-left radius toward the center of the pocket. The feedrate for this move is programmed as I. Defaults to last programmed feedrate.
<b>J</b>	After the ramp-in move, the tool will rough-mill the pocket, at feedrate J. Defaults to last programmed feedrate.
<b>S</b>	Finish stock amount per side (including bottom). If entered as negative, stock will be left, but no finish pass will occur. If not programmed, no finish stock is left.
<b>K</b>	Finish-pass feedrate. Defaults to last programmed feedrate.

(Continued...)

**Table 5-19, G78 Address Words (Continued)**

Address Word	Description
P	Z-axis absolute finish height (must be equal to or above H). Executed in rapid. Defaults to H value.  <b>WARNING: When you cut a pocket inside another pocket, you must set P above the highest pocket. At the end of each pocket, the tool will rapid to P, then rapid to the start position.</b>

**Example:**


G78 M4 W2 H.1 Z-.5 U.75 A.35 B.25 I7 J12 S.01 K20 P.1

**NOTE:** If you do not use X and Y words, you must position the tool at the center of the pocket before the G78 block.

In **Figure 5-12**, the tool will perform the following operations:

**NOTE:** **Figure 5-12** shows only the tool path.

1. Tool moves to the center of the radius in the lower-left corner (position 1).
2. Tool feeds  $-.1''$  (2 mm) to meet the part surface.
3. Tool moves in XYZ toward center of pocket (position 2) to the first roughing depth, at feedrate I.
4. Tool mills out the pocket with straight lines and arcs (if necessary), using feedrate J, until first level is completed.
5. Tool repeats this process if necessary to achieve full depth (less finish stock).
6. Optional finish pass is made in the same manner at feedrate K.
7. When the pocket is complete, tool rapids to P, then to the center of the pocket.

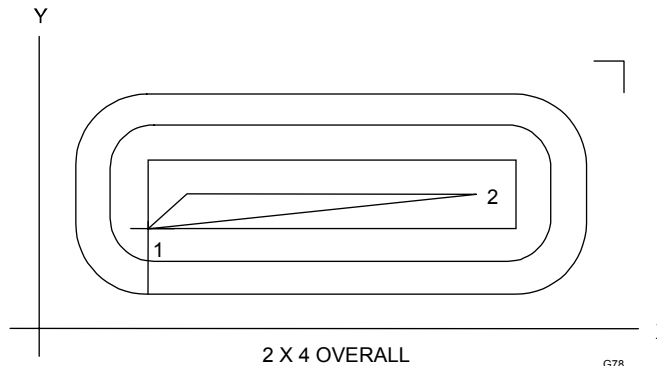

**Figure 5-12, G78 Programming Example**

**Area Clearance (Irregular) Pocket Milling (G169)**

**Format:** G169 Wn Xn Yn Hn Zn Cn Dn En An Bn Sn In Jn Kn Pn

Use G169 to mill irregular pockets. You must enter the perimeter of the shape into a subprogram. The first move in the subprogram must be a rapid move to the pocket start point (corner, end, or most convenient location). Do not include parametric programming, tool compensation, or feedrates in the subprogram, only the exact perimeter of the pocket. Use only closed shapes. In a closed shape, the start point of the first (rapid) move and the endpoint of the last move (line or arc) are the same. The CNC will automatically calculate the moves necessary to clear out the shape. Islands are not allowed. Refer to **Table 5-20**.

**Table 5-20, G169 Address Words**

<b>Address Words</b>	<b>Description</b>
<b>W</b>	The number of the subprogram that contains the perimeter of the pocket. Must be a closed shape. Required.
<b>X</b>	The X position from which the stepover cuts will begin. Must be inside the pocket, including the tool radius. <b>NOTE:</b> ANILAM recommends that you leave this parameter blank. (The CNC will pick point.)
<b>Y</b>	The Y position from which the step-over cuts will begin. Must be inside the pocket, including the tool radius. <b>NOTE:</b> ANILAM recommends that you leave this parameter blank. (The CNC will pick point.)
<b>H</b>	The Absolute Z position before beginning to mill the pocket. This must be 0.1 in. (or 2 mm) above the surface.
<b>Z</b>	The Absolute depth of the pocket.
<b>C</b>	The angle of the cut, in reference to 0 degrees (3-o'clock position). This is necessary only if the first element of the profile subroutine is an arc, or if you want to change the original path automatically output by the CNC. Defaults to angle of the first subprogram move.
<b>D</b>	The X starting coordinate of the tool. The tool will move from this point to the XY starting point, in a 3-axis ramp move. This is a "ramp-from" point.
<b>E</b>	The Y starting coordinate of the tool. The tool will move from this point to the XY point, in a 3-axis ramp move. This is a "ramp-from" point.
<b>A</b>	The distance the tool will step over (width of cut) as it mills out the pocket. The step over selected may need to be adjusted to ensure that excessive stock is not left on any of the pocket sides.

*(Continued...)*

**Table 5-20, G169 Address Words (Continued)**

Address Words	Description
<b>B</b>	The depth per pass. If a deep pocket is necessary, it might not be feasible to take all the stock in one cut, so the Depth of Cut can be programmed to allow two or more passes.
<b>S</b>	Finish stock. The CNC automatically executes a finish pass after it roughs out the pocket. The finish stock amount applies to sides and bottom. If you do not specify a value, finish stock is not left.
<b>I</b>	The feedrate at which the tool will "ramp" into the pocket in all three axes.
<b>J</b>	Rough-cycle feedrate.
<b>K</b>	Finish-cycle feedrate.
<b>P</b>	The Absolute Z position at the end of the cycle. Defaults to H value.

### Using Irregular Pocket in Subprograms

The Irregular Pocket is typically used with the main program. In cases where the Irregular Pocket is being used in a subprogram, an M-code must be used to specify the tool number whose tool diameter must be used in the calculations of the Irregular Pocket. The M-code must be placed immediately before the Irregular Pocket. If Irregular Pocket is used in the main program, it is not necessary to use this M-code.

**Format:** MCode 9367 X (tool#)

Tool# is the number of the tool diameter whose diameter must be used in the calculations of the Irregular Pocket.

**Example:**

```
M9367 X3
G169 W1 X2.0 Y2.0 (etc.)
```

This will use the diameter of Tool# 3 in the calculations of the Irregular Pocket.

## Pockets with Islands (G162)

**Format:** G162 An Bn Cn Dn En

This cycle allows islands in irregular pockets. The main pocket must be the lowest subroutine number. Normally, this would be one (1). Pockets with Islands can be programmed using:

- DXF (see “[Section 17, Using DXF for Pockets with Islands \(G162\)](#)”)
- CAM (see “[Section 18, Example #12 Using CAM for Pockets with Islands \(G162\)](#)”)
- Subroutines

More than one **G162** Island cycle can be programmed at a time. They may be strung together, but on separate lines. Islands can be programmed inside of islands. Five islands can be put on a line. The shape number subroutine number is used as inputs. Refer to **Table 5-21**.

Activate a tool prior to programming G78, so cutter diameter is known.

**Table 5-21, G162 Address Words**

Address Word	Description
<b>A</b>	First island. Required.
<b>B</b>	Second island. Optional.
<b>C</b>	Third island. Optional.
<b>D</b>	Fourth island. Optional.
<b>E</b>	Fifth island. Optional.

### Using Subroutines for Pockets with Islands

The program below is the same one used in the DXF portion with subroutines added for the letters. In the third G162 some of the numbers have negative sign (-) in front of them, this changes the side of the cutter comp for the islands in islands. See [Figure 5-13, Subroutines Pockets with Islands Example Workpiece](#) and [Table 5-22, Pockets with Islands Subroutines Programming Example](#).

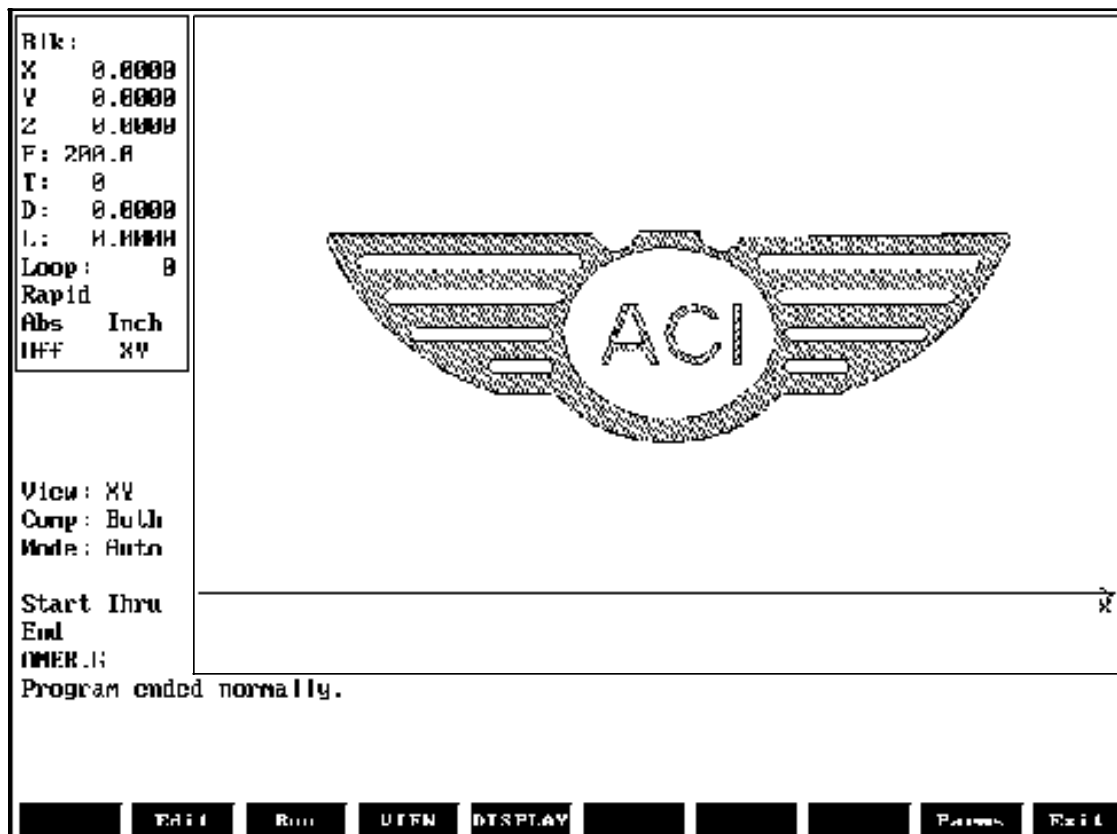


Figure 5-13, Subroutines Pockets with Islands Example Workpiece

Table 5-22, Pockets with Islands Subroutines Programming Example

N1	G00 G17 G70 G90
N2	T1D.0205 L-1 M6
N3	S1250M3
N4	M8
N5	G53O01
N6	G162 A2 B3 C4 D5 E6
N7	G162 A7 B8 C9 D10
N8	G162 A-11 B12 C-13 D-14
N9	G169 W1 H0.1 Z-0.0050 C299. A0.0080 I5.0 J12.0 S0.0010 K10.0 P1
N10	M2
N11	
N12	O11
N13	X1.1044 Y0.5
N14	Z0.1
N15	G01 Z-0.005
N16	G01 X1.159 Y0.65
N17	X1.2052


N18	X1.2598 Y0.5
N19	X1.2226
N20	X1.2135 Y0.525
N21	X1.1507
N22	X1.1416 Y0.5
N23	X1.1044
N24	G00 Z0.1
N25	M99
N26	
N27	
N28	O12
N29	X1.1634 Y0.56
N30	Z0.1
N31	G01 Z-0.005
N32	G01 X1.1821 Y0.6112
N33	X1.2007 Y0.56
N34	X1.1634
N35	G00 Z0.1
N36	M99
N37	
N38	O13
N39	X1.4007 Y0.55
N40	Z0.1
N41	G01 Z-0.005
N42	G01 X1.3612
N43	G02 Y0.6 I-0.0312 J0.025
N44	G01 X1.4007
N45	G03 Y0.55 I-0.0707 J-0.025
N46	G00 Z0.1
N47	M99
N48	
N49	O14
N50	G0 X1.42Y.5
N51	G1 X1.42Y.65
N52	G1 X1.460 Y.65
N53	G1 X1.460 Y.5
N54	G1 X1.42 Y.5
N55	M99



### Irregular Pocket Examples

#### Example 1:

This example uses an irregular pocket cycle to cut the pocket shape. Refer to **Figure 5-14**. Program the perimeter of the pocket in a subprogram. The CNC calculates the moves to mill out the pocket. Enter a 3/8" diameter tool in the Tool Page. This part program consists of a main program and a subprogram. Refer to **Table 5-23**.

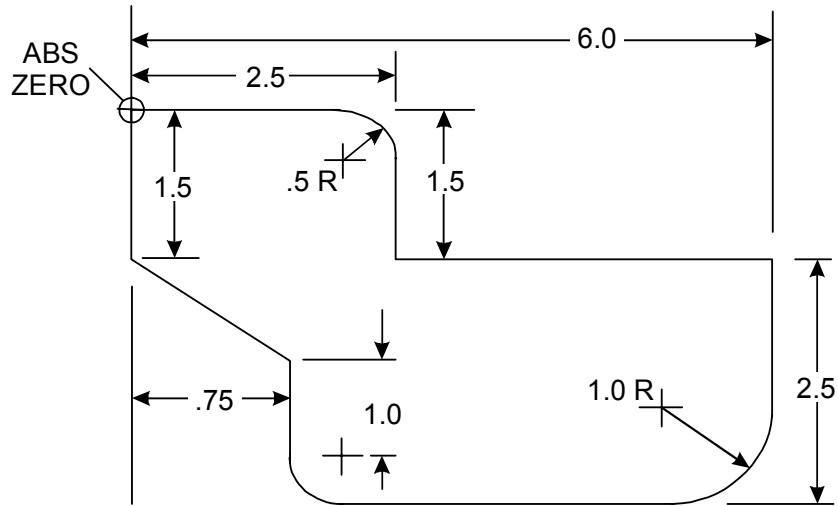

**Figure 5-14, G169 Programming Example 1**


**Table 5-23, G169 Programming Example 1**

1	G90 G70 G17
2	T1
3	G169 W1 H.1 Z-.125 D1.0 E-1.0 A.15 S.01 I7.5 J12.5 K9.5
4	G90 G00 T0 Z0
5	M2
6	O1
7	G90 G00 X0.0 Y0.0
8	G01 X2
9	G2 X2.5 Y-.5 R.5
10	G1 Y-1.5
11	X6
12	Y-3
13	G2 X5 Y-4 R1
14	G1 X1.25
15	G2 X.75 Y-3.5 R.5
16	G91 G1 Y1

17	G90 X0 Y-1.5
18	Y0
19	M99

**Example 2:**

Use an irregular pocket cycle to cut the pocket shape. Input the "perimeter" of the pocket into a subprogram. The CNC will calculate the moves to mill out the pocket. Input a 3/8" diameter tool in the Tool Page. This part program consists of a main program and a subprogram. Refer to **Figure 5-15** and **Table 5-24**.

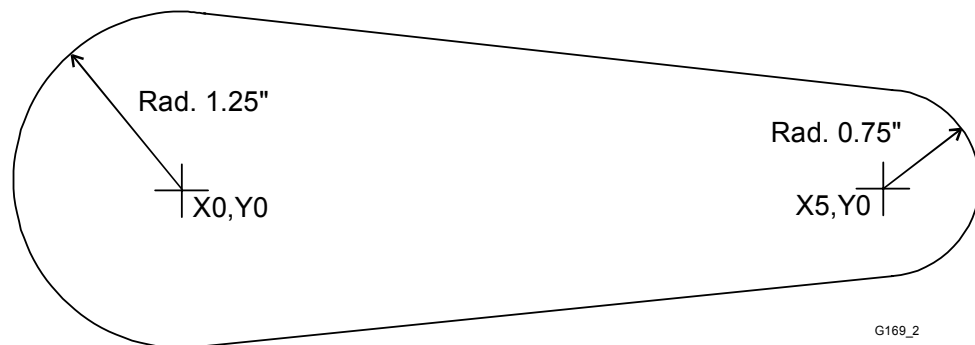


**Figure 5-15, G169 Programming Example 2**

**Table 5-24, G169 Programming Example 2**

1	G90 G70 G0 T0 Z0
2	T1
3	G169 W99 H.1 Z-.25 C89.9 D0 E0 A.16 B.125 S.01 I7.5 J12.5 K9.5
4	G90 G00 T0 Z0
5	M2
6	O99
7	G90 G00 X-1.25 Y0
8	G2 X .125 Y 1.2437 R1.25
9	G1 X 5.075 Y .7462
10	G2 X5.075 Y-.7462 R.75
11	G1 X .125 Y -1.2437
12	G2 X -1.25 Y0.0 R1.25
13	M99

[Figure 5-16, Example 2, Toolpath](#) illustrates the toolpath used by the CNC to mill out Example 2.

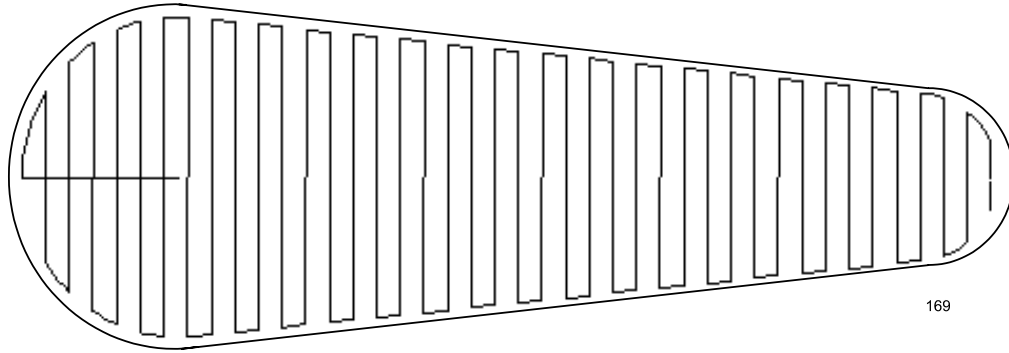


**Figure 5-16, Example 2, Toolpath**

### Facing Cycle (G170)

**Format:** G170 Xn Yn An Bn Fn Hn Zn Dn En

Facing cycles simplify the programming required to face the surface of a part.

Execution begins one tool radius from the D and E (start point). The selected stepover determines the approach axes. Refer to **Figure 5-17**.

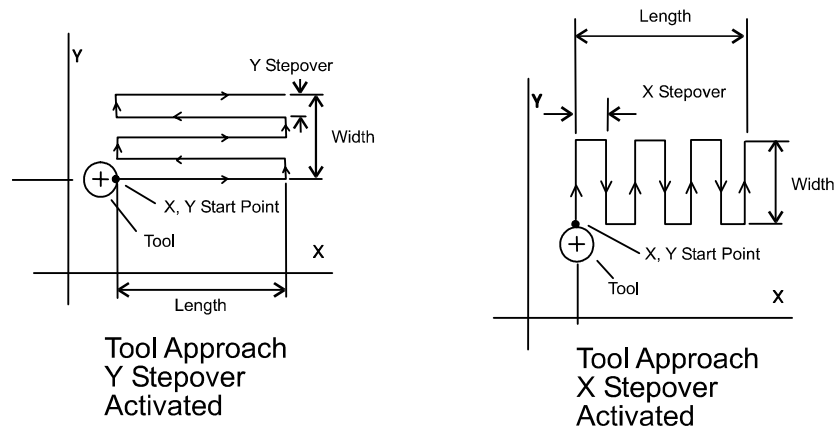

**Figure 5-17, Face Cycle Tool Approach**

Facing cycles can start in any corner of the surface and cut in any direction, depending on the sign (+/-) of the X (Length) and A (Width) values. Program a slightly oversized X and A to ensure complete facing of the surface.

At the end of the cycle, the tool rapids to H, then rapids back to D and E (start position).

Table 5-25 describes the **FACE POCKET** entry fields.

**Table 5-25, G170 Address Words**

Address Word	Description
<b>Y</b>	Y-axis length to be faced. Required.
<b>X</b>	X-axis length to be faced. Required.
<b>A</b>	Width of cut in the X-axis direction. When you do not enter a value, the CNC defaults to 70% of the active tool radius. Maximum step-over permitted is 70% of the active tool radius.
<b>B</b>	Width of cut in the Y-axis direction. When you do not enter a value, the CNC defaults to 70% of the active tool radius. Maximum stepover permitted is 70% of the active tool radius.
<b>F</b>	Feedrate used in cycle.
<b>H</b>	The Absolute Z position before beginning the facing cycle. This must be 0.1 in. (or 2 mm) above the surface. Executed in rapid. Required.
<b>Z</b>	Absolute depth of the finished surface. Required. <b>NOTE:</b> Z must be lower than H. H is 0.1 in. (2.0 mm) above the work surface.
<b>D</b>	X coordinate of the starting point. Defaults to current position.
<b>E</b>	Y coordinate of the starting point. Defaults to current position.

**NOTE:** Enter either an X or Y stepover only. Do not enter both.

**NOTE:** The Program Editor will allow you to inadvertently write a block containing a stepover value greater than 70% of the active tool radius. Test a program in the Draw Graphics Mode to reveal this type of error.

**NOTE:** Z must be lower than H. H is 0.1 in. (2.0 mm) above the work surface.

### Circular Profile Cycle (G171)


**Format:** G171 Xn Yn Hn Dn Zn An Rn Bn Sn In Jn Kn Pn

The Circular Profile Cycle cleans up the inside or outside profile of an existing circle.

When executed, the CNC rapids to Ramp#1 starting position, rapids to H (StartHgt), then feeds to the depth of the first cut.

The machine feeds into the profile along Ramp #1, cuts the circle to the specified **D** (Diameter) then ramps away from the work along Ramp #2.

When cutting an outside profile, the tool ramps into the work along Ramp #1 and away from the work along Ramp #2 as illustrated in **Figure 5-18**.

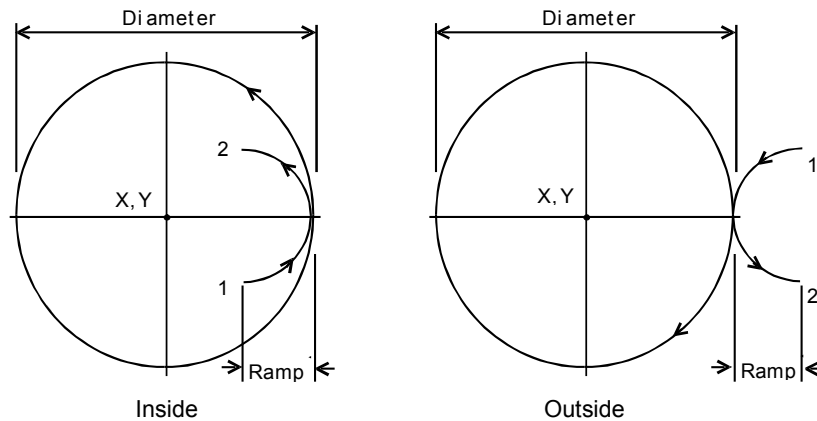

**Figure 5-18, Ramp Position for Inside and Outside Profile**

The Circular Profile Cycle automatically compensates for tool diameter. Activate the correct tool diameter before the G171 block.

**Table 5-26** describes the **CIRCULAR PROFILE** entry fields.

**Table 5-26, G171 Address Words**

Address Word	Description
<b>X</b>	X coordinate of the center. Default: present position. Optional.
<b>Y</b>	Y coordinate of the center. Default: present position. Optional.
<b>H</b>	Z absolute starting (rapid) height (must be 0.1 in. or 2 mm above surface to be cut into). Executed in rapid. Required.
<b>D</b>	Finished diameter of circle. If you enter a negative value, both the direction of cut and the starting and endpoints reverse. Required.

(Continued...)

**Table 5-26, G171 Address Words (Continued)**

<b>Address Word</b>	<b>Description</b>
<b>Z</b>	Absolute depth of the finished profile. Required.
<b>A</b>	Setting for cutting on the inside of the profile (In) or the outside (Out). Selection required. 0=In, 1=Out.
<b>R</b>	Ramp distance used for each pass. Optional.
<b>B</b>	Z-axis increment used for each pass. Optional.
<b>S</b>	Amount of stock left by the machine before the finish pass. Default: 0. Enter a negative value to leave the stock without making a finish pass. Optional.
<b>I</b>	Z-axis feedrate. Optional.
<b>J</b>	Rough-pass feedrate. Optional.
<b>K</b>	Finish-pass feedrate. Optional.
<b>P</b>	Retract Hght.

If you enter a Depth Cut = B (Z Max.cut), the CNC executes the number of passes required to get from the H (Z Start Hgt.) to Z (Z Depth), cutting to the Depth Cut = B (Z Max.cut) on each pass.

When you enter an S (Finish Stock) value, the CNC leaves the specified stock on the profile and depth for a finish pass. The CNC finishes to the entered diameter on the finish pass. Enter a negative S (Finish Stock) to leave the finish stock without making a finish pass.

If you do not enter a J (Rough Feed) or K (Finish Feed) value, the CNC executes feed moves at the current feedrate. J controls feedrate of the roughing cycle. K controls the feedrate of the finishing cycle.

### Rectangular Profile Cycle (G172)


**Format:** G172 Xn Yn Hn Mn Wn Zn An Rn Un Bn Sn In Jn Kn Pn

The Rectangular Profile Cycle cleans up the inside or outside profile of a rectangle. When run, the CNC rapids to the Ramp #1 starting position, rapids to H (Z StartHgt), and then feeds to the depth of the first cut.

The machine feeds into the profile along Ramp #1, cuts the rectangle to the M (Length) and W (Width) specified then ramps away from the work along Ramp #2.

When cutting an inside profile, the Graphic Menu displays ramp moves.

When cutting an outside profile, the tool ramps into the profile along Ramp #1 and away from the profile along Ramp #2, as illustrated in **Figure 5-19**.

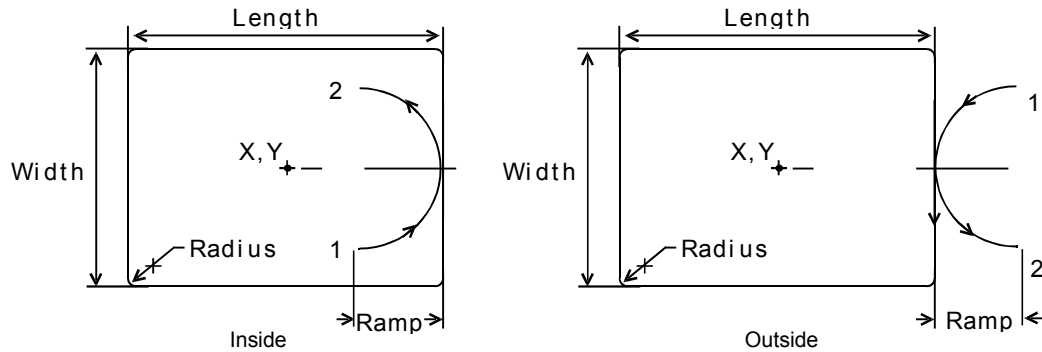

**Figure 5-19, Inside and Outside Profile Ramp Moves**

The Rectangular Profile Cycle automatically compensates for tool diameter. Activate the correct tool diameter before the G172 block.

**Table 5-27** describes the **Outside Profile Ramp Moves** entry fields.

**Table 5-27, G172 Address Words**

Address Word	Description
<b>X</b>	X coordinate of the center. If no coordinate is entered, the CNC centers the pocket at its present position.
<b>Y</b>	Y coordinate of the center. If no coordinate is entered, the CNC centers the pocket at its present position.
<b>H</b>	The Absolute Z position before beginning to mill the pocket. This must be 0.1 in. (or 2 mm) above the surface.
<b>M</b>	Finished length of rectangle. Required.
<b>W</b>	Finished width of rectangle. Required.
<b>Z</b>	Absolute depth of the finished profile. Value required.

(Continued...)

**Table 5-27, G172 Address Words (Continued)**

<b>Address Word</b>	<b>Description</b>
<b>A</b>	0 = Inside 1 = Outside
<b>R</b>	Radius of the ramping moves. Required.
<b>U</b>	Corner radius setting. If the programmer enters a negative value, both direction of cut and the starting and endpoints reverse. Optional.
<b>B</b>	Maximum Z-axis increment used for each pass. Optional.
<b>S</b>	Amount of stock left by the machine before the finish pass. Default: 0. If the programmer enters a negative value, the CNC will leave the stock without making a finish pass. Optional.
<b>I</b>	Z-axis feedrate. Optional.
<b>J</b>	Rough-pass feedrate. Optional.
<b>K</b>	Finish-pass feedrate. Optional.
<b>P</b>	Retract Hgt.

When you enter a value, the CNC executes the number of passes required to get from the H (Z Start HGT) to the Z (Z Depth), cutting the B (Z Max.cut) on each pass.

When you enter an S (Finish Stock) value, the CNC leaves the specified stock on the profile and depth for a finish pass. The CNC cuts the rectangle to the M (Length), W (Width), and Z (Z Depth) dimensions on the finish pass. Enter a negative S (Finish Stock) to leave the finish stock without making a finish pass.

When you do not enter a J (Rough Feed) or K (Finish Feed), the CNC executes feed moves at the current feedrate. J (RoughFeed) controls the feedrate of the roughing cycle. K (Finish Feed) controls the feedrate of the finishing cycle.



### Thread Mill Cycle (G181)

**Format:** G181 Xn Yn Zn Hn Pn Dn Cn Bn Rn Sn En Jn Kn Vn

**WARNING:** The first move in this cycle is a rapid move to the center of the thread before moving the Z axis. Make sure the tool is properly located before calling up this cycle.


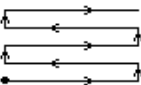
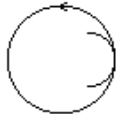
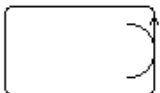

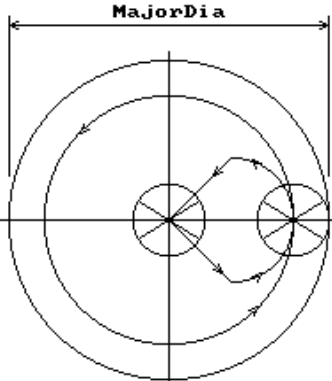
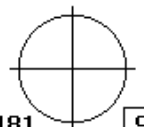
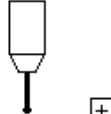

Use the thread milling for cutting inside or outside threads. It will cut either Inch or MM, left or right hand, and Z movement up or down. A single tooth or multi-toothed tool may be used. Start can be at the top or bottom of the hole or boss. The tools are set, as you would normally set TLO.

### Programming the Thread Mill Cycle

To program the Thread Mill Cycle:

1. In Edit mode, press **Help (F1)**, select **PATHS** from the menu, then **"THREAD MILL"** to display the G181 Thread Mill pop-up menu (refer to **Figure 5-20**).
2. Complete the entry fields (refer to [Table 5-28, G181 Address Words](#)), and press **EXIT (F10)**.

Depending on the parameters used and their values, when cutting a thread, the tool can ramp into the cut as illustrated in **Figure 5-20**. See [Table 5-28, G181 Address Words](#).

 <b>SPIRAL</b> G06 <span style="float: right;">3</span>	 <b>FACING</b> G170 <span style="float: right;">5</span>	 <b>CIRC PROFILE</b> G171 <span style="float: right;">7</span>	 <b>RECT PROFILE</b> G172 <span style="float: right;">8</span>
 <b>ELLIPSE</b> G05 <span style="float: right;">2</span>	<b>G181 THREAD MILL</b> X, Y, Z, H & P are all absolute D, - = Ccw, + = Cw C, Thread Depth, + = Inside Thread - = Outside 		 <b>THREAD MILL</b> G181 <span style="float: right;">9</span>
Incr. G91 Absolute G90  MM G71 Inch G70  YZ Plane G19 XZ Plane G18 XY Plane G17  Feed G1 Rapid G0 <span style="float: right;">1</span>	X Center X <input type="text"/> Y Center Y <input type="text"/> Z Fin Posn Z +0.0000 Z Start Posn H +0.0000 Z Safe Posn P +0.0000 Maj Thd Dia D +0.0000 Thread Depth C +0.0000 TPI/Lead B +0.0000 ArcIn Radius R <input type="text"/> Stock Amount S <input type="text"/> #Rough Pass E <input type="text"/> Rough Feed. J <input type="text"/> Finish Feed. K <input type="text"/> Taper Angle V <input type="text"/>		 <b>SPIN PROBING</b>   <b>TOOL PROBING</b>
G181 20.0000 H0.0000 P0.0000 D0.0000 C0.0000 B0.0000			

THREADMILLPU

**Figure 5-20, Thread Mill Pop-up Menu**

Table 5-28 describes the Thread Mill Cycle entry fields.

Table 5-28, G181 Address Words

Address Word	Description
<b>X</b>	Absolute X coordinate of the center of the thread. If no coordinate is entered, the CNC puts the center of thread at the current tool position. (Optional)
<b>Y</b>	Absolute Y coordinate of the center of the thread. If no coordinate is entered, the CNC puts the center of thread at the current tool position. (Optional)
<b>Z</b>	Absolute Z position where the thread cut will finish. This can be above or below the start position depending on the direction of the thread cut: up or down. (Required)
<b>H</b>	Absolute Z position where the thread cut starts. This can be above or below the finish position depending on the direction of the thread cut, up or down. If not set, cycle will use the current Z tool position. (Optional)
<b>P</b>	An Absolute safe Z position above the part for rapid moves in X and/or Y. (Required) <b>Warning: P must be above the part to avoid a crash while positioning.</b>
<b>D</b>	Major thread Diameter. If this is a tapered thread, it is the major diameter at the Z start position. Hence, if you have a tapered hole and you start at the top and cut down, you would have a different major diameter than if you started at the bottom and cut up. A plus (+) value cuts in the CW direction and a minus (-) value cuts in the CCW direction. (Required)
<b>C</b>	Depth of thread. The incremental depth of thread on one side. A plus (+) value is inside thread, a minus (-) value is outside thread. (Required)
<b>B</b>	Threads per inch (TPI) or lead of thread in MM. Note: The minimum number of threads per inch is "1". (Required)
<b>R</b>	Size of radius arcing into start of thread. (Optional) <b>Note:</b> If <b>R</b> is a positive value or not set and the thread is "inside", the cycle will always return to the center between passes. If <b>R</b> is a negative value, the cutter will move to the start or end point that is closest to the center if inside thread, and farthest away from center if outside thread. If <b>R</b> is not specified at all and the thread is outside, the cutter will back away from the largest diameter by an amount equal to the thread depth.
<b>S</b>	Amount to leave for a finish pass after the roughing passes. (Optional)
<b>E</b>	Number of roughing cuts to be taken. (Optional) <b>Note:</b> If "Stock" is not set or set to zero and <b>E</b> is 1 or 0, the cycle will make just one pass at the full depth. If "Stock" is set to greater than zero and <b>E</b> is 1 or 0, the cycle will make one pass at the stock depth and one pass at full thread depth. <b>Note:</b> If you would like all non-cutting positioning moves to be rapid, set <b>E</b> to a negative number.

(Continued...)

**Table 5-28, G181 Address Words (Continued)**

Address Word	Description
<b>J</b>	Feedrate for roughing. (If not set (blank), the cycle will use the current active feedrate) (Optional)
<b>K</b>	Feedrate for the finish pass. (If not set (blank), the cycle will use the current active feedrate) (Optional)
<b>V</b>	Angle on one side of the thread, (not the included angle). The angle is measured from the right side going counter clockwise with a positive number and clockwise with a negative number. A standard pipe tape with an inside cut would be -1.7833. If not set (blank), than the thread is straight. (Optional)

Tool Length Offset is set the same as with any other tool or operation. A tool diameter also has to be set in the tool table, as cutter compensation is built into this cycle (cutter compensation is not allowed during the use of this cycle).

If X and Y are not programmed, position tool center of the thread before the G181 line:

- X and Y will rapid to the starting position of the thread.
- Z will rapid to the safe height specified in "P".
- The Z axis will feed down to the start cut position "H". This could be above or below the Z position specified in the "Z" finish position.
- Depending on what is in the "R" parameter the tool will arc into the first cut position.
- Spiral up or down, depending on the difference between "Z" and "H" and go counterclockwise or clockwise depending if "D" is plus or minus.
- Then arc-out and feed to the thread center for inside threads or a safe distance away from the thread for outside threads depending on the value in "R".
- Then feed back to the "H" height.
- Then feed X and Y to the next depth of cut. The depth of each roughing pass will be the thread depth specified in the "C" parameter minus the stock amount specified in the "S" parameter, divided by the number of roughing passes specified in the "E" parameter.
- The cycle repeats this process until the final finish pass.
- It will then cut the thread at the full thread major diameter.

When cutting a taper on an inside thread, care should be taken. An error will be generated if the diameter on the small end of the taper becomes too small for the tool to fit along with arc in and out moves. Not entering and arc-in value in the "R" parameter will allow the cycle to move to the center of the hole for maximum clearance.

**Sample Thread Milling Cycle Program**

```
1   G0 G90 G70 G17
2   T1 M6
3   S2000 M3
4   X0 Y0
5   G181 Z-1. H0.1 P.5 D1. C.0625 B8. R.1 S.002 E2 J20.0 K5.0
6   Z5
7   M5
8   M2
```

With a cutter diameter of 0.625, this program will cut a 1-8 inside thread at X0 Y0. The tool will spiral down the thread pitch of 8 threads per inch, finishing at a depth of -1. The starting height is 0.1, the safe rapid Z height is 0.5, the major thread diameter is 1 inch, and depth of thread is 0.0625. The arc-in radius is 0.1 and the stock amount for the finish pass is 0.002. The rough feedrate is 20.0 and the finish feedrate is 5.0.

<p><b>Note:</b> If you would like all non-cutting positioning moves to be rapid, set "E" to a negative number. The idea is to initially set "E" as a positive number and after proving out the program, change "E" to a negative number for faster production. If you only need one pass to size and you want the positioning moves to be rapid, set "E" to -1.</p>
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

### Plunge Circular Pocket Milling (G177)

**Format:** G177 Xn Yn Hn Zn Dn An Bn In Jn Sn Kn Pn

Use the plunge circular pocket cycle (G177) for carbide tooling, when a multiple-axis ramp-in move is not possible. The Z-axis will plunge (single-axis) to programmed depths. You must drill a start hole prior to using this cycle. Activate the tool prior to G177 so that tool diameter is known. The tool is not required to be at the center of the pocket, as the cycle has variable words for X and Y center. If you do not program X and Y variable words with G177, then the CNC will use the current position as the pocket center. Refer to **Table 5-29**.

**Table 5-29, G177 Address Words**

Address Word	Description
<b>X</b>	Center of the pocket in X-axis. Defaults to current position.
<b>Y</b>	Center of the pocket in Y-axis. Defaults to current position.
<b>H</b>	The Absolute Z position before beginning to mill the pocket. This must be 0.1 in. (or 2 mm) above the surface. Executed in rapid.
<b>Z</b>	Absolute depth of pocket.
<b>D</b>	Diameter of pocket. +D dimension = climb (CCW). -D dimension = conventional (CW).
<b>A</b>	Maximum tool stepover (must be less than tool diameter). If +A dimension = outward spiral. -A dimension = inward spiral. On inward spirals, the tool moves to O.D. at 0 degrees, and begins the roughing process there (3 o'clock). Defaults to tool radius.
<b>B</b>	Maximum Z depth per pass (For example, if Z = -1, and B to = .5, the pocket will be roughed out in two levels.) B is positive. Defaults to tool diameter (depth), less finish stock.
<b>I</b>	Z feedrate for plunge move. The tool will feed to the first depth of cut with a plunge move. Defaults to last programmed feedrate.
<b>J</b>	Feedrate of rough cycle used to mill out the pocket. Defaults to last programmed feedrate.
<b>S</b>	Finish stock amount per side (including bottom). Positive = leave stock and execute finish pass. Negative = leave stock without executing a finish pass. If no value is given, no finish stock is left.
<b>K</b>	Finish-pass feedrate. Defaults to last programmed feedrate.
<b>P</b>	Z-axis absolute-retract height (must be equal to or above H). Executed in rapid. Defaults to H value.

The required position of the start hole is as follows:

1. For inward to outward cutting (+A): at the hole center.
2. For outward to inward cutting (-A): start hole must be at the 3 o'clock position on the pocket perimeter, less finish stock, less tool radius.
3. Drilled to a sufficient depth.
4. The axes must be positioned over the start hole prior to programming this cycle.
5. If you position the tool at the pocket center and omit XY words from G177 block, the CNC will use current position as pocket center.

### Plunge Rectangular Pocket Milling (G178)

**Format:** G178 Xn Yn Hn Zn Un An Bn In Jn Sn Kn Pn

Use the plunge rectangular pocket cycle (G178) for carbide tooling, where a multiple-axis ramp-in move is not possible. The Z-axis will plunge (single-axis) to the programmed depth. You must drill a start hole previous to the G178 cycle. Activate a tool prior to programming G178, so cutter diameter will be known. Position the tool at the center of the pocket prior to G178, or use the X and Y words. Refer to **Table 5-30**.

**Table 5-30, G178 Address Word**

Address Word	Description
<b>X</b>	X center of pocket. Optional.
<b>Y</b>	Y center of pocket. Optional.
<b>M</b>	Length of pocket in X-axis. Required.
<b>W</b>	Width of pocket in Y-axis. Required.
<b>H</b>	Z absolute starting (rapid) height (0.1" or 2 mm above surface). Required. Executed in rapid.
<b>Z</b>	Absolute depth of pocket. Required.
<b>U</b>	Actual corner radius of pocket (all four corners). Must be equal or greater than tool radius. Defaults to tool radius.
<b>A</b>	Maximum tool stepover (must be 70% or less of tool diameter). Positive = CCW. Negative = CW. Defaults to half tool diameter.
<b>B</b>	Maximum Z depth per pass. (For example, if you program Z to be -1, and B to be .5, the CNC will rough out the pocket in two levels.) B is positive. Defaults to tool diameter (depth), less finish stock.
<b>I</b>	Z Plunge feed. The tool will plunge to the first depth of cut with a single-axis Z move from the centerline of the lower-left radius. Defaults to last programmed feedrate.
<b>J</b>	After the plunge move, the tool will rough mill the pocket, at feedrate J. Defaults to last programmed feedrate.
<b>S</b>	Finish stock amount per side (including bottom). Negative = stock will be left, but no finish pass will occur. Positive = leave stock and execute finish pass. If not programmed, no finish stock is left.
<b>K</b>	Finish-pass feedrate. Defaults to last programmed feedrate.
<b>P</b>	Z-axis absolute finish height (must be equal to or above H). Defaults to H value. Executed in rapid.  <b>WARNING: When you cut a pocket inside another pocket, you must set P above the highest pocket. At the end of each pocket, the tool will rapid to P, then rapid to the start position.</b>

You must position the start hole at the center of the pocket prior to G177 and drill to a sufficient depth.

**Mold Rotation (G45)**

**NOTE:** Activate the required plane (G17, G18 or G19) prior to G45.

I, J centerline of rotation values are used only if the other axis is not 0.

For X rotation, I = Y and J = Z.

For Y rotation, I = X and J = Z.

For Z rotation, I = X and J = Y.

A Mold Rotation (G45) is used to mill cylindrically symmetrical cavities and cores. A cylindrically symmetrical shape is a shape defined by rotating a profile around an axis. Refer to **Table 5-31** and [Figure 5-21, XY-Axis Mold Rotation](#).

There are two categories of mold rotation:


- Rotation around X- or Y-axes
- Rotations around the Z-axis

**Format:** G45 An Bn Cn Fn Rn X (or Y) (or Z) In Jn Kn

**Table 5-31, G45 Address Words**

Address Word	Description
<b>A</b>	Absolute start angle. Starting angle of the rotation. Required.
<b>B</b>	Absolute end angle. Final angle of the rotation. Required.
<b>C</b>	Number of subprogram cycles executed between start and stop angles. One cycle equals one forward plus one reverse subprogram pass. Set low for rough cycle. Set high for finish cycle. Required.
<b>F</b>	Forward subprogram call. Required.
<b>R</b>	Reverse subprogram call. Required.
<b>X (or Y) (or Z)</b>	Axis of rotation select. Required.
<b>I</b>	The centerline of rotation in the "other" axis. Other axis is X or Y (not the rotation axis described in XY).
<b>J</b>	Second position coordinate of the rotated axis in Z. Use only for Z rotation. Optional.
<b>K</b>	Z-axis rotation of XY-axis mold. Calculate CCW from XY plane 3 o'clock. Use only for X or Y rotation. Optional.




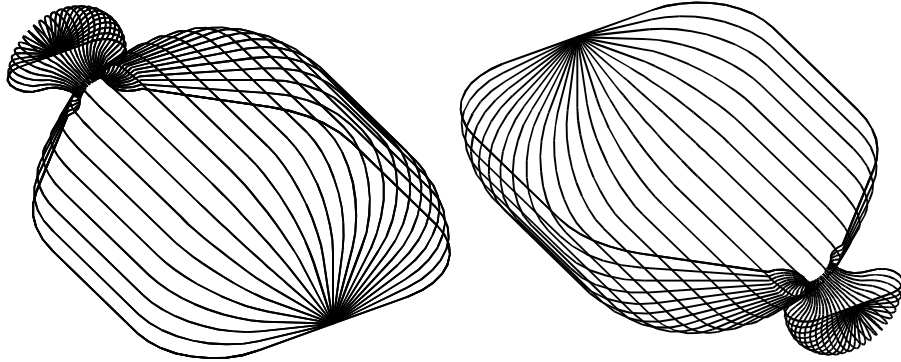

**Figure 5-21, XY-Axis Mold Rotation**

**Rotations Around X and Y Axes (Small Radius)**


Each Mold Rotation block requires two subprograms: a forward subprogram to define the profile moving away from the starting point and a reverse subprogram to define the profile moving back to the starting point. Refer to **Figure 5-22**.

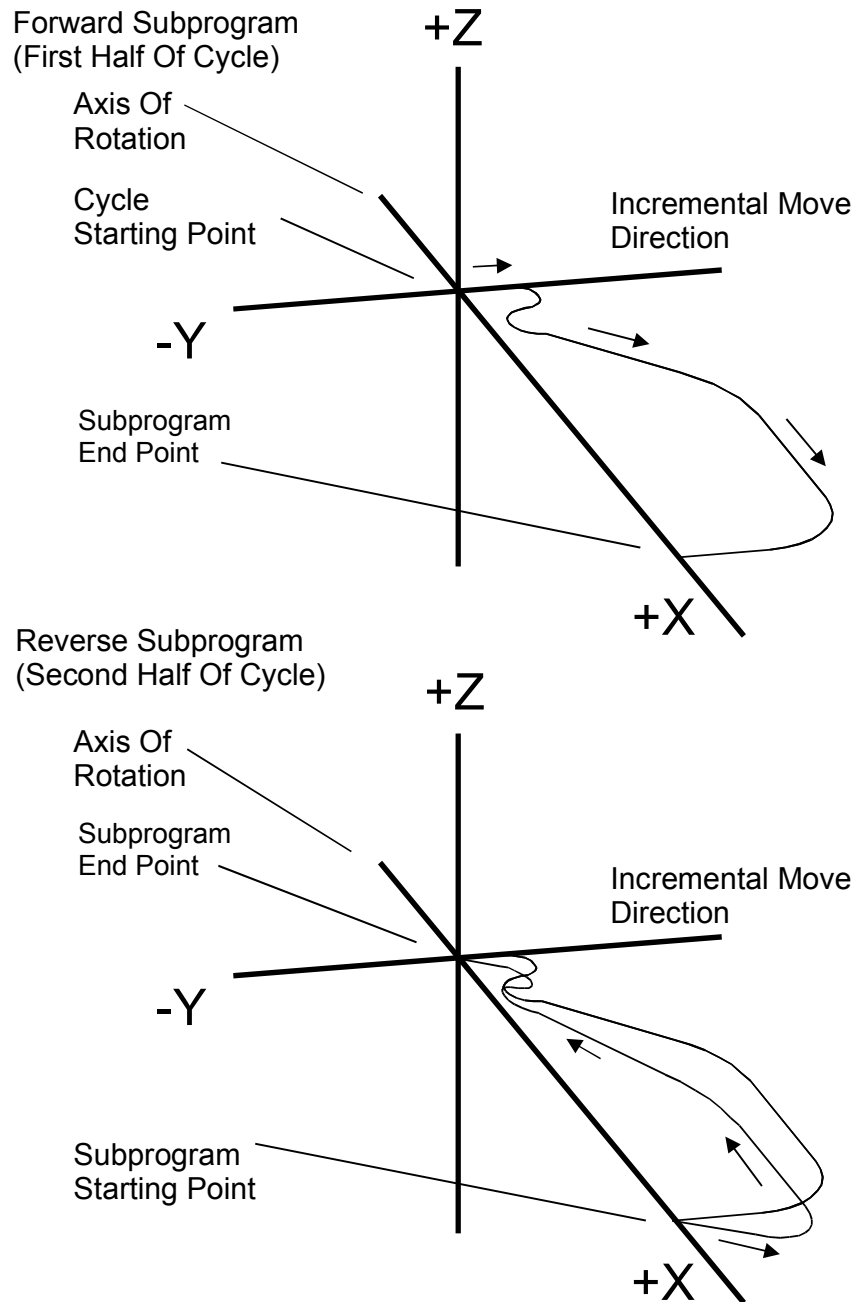

**Figure 5-22, Subprogram Orientation**

In one cycle, the CNC executes the forward subprogram to the profile endpoint, then executes the reverse subprogram back to the starting point. Each cycle is incremented around the axis of rotation from the start angle (A) to the end angle (B). The amount of rotation in each increment is determined from the number of cycle's (C) and the size of the start and end angle values programmed into the block.

The cycle starts cutting the first subprogram (profile) from the machine's present position. Refer to **Figure 5-23**.

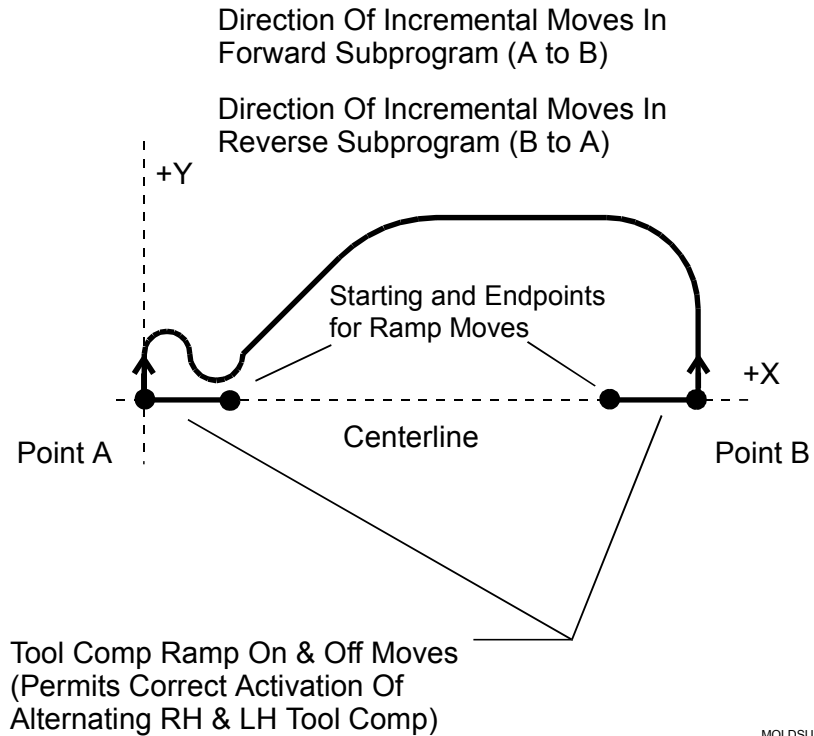

**Figure 5-23, Subprogram Specifics**

In small radius rotations, subprogram start and endpoints can lie along the centerline of rotation. All subprogram moves must be incremental. Both subprograms must produce profiles that are exactly the same shape, but that execute in opposite directions.

When the rotation is around the X-axis, all of the moves in the subprogram must be contained in the +Y half of the XY plane. When the rotation is around the Y-axis, all of the moves in the subprogram must be contained in the +X half of the XY plane.

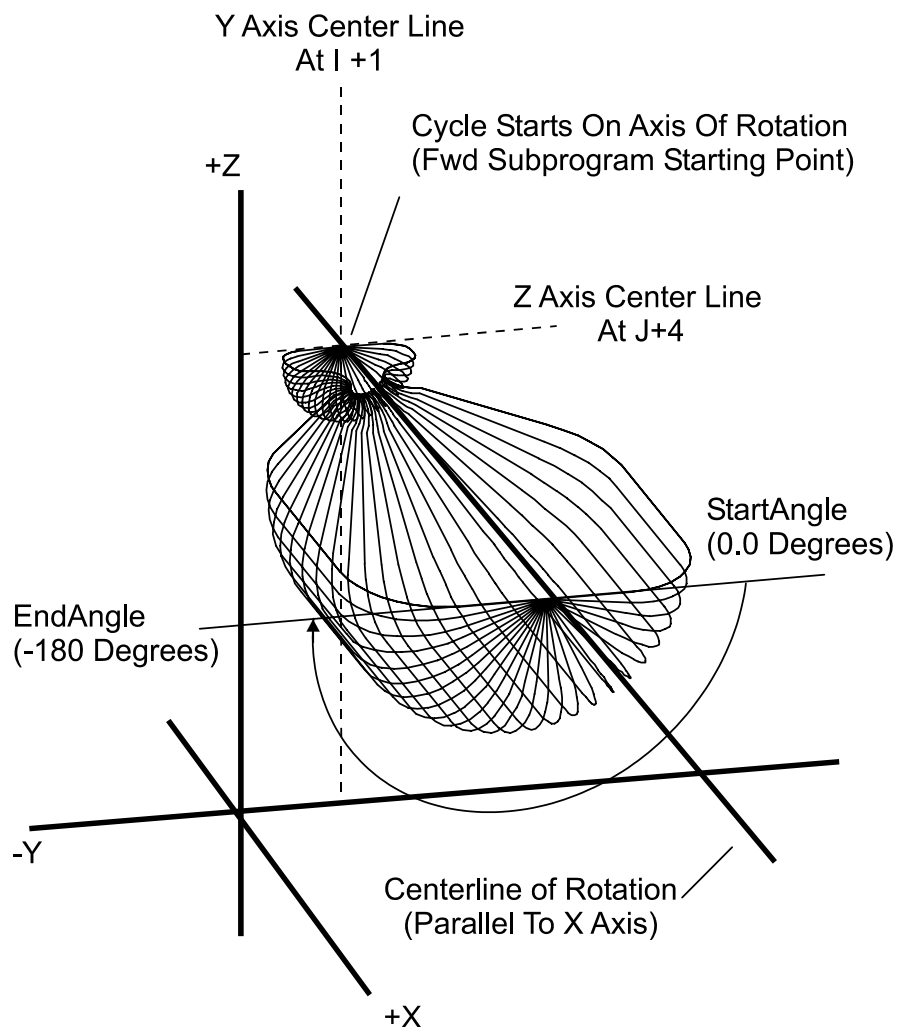
If tool compensation is not used, the path in the subprogram must be adjusted for the radius of the tool. If cutting a core, the path must be increased by one tool radius. If cutting a cavity, the path must be reduced by one tool radius.

To use tool compensation, write compensated moves in the subprograms. Tool compensation for each subprogram must be on opposite sides.

Each time you activate tool compensation, you must program a ramp on/off move for position adjustment. Add ramp moves to subprograms as shown.

Refer to "[Programming Concepts](#)" in "[Section 1](#)" for information on using tool length offset and diameter compensation with ball-end mills.

The rotation occurs around the axis selected in the axis of rotation (centerline of rotation). Use I and J values to define the position of the centerline when it is not located at the axis zero (X0, Y0, Z0). Refer to **Figure 5-24**.



MOLDAXES

**Figure 5-24, Axes of Rotation**

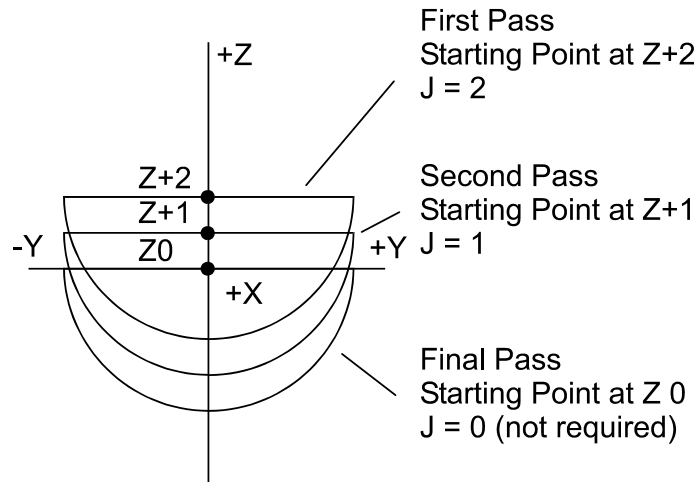
When the rotation is around the X-axis, the centerline is defined by the Y-axis position (in the I field) and the Z-axis position (in the J field).

When the rotation is around the Y-axis, the centerline is defined by the X-axis position (in the I field) and the Z-axis position (in the J field).

The start angle (A) and the end angle (B) are absolute start and stop angles of the rotation. Use negative angle values to cut cavities and positive angle values to cut cores.

To execute a Mold Rotation that requires more than one pass, write the subprograms for the finished shape and call the subprograms from more than one Mold Rotation block.


Adjust the starting position and J value of each block so that each pass comes closer to the finished shape. Reverse the sequence shown in the figure to cut a core. Refer to **Figure 5-25**.



MOLDPAS

**Figure 5-25, Cutting a Cavity Using More Than One Pass**

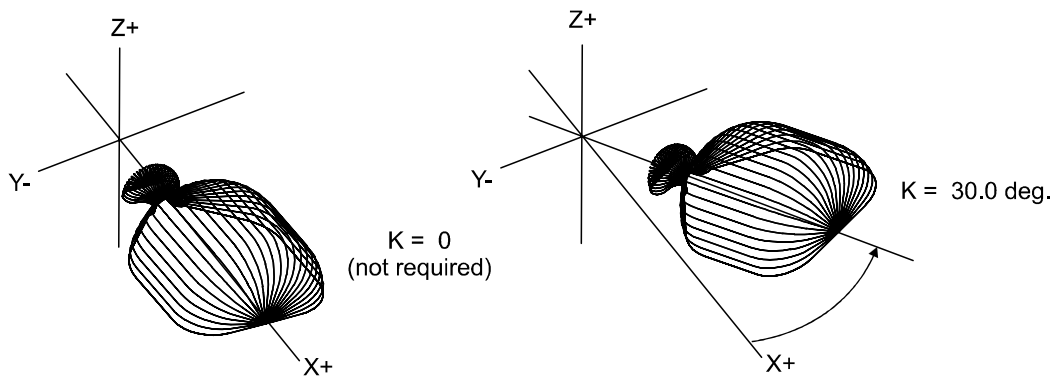X- and Y-axis rotations can be rotated around the Z-axis by entering a Z angle (K). Refer to **Figure 5-26**



MOLDZRT1


**Figure 5-26, Rotating XY Mold Rotations Around Z**

**Rotations Around X and Y Axes (Large Radius)**

The mold rotation cycle starts executing the subprograms at the machine's present position.

To cut a large radius rotation, start the cycle at the required distance from the centerline. The additional distance is automatically added to the radius of the rotation.

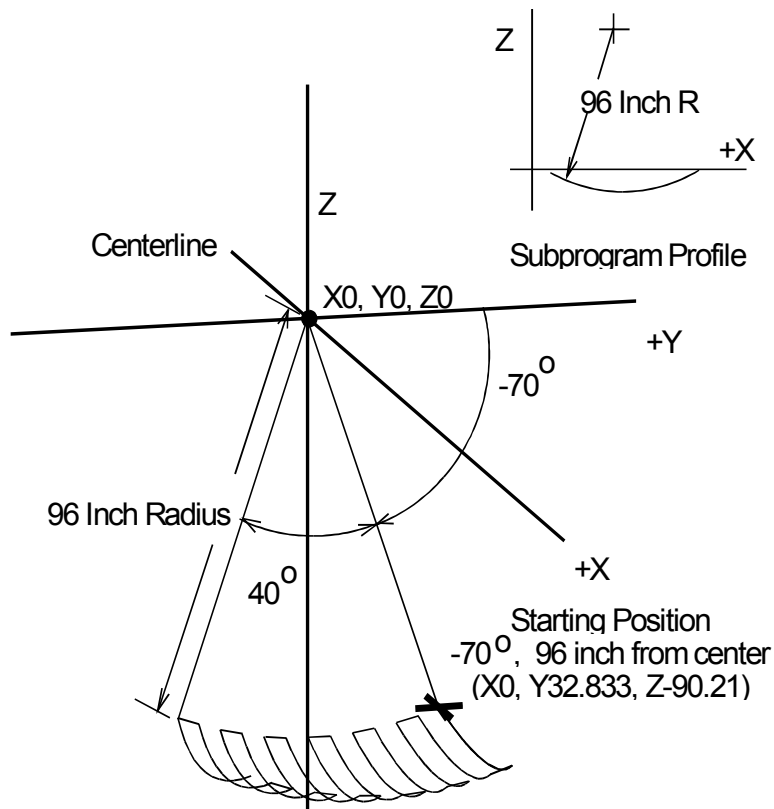If the rotation does not swing a full 180°, the starting position will be a point on the starting angle the required distance from the centerline. Refer to **Figure 5-27**.




LG-RAD2

**Figure 5-27, Large Radius Mold Rotation**

### Rotation Around the Z-Axis

The centerline of rotation is parallel to the Z-axis (Axis Rotation). The I and J values are the X and Y coordinates of the centerline. Enter the X coordinate in the I field and the Y coordinate in the J field. Refer to **Figure 5-28**.

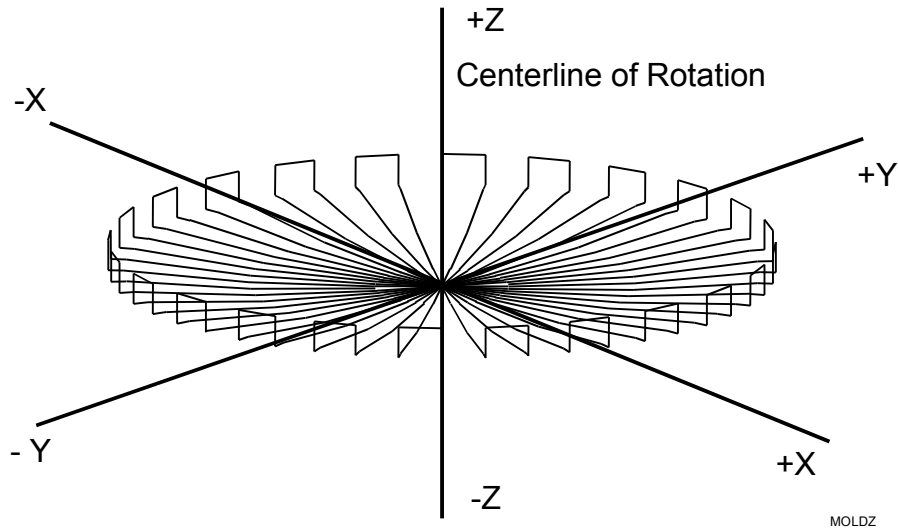

**Figure 5-28, Z-Axis Mold Rotation**


The machine must be positioned at the center of the rotation when the cycle starts. The finished shape will be centered on the starting position. The Z-axis position of the starting point determines the Z-axis position of the finished shape.

All of the moves in subprograms for Z-axis rotations must be contained in the +X half of the XZ plane. Rules for using tool compensation are the same as for Y- and X-axis rotations. Refer to **Figure 5-29**.

Direction Of Incremental Moves In  
Forward Subprogram (A to B)


Direction Of Incremental Moves In  
Reverse Subprogram (B to A)

Tool Comp Ramp On And Off Moves  
(Permits Correct Activation Of  
Alternating RH & LH Tool Comp)

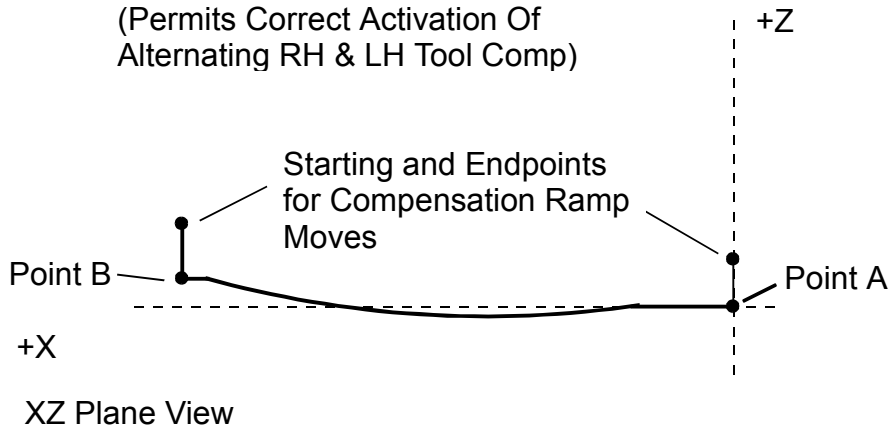

**Figure 5-29, Z-Axis Rotation Subprogram Details**

Z-axis rotation start and end angles are shown. Refer to **Figure 5-30**.

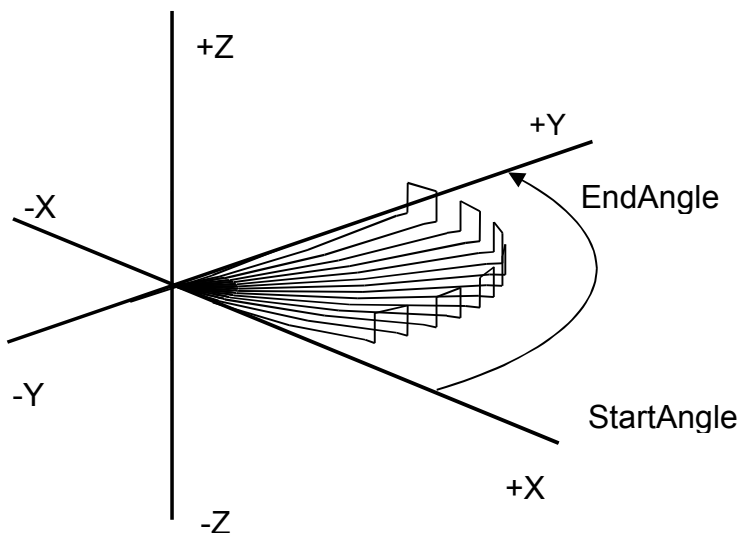


**Figure 5-30, Z-Axis Rotation Start and End Angles**



### Example 1:

The following programming example mills out a handle-mold core using G45 around the Y-axis. Refer to **Figure 5-31** and **Table 5-32**.

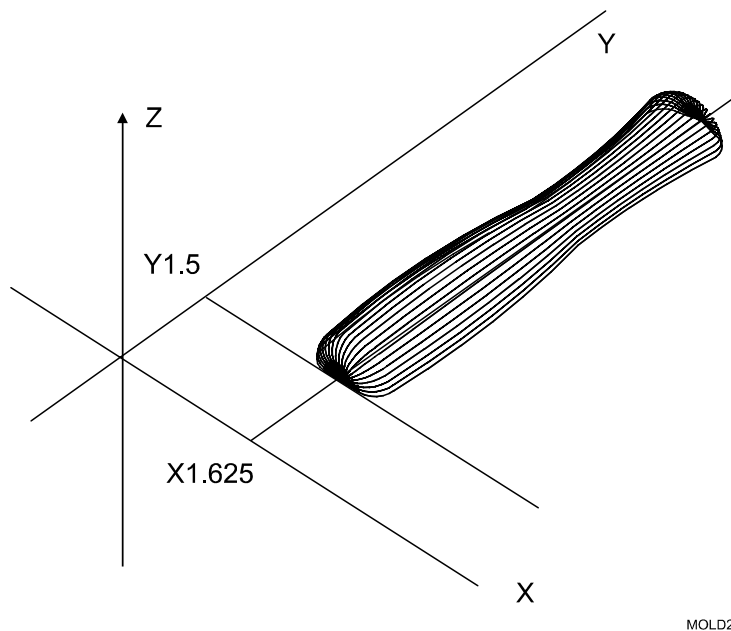

**Figure 5-31, Handle Mold Core**

**Table 5-32, G45 Programming Example 1**

Main Program	
O2020 * HANDLE.G	
G90 G70 G0 G17	
X1.625 Y1.5	
G90 G1 Z0 F12	
G45 A0 B180 C10 F15 R16 Y I1.625 J0	
G90 G0 Z1.0	
M2	
Forward Subprogram (O15)	Reverse Subprogram (O16)
O15 * HANDLE-FWD	O16 * HANDLE-REV
G91 G1 X-.25	G91 G3 X-.25 Y-.0625 R3
G2 X-.25 Y.27 R.25	G3 X-.25 Y-.25 R.25
G2 X.125 Y3 R12	G2 X.125 Y-2 R9
G3 X-.125 Y2 R9	G3 X-.125 Y-3 R12
G2 X.25 Y.25 R.25	G3 X.25 Y-.27 R.25
G2 X.25 Y.0625 R3	G1 X.25
M99	M99

**Example 2:**

The following example mills a dish shape. The forward and reverse tool paths are programmed in the XZ plane, with tool compensation. Refer to **Table 5-33**.

**Table 5-33, G45 Programming Example 2**

<b>Main Program</b>	
O99 * MOLD-Z	
G90 G70 G0 T0 Z0	
X0 Y0	
T1 * .25 BALL-MILL	
Z.225	
G1 Z0 F3	
G45 A0 B350 C18 F1 R2 Z I0 J0	
G17 G90 G0 T0 Z0	
M2	
<b>Forward Subprogram</b>	<b>Reverse Subprogram</b>
O1 * FWD SUB	O2 * REV SUB
G18 G91 G42 Z-.25 F3	G41 Z-.25
X.5	X-.125
G2 X2 Z.125 R5 F8	G3 X-2 Z-.125 R5
G1 X.125	G1 X-.5
G40 Z.25	G40 G1 Z.25
M99	M99

**NOTE:** The tool diameter in the Tool Page could be set to .270 for roughing (at C18 - 18 cycles). Then for finishing, set tool diameter to .2500, and increase B to 359, and C to 180.

### Elbow Milling Cycle (G49)

**Format:** G49 Bn Kn An Cn In Jn Dn Fn En Rn Zn Hn Un Sn Vn


Elbow Milling cycles simplify the required programming for milling elbow shaped cavities and cores. Finished elbows can have the same radius at each end (bent cylindrical shape), or a different radius at each end (bent conical shape). Refer to **Table 5-34**.

**NOTE:** Position the tool at the start position prior to G49.

**Table 5-34, G49 Address Words**


Address Word	Description
<b>B</b>	Start radius. Required.
<b>K</b>	End radius. Required.
<b>A</b>	Included angle of elbow. Default: CCW (Counterclockwise) To change direction, use the D parameter. <b>NOTE:</b> Must specify A or F, but not both.
<b>C</b>	Number of cycles to complete elbow. (Positive for female cavity and negative for male core.) Required.
<b>I</b>	Absolute elbow origin in X.
<b>J</b>	Absolute elbow origin in Y.
<b>D</b>	Direction of cone from starting point: +1 CCW (Counterclockwise) -1 CW (Clockwise) If you use D, you must use it with A or F, but not both.
<b>F</b>	End angle from 3 o'clock using center (I,J) as polar reference. Must be used with D if used. <b>NOTE:</b> Must specify A or F, but not both.
<b>U</b>	Rough-cycle feedrate.
<b>V</b>	Finish-cycle feedrate.
<b>S</b>	Finish-stock amount.
<b>NOTE:</b> Next four variables must be used as a group. They provide XY and Z positions to the start of the conic cut.	
<b>E</b>	Start angle, referenced from polar center (I,J).
<b>R</b>	Radius to the centerline of the cone, referenced from polar center (I,J).
<b>Z</b>	Absolute rapid height.
<b>H</b>	Start height in Z.

The Elbow Milling Cycle starts at the machine's present position. The CNC executes passes back and forth around the elbow inner radius from the start radius to the end radius. The tool is incremented further into the cavity (or around the core) at the end of each pass until the elbow is complete. The cycle stops at the opposite side of the elbow at the same Z-axis position from which it started. Refer to **Figure 5-32**.

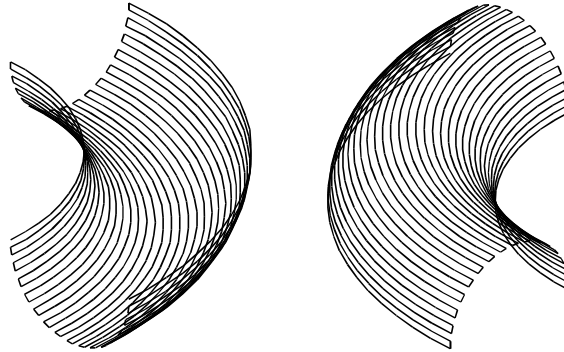

**Figure 5-32, Elbow Cavity and Core**

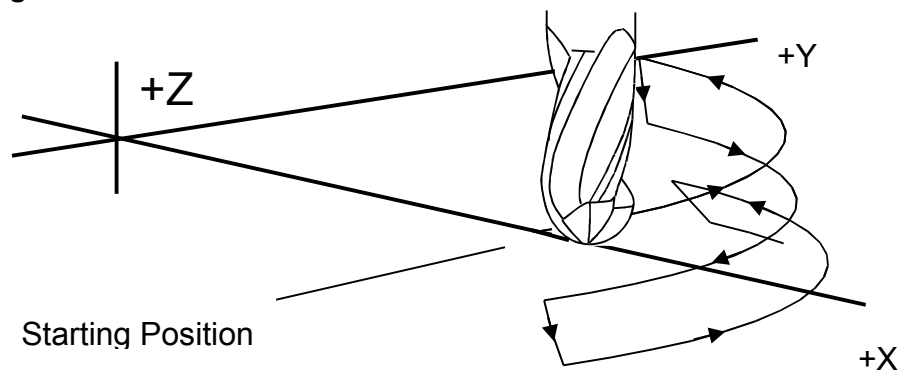
You cannot use tool compensation with the Elbow Milling Cycle. When cutting a particularly deep elbow, it may be necessary to cut the shape in several passes. The easiest way to do this is to program the elbow in a subprogram. The main program should consist of moves to position the machine at consecutively lower Z-axis starting positions. The subprogram is called at each successive starting position. Refer to **Figure 5-33**.



CW Execution Of Moves For Elbow Cavity


**Figure 5-33, Execution of Elbow Milling Cycle Moves**

Carefully consider the starting position of the Elbow Milling Cycle. The distance between the starting point and the XY center determines the elbow's inner radius. The line between the starting point and the XY center is the zero degree reference for the included angle. If you leave the X and Y center values blank the CNC uses X0, Y0. Refer to **Figure 5-34**.

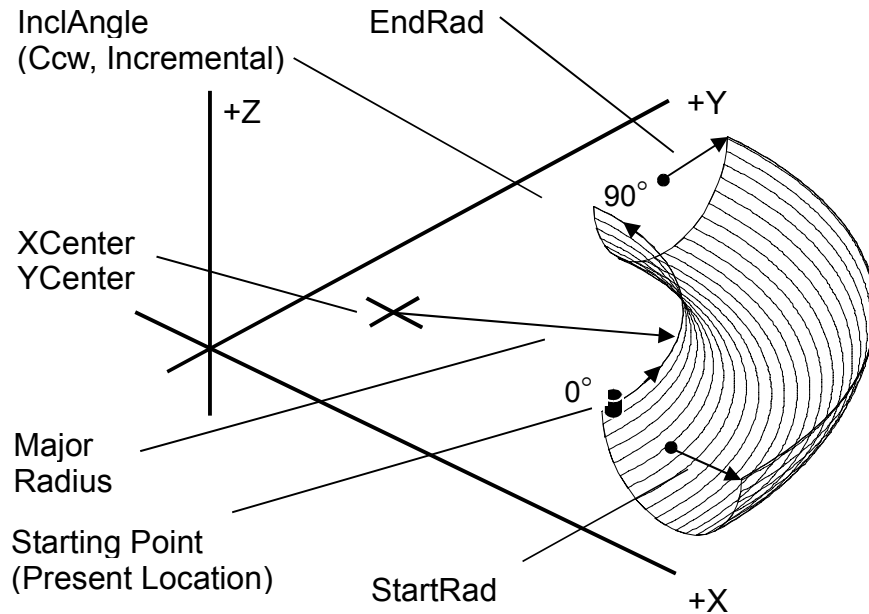


**Figure 5-34, Elbow Milling Cycle Details**

When the line between the starting point and the X Center, Y Center does not lie along an X or Y-axis, the orientation of the finished elbow will shift around the XY center accordingly. Refer to **Figure 5-35**.

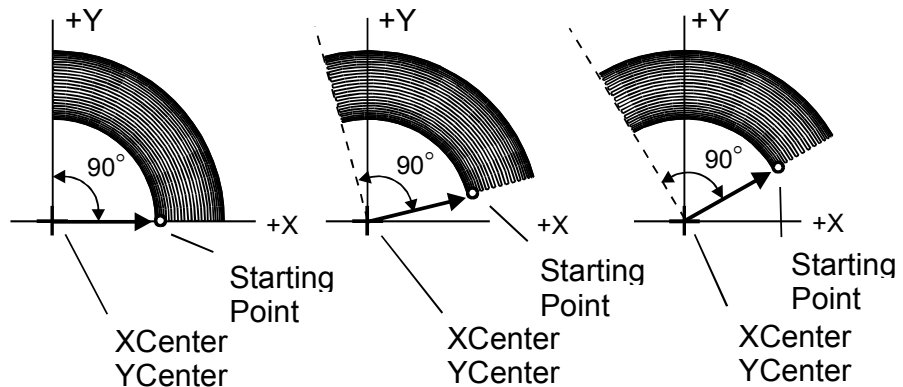


**Figure 5-35, Starting Points Effect On Orientation**

The distance between the starting point and the XY center determines the elbow inner radius. Moving the starting point away from the XY center increases the overall size of the finished elbow as shown. Refer to **Figure 5-36**.

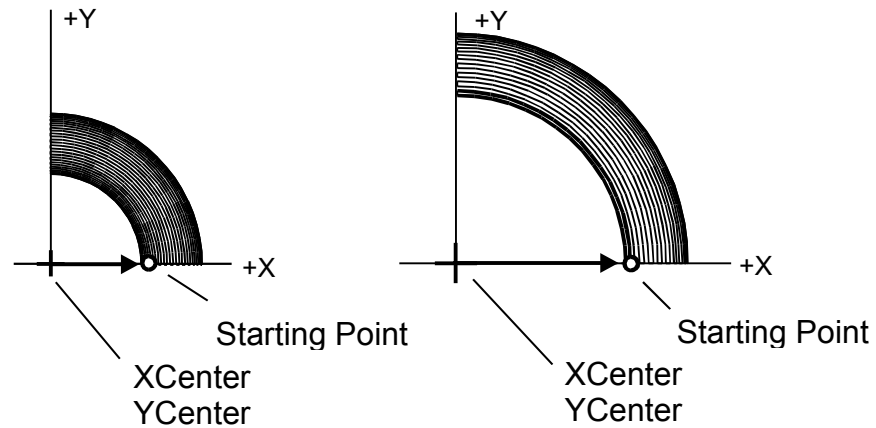


**Figure 5-36, Starting Points Effect On Size**

The Cycles (C) value determines the number of passes used to cut the elbow. A negative cycle value cuts a core while a positive cycle value cuts a cavity. Refer to **Figure 5-37**.

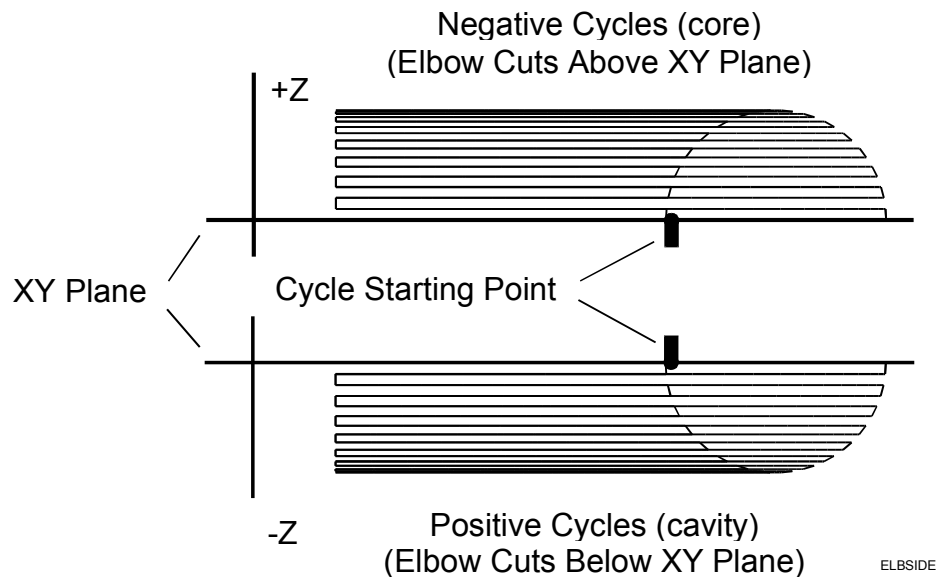

**Figure 5-37, Core and Cavity Detail**

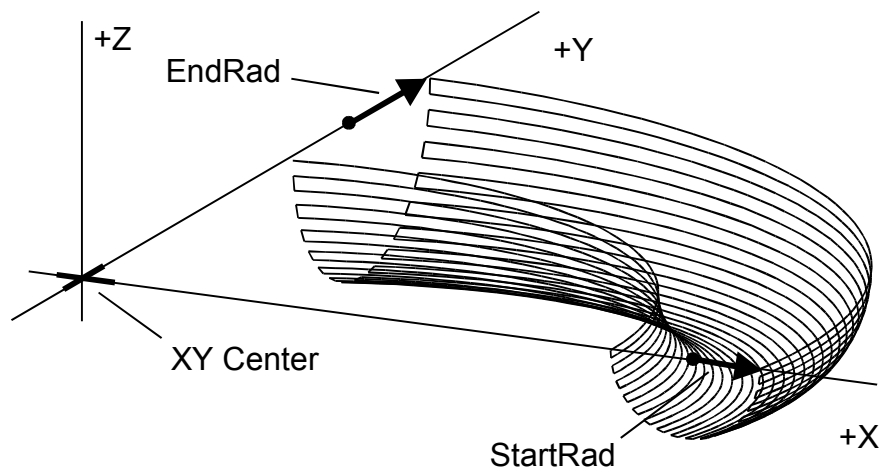Programming an Elbow Milling Cycle with unequal start radius and end radius values produces a conical elbow. Refer to **Figure 5-38**.



EndRad Greater Than StartRad

**Figure 5-38, Conical Elbow Details**

**Example:**

The programming example in **Table 5-35** machines an elbow cavity.

**Table 5-35, G49 Programming Example**

N1	O49 * ELBOW.G
N2	G90 G70 G0 G17
N3	T0 Z0
N4	X0 Y0
N5	T1 * .25-BALL
N6	X3.125 Y1.125
N7	Z.225
N8	G1 Z0 F10
N9	G49 B.875 K.875 A90 C8 I1.125 J1.125
N10	G90 G0 Z.225
N11	T0 Z0
N12	X0 Y0
N13	M2

## Subprograms

Program repetitive sequences or patterns in a subprogram. Enter subprograms in the program after the end of the main program. Call subprograms from the main program. Refer to **Table 5-36**.

**Table 5-36, Subprogram Addresses**

M98 Pn	Jump to subprogram.
M99	Return to main program.
Oxxxx	Subprogram label. Up to 4 digits.
Pn	Subprogram number to jump to.

A subprogram can use any code or move type. For example, to cut a contour twice (one rough pass and one finish pass), program it as a subprogram. You can call the subprogram from the main program as many times as required, but you enter the parameters only once.

Subprogram(s) must be stored in the same file as the main program that calls them.

### Subprogram Addresses

#### Examples:

M98 P2000 commands a jump to subprogram O2000.

Following the program number, blocks in a subprogram are numbered as in normal programming, as in the following example:

```
N2000 O2000 * SUBPROGRAM #2000
N2001 * blocks in program
N2002
N2003 etc.
```

You can store subprograms anywhere in the program after the main program. They do not have to be entered in numerical order or begin on any specific block number. Refer to **Table 5-37**.

**Table 5-37, Subprogram Called from a Main Program**

Main Program	
N1 O3 *SUB-EX1	
N2	
N3 M98 P100	Jump to N67 to execute subprogram 100.
N4	
N5	
N6	
N7	
N8 M02	

(Continued...)



**Table 5-37, Subprogram Called from a Main Program (Continued)**

Subprogram	
N67 O100	CNC jumps to here at N3, completes subprogram until it reaches M99 (N71), then returns to the main program at N4.
N68	
N69	
N70	
N71 M99	

### Repetition of Subprogram (Loop)

**Format:** M98 Pxxx Lxx

L is the number of repetitions of the subprogram.

**Example:**

M98 P2000 L12

The block commands twelve repetitions of subprogram number 2000. The maximum number of repetitions is 9999.

### Calling a Subprogram from a Subprogram

Calling a subprogram from another subprogram is referred to as nesting. The maximum number of programs that can be nested is ten.

The method of calling an additional subprogram is similar to calling the first. Refer to **Table 5-38**.

**Table 5-38, Nesting Subprograms**

Main Program	Flow of Program During Call of Additional Subprogram
N1 O9 *SUB-EX2	
N2	
N3	
N4 M98 P101	Jump to 1 <sup>st</sup> subprogram N501 from main program at N4.
N5	Return from 1 <sup>st</sup> subprogram.
N6	
N7	
N8 M02	Return to N1 after all subprograms are complete.
<b>1st Subprogram</b>	
N501 O101	
N502	


*(Continued...)*

**Table 5-38, Nesting Subprograms (Continued)**

Main Program	Flow of Program During Call of Additional Subprogram
N503	
N504	
N505 M98 P200	Jump from 1 <sup>st</sup> subprogram to 2 <sup>nd</sup> subprogram occurs at N505. Executes N600 to M606 (M99).
N506	Return to N506 after 2 <sup>nd</sup> subprogram is completed (M99). Finish 1 <sup>st</sup> subprogram.
N507	
N508	
N509 M99	Return to main program at N5.
<b>2nd Subprogram</b>	
N600 O200	
N601	
N602	
N603	
N604	
N605	
N606 M99	Jump to N506.

**Example:**

Mill out a series of identical slots in a plate. Each slot is 1/2" wide and .375" deep. Slot 1 is programmed in a subprogram. All XY dimensions will be incremental to enable you to position the slot anywhere on the coordinate system. Refer to **Figure 5-39**.

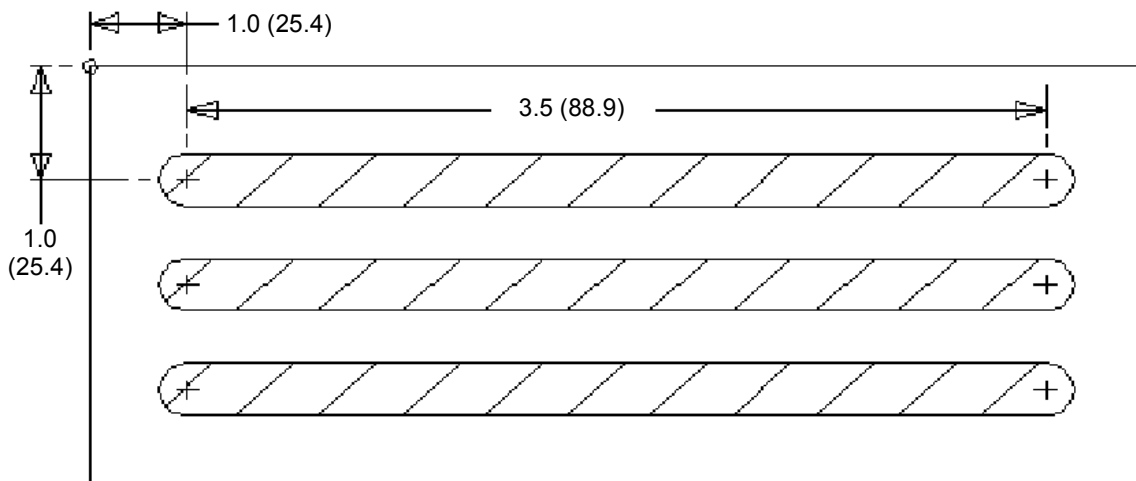

**Figure 5-39, Subprogram Programming Example**

The main program will position the cutter for each slot and call the subprogram that mills out the slots. Subprogram O100 uses incremental values to enable you to position the slot at various positions on the work. For all three slots, you must position the cutter before you call the subprogram. Refer to **Table 5-39**.

**Table 5-39, Subprogram Programming Example**

Blk #	Block	Description
N1	O12 *SLOTS-MAIN PROGRAM	Define program #12, program name.
N2	G90 G70 (G71) G0 G17 T0 Z0	Set absolute inch, rapid, XY plane, cancel tool, Z0.
N3	X-2 (X-50) Y2 (Y50)	Move to X-2 Y2.
N4	T1 * 1/2" MILL	Activate Tool #1.
N5	X1 (X25.4) Y-1 (Y-25.4) Z.1 (Z2.54) M98 P100	Move to slot location #1 and call sub.
N6	Y-2 (Y-50.8) M98 P100	Move to slot 2 and calls sub.
N7	Y-3 (Y-76.2) M98 P100	Move to slot 3 and calls sub.
N8	T0 Z0	Cancel tool offset and raises Z.
N9	X-2 (X50.8) Y2 (Y50.8)	Move to X-2 Y2.
N10	M02	End program, reset to N1.
N11		
N12	O100 *SLOTS-SUBPROGRAM	Define this as program #100, and gives name.
N13	G90 G1 Z-.375 (Z-9.53) F3.5 (F89)	Feed Z to -.3750" in absolute.
N14	G91 X3.5 (X88.9) F10 (F254)	Feed X 3.5" incrementally.
N15	G90 G0 Z.1 (Z2)	Rapid Z to .1" absolute.
N16	G91 X-3.5 (X-88.9)	Rapid X-3.5000", return to start point.
N17	G90 M99	Set Absolute Mode, end sub, return to main.

## End of Subprogram (M99) with a P-Code

M99 Pxxx

When the End of Subprogram (M99) command contains a P-code, the P-code refers to the block number in the main program to which the subprogram returns.

### Example:

M99 P70

At N30, the CNC will execute the subprogram and then return to N70 (skipping N40 to N70) in the main program. From N70 it will resume main program execution.

The subprogram will return the program to N70 of the main program, skipping N40 through N60. Refer to **Table 5-40**.

**Table 5-40, M99 P-Code Usage**

Main Program	
N10	
N20	
N30 M98 P100	Call subprogram.
N40	
N50	
N60	
N70	
N80	
N90 M2	
Subprogram	
N110 O100	
N120	
N130	
N140 M99 P70	After complete subprogram, return to N70 in main.

## Subprogram for Multiple Parts Programming

To set up a subprogram to machine multiple parts, follow this method.

In this example, a table has two vises installed. Each table holds a part of identical configuration. The same tool does all the work.

1. Program the machining sequence as a subprogram in Absolute or Incremental Mode.
2. When the sequence is finished on Part #1, program a coordinate shift (G92 or G53) and recall the subprogram.
3. If you program the subprogram incrementally, you do not have to shift the zero point. If programmed in absolute, then use a coordinate (zero) shift.

### Loop and Repeat Function

In some cases, it is simpler to command a program block or series of blocks to loop (repeat), rather than to program the block(s) several times.

**Format:** N680 LOOP nnnn  
 N685 .  
 .  
 .  
 N695 END

LOOP instructs the CNC to execute the blocks following block N680 until END. The block is repeated nnnn times. Subprogram calls, axes moves, M-codes, etc. are all available within a "loop".

Each LOOP must have an END. Nesting loops (one loop inside of another) is possible, to 10 levels deep.


The full body of the LOOP command (LOOP to END) must be contained in the main program or the subprogram in which it was initiated.

#### Example:

In the following program example, M and S codes are omitted. The program assumes that a manual tool change machine is used (no ATC). Check your machine tool manual for details on programming M, S, and T codes. Refer to **Figure 5-40** and [Table 5-41, Loop Programming Example](#).

Tooling to be used:

- Tool 1 = #4 centerdrill
- Tool 2 = 1/4" diameter twist drill
- Tool 3 = 3/8" diameter end mill

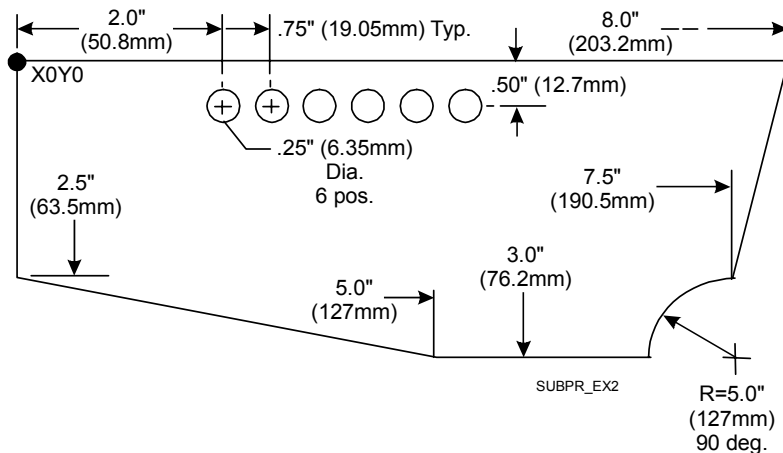

**Figure 5-40, Loop Programming Example**

Table 5-41, Loop Programming Example

Blk. #	Block	Description
N1	O100 * EXAMPLE	Program name and number.
N2	G90 G70 (G71) G0 T0 Z0	Set modes. Cancel tool. Rapid to Z0.
N3	X-2 (X-50) Y2 (Y50)	Rapid to tool change position.
N4	T1 * #4 CTR-DRL (6.35 CTR-DRL)	Activate tool 1, centerdrill.
N5	G81 Z-.23 (Z-.584) R.1 (R2) F8 (F203)	Activate spot drill cycle 1.
N6	M98 P1	Call subprogram 1.
N7	T2 * 1/4" DRL (* 6.35 DRILL)	Activate tool 2, twist drill.
N8	G83 Z-.45 (Z-11.43) R.1 (R2) F10 (F254) I.15 (I3.81)	Activate peck drill cycle.
N9	M98 P1	Call subprogram 1.
N10	T3 * 3/8" MILL (* 9.525 MILL)	Activate tool 3, end mill.
N11	G41 X-.3 (X-76.2) Y0	Activate cutter compensation. Feed to XY position.
N12	Z.1 (Z2)	Retract move in Z.
N13	G1 Z-.38 (Z-9.65) F13 (F330)	Feed to cutting depth.
N14	X8 (X203.2)	Cut top of part.
N15	X7.5 (X190.5) Y-2.5 (Y-63.5)	Cut right side of part (vectored path).
N16	G3 X7 (X177.8) Y-3 (Y-76.2) I0 J-.5 (J-12.7)	Activate circular interpolation. Make arc move.
N17	G1 X5 (X127)	Feed to X position (bottom of part).
N18	X0 Y-2.5 (Y-63.5)	Return to start position (cut left side of part).
N19	Y.3 (Y8)	Move off part in Y.
N20	G0 Z.1 (Z2)	Retract move in Z.
N21	G40 X-.3 (X-8)	Cancel cutter compensation.
N22	T0 Z0	Cancel tool offsets and tools. Retract to Z home.
N23	X-2 (X-50) Y2 (Y50)	Move off in X.
N24	M2	End Main.
N25		
N26		
N27	O1 * HOLE LOCATIONS SUB.	Subprogram.

(Continued...)

**Table 5-41, Loop Programming Example (Continued)**

<b>Blk. #</b>	<b>Block</b>	<b>Description</b>
N28	G90 G0 X2 (X50.80) Y-.5 9Y-12.7)	Activate Absolute and Rapid Modes. Move to first hole location.
N29	LOOP 5	Repeat following moves 5 times.
N30	G91 X.75 (X19.05)	Distance between holes.
N31	END	End of loop.
N32	G80 G90 T0 Z0	Cancel drill cycle. Activate Absolute, Raise Z.
N33	X-2 (X-50) Y2 (Y50)	Rapid to tool change position.
N34	M99	Return to main program.

## Probing Cycles

This section describes operation and an overview of the tool and spindle probe canned cycles available on the 5000M (optional) CNC products. The cycles provided perform the most common tool and spindle probing functions. Custom cycles to perform specific functions can be written using the **G31** primitive and parametric programming. Refer to [“Section 4, Probe Move \(G31\)”](#) for more details. If Probing has been added post-sale, beside Setup Utility changes, there may be Integral Programmable Intelligence (IPI) program modifications required.

The tool probe cycles are only supported on machines with automatic spindle forward/reverse and spindle speed, and homing with a permanent X, Y, and Z machine position. The method described assumes the use of negative tool-length offsets. In this method, the Tool-Length Offset (TLO) in the length column for each tool represents the distance from the tool tip at machine home to top of work piece and is a negative number. This method does not require the use of any Z work coordinate offset to be active. This procedure will find the effective tool diameter by turning the spindle on in reverse and touching two sides of the probe stylus, then storing the tool’s diameter in the tool’s diameter offset table.

The spindle probing cycles are designed to assist in part setup. Using these cycles, one or more features (edges) of a part can be measured. Using the data obtained with these measurements, calculations are made that can be used to set a given fixture offset. It is also possible to find the orientation angle of a part so as to not always have to align the part exactly.

Tool and spindle probing does not allow rotation, scaling, and mirroring. Plane will be set to **XY G17** when these cycles are complete.

## Tool Probe Cycles

Before using your tool probe and tool probe cycles, you must setup the probe following the probe manufacturer’s specifications.

This section covers the following topics:

- ❑ [Tool Probe G-code cycle designations](#)
- ❑ [Description of tool probe cycles](#)

For probing system parameter setup information, refer to [5000M CNC Setup Utility Manual, P/N 70000509, “Section 2 - Builder Setup,” “Probing.”](#)

The tool probe will update the tool registers only. If you are going to use the tool being measured after the probing cycle, you must recall that tool for the new offsets to be active.

For tool probing or tool length presetting, Tool-Length Offset (TLO) is the distance from machine home to top of work piece or wherever you wish to set your part **Z** zero.



Before starting to set your tools, you must calibrate the probe. Once the probe has been calibrated, calibration does not have to be done again unless you remove the probe or replace the stylus.

Recalibration may also be required if the Z location of the top of the part changes, and is not compensated by a Z work offset shift.

### Tool Probe G-code Cycle Designations

The following summarizes the cycles available:

#### **G150 Tool Probe Calibration Cycle**

This is used to set the Z datum for length preset, the effective probe stylus diameter for setting tool diameter registers, and establishes the center of the probe stylus.

**NOTE:** Calibration must be done at least once before using the tool probe. Once the probe has been calibrated, calibration does not need to be done again unless the probe is moved or a new part is being setup. The cycle must always know the relationship between the top of the part and the top of the probe to set the TLO.

#### **G151 Tool Length and Diameter Offset Preset**

Updates length and diameter tool registers.

**NOTE:** If the tool has a hole on the bottom so that the probe would fall between the tool teeth, do not use this cycle. Damage to the probe could result. In this case, use **G152** for manual length preset or **G153** for manual diameter preset.

#### **G152 Manual Tool-Length Offset Preset**

Updates tool-length register. To be used for large face mill style tools or shell mill tools that have a hole in the center of the bottom of the tool.

#### **G153 Manual Tool Diameter Preset**

Updates tool diameter register for irregular shaped tools or tools with a hole in the center of the bottom.

#### **G154 Tool Breakage, Length and Diameter Wear Detection**

Checks the tool and gives an alarm if not within tolerance. Length and Diameter Wear – Check the Length and/or Diameter and updates the Length and/or Diameter wear registers up to a user-defined limit. Once the user-defined limit has been reached, the cycle will give an alarm and the program will stop.

## Description of Tool Probe Cycles

This section contains detailed descriptions of the tool probe cycles:

- [Tool Probe Calibration Cycle \(G150\)](#)
- [Tool Length and Diameter Offset Preset \(G151\)](#)
- [Manual Tool Length Measure for Special Tools \(G152\)](#)
- [Manual Tool Diameter Measure for Special Tools \(G153\)](#)
- [Tool Breakage, Length and Diameter Wear Detection \(G154\)](#)

### Tool Probe Calibration Cycle (G150)

**Format:** G150 Dn En

This cycle is used to calibrate the probe. This is used to set the Z datum for length preset, establishing the center of the probe stylus, and the effective probe stylus diameter for setting tool diameter registers. Refer to **Table 5-42**.

**Table 5-42, G150 Address Words**

Address Word	Description
<b>D</b>	The diameter of the part of the calibration standard that comes in contact with the probe stylus during calibration. This should be an exact measurement. (Optional override for the “ <b>Diameter of tool probe gauge</b> ” machine setup parameter)
<b>E</b>	The distance to go down along the side of the probe stylus with the probe calibration standard when touching the side of the stylus for diameter calibration. The maximum <b>E</b> value is 0.55” (13.97 mm). Without any <b>E</b> value, the cycle will bring the calibration standard down past the top of the probe stylus the default 0.1” (2.54mm). If you put a number higher than 0.55” (13.97 mm), the control displays an error. (Optional) [Default: 0.1”]

To calibrate the tool probe:

1. Jog the calibration standard (the calibration standard should be in the spindle) to the top of your work piece, and set its tool-length offset to the top of the work piece or to wherever you would like your Z zero to be. To calibrate the tool number:
  - a) Jog the tip of the calibration standard to the proper spot
  - b) Press the **Calib Z** function key.
2. Manually jog the calibration standard over the probe stylus center and less than 0.1” (2.54 mm) above the probe stylus. It should be no more than 0.1” (2.54 mm) from the center of the stylus.

3. From the manual mode, type **G150 D(n)**, and press the **START** button. Where **D** is the exact diameter of the calibration standard. (For example, G150 D.5)
4. The Z-axis will initially go down and touch the top of the probe stylus at the feedrate specified in the “**Z first pick, MEDIUM feedrate**” machine setup parameter. Then retouch at the slow feedrate, specified in the “**Z final pick, SLOW feedrate**” machine setup parameter, establishing the zero probe stylus top.
5. Then incrementally rapid up whatever value that is in the “**Z retract amount**” machine setup parameter.
6. The spindle will come on at the RPM specified in the “**RPM for calibration and tool measurement**” machine setup parameter and then the calibration standard will move over an incremental amount that is equal to (Half the value entered in the **D** cycle parameter + Half the value entered in the “**Nominal probe stylus diameter**” machine setup parameter + The value in the “**XY retract amount**” machine setup parameter). The direction the probe will move over depends on what is placed in the “**Probe orientation**” machine setup parameter:
  - 1 Go first to the left
  - 1 Go first to the right
  - 2 Go first to the front
  - 2 Go first to the back
7. The Z-axis will then do a guarded Z move down 0.1” (2.54 mm) or whatever amount was placed in the **E** cycle parameter and then move over toward the probe stylus 0.3” (7.62 mm) or until it touches the probe stylus. If contact is not made with the probe or if contact is made during a guarded move, then an alarm will be generated and the canned cycle will terminate.
8. After the probe stylus is touched on the first side, the machine will then rapid up and over the stylus then down on the opposite side then over to the other two sides until it has touched the probe stylus on all four quadrants. This will establish the center of the probe stylus.
9. The spindle will then turn off and the machine will touch off on two sides of the probe with the spindle off finding the effective probe stylus diameter. Then, will rapid up above the probe stylus and over to the center.
10. Remove the calibration standard. You are now ready to start running the **G151** to set your tool-length offsets or tool diameter registers.

**Tool Length and Diameter Offset Preset (G151)****Format:** G151 Tn Dn Qn En Fn Mn Sn Rn

- ❑ Each tool must have the length set once before trying to set the diameter. Call this cycle up the first time using Q2 because it will automatically set the length first then the diameter.
- ❑ Calibrate the tool probe at least once before trying to automatically preset a tool. This is done initially, but if the stylus is ever changed or the probe is moved, then you must again calibrate the tool probe.
- ❑ This tool preset (**G151**) can be run from within a program or from the manual mode. Refer to **Table 5-43**.

**Table 5-43, G151 Address Words**

Address Word	Description
<b>T</b>	<p>Tool number. (Required)</p> <p>With only the <b>T</b> cycle parameter present, the canned cycle will not step over half the tool's diameter but come straight down measuring the tool length and storing it in the tool register.</p>
<b>D</b>	<p>This is the rough diameter of the tool. This should be within 0.04" (1.0 mm). (Optional)</p> <p>If the <b>D</b> cycle parameter is present, the tool will step over half of its diameter, the spindle will turn on in reverse and then the canned cycle will measure the tool's length.</p> <p>A negative <b>D</b> value is for a left-handed tool and will cause the spindle to come on forward instead of reverse.</p> <p>For on center length measurement, do not give a <b>D</b> cycle parameter.</p>
<b>Q</b>	<p>This option specifies to measure length, diameter, or both and the appropriate tool registers are updated. (Optional) [Default: <b>Q1</b>]</p> <p><b>Q0</b> Measure the diameter only  <b>Q1</b> Measure the length only  <b>Q2</b> Measure both length and diameter</p> <p>If <b>Q</b> is not set, the cycle will measure the tool length only.</p> <p>If <b>Q0</b> or <b>Q2</b> are programmed, you must also have a <b>D</b> cycle parameter or the control will display an error message.</p>

*(Continued...)*

**Table 5-43, G151 Address Words (Continued)**

Address Word	Description
<b>E</b>	<p>The distance to go down along the side of the probe stylus when doing a diameter pick. The maximum <b>E</b> value is 0.55" (13.97 mm) or the tool may crash into the probe or table. If you enter a value larger than 0.55" (13.97 mm), the control will issue an error message. If <b>E</b> is not set, the cycle will use a default value of 0.1" (2.54 mm). (Optional) [Default: 0.1"]</p> <p>Ball nose cutters and special cutters that require a move down more than 0.55" (13.97 mm) are not supported.</p>
<b>F</b>	<p>This is the override for the fast Z feedrate that was set in the machine setup parameter "<b>Z first pick, FAST feed-rate</b>". Sometimes there may be a tool that has a large diameter making it necessary to slow it down to prevent the touch probe from being hit too hard. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)</p>
<b>M</b>	<p>This is the override for the medium feedrate that was set in the machine setup parameter "<b>Z first pick, MEDIUM feed-rate</b>". This is used for the same reason as the <b>F</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)</p>
<b>S</b>	<p>This is the override for the slow feedrate that was set in the machine setup parameter "<b>Z final pick, SLOW feed-rate</b>". This is used for the same reason as the <b>F</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)</p>
<b>R</b>	<p>This is the override for the RPM that was set in the machine setup parameter "<b>RPM for calibration and tool measurement</b>". This is used for the same reason as the <b>F</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original RPM. (Optional)</p>

To use the automatic tool preset:

1. Install all the tools you wish to set, in the tool changer.
2. Type in:  
 G151 T(tool#) D(tool rough diameter) Q2  
 If run from the inside of a program, this line needs to be repeated for every tool that you want to set.
3. Execute that line if you are in Manual, or run the program if you have set all the tools up in a program.

4. If you have done a single tool in Manual, that tool is now measured and you are ready to measure the next tool. If you have placed multiple lines in a program, one for each tool, all your tools are measured and ready for use.

Shell mill style tools that have a hole in the center of the bottom will not work with this canned cycle; in this case, you must use the manual canned cycles **G152 Manual Tool Length Measure for Special Tools** for length and **G153 Manual Tool Diameter Measure for Special Tools** for diameter. See [Table 5-43, G151 Address Words](#). This cycle is only good for drills, taps, reamers, ball nosed endmills, and standard endmills with a flat bottom, the cycle updates length and diameter tool registers clearing anything in the wear registers.

The following examples are described for machining centers with automatic tool changers.

**Format:** G151 T(tool#)

With **T** cycle parameter only set:

1. The machine will rapid the Z-axis up and pick up the tool designated in the **T** parameter and rapid directly over the center of the probe stylus.
2. The Z-axis will rapid down the distance placed in the “**Z rapid to start position from home**” machine setup parameter, then start feeding down toward the probe for the initial touch at the feedrate that was placed in the “**Z first pick, FAST feed-rate**” machine setup parameter, then will back up and retouch the probe at the feedrate that is in the “**Z final pick, SLOW feed-rate**”.
3. The tool-length register for that tool is now updated, and that tool’s length-wear register is set to zero.
4. Then the Z-axis will rapid up to home position.
5. If you have done a single tool in Manual, that tool is now measured and you are ready to measure the next tool. If you have placed multiple lines in a program, one for each tool, the machine will then grab the next tool and repeat steps 1 through 4 until all the tools have been measured.

**Format:** G151 T(tool#) D(tool rough diameter)

With **T** and **D** cycle parameters only set:

1. The machine will rapid the Z-axis up and pick up the tool designated in the **T** cycle parameter and rapid directly over the center of the probe stylus.
2. The Z-axis will rapid down the distance placed in the “**Z rapid to start position from home**” machine setup parameter, then start feeding down toward the probe for the initial touch at the feedrate that was placed in the “**Z first pick, FAST feed-rate**” machine setup parameter, then will back up.
3. The machine will rapid over half the diameter of the cutter from the probe stylus center in the direction related to the “**Probe orientation**” machine setup parameter.
4. The spindle will then come on in reverse at the RPM specified in the “**RPM for calibration and tool measurement**” machine setup parameter and retouch the probe twice, once at the feedrate that is in the “**Z first pick, Medium feed-rate**” machine setup parameter and again at the “**Z final pick, SLOW feed-rate**” machine setup parameter.
5. The tool-length register for that tool is now updated, and that tool’s length-wear register is set to zero.
6. Then the Z-axis will rapid up to the home position.
7. If you have done a single tool in Manual, that tool is now measured and you are ready to measure the next tool. If you have placed multiple lines in a program, one for each tool, the machine will then grab the next tool and repeat steps 1 through 6 until all the tools have been measured.

**Format:** G151 T(tool#) D(tool rough diameter) Q2

With **T**, **D**, and **Q** cycle parameters set:

1. The machine will rapid the Z-axis up and pick up the tool designated in the **T** cycle parameter and rapid directly over the center of the probe stylus.
2. The Z-axis will rapid down the distance placed in the “**Z rapid to start position from home**” machine setup parameter then start feeding down toward the probe for the initial touch at the feedrate that was placed in the “**Z first pick, FAST feed-rate**” machine setup parameter then will back up.
3. The machine will rapid over half the diameter of the cutter from the probe stylus center in the direction related to the “**Probe orientation**” machine setup parameter.

4. The spindle will then come on counter clockwise at the RPM specified in the “**RPM for calibration and tool measurement**” machine setup parameter and retouch the probe twice, once at the feedrate that is in the “**Z first pick, Medium feed-rate**” machine setup parameter and again at the “**Z final pick, SLOW feed-rate**” machine setup parameter.
5. The tool-length register for that tool is now updated, and any value in the length wear register will be reset to zero.
6. Then the Z-axis will rapid up above the probe stylus the distance specified in the “**Z retract amount**” machine setup parameter. Then it will rapid the X & Y axes over the center of the probe and turn the spindle on in reverse.
7. The machine will move the tool’s edge off to one side of the probe stylus in the direction indicated in the “**Probe orientation**” machine setup parameter, before making a guarded move down 0.1” (2.54 mm) or whatever value has been placed in the **E** cycle parameter.
8. The machine will then touch the tool to the probe stylus on two opposite sides at the feedrate specified in the “**Z first pick, MEDIUM feed-rate**” machine setup parameter with the spindle running at the RPM specified in the “**RPM for calibration and tool measurement**” machine setup parameter, backing up 0.02” (0.508 mm) after each first touch then retouching at the feedrate specified in the “**Z final pick, SLOW feed-rate**” machine setup parameter, calculating the diameter of the tool and placing the calculated diameter value in the diameter register for the tool being preset and any value in the diameter wear register will be reset to zero.
9. Then the Z-axis will rapid up to the home position.
10. If you have done a single tool in Manual, that tool is now measured and you are ready to measure the next tool. If you have placed multiple lines in a program, one for each tool, the machine will then grab the next tool and repeat steps 1 through 9 until all the tools have been measured.



### Manual Tool-Length Measure for Special Tools (G152)

**Format:** G152 Tn Dn Mn Sn Rn

This cycle is used to measure the length of large face mill style tools that have a hole in the center of the bottom of the tool. Refer to **Table 5-44**.

**Table 5-44, G152 Address Word**

Address Word	Description
<b>T</b>	Tool number. (Required)  With only the <b>T</b> parameter present, the spindle will turn on in reverse and the canned cycle will come straight down measuring the tool length and storing it in the tool-length register. The <b>T</b> parameter must be the same as the current tool in the spindle.
<b>D</b>	This is the rough diameter of the tool and is only used in this cycle to determine if the spindle should be turned on in reverse or forward. If you have a left-handed tool you would give a negative value to the diameter. If this parameter is left off the control will always turn on in reverse by default. (Optional)
<b>M</b>	This is the override for the medium feedrate that was set in the machine setup parameter " <b>Z first pick, MEDIUM feedrate</b> ". Sometimes there may be a tool that has a large diameter making it necessary to slow it down to prevent the touch probe from being hit too hard. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)
<b>S</b>	This is the override for the slow feedrate that was set in the machine setup parameter " <b>Z final pick, SLOW feedrate</b> ". This is used for the same reason as the <b>M</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)
<b>R</b>	This is the override for the RPM that was set in the machine setup parameter " <b>RPM for calibration and tool measurement</b> ". This is used for the same reason as the <b>M</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original RPM. (Optional)

**WARNING:** Large tools can result in probe damage if the touch feedrate is set too fast. For this reason, the cycle parameters: **M**, **S**, and **R** have been added to enable the programmer/operator to override the values in the machine setup parameters for the specific tool being checked or set.

You must have the tool positioned over the probe stylus so the tooth that sticks down the furthest is directly over the center of the probe stylus and above the stylus less than 0.100" (2.0 mm).

**NOTE:** If the spindle is locked, you may have to unlock it to manually orient the tool tooth over the probe stylus.

To measure the tool length:

1. Jog the tool to the top of the probe stylus so that the tooth that sticks down the furthest is directly over the center of the probe stylus.
2. From the manual mode, type **G152 Tn Dd** and press the **START** button. Where **T** is the tool number and **D** is roughly the diameter of the special tool. (For example, G152 T3 D3.5)
3. The spindle will turn on in reverse and the Z-axis should go down and touch the top of the probe stylus keeping the X and Y position the same, then rapid up 0.02" (0.508 mm) and then retouch using the slow feedrate programmed in the machine setup parameter. The cycle will then update the tool-length offset register clearing any value in the length wear register, turn the spindle off and return the tool to the Z height where it started.
4. The Tool Length has been set and you can now change to another tool, and repeat steps 1 through 3.

### Manual Tool Diameter Measure for Special Tools (G153)

**Format:** G153 Tn Dn En Mn Sn Rn

This cycle is used to measure the diameter of irregularly shaped tools or tools with a hole in the center of the bottom. Refer to **Table 5-45**.

**Table 5-45, G153 Address Words**

Address Word	Description
<b>T</b>	Tool number. (Required) The <b>T</b> cycle parameter must be the same as the current tool in the spindle.
<b>D</b>	This is the rough diameter of the tool. (Required) The diameter specified in this cycle parameter should be larger than the actual diameter of the tool being measured but no more than 0.04" (1.0 mm) over. If you have a left-handed tool, you would give a negative value to the diameter so the spindle will turn on in the forward direction.
<b>E</b>	The distance to go down along the side of the probe stylus when doing a diameter pick. The maximum <b>E</b> value is 0.55" (13.97 mm) or the tool may crash into the probe or table. If you enter a value larger than 0.55" (13.97 mm), the control will issue an error message. If <b>E</b> is not set, the cycle will use a default value of 0.1" (2.54 mm). (Optional) [Default: 0.1"] Ball nose cutters and special cutters that require a move down more than 0.55" (13.97 mm) are not supported.
<b>M</b>	This is the override for the medium feedrate that was set in the machine setup parameter " <b>Z first pick, MEDIUM feed-rate</b> ". Sometimes there may be a tool that has a large diameter making it necessary to slow it down to prevent the touch probe from being hit too hard. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)
<b>S</b>	This is the override for the slow feedrate that was set in the machine setup parameter " <b>Z final pick, SLOW feed-rate</b> ". This is used for the same reason as the <b>M</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)
<b>R</b>	This is the override for the RPM that was set in the machine setup parameter " <b>RPM for calibration and tool measurement</b> ". This is used for the same reason as the <b>M</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original RPM. (Optional)

**WARNING:** Large tools can result in probe damage if the touch feedrate is set too fast. For this reason, the cycle parameters: **M**, **S**, and **R** have been added to enable the programmer/operator to override the values in the machine setup parameters for the specific tool being checked or set.

You must:

- Load the tool in the spindle and call up that tool's offset.
- Know the distance from the top of the probe stylus down you will have to move so that the largest part of the tool diameter is even with the side of the probe stylus for diameter measurement. That value will be placed in **E** if different from the default 0.1" (2.54 mm).
- Position the tool over the probe stylus so that the tooth that sticks down the furthest is directly over the center of the probe stylus and above the stylus less than 0.200 (5.08 mm).

To measure the tool diameter:

1. Jog the tool to the top of the probe stylus so that the tooth that sticks down the furthest is directly over the center of the probe stylus.
2. From the manual mode and the spindle off, input:  
"G153 Tn Dn En" and press the **START** button. Where **T** is the tool number, **D** is roughly the diameter of the special tool (this should be larger but not more than 0.100" (2.54 mm) larger), and **E** is the Z-axis move down needed if different than the default 0.100" (2.54mm) so that the largest part of the tool diameter comes in contact with the edge of the probe stylus. (For example, G153 T3 D3.5 E.25 and press the **START** button.
3. The Z-axis will feed down with the spindle on, touching the top of the probe stylus. Once the top of the probe is found, the Z-axis will rapid back up above the probe and move over to one side of the probe stylus. The tool will then move down the distance in **E** or 0.1" (2.54 mm) if **E** is not programmed. Then, with the spindle turning in reverse, the canned cycle will touch the side of the tool to the probe stylus twice on opposite sides establishing the tool's diameter. The new diameter will then be stored in that tool's diameter register and clear any value in the diameter wear register. The Z-axis will then rapid up to machine home.
4. The Tool Diameter has now been set and you can change to another tool and repeat steps 1 through 3.

### Tool Breakage, Length, and Diameter Wear Detection (G154)

**Format:** G154 Tn Dn Kn Jn En Un Mn Sn Rn

Refer to **Table 5-46**.

**Table 5-46, G154 Address Word**

Address Word	Description
<b>T</b>	Tool number. (Required) The <b>T</b> cycle parameter will be the tool number you want checked.
<b>D</b>	This is the rough diameter on the bottom of the tool. (Optional) The diameter specified in this parameter should be roughly the diameter on the bottom of the tool that you want to be over the center of the probe stylus. If you have a left-handed tool, you would give a negative value to this diameter so the spindle will turn on forward verses reverse. When stepping over for checking the diameter of the tool, this cycle will use the diameter in the tool table for the tool being checked.
<b>K</b>	The maximum length wear value limit. The cycle will check to see if the cutter length has changed by more then this amount and will alarm, stopping the program if exceeded. If not set, the cycle will not check the tool length. (Optional)  <b>NOTE:</b> At least one, <b>K</b> or <b>J</b> must be set or the cycle will alarm.
<b>J</b>	The maximum diameter wear value limit. The cycle will check to see if the cutter diameter has changed by more then this amount and will alarm, stopping the program if exceeded. If not set, the cycle will not check the tool diameter. (Optional)  <b>NOTE:</b> At least one, <b>K</b> or <b>J</b> must be set or the cycle will alarm.
<b>E</b>	The distance to go down along the side of the probe stylus when doing a diameter check. The maximum <b>E</b> value is 0.55" (13.97 mm) or the tool may crash into the probe or table. If you enter a value larger than 0.55" (13.97 mm), the control will issue an error message. If <b>E</b> is not set, the cycle will use a default value of 0.1" (2.54 mm). (Optional) [Default: 0.1"]  Ball nose cutters and special cutters that require a move down more than 0.55" (13.97 mm) are not supported.
<b>U</b>	If this is undefined or set to 0, the <b>G154</b> cycle will not update the diameter or length wear register each time it checks a tool. If set to one, the cycle will update the wear registers. In both cases, the control will alarm when the maximum limit set in <b>K</b> or <b>J</b> has been exceeded. (Optional)

(Continued...)

Table 5-46, G154 Address Word (Continued)

Address Word	Description
<b>M</b>	This is the override for the medium feedrate that was set in the machine setup parameter “ <b>Z first pick, MEDIUM feedrate</b> ”. Sometimes there may be a tool that has a large diameter making it necessary to slow it down to prevent the touch probe from being hit too hard. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)
<b>S</b>	This is the override for the slow feedrate that was set in the machine setup parameter “ <b>Z final pick, SLOW feedrate</b> ”. This is used for the same reason as the <b>M</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original feedrate. (Optional)
<b>R</b>	This is the override for the RPM that was set in the machine setup parameter “ <b>RPM for calibration and tool measurement</b> ”. This is used for the same reason as the <b>M</b> cycle parameter. This can only be set slower. Trying to set this higher will only result in the software using the original RPM. (Optional)

**WARNING:** Large tools can result in probe damage if the touch feedrate is set too fast. For this reason, the cycle parameters: **M**, **S**, and **R** have been added to enable the programmer/operator to override the values in the machine setup parameters for the specific tool being checked or set.

**WARNING:** Running this cycle without first initially setting the length and diameter offset could result in damage to the probe and/or the machine tool. **G150 Calibration** and **G151 Automatic Tool Length and Diameter set**, or **G152 Manual Tool Length Measure for Special Tools** and **G153 Manual Tool Diameter Measure for Special Tools**, must be run first before using the **G154** cycle.

The **G154** cycle loads the tool, checks, and updates length and diameter wear registers if specified, until a maximum value is exceeded, then it will alarm out stopping the program.

This cycle can be used in place of calling up a tool before running it.

You must know the distance from the top of the probe stylus down that you will have to move so that the largest part of the tool diameter is even with the side of the probe stylus for diameter measurement. That value will be placed in **E** if different then the default 0.1” (2.54 mm).

To check the tool length and/or tool diameter for wear or breakage:

In place of the usual **Tn M6** command, use:

**G154 Tn Dn Kn Jn En Un**” at a tool change according to the instructions above and the control will check the tool prior to using it. To activate the new offset wear values you must call that tool with “T(Tool#) M6” after this cycle has been run.

### Spindle Probe Cycles

This section describes operation and an overview of the spindle probing cycles available in 5000M CNCs. It is designed to assist in part setup.

Before using your spindle probe for part setup, you must set the probe up according to the probe manufacturer's specification so that it is set to turn on with a signal (if cordless) from the optical module sending unit and to automatically time out after approximately 120 seconds.

Rotation, mirroring and scaling is not allowed while running these cycles. Plane will be set to **XY G17** when these cycles are complete.

This section contains the following topics:

- Spindle probe G-code cycle designations
- [Canned cycle parameter settings](#)
- [Description of spindle probe cycles](#)

### Spindle Probe G-code Cycle Designations

The following summarizes the cycles available:

**G140 Spindle Probe Calibration Cycle**  
This is used to set the effective probe stylus diameter and set the compensation factor for any run-out of the probe stylus.

You will also need to calibrate the probe using the **G140** cycle.

**NOTE:** On machines that do not have spindle orientation or if you are using a corded probe or cordless UD probe and cannot orient the spindle 180 degrees during calibration, the spindle probe stylus needs to be indicated true to the spindle centerline. In this case the accuracy of the spindle probe is only as good as the stylus concentricity to the spindle. Calibration must be done at least once before using the spindle probe. Once calibrated, calibration does not have to be done again unless you replace the probe stylus.

**G141 Single Surface Measure/Edge Find**  
This cycle will find a single surface and store that surface in a work or fixture offset register if programmed.

**G142 Outside Part Corner Find**  
This cycle will find the X & Y surface on an outside corner of a part and store that location in a work or fixture offset register if programmed.

**G143 Inside Part Corner Find**  
This cycle will find the X & Y surface in an inside corner of a part and store that location in a work or fixture offset register if programmed.

- G144      Inside or Outside Hole or Boss Center Find**  
This cycle will find the X & Y center of an inside hole or outside standing boss on a part and store that location in a work or fixture offset register if programmed.
- G145      Inside or Outside Web or Slot Center Find**  
This cycle will find the X or Y center of an inside or outside web or slot on a part and store that location in a work or fixture offset register if programmed. The slot or standing web must be parallel to either the X- or Y-axes.
- G146      Protected Positioning Move**  
This cycle allows for safe positioning of the probe around the part and will generate an alarm and stop the program if an obstruction is encountered.
- G147      Skew Error or Angle Find**  
This cycle will make two touches on a surface in the X or Y axes and stores the angle relative to the 3 O'clock position. This cycle can also activate the **SkewComp** at the same time as it is measured or in a subsequent call at another place in the program without measuring again by using **Q2**.

### Canned Cycle Parameter Settings

Before you set the cycle parameters for the Spindle probe you must:

- Know the exact diameter of the Ring Gauge (calibration standard).
- Know that the Ring Gauge is a standard that is specifically designed for calibrating the probe. The **D** cycle parameter is the diameter of hole that comes in contact with the probe stylus during calibration and should be an exact measurement.

### Description of Spindle Probe Cycles

This section contains detailed descriptions of the spindle probe cycles:

- [Spindle Probe Calibration \(G140\)](#)
- [Edge Finding \(G141\)](#)
- [Outside Corner Finding \(G142\)](#)
- [Inside Corner Finding \(G143\)](#)
- [Out/Inside Boss/Hole Finding \(G144\)](#)
- [Out/Inside Web Finding \(G145\)](#)
- [Protected Probe Positioning \(G146\)](#)
- [Skew Error Find \(G147\)](#)



### Spindle Probe Calibration (G140)

**Format:** G140 Qn Hn En Vn Dn An Bn

Refer to **Table 5-47**.

**Table 5-47, G140 Address Word**

Address Word	Description
<b>Q</b>	Set <b>Q</b> to <b>1</b> if you are calibrating to a boss verses a ring gauge. Otherwise, do not set or set to <b>0</b> . Default is: <b>0</b> . (Optional)
<b>H</b>	If set to <b>1</b> , the cycle will find the top of the part before calibrating the probe. If <b>Q</b> parameter is set to <b>1</b> , <b>H</b> is forced to <b>1</b> as well; otherwise, the Default is: <b>0</b> . (Optional)
<b>E</b>	The distance to go down from the top of the ring gauge or standing boss for calibration. This is only used if <b>H</b> parameter is set to <b>1</b> . Without any <b>E</b> value, the cycle will bring the probe down past the top of the ring gauge after finding the top, 0.1". Note: If the stylus ball is greater than .2" (5.08 mm), E must be set to at least half the ball diameter. (Optional)
<b>V</b>	The <b>V</b> parameter specifies the distance to back away from the edge for the probe to fast feed to before trying to find it. Default is: 0.1" (2.54 mm) if not set. (Optional)
<b>D</b>	The diameter of the ring gauge hole the probe stylus will come in contact with. This is only to override the value in the machine setup parameter " <b>Diameter of spindle probe Gauge</b> " if needed and <u>should be an exact measurement</u> . (Optional)
<b>A</b>	The distance from the starting point to move in the X-axis to find the top of the gauge. The default, if <b>Q</b> is not set or set to <b>0</b> , is 0.1" (2.54 mm) beyond the edge of the ring gauge hole. If <b>Q</b> is set to <b>1</b> , the default is the current probe position. (Optional)
<b>B</b>	The distance from the starting point to move in the Y axis to find the top of the gauge. The default is the current probe position. (Optional)

You must have:

1. The probe in the spindle.
2. The Ring Gauge mounted on the machine table.

To calibrate the probe:

1. Jog the probe to the approximate center of the ring gauge by eye and into the hole of the ring gauge at the depth that you wish the probe stylus to come in contact with the inside of the ring gauge hole.
2. From the manual mode, type "**G140**" and press **START**.
3. The probe will touch four sides of the inside of the hole. The spindle will rotate 180 degrees (if machine has spindle orientation) and touch the same four sides again establishing the center of the ring gauge. The spindle will then orient and touch four sides one more time calibrating the probe.
4. Remove the ring gauge from the machine and you are now ready to start spindle probing.

**NOTE:** On machines that allow the spindle probe to be installed in the spindle with more than one orientation or machines that cannot orient the spindle, the probe stylus must be indicated true to the spindle centerline or the probe will not be accurate once removed and replaced into the spindle again.

### Edge Finding (G141)

**Format:** G141 Qn Wn

- ❑ Calibrate the work probe at least once before trying to use this cycle.
- ❑ A preliminary tool-length offset must be set by eye for the work probe and that tool offset active before using this cycle in a program. See "[Section 9, Tool-Length Offsets](#)" for setting and activating tool-length offsets.
- ❑ A preliminary work offset must be set by eye and that work coordinate active before using this cycle in a program. See "[Section 9, Tool-Length Offsets](#)" for setting and activating work coordinate offsets.
- ❑ The G141 Edge Finding Cycle can be run from within a program or from the manual mode. Refer to **Table 5-48**.

**Table 5-48, G141 Address Words**

Address Word	Description
<b>Q</b>	Axis and direction to find edge. <b>0</b> = X+, <b>1</b> = X-, <b>2</b> = Y+, <b>3</b> = Y-, <b>4</b> = Z+, <b>5</b> = Z- (Required)
<b>W</b>	Work Coordinate to update with edge location in X- or Y-axes. If set, work coordinate will be updated if 1 through 4 are specified for <b>Q</b> or tool-length offset will be set for the current tool number if <b>Q</b> is set to <b>5</b> or <b>6</b> . <b>NOTE:</b> Before any tool-length offset is active, you must recall that tool. Work coordinate register or Tool-length register will not be updated if <b>W</b> is not set and a warning message will tell the operator no update has taken place. (Optional)

To use the Edge Finding Cycle:

1. Place the probe in the spindle.
2. Manually jog the probe stylus less than 0.1" (2.54 mm) away from the surface to be found.
3. Type **G141 Qn Wn**. If this is run from inside a program, this line needs to be repeated for every surface you wish to find.

**CAUTION:** When positioning the probe from within the program you should always use the **G146 (Protected Probe Positioning)** cycle (see **G146** instructions later in this document).

4. Execute that line in Manual by pressing **START**.

**Outside Corner Finding (G142)****Format:** G142 Qn Hn En Dn Vn An Bn In Jn Kn Wn

- ❑ Calibrate the work probe at least once before trying to use this cycle.
- ❑ A preliminary tool-length offset must be set by eye for the work probe and that tool offset must be active before using this cycle in a program. See "[Section 9, Tool-Length Offsets](#)" for setting and activating tool-length offsets.
- ❑ A preliminary work offset must be set by eye and that work coordinate active before using this cycle in a program. See "[Section 9, Tool-Length Offsets](#)" for setting and activating work coordinate offsets.
- ❑ The G142 Outside Corner Finding Cycle can be run from within a program or from the manual mode. Refer to **Table 5-49**.

**Table 5-49, G142 Address Words**

Address Word	Description
<b>Q</b>	Quadrant of corner to find. <b>0</b> = +,+ (upper right) <b>1</b> = -,+ (upper left) <b>2</b> = -,- (lower left) <b>3</b> = +,- (lower right) (Required)
<b>H</b>	If set to <b>1</b> , the cycle will find the top of the part before finding the X & Y corner coordinate. Default is: <b>0</b> . If <b>H</b> is not set or is set to <b>0</b> , the Z-axis must be at the picking depth. If <b>H</b> = <b>1</b> , then the Z-axis must be within 0.1" (2.54 mm) above the part. The probe stylus must be positioned within 0.1" (2.54 mm) from the outside of the corner in X & Y. (Optional)
<b>E</b>	The distance to go down from the top of part to find X & Y coordinate of the corner. This is only used if <b>H</b> parameter is set to <b>1</b> . Without any <b>E</b> value, the cycle will bring the probe stylus center down past the top of the part after finding the top, 0.1" (2.54 mm). (Optional)
<b>D</b>	The distance over from the corner to find X & Y edge. This will allow for a part corner that has a large chamfer or radius where you cannot pick the edge close to the theoretical corner or has an obstruction interfering with the default move. Default is: 0.4" (10.16 mm). (Optional)
<b>V</b>	Specifies the distance away from the edge for the probe to fast feed to before trying to find it. Default is: 0.1" (2.54 mm) if not set. (Optional)

*(Continued...)*

**Table 5-49, G142 Address Words** (Continued)

Address Word	Description
<b>A</b>	The distance from the starting point to move in the X-axis to find the top of the part. The default is toward the corner being found 0.4" (10.16 mm). (Optional)
<b>B</b>	The distance from the starting point to move in the Y-axis to find the top of the part. The default is toward the corner being found 0.4" (10.16 mm). (Optional)
<b>I</b>	This causes the cycle to make a protected X move to the coordinate entered relative to the current active work coordinate before finding the corner. (Optional)
<b>J</b>	Same as I only for the Y-axis. (Optional)
<b>K</b>	Same as I only for the Z-axis. (Optional)
<b>W</b>	Work Coordinate to update with edge location in X- and Y-axes. If set, work coordinate will be updated. Work coordinate register will not be updated if not set and a warning message will tell the operator no update has taken place if <b>W</b> is not set. (Optional)

To use the Outside Corner Finding Cycle:

1. Place the probe in the spindle.
2. Manually jog the probe stylus less than 0.1" (2.54 mm) away from the outside of the corner you wish to find in X & Y. If **H = 1**, the Z-axis should be within 0.1" (2.54 mm) above the part otherwise the Z-axis should be at the side picking depth.
3. Type **G142 Qn Wn**. If this is run from inside a program, this line needs to be repeated for every corner you wish to find or whose position you want to reestablish.

**CAUTION:** When positioning the probe from within the program, you should always use the **G146 (Protected Probe Positioning)** cycle (see **G146** instructions later in this document) or use the **I, J, or K** cycle parameters for the same purpose.

4. Execute that line in Manual by pressing **START**.

**Inside Corner Finding (G143)****Format:** G143 Qn Hn En Dn Vn An Bn In Jn Kn Wn

- Calibrate the work probe at least once before trying to use this cycle.
- A preliminary tool-length offset must be set by eye for the work probe and that tool offset active before using this cycle in a program. See [“Section 9, Tool-Length Offsets”](#) for setting and activating tool-length offsets.
- A preliminary work offset must be set by eye and that work coordinate active before using this cycle in a program. See [“Section 9, Tool-Length Offsets”](#) for setting and activating work coordinate offsets.
- The G143 Inside Corner Finding Cycle can be run from within a program or from the manual mode. Refer to **Table 5-50**.

**Table 5-50, G143 Address Words**

Address Word	Description
<b>Q</b>	Quadrant of corner to find. <b>0</b> = +,+ (upper right) <b>1</b> = -,+ (upper left) <b>2</b> = -,- (lower left) <b>3</b> = +,- (lower right) (Required)
<b>H</b>	If set to <b>1</b> , the cycle will find the top of the part before finding the X & Y corner coordinate. Default is: <b>0</b> . If <b>H</b> is not set or is set to <b>0</b> , the Z-axis must be at the picking depth. If <b>H</b> = <b>1</b> , then the Z-axis must be within 0.1” (2.54 mm) above the part. The probe stylus must be positioned within 0.1” (2.54 mm) from the inside of the corner in X & Y. (Optional)
<b>E</b>	The distance to go down from the top of part to find X & Y coordinate of the corner. This is only used if <b>H</b> parameter is set to <b>1</b> . Without any <b>E</b> value, the cycle will bring the probe stylus center down past the top of the part after finding the top, 0.1” (2.54 mm). (Optional)
<b>D</b>	The distance over from the corner to find X & Y edge. This will allow for a part corner that has a large chamfer or radius where you cannot pick the edge close to the theoretical corner or has an obstruction interfering with the default move. Default is: 0.4” or 10.16 mm. (Optional)
<b>V</b>	Specifies the distance away from the edge for the probe to fast feed to before trying to find it. Default is: 0.1” (2.54 mm) if not set. (Optional)
<b>A</b>	The distance from the starting point to move in the X-axis to find the top of the part. The default is toward the corner being found 0.4” or 10.16 mm. (Optional)

*(Continued...)*

Table 5-50, G143 Address Words (Continued)

Address Word	Description
<b>B</b>	The distance from the starting point to move in the Y-axis to find the top of the part. The default is toward the corner being found 0.4" or 10.16 mm. (Optional)
<b>I</b>	This causes the cycle to make a protected X move to the coordinate entered relative to the current active work coordinate before finding the corner. (Optional)
<b>J</b>	Same as I only for the Y-axis. (Optional)
<b>K</b>	Same as I only for the Z-axis. (Optional)
<b>W</b>	Work Coordinate to update with edge location in X- and Y-axes. If set, work coordinate will be updated. Work coordinate register will not be updated if not set and a warning message will tell the operator no update has taken place if <b>W</b> is not set. (Optional)

To use the Inside Corner Finding Cycle:

1. Place the probe in the spindle.
2. Manually jog the probe stylus 0.1" (2.54 mm) away from the inside of the corner you wish to find in X & Y. If **H = 1**, the Z-axis should be within 0.1" (2.54 mm) above the part otherwise the Z-axis should be at the side picking depth.
3. Type **G143 Qn Wn**. If this is run from inside a program, this line needs to be repeated for every corner you wish to find or whose position you want to reestablish.

**CAUTION:** When positioning the probe from within the program you should always use the **G146 (Protected Probe Positioning)** cycle (see **G146** instructions later in this document) or use the **I, J, or K** cycle parameters for the same purpose.

4. Execute that line in Manual by pressing **START**.

**Inside/Outside Boss/Hole Finding (G144)****Format:** G144 Qn Xn Yn Hn En Vn An Bn In Jn Kn Rn Wn

- Calibrate the work probe at least once before trying to use this cycle.
- A preliminary tool-length offset must be set by eye for the work probe and that tool offset active before using this cycle in a program. See “[Section 9, Tool-Length Offsets](#)” for setting and activating tool-length offsets.
- A preliminary work offset must be set by eye and that work coordinate active before using this cycle in a program. See “[Section 9, Tool-Length Offsets](#)” for setting and activating work coordinate offsets.
- The G144 Inside or Outside Boss/Hole Finding Cycle can be run from within a program or from the manual mode. Refer to **Table 5-51**.

**Table 5-51, G144 Address Words**

Address Word	Description
<b>Q</b>	Inside or Outside. <b>0</b> = Inside Hole <b>1</b> = Outside Boss (Required)
<b>X</b>	Estimated length of boss/hole if rectangular or the Diameter if round. (Required)
<b>Y</b>	Estimated width of boss/hole. <b>Y</b> is only specified if boss or hole is rectangular in shape. (Optional)
<b>H</b>	If set to <b>1</b> , the cycle will find the top of the part before finding center of hole or boss. If <b>Q</b> parameter is set to <b>1</b> , <b>H</b> is forced to <b>1</b> as well; otherwise, the Default is: <b>0</b> . (Optional)
<b>E</b>	The distance to go down from the top of part to find X & Y coordinate of the center. This is only used if <b>H</b> parameter is set to <b>1</b> . Without any <b>E</b> value, the cycle will bring the probe stylus center down past the top of the part after finding the top, 0.1” (2.54 mm). (Optional)
<b>V</b>	Specifies the distance away from the edge for the probe to fast feed to before trying to find it. Default is: 0.1” (2.54 mm) if not set. (Optional)
<b>A</b>	The distance from the starting point to move in the X-axis to find the top of the part. The default, if <b>Q</b> is not set or set to <b>0</b> , is 0.1” beyond the edge of the boss/hole. If <b>Q</b> is set to <b>1</b> , the default is the current probe position. (Optional)

*(Continued...)*



**Table 5-51, G144 Address Words (Continued)**

Address Word	Description
<b>B</b>	The distance from the starting point to move in the Y-axis to find the top of the part. The default is the current probe position. (Optional)
<b>I</b>	This causes the cycle to make a protected X move to the coordinate entered relative to the current active work coordinate before finding the boss/hole center. (Optional)
<b>J</b>	Same as I only for the Y-axis. (Optional)
<b>K</b>	Same as I only for the Z-axis. (Optional)
<b>W</b>	Work Coordinate to update with the center location in X and Y axes. If set, work coordinate will be updated. Work coordinate register will not be updated if not set and a warning message will tell the operator no update has taken place if <b>W</b> is not set. (Optional)
<b>R</b>	If set to <b>1</b> , the cycle will do a preliminary measure in the X-axis to get on center before measuring the Y-axis, making a total of 6 touches. If set to <b>0</b> , the cycle will only measure "X" once for a total of 4 touches. Default is: <b>0</b> . (Optional)

To use the Inside/Outside Boss/Hole Finding Cycle:

1. Place the probe in the spindle.
2. Manually jog the probe stylus the approximate center in X & Y within 0.1" (2.54 mm). If **H = 1**, the Z-axis should be within 0.1" (2.54 mm) above the part otherwise the Z-axis should be at the side picking depth.
3. Type **G144 Qn Xn Yn Wn**. If this is run from inside a program, this line needs to be repeated for every boss/hole you wish to find or whose position you want to reestablish.

**CAUTION:** When positioning the probe from within the program, you should always use the **G146 (Protected Probe Positioning)** cycle (see **G146** instructions later in this document) or use the **I, J, or K** cycle parameters for the same purpose.

4. Execute that line in Manual by pressing **START**.

**Inside/Outside Web Finding (G145)****Format:** G145 Qn Xn Yn Hn En Vn An Bn In Jn Kn Wn

- ❑ An inside Web is a slot. An outside Web is a standing rib.
- ❑ Webs can only be measured in the X- or Y-axis.
- ❑ Calibrate the work probe at least once before trying to use this cycle.
- ❑ A preliminary tool-length offset must be set by eye for the work probe and that tool offset active before using this cycle in a program. See [“Section 9, Tool-Length Offsets”](#) for setting and activating tool-length offsets.
- ❑ A preliminary work offset must be set by eye and that work coordinate active before using this cycle in a program. See [“Section 9, Tool-Length Offsets”](#) for setting and activating work coordinate offsets.
- ❑ The G145 Inside or Outside Web Finding Cycle can be run from within a program or from the manual mode. Refer to **Table 5-52**.

**Table 5-52, G145 Address Words**

<b>Address Word</b>	<b>Description</b>
<b>Q</b>	Inside or Outside. <b>0</b> = Inside Hole <b>1</b> = Outside Boss (Required)
<b>X</b>	Estimated X width of Web if measuring in the X-axis. X or Y must be specified; but only one, not both.
<b>Y</b>	Estimated Y width of Web if measuring in the Y-axis. X or Y must be specified; but only one, not both.
<b>H</b>	If set to <b>1</b> , the cycle will find the top of the part before finding center of Web. If <b>Q</b> parameter is set to <b>1</b> , <b>H</b> is forced to <b>1</b> as well; otherwise, the Default is: <b>0</b> . (Optional)
<b>E</b>	The distance to go down from the top of part to find X or Y coordinate of the center. This is only used if <b>H</b> parameter is set to <b>1</b> . Without any <b>E</b> value, the cycle will bring the probe stylus center down past the top of the part after finding the top, 0.1” (2.54 mm). (Optional)
<b>V</b>	Specifies the distance away from the edge for the probe to fast feed to before trying to find it. Default is: 0.1” (2.54 mm) if not set. (Optional)

*(Continued...)*

**Table 5-52, G145 Address Words (Continued)**

Address Word	Description
<b>A</b>	The distance from the starting point to move in the X-axis to find the top of the part. The default, if <b>Q</b> is not set or set to <b>0</b> , is 0.1" beyond the edge of the web. If <b>Q</b> is set to <b>1</b> , the default is the current probe position. (Optional)
<b>B</b>	The distance from the starting point to move in the Y-axis to find the top of the part. The default is the current probe position. (Optional)
<b>I</b>	This causes the cycle to make a protected X move to the coordinate entered relative to the current active work coordinate before finding the web center. (Optional)
<b>J</b>	Same as <b>I</b> only for the Y-axis. (Optional)
<b>K</b>	Same as <b>I</b> only for the Z-axis. (Optional)
<b>W</b>	Work Coordinate to update with the center location in X- or Y-axes. If set, work coordinate will be updated. Work coordinate register will not be updated if not set and a warning message will tell the operator no update has taken place if <b>W</b> is not set. (Optional)

To use the Inside/Outside Web Finding Cycle:

1. Place the probe in the spindle.
2. Manually jog the probe stylus the approximate center in X or Y within 0.1" (2.54 mm). If **H = 1**, the Z-axis should be within 0.1" (2.54 mm) above the part otherwise the Z-axis should be at the side picking depth.
3. Type **G145 Qn Xn Wn**. If this is run from inside a program, this line needs to be repeated for every web you wish to find or whose position you want to reestablish.

**CAUTION:** When positioning the probe from within the program you should always use the **G146 (Protected Probe Positioning)** cycle (see **G146** instructions later in this document) or use the **I, J, or K** cycle parameters for the same purpose.

4. Execute that line in Manual by pressing **START**.

## Protected Probe Positioning (G146)

**Format:** G146 Xn Yn Zn Fn

- ❑ When an X, Y, and/or Z move is programmed using the G146 (Protected Positioning Cycle), the control will stop the axis travel and program and alarm, if the probe stylus is triggered before reaching the target set in the X, Y, and/or Z parameters.
- ❑ This cycle is intended to offer some degree of safety when moving the probe around the part; however, it is not fool proof and will not protect against gross bad programming where the probe body would encounter an obstruction before the probe stylus is triggered. Extreme care should be taken to avoid this condition as probe damage may result.
- ❑ Calibrate the work probe at least once before trying to use this cycle.
- ❑ A preliminary tool-length offset must be set by eye for the work probe and that tool offset active before using this cycle. See "[Section 9, Tool-Length Offsets](#)" for setting and activating tool-length offsets.
- ❑ A preliminary work offset must be set by eye and that work coordinate active before using this cycle. See "[Section 9, Tool-Length Offsets](#)" for setting and activating work coordinate offsets.
- ❑ The G146 Protected Probe Positioning Cycle can be run from within a program or from the manual mode. Refer to **Table 5-53**.

**Table 5-53, G146 Address Words**

Address Word	Description
<b>X</b>	X Target position relative to current active work coordinate.
<b>Y</b>	Y Target position relative to current active work coordinate.
<b>Z</b>	Z Target position relative to current active work coordinate combined with the current active tool-length offset.
<b>F</b>	Feedrate at which to travel to target. <b>F</b> is only active for the current move so it must be restated every time or the default will take precedence. The default is set in the machine setup parameter " <b>Positioning feedrate normally</b> ". (Optional)

To use the Protected Probe Positioning Cycle:

1. Place the probe in the spindle and make sure that its tool and work coordinate offsets are active.
2. Type **G146 Xn Yn Zn Fn**. If this is run from inside a program, this line needs to be repeated for every move you wish to make.
3. Execute that line in Manual by pressing **START**.

### Skew Error Find (G147)

**Format:** G147 Qn Sn Dn Hn En Vn An Bn In Jn Kn

- ❑ G68, axis rotation, cannot be used with **G147**, skew error find.
- ❑ Skew error is only supported for along the side edge of a part relative to the X,Y plane.
- ❑ Calibrate the work probe at least once before trying to use this cycle.
- ❑ A preliminary tool-length offset must be set by eye for the work probe and that tool offset active before using this cycle in a program. See [“Section 9, Tool-Length Offsets”](#) for setting and activating tool-length offsets.
- ❑ A preliminary work offset must be set by eye and that work coordinate active before using this cycle in a program. See [“Section 9, Tool-Length Offsets”](#) for setting and activating work coordinate offsets.
- ❑ The probe must be pre-positioned to the proper spot in relation to the part in accordance with the specified **S** parameter as described below or an **I**, **J**, and/or **K** should be included for pre-positioning.
- ❑ The **G147** Skew Error Finding Cycle can be run from within a program or from the manual mode. Refer to **Table 5-54**.

**Table 5-54, G147 Address Words**

Address Word	Description
<b>Q</b>	<p><b>Q0</b> Finds the skew angle, but does not activate skew compensation.  <b>Q1</b> Finds the skew angle, and activates skew compensation.  <b>Q2</b> Activates skew compensation with the current skew value, but will not rerun the cycle on the part.</p> <p><b>NOTE:</b> If <b>Q2</b> is used, all other <b>G147</b> parameters are ignored.</p> <p><b>NOTE:</b> Before using <b>G147 Q2</b>, you must have called <b>G147</b> at least once with <b>Q0</b> or <b>Q1</b>, or the error message “Skew error has not been found!” is displayed.</p> <p>Skew compensation will be activated around the current active work coordinate and will only work from within the program being run. Skew compensation cannot be activated directly or indirectly using <b>G147</b> from the MDI mode. The operator can run the <b>G147</b> from MDI but must place <b>G147 Q2</b> inside the program for skew compensation to take effect. A G53 work coordinate call will deactivate skew compensation, necessitating a re-issuance of <b>G147 Q2</b> to activate skew compensation. Using <b>Q1</b> or <b>Q2</b> will default the control to <b>G90</b> (Absolute). If you are in <b>G91</b> (Incremental), you will need to switch back after the cycle has been run. (Optional)</p>

*(Continued...)*

Table 5-54, G147 Address Words (Continued)

Address Word	Description
<b>S</b>	<p>Estimated amount of angle from 3 O'clock. Default is <b>0</b> which will cause the cycle to find the angle of the back edge of the part starting its first pick in the upper-left corner and making the second pick to the left of that, as you are facing the surface being picked. Examples:</p> <p><b>S=90</b> would start in the lower-left side, picking in the X positive direction, finding the skew of the left side of the part.</p> <p><b>S=-90</b> would start in the upper-right side, picking in the X negative direction, finding the skew of the right side of the part.</p> <p><b>S=180</b> would start in the lower-right front edge of the part, picking in the Y positive direction, finding the skew of the front edge of the part.</p> <p>Default is: <b>0</b>. (Optional)</p>
<b>D</b>	<p>The distance from the first pick to the second pick. Default is: 2.0" (50.8 mm) (Optional)</p>
<b>H</b>	<p>If set to <b>1</b>, the cycle will find the top of the part before finding part skew angle. Default is: <b>0</b>. If <b>H</b> is set to <b>1</b>, the probe stylus should be pre-positioned within 0.1" (2.54 mm) above the part. If <b>H</b> is set to <b>0</b>, the probe stylus should be positioned at the Z-axis depth from which you want to make side picks. (Optional)</p>
<b>E</b>	<p>The distance to go down from the top of part to find part skew angle. This is only used if <b>H</b> parameter is set to <b>1</b>. Without any <b>E</b> value, the cycle will bring the probe stylus center down past the top of the part after finding the top, 0.1" (2.54 mm). (Optional)</p>
<b>V</b>	<p>Specifies the distance away from the edge for the probe to fast feed to before trying to find it. Default is: 0.1" (2.54 mm) if not set. This would be used to make sure that the cycle is picking from far enough away from the edge so that it will not trigger the probe prematurely when stepping over to make the second pick.</p> <div style="border: 1px solid black; padding: 5px; margin: 5px 0;"> <p><b>Hint:</b> If the <b>S</b> cycle parameter is relatively accurate, this parameter will not be needed because the default will be good enough.</p> </div> <p>(Optional)</p>
<b>A</b>	<p>The distance from the starting point to move in the "X" axis to find the top of the part. The Default is: 1.0" (25.4 mm) toward the part at the angle specified in the <b>S</b> cycle parameter. (Optional)</p>
<b>B</b>	<p>The distance from the starting point to move in the "Y" axis to find the top of the part. The Default is: 1.0" (25.4 mm) toward the part at the angle specified in the <b>S</b> cycle parameter. (Optional)</p>
<b>I</b>	<p>This causes the cycle to make a protected X move to the coordinate entered relative to the current active work coordinate before finding the skew angle. (Optional)</p>

(Continued...)

**Table 5-54, G147 Address Words (Continued)**

Address Word	Description
J	Same as I only for the Y-axis. (Optional)
K	Same as I only for the Z-axis. (Optional)

To use the Skew Error Finding Cycle:

1. Place the probe in the spindle.
2. Manually jog the probe stylus to the appropriate start position relative to the part as specified by the **S** parameter in **Table 5-54** above. X or Y should be within 0.1" (2.54 mm) of the part edge. If **H = 1**, the Z-axis should be within 0.1" (2.54 mm) above the part otherwise the Z-axis should be at the side picking depth. If run from within a program, probe must be pre-positioned.
3. Type **G147 Qn Sn**. If this is run from inside a program, this line needs to be repeated every time you wish to find a skew angle.

**CAUTION:** When positioning the probe from within the program you should always use the **G146 (Protected Probe Positioning)** cycle (see **G146** instructions above in this document) or use the **I, J, or K** parameters for the same purpose.

4. Execute that line in Manual by pressing **START**.

## Section 6 - Program Editor

### Activating the Program Editor

Program blocks are written using the Program Editor. The Program Editor can be activated from the Manual screen, Program Directory, or Draw Graphics.

When you activate the Program Editor, the selected program opens for editing.

#### Activating Edit Mode from the Manual Screen

To activate the Edit Mode from the Manual screen:

1. With the appropriate program loaded, press **EDIT (F3)**. The Edit Screen activates and **Ins (F3)** highlights. See **Figure 6-1**.

#### Activating Edit Mode from the Program Directory


To activate the Edit Mode from the Program Directory:

1. Highlight a program in the Program Directory.
2. Press **EDIT (F8)**. The Edit screen activates and **Ins (F3)** highlights.

#### Activating Edit Mode from Draw Graphics

To activate the Edit Mode from Draw Graphics:

1. Press **Edit (F2)**. The Edit screen activates and **Ins (F3)** highlights.

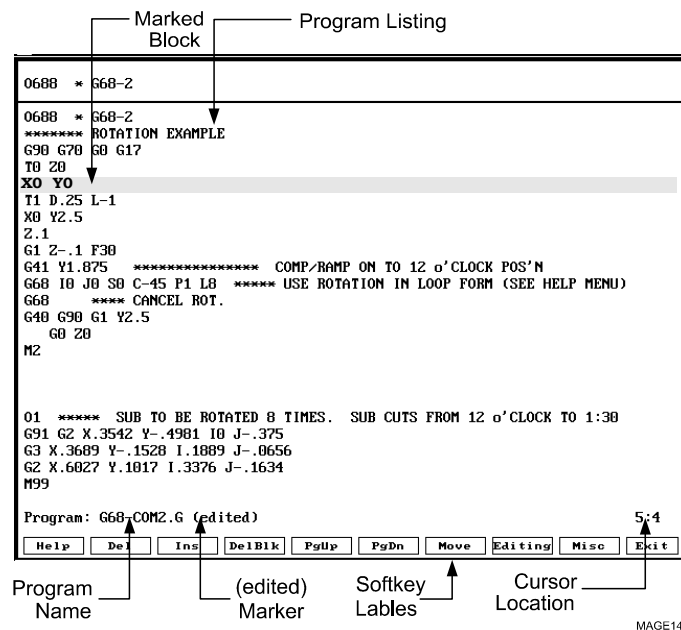

**Figure 6-1, Edit Screen**



You can write and edit programs from the Edit Screen. The Edit screen provides the following options:

<b>Program Name</b>	The name of the program listed on the screen.
<b>Cursor Location</b>	Indicates where text will be inserted (Line:Column).
<b>Soft Key Labels</b>	These labels define soft key functions. Some soft keys, when pressed, activate pop-up menus that contain additional features.
<b>(edited) Marker</b>	The (edited) marker indicates that the program has been edited and the edits have not been saved.
<b>Marked Block</b>	Highlighted block(s) to which the activated editing feature (cut, paste, delete, etc.) will be applied.
<b>Program Listing</b>	Area of the screen where the program is listed.

### Editing Soft Keys

The Edit screen contains fourteen soft keys, four of which are activated by pressing the **SHIFT** key. See **Table 6-1**.

To activate any **SHIFT** soft key:

1. In Edit Mode, press **SHIFT** and then press the appropriate soft key.

**Table 6-1, Editing Soft Keys**

Soft Key Label	F Key	Function
<b>Help</b>	<b>F1</b>	Activates Edit Help Menu.
<b>Del</b>	<b>F2</b>	Deletes a single character located at the cursor.
<b>Ins</b>	<b>F3</b>	Activates Insert Mode. Use to insert typed characters at the cursor without overwriting the existing text.
<b>DelBlk</b>	<b>F4</b>	Deletes a single block located at the cursor.
<b>PgUp</b>	<b>F5</b>	Returns the display to the previous page of the Program Listing.
<b>PgDn</b>	<b>F6</b>	Advances the display to the next page of the Program Listing.
<b>MOVE</b>	<b>F7</b>	Activates the Move Pop-Up Menu. Use this menu to return to the beginning or advance to the end of a line or program. The menu contains word and line search features.
<b>EDITING</b>	<b>F8</b>	Activates the Editing Pop-Up Menu. Use this menu to perform various editing functions within a single program or between two programs. This includes inserting and restoring (deleted) blocks. It also includes cutting and pasting blocks within a program or writing and reading blocks between programs.

*(Continued...)*

Table 6-1, Editing Soft Keys (Continued)

Soft Key Label	F Key	Function
<b>MISC</b>	<b>F9</b>	Activates the Misc Pop-Up Menu. Use this menu to record keystrokes, recall recorded keystrokes, repeat programming commands, print the program, or display or edit another program.
<b>Exit</b>	<b>F10</b>	Closes the Edit screen and returns the CNC to the Program Directory.
<b>UnDelBk</b>	<b>SHIFT + F4</b>	Restores deleted blocks. The CNC will restore up to 128 deleted blocks.
<b>FinNext</b>	<b>SHIFT + F7</b>	Advances to the next occurrence of the text specified in the <b>Find Word</b> feature. The <b>Find Word</b> feature is located in the Move Pop-Up Menu.
<b>ChaNext</b>	<b>SHIFT + F8</b>	Advances to the next occurrence of the text specified in the <b>Find Word</b> feature and changes the text to the replacement text specified in the <b>Find Word</b> feature. The <b>Find Word</b> feature is located in the Move Pop-Up Menu.
<b>Quit</b>	<b>SHIFT + F10</b>	Returns the CNC to the Program Directory without saving edits made to the Program Listing.

### Marking Programming Blocks

For many editing features, you must mark the affected program blocks before the edit is performed. To mark program blocks:

1. In Edit Mode, place the cursor at the beginning of the first block to be marked.
2. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
3. Highlight **Mark block**. Press **ENTER**. The block is marked.
4. Use **ARROWS** to mark the appropriate blocks.

### Unmarking Program Blocks

1. In Edit Mode, press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
2. Highlight **Mark block**. Press **ENTER**. Previously marked blocks will no longer be highlighted.

## Saving Edits

The Program Listing displays edits as soon as they are made, but the edits are not saved until you exit the Program Editor. If the program contains unsaved edits, the **(edited)** Marker is displayed next to the Program Name.

To save edits:

1. In Edit Mode, press **Exit (F10)**. The CNC returns to the Program Directory or Draw Graphics screen and saves all edits.

## Canceling Unsaved Edits

If edits have not been saved, they can be canceled.

To cancel unsaved edits:

1. In Edit Mode, press **SHIFT** and then press **Quit (SHIFT + F10)**.
2. The message **WARNING: Program has been edited. Sure you want to Quit?** is displayed on the screen, and the soft keys change. Press **Yes (F1)** to cancel edits and return to the Program Directory. Press **No (F2)** to return to the Edit Mode.

## Deleting a Character

To delete a character:

1. In Edit Mode, use **ARROWS** to place the cursor on the character you want to delete.
2. Press **Del (F2)** to delete the character.

## Deleting a Program Block

There are two ways to delete program blocks from a Program Listing.

- Use the **DeIBlk (F4)** soft key to delete blocks one at a time.
- Use the **BLOCK operations Delete** feature to delete several blocks at a time.

To delete a program block using the **DeIBlk (F4)** soft key:

1. In Edit Mode, place the cursor on the program block to be deleted.
2. Press **DeIBlk (F4)**. The CNC deletes the block.

To delete program blocks using the **BLOCK operations Delete** feature:

1. In Edit Mode, mark the blocks to be deleted.
2. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
3. Highlight **BLOCK operations**. Press **ENTER**. The Block Operation Pop-Up Menu activates.
4. Highlight **Delete**. Press **ENTER**. The CNC deletes the marked blocks.

## Undeleting a Block

You can restore deleted blocks with the **Undelete Block** feature. The last block deleted is the first block restored. There are two ways to restore a block.

To restore a block using the **EDITING (F8)** Pop-Up Menu:

1. In Edit Mode, place the cursor at the point where the restored block will appear.
2. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
3. Highlight **Undelete Block**. Press **ENTER**. The last line deleted from the program is displayed at the cursor.

To restore a block with the **SHIFT** soft key menu:

1. In Edit Mode, place the cursor where the restored block will appear.
2. Press **SHIFT** and then press **UnDeIBk (SHIFT + F4)**. The last line deleted from the program is inserted at the cursor.

<b>NOTE:</b> Up to 128 consecutively deleted blocks can be restored.
----------------------------------------------------------------------

## Canceling Edits to a Program Block

Use the **Restore Block** feature to cancel edits made to a program block and restore the block to its original form. The feature must be activated before the cursor has been moved to another block.

To cancel edits to a program block:

1. In Edit Mode, place the cursor on the program block to be restored. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
2. Highlight **Restore Block**. Press **ENTER**. The CNC cancels the edits and restores the original block.

## Inserting Text without Overwriting Previous Text

Use **Ins (F3)** to activate the Insert Mode. In Insert Mode, the CNC inserts typed text at the cursor, without overwriting previously entered text.

To insert text into a program without overwriting previously entered text:

1. In Edit Mode, press **Ins (F3)**.
2. Place the cursor where you want to insert the text. Type the new text. The new text is inserted at the cursor. The CNC does not delete previously typed text as you type.

## Inserting Text and Overwriting Previous Text

To insert text into a program while overwriting previously entered text:

1. In Edit Mode, press **Ins (F3)** to cancel the Insert Mode. The soft key will no longer be highlighted.
2. Place the cursor where the text will be inserted. Type the new text. The new text is inserted at the cursor. The CNC deletes previously typed text as you type.

## Advancing to the Beginning or End of a Block

To advance to the beginning or end of a program block:

1. In Edit Mode, place the cursor on any block of the program. Press **MOVE (F7)**. The soft key highlights and the Move Pop-Up Menu activates.
2. Highlight **End of Block**. Press **ENTER**. The cursor advances to the end of the block.

– or –

Highlight **Start of Block**. Press **ENTER**. The cursor returns to the beginning of the block.

## Advancing to the First or Last Block of a Program

To advance to the first or last block of a program:

1. In Edit Mode, press **MOVE (F7)**. The soft key highlights and the Move Pop-Up Menu activates.
2. Highlight **End of program**. Press **ENTER**. The cursor advances to the last block of the program.

– or –

Highlight **Start of program**. Press **ENTER**. The cursor returns to the first block of the program.

## Searching the Program Listing for Selected Text

Use **Find Word** and **Find Next** to search blocks for selected text. Type the text to be found.

To find all references of text in a program:

1. In Edit Mode, place the cursor at the beginning of the program. (**Find Word** and **Find Next** search forward in the program only.)
2. Press **MOVE (F7)**. The soft key highlights and the Move Pop-Up Menu activates.
3. Highlight **Find Word**. Press **ENTER**.

4. The message **Enter Word to Find:** is displayed on the screen. Type the text to be found. Press **ENTER**. The cursor advances to the first occurrence of the text in the program.
5. To advance to the next occurrence of the text, press **MOVE (F7)**. The soft key highlights and the Move Pop-Up Menu activates.
6. Highlight **Find Next**. Press **ENTER**. The CNC advances to the next occurrence of the text in the program.
7. Use this method to search for all occurrences of the text in the Program Listing.

**NOTE:** You can also activate **Find Next** from the **SHIFT** soft key menu:

8. In Edit Mode, press **SHIFT**. The soft key changes. Press **FinNext (F7)**. This soft key performs the same function as **Find Next** in the Move Pop-Up Menu. Each time you press the soft key, the CNC advances to the next occurrence of the **Find Word** text.

## Going to a Block of the Program Listing

Use **Go to Block** to move to any line in the Program Listing. **Go to Block** operates independently of block numbering. Blocks can be numbered sequentially by any increment (**1, 5, 10...**). **Go to Block** counts the blocks of the program in increments of 1 (**1 [starting block], 2, 3...**). When the feature is activated, the CNC goes to the line number specified by the user, regardless of how the blocks are numbered.

Block #	Line #
N10	Line 1
N20	Line 2
N30	Line 3

1. In Edit Mode, press **MOVE (F7)**. The soft key highlights and the Move Pop-Up Menu activates.
2. Highlight **Go to Block**.
3. The message **Go to Block:** is displayed on the screen, Type in the appropriate line number. Press **ENTER**. The CNC places the cursor at that line number.

---

## Replacing Typed Text with New Text

Use **Change word** to replace selected occurrences of text. Enter the appropriate text and the CNC searches the Program Listing for all occurrences of the text. You can edit or skip each occurrence.

To edit selected occurrences of the typed text:

1. In Edit Mode, **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
2. Highlight **Change Word**. Press **ENTER**.
3. The message **Enter String to Change:** is displayed on the screen. Type the text to be replaced. Press **ENTER**.
4. The message **Change <<TEXT>> with:** is displayed on the screen, Type in the replacement text. Press **ENTER**. The CNC goes to the first occurrence of the text in the program. The message **Change <<TEXT>> with <<REPLACEMENT TEXT>>?** is displayed on the screen, and the soft keys change.
5. The CNC finds each occurrence of the text in the program. For each occurrence, you can choose one of the following features:

<b>Yes</b>	<b>(F1)</b>	Inserts replacement text for highlighted text.
<b>No</b>	<b>(F2)</b>	Highlighted text does not changed.
<b>All</b>	<b>(F3)</b>	Inserts replacement text for highlighted text for all occurrences.
<b>Only</b>	<b>(F4)</b>	Changes highlighted word and exits to Edit screen.
<b>STOP</b>	<b>(F9)</b>	<b>Change word</b> feature is deactivated.
6. Press **Yes (F1)** to replace highlighted text with replacement text. Press **No (F2)** to leave text unchanged. When you press **Yes (F1)** or **No (F2)**, the CNC highlights the next occurrence of the search text.

**Change Word** deactivates when all occurrences of the text have been found or if you press **Only (F4)** or **STOP (F9)**. After **Change Word** is deactivated, the message **Change complete; [# of changes] occurrences changed.** is displayed. The CNC returns to the Edit Mode.

<p><b>NOTE:</b> The <b>ChaNext (SHIFT + F8)</b> soft key provides another way to change text entered in the <b>Change Word</b> feature.</p>
---------------------------------------------------------------------------------------------------------------------------------------------

7. With **Change Word** deactivated, press **SHIFT**. The **SHIFT** soft key menu activates.

8. Press **SHIFT** and then press **ChaNext (SHIFT + F8)**. The CNC finds the next occurrence of the text entered in the **Change Word** feature. It replaces the text with the replacement text specified in the **Change Word** feature.

## Scrolling Through the Program

In Edit Mode, press the up and down **ARROWS** to scroll up and down in the Program Listing.

## Paging Through the Program

With long programs, it is convenient to move the Program Listing display up and down a whole page at a time.

1. In Edit Mode, press **PgUp (F5)** to advance forward or press **PgDn (F6)** to go backward in the program. The CNC advances or goes back one page at a time.

## Inserting a Blank Line

Insert a line at the cursor with the Insert Line feature. All subsequent lines will be moved down one line in the program. To insert a blank line:

1. In Edit Mode, place the cursor where you want the blank line to appear. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
2. **Insert line** is highlighted when the menu activates. Press **ENTER**. A blank line is inserted at the cursor. You can type a new program block on the line.

## Abbreviating Statements

To access statements without typing the entire statement, type an abbreviation assigned to the statement and activate **Expand key**.

For conditional statements, the CNC displays the statement and waits for you to enter the condition under which the statement will be activated. Not all statements require you to enter a condition.

[Table 6-2, Statement Abbreviations](#) lists statements to which you can apply Expand key, and the abbreviation assigned to each statement. The statements are displayed within brackets. These brackets do not appear on the screen.



**Table 6-2, Statement Abbreviations**

<b>Abbreviation</b>	<b>Statement</b>
<b>D</b>	[DO] [END]
<b>E</b>	[END] or [ENDIF] or [ELSE]
<b>G</b>	[GOTO]
<b>I</b>	[IF ( ) THEN] [ENDIF]
<b>L</b>	[LOOP] [END]
<b>P</b>	[PRINT]
<b>W</b>	[WHILE ( ) DO] [END]

To generate a statement from an abbreviation:

1. In Edit Mode, type the abbreviation that corresponds to the conditional statement. The cursor must be on the space after the abbreviation.
2. Press **EDITING (F8)**. The Editing Pop-Up Menu activates.
3. Highlight **Expand key**. Press **ENTER**. The CNC generates the statement on the screen.
4. If the cursor is displayed within parentheses ( ), you must enter a condition under which the statement will be activated. Type in the condition, if applicable.

## Copying Program Blocks

**NOTE:** You can cut, save and paste blocks within a Program Listing. The Cut, Save and Paste features do not work for copying and pasting blocks between two different programs.

Copy one or more program blocks and place them elsewhere in the same Program Listing. **Table 6-3** describes two ways to copy program blocks.

**Table 6-3, Copying Program Blocks**

Method	Description
<b>Mark and save blocks</b>	Copies and stores marked blocks. Leaves original blocks unchanged.
<b>Mark and cut blocks</b>	Copies and stores marked blocks. Deletes original blocks.

To mark and save blocks:

1. In Edit Mode, place the cursor at the beginning of the first block to be copied.
2. Mark the blocks to be copied.
3. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
4. Highlight **BLOCK operations**. Press **ENTER**. The Block Operations Pop-Up Menu activates.
5. Highlight **Copy**. Press **ENTER**. The CNC saves the blocks in memory and the original blocks remain in the Program Listing.

To copy program blocks and delete the original blocks:

1. In Edit Mode, place the cursor at the beginning of the first block to be copied.
2. Mark the blocks to be copied.
3. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
4. Highlight **BLOCK operations**. Press **ENTER**. The Block Operations Pop-Up Menu activates.
5. Highlight **Cut**. Press **ENTER**. The CNC saves the blocks in memory and deletes the original blocks from the Program Listing.

## Pasting Blocks within a Program

To copy blocks and paste them into another section of the program:

1. In Edit Mode, place the cursor where you want to paste the copied blocks.
2. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
3. Highlight **BLOCK operations**. Press **ENTER**. The Block Operations Pop-Up Menu activates.
4. Highlight **Paste**. Press **ENTER**. The CNC pastes the copied blocks into the Program Listing at the cursor.

## Recording Keystrokes

Use **Record Keys** to record keystrokes as they are typed. It is useful for recording block sequences that are used in several areas of the program. When you activate **Record Keys**, the keystrokes are saved in a part of memory called the “macro buffer”. The **Play keys** feature recalls recorded keystrokes.

To record keystrokes as they are typed:

1. In Edit Mode, press **MISC (F9)**. The soft key highlights and the Misc Pop-Up Menu activates.
2. Highlight **Record Keys**. Press **ENTER**.
3. If any data has been stored in the macro buffer, the message **Overwrite existing macro buffer?** is displayed. If the message is displayed, choose **Yes (F1)**.
4. Type in the appropriate text. The CNC records the typed text.
5. Highlight **Record Keys**. Press **ENTER** to deactivate the **Record Keys** feature.

**NOTE:** Information remains in the macro buffer until overwritten by new data or until the Edit Mode deactivates.

## Retrieving Recorded Keystrokes

Use **Play Keys** to retrieve recorded keystrokes and print them on the screen. To retrieve recorded keystrokes:

1. In Edit Mode, press **MISC (F9)**. The soft key highlights and the Misc Pop-Up Menu activates.
2. Highlight **Play Keys**. Press **ENTER**. The CNC displays the recorded keystrokes at the cursor.

## Repeating a Command or Key

**NOTE:** Use **Repeat Command** with other features. You should understand how a feature works before duplicating it with **Repeat Command**.

The **Repeat Command** feature performs the following functions:

- repeats activated commands
- repeats (single) typed character

To repeat a command or character:

1. In Edit Mode, press **MISC (F9)**. The soft key highlights and the Misc Pop-Up Menu activates.
2. Highlight **Repeat Command**. Press **ENTER**.
3. The message **Enter Repeat Count:** is displayed. Type the number of times the command will be repeated.
4. The CNC prompts you to **Select command (key) To Repeat**.
5. Select the command (or key) to be repeated. The CNC repeats the command. The command is repeated the number of times entered after the **Enter Repeat Count:** inquiry.

**NOTE:** The maximum repeat count is 99,999.

## (Re)numbering Program Blocks

To number or renumber blocks in a program:

1. In Edit Mode, mark all the blocks in the program.
2. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
3. Highlight **BLOCK operations**. Press **ENTER**. The **Block Operations** Pop-Up Menu activates.
4. Highlight **Renum**. Press **ENTER**. The soft key menu changes.
5. The CNC displays the message, **Enter starting N#:**. Type a value (**1, 5, 10...**). The CNC assigns the number to the starting block of the program. Press **ENTER**.
6. The message **Enter N# increment:** is displayed. Type an incremental value (**1, 5, 10...**). The CNC uses the entered values to number the program. The numbering sequence assigned to the listing starts at the number assigned to the starting block. Subsequent block numbers are assigned based on the incremental value entered (**1, 2, 3...**; **5, 10, 15...**; **10, 20, 30...**).
7. Unmark highlighted blocks.

---

## Printing the Entire Program

**NOTE:** Use the **Print program** located in the Block Operations Pop-Up Menu to print part of a program.

Use **Print program**, from the MISC Pop-Up Menu, to print an entire program. The parallel printer connection is located on the computer assembly. The machine builder determines the actual position.

To print an entire program:

1. In Edit Mode, press **MISC (F9)**. The soft key highlights and the Misc Pop-Up Menu activates.
2. Highlight the **Print program**. Press **ENTER**.
3. The message **Print <<PROGRAM.G>>?** is displayed. Press **Yes (F1)** to print the program.  
– or –  
Press **No (F2)** to cancel the feature.
4. When **Yes (F1)** is pressed, the CNC prints the program. A status screen is displayed containing the program name, the line, page and number of copies being printed. At the completion of the print job, the CNC displays a message and the soft keys change.
5. Press **Continue (F10)** to return to the Edit screen.

**NOTE:** Press **Cancel (F9)** to cancel the print job while the program is printing.

## Printing a Portion of a Program

**NOTE:** Use **Print program**, from the **Misc (F9)** Pop-Up Menu, to print the entire Program Listing.

Use **Print**, from the BLOCK Operations Pop-Up Menu, to print part of a Program Listing. Select one or more blocks from the Listing. The CNC prints out the selected blocks.

1. In Edit Mode, mark all blocks to be printed.
2. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
3. Highlight **BLOCK operations**. Press **ENTER**. The Block Operations Pop-Up Menu activates.
4. Highlight **Print**. Press **ENTER**. The soft key menu changes.
5. The message **Print selected block?** is displayed. Press **Yes (F1)** to print the program, or **No (F2)** to cancel the feature.

6. When you press **Yes (F1)**, the CNC prints the selected program blocks. A status screen is displayed containing the program name and the line, page, and number of copies being printed. At the completion of the print job, the CNC displays a message and the soft keys change.
7. Press **Continue (F10)** to return to the Edit screen.

**NOTE:** Press **Cancel (F9)** to cancel the print job while the program is printing.

## Accessing the Most Recently Used Programs

Use **Pick Program**, from the MISC Pop-Up Menu, to access and display any of the last ten programs opened in the Edit Mode. The feature lists the programs in descending order, with the most recently opened program at the top of the list. The currently open program will not appear on the list.

To access and display any of the last ten programs opened in the Edit Mode:

1. In Edit Mode, press **MISC (F9)**. The soft key highlights and the Misc Pop-Up Menu activates.
2. Highlight **Pick Program**. Press **ENTER**. The Pick program screen activates.
3. Highlight a program. Press **ENTER**. The CNC replaces the current Program Listing with the selected program.

## Opening Another Program from the Program Listing

After final edits have been made to a program, use **Edit Program** to open and edit another program from the Program Listing. To use **Edit program** to open a program:

1. In Edit Mode, press **MISC (F9)**. The soft key highlights and the Misc Pop-Up Menu activates.
2. Highlight **Edit program**. Press **ENTER**.
3. The message **Enter program name:** is displayed. Type the program name.
4. If the current Program Listing has been edited, the message **Program <<PROGRAM>> has been edited. Save before LOAD?** is displayed. Press **Yes (F1)** to save the edits; press **No (F2)** to cancel edits to the current Listing.
5. If **Yes (F1)** is selected, press **ENTER**. The CNC displays the entered program.

**NOTE:** Blocks saved in memory can be pasted into another program.

---

## Copying Blocks to Another Program

Use **Write**, located in the Block Operations Pop-Up Menu, to copy one or more blocks to another program. If you are copying to an existing program, select the program to which the copied blocks will be written. The **Write** feature deletes any information currently in the selected program and replaces it with the copied blocks. If you type a new program name, the CNC creates a file with the name you typed and adds an .M extension. The copied blocks remain in the original program.

To copy blocks from one program to another:

1. In Edit Mode, mark all blocks to be copied.
2. Press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
3. Highlight **BLOCK operations**. Press **ENTER**. The Block Operations Pop-Up Menu activates.
4. Highlight **Write**. Press **ENTER**. The soft key menu changes.

**NOTE:** Press **Cancel (F9)** to cancel the operation.

5. The message **Write block as:** is displayed. Type the name of the program to which the blocks are being copied. (You must type the entire program name or the CNC generates an error message.) Press **ENTER**. The blocks replace the existing program.

**NOTE:** **Write** does not use or overwrite information in the buffer, where cut and saved blocks are stored. When the **Write** feature is used, the information in the buffer remains unchanged.

## Copying an Entire Program into Another Program

Use **Read**, in the Block Operations Pop-Up Menu, to copy an entire program into the displayed Program Listing automatically. The copied program will appear at the cursor.

1. In Edit Mode, press **EDITING (F8)**. The soft key highlights and the Editing Pop-Up Menu activates.
2. Highlight **BLOCK operations**. Press **ENTER**. The Block Operation Pop-Up Menu activates.
3. Highlight **Read**. Press **ENTER**.
4. The message **Enter program to read:** is displayed. Type the name of the program to be copied into the Program Listing. Press **ENTER**. The CNC copies the entered program into the Program Directory at the cursor. The message **Block read from <<PROGRAM>>** is displayed indicating that the operation is finished.

## Including Comments in a Program Listing

Use an asterisk (\*) to make comments within a Program Listing or to mask all or part of a block from the CNC. When an asterisk is placed before a string of text, the CNC ignores all the text to the right of and on the same block as the asterisk. **Table 6-4** shows various ways to use the asterisk in a Program Listing.

**Table 6-4, Comment Blocks**

Commented Block	Ignored Text
*N20 G1 X5 Z6 N30 ...	CNC ignores the entire block. The next block is executed.
N20 G1 *X5 Z6 N21 ...	CNC activates Linear Interpolation (G1). Then, programmed move to X5 Z6 is ignored. The next block is executed.
N10 G70 G90 G0 X0 Z0 T0 N20 T1 *FACE/TURN TOOL	Block N20 activates Tool #1. The comment contains the type of tool used.



## Section 7 - Edit Help

Edit Help provides diagrams and entry fields to program move types and Canned Cycles. The following section describes how to activate a Help Graphic Screen for a G-code command and type values in the appropriate entry fields.

**NOTE:** To select menu items (**2** through **9**, **+/-** or **.**), press the key corresponding to the desired item and press **ENTER**. Menu items **2** through **9** correspond to the numeric keypad keys **2** through **9**. Menu item **+/-** corresponds to the **+/-** key. Menu item **.** corresponds to the period (**.**) key.

– or –

If you know the G-code, type the G-code that you want, and press **ENTER** to go directly to the Help Graphic screen. This is a short cut to the Help Graphic screen, you do not have go through the menus.

[Figure 7-1, Overview of the Edit Help Screens](#), illustrates how to activate the Scaling (G72) Help Graphic Screen.

To access the Scaling (G72) Help Graphic Screen:

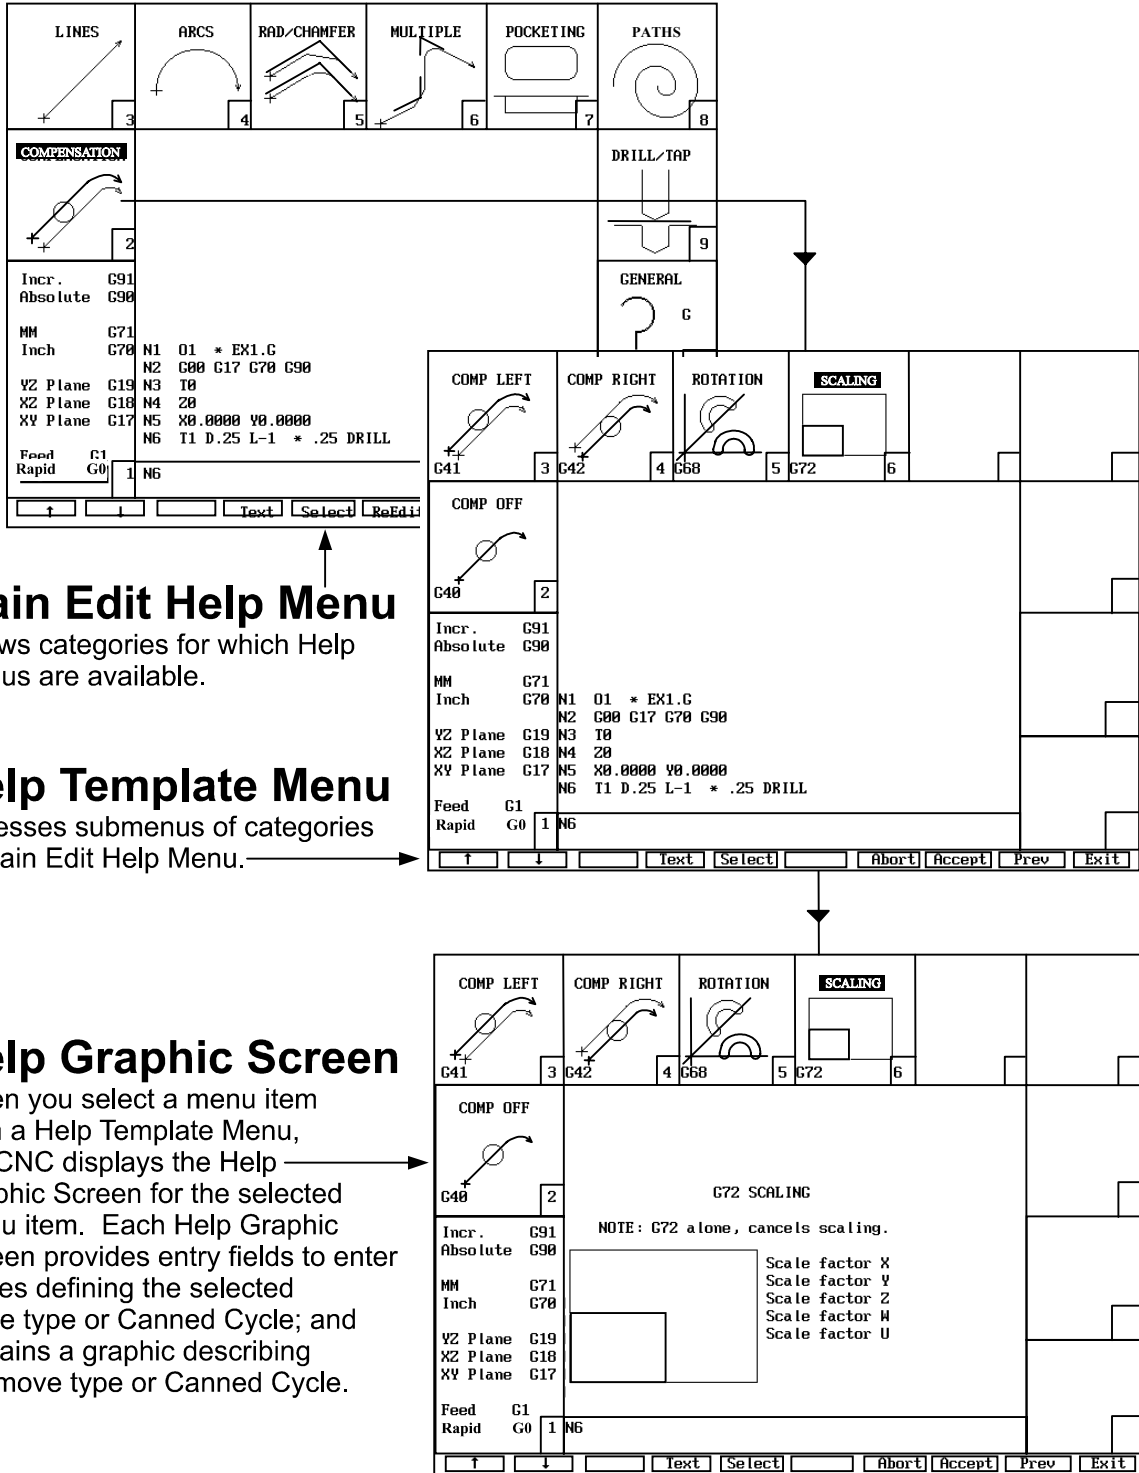
1. In Edit Mode, open the appropriate program. Press **Help (F1)**. The Edit Help Menu activates.
2. In the Edit Help Menu, press **2 (Compensation)**. Press **ENTER**. The Compensation Help Template Menu activates.
3. Press **6 (Scaling)**. Press **ENTER**. The Scaling Help Graphic Screen activates.

**NOTE:** Most Help Template Menus contain some inactive menu items. Inactive menu items contain no graphics and no item numbers.

4. Type the appropriate scaling factor for the G72 (Scaling) Canned Cycle. Fill in **ALL** entry fields displaying **0.0000**. All other entries are optional. In the Scaling Help Graphic Screen, all fields are optional.
5. Press **ENTER**. The program block is displayed in the Input Box. Press **Accept (F8)** or **ENTER** to insert the block in the program.

– or –

1. In the Main Edit Help Menu or Help Template Menu, type the G-code that you want (for example, G72), and press **ENTER** to go directly to the Help Graphic screen. This is a short cut to the Help Graphic screen, you do not have go through the menus.
2. Go to Step 4 above.



### Main Edit Help Menu

Shows categories for which Help menus are available.

### Help Template Menu

Accesses submenus of categories in Main Edit Help Menu.

### Help Graphic Screen

When you select a menu item from a Help Template Menu, the CNC displays the Help Graphic Screen for the selected menu item. Each Help Graphic Screen provides entry fields to enter values defining the selected move type or Canned Cycle; and contains a graphic describing the move type or Canned Cycle.

EDITHELP

Figure 7-1, Overview of the Edit Help Screens


## Main Edit Help Menu

The [Main Edit Help Menu \(Figure 7-2\)](#) displays categories for which Help Menus are available. Refer to **Table 7-1** for a description of Main Edit Help Menu features.

**Table 7-1, Main Edit Help Menu Features**

Feature	Description
<b>Menu Item Number</b>	Use this number to select a menu item.
<b>Help Templates</b>	Access help template menus for selected move type or canned cycle. (Help template menus access help graphic screens in which you program move types and canned cycles.)
<b>Program Listing</b>	The program open for editing.
<b>G-Code Listing</b>	Lists and describes commonly used G-codes. Not a complete listing. Refer to " <a href="#">G-Code Listing</a> ."
<b>M-Code Listing</b>	Lists and describes commonly used M-Codes (Miscellaneous Functions). Not a complete listing. Refer to " <a href="#">M-Code Listing</a> ."
<b>Input Box</b>	Displays commands selected in the Edit Help Menu. The CNC inserts the selected commands at the block displayed in the Input Box.  <b>NOTE:</b> Before you activate the Edit Help Menu, place the cursor on the program block you wish to edit. The CNC will activate the Edit Help Menu with the cursor located on that block.
<b>Soft Keys</b>	Labeled function keys below the screen. Press the labeled soft key (F-key) to activate.
<b>Modal G-Codes</b>	Modal G-codes do not program actual moves. Use these commands to change the feedrate, Inch/MM Mode, Absolute/Incremental Mode or Feed Per Revolution/Feed Per Minute Mode. Refer to " <a href="#">Modal G-Code Box</a> ."


Menu items 2,3,4,5 and 6 are referred to as move types. Menu items 7,8 and 9 are canned cycles.

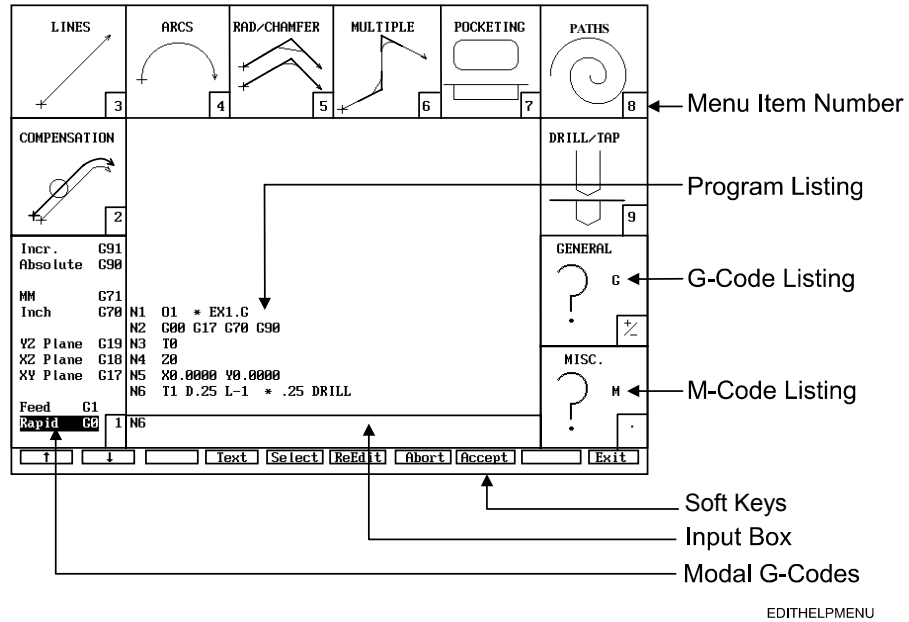

**Figure 7-2, Main Edit Help Menu**










### Help Template Menu

Help Template Menus (see **Figure 7-3**) access submenus of move types or G-codes. Refer to [Table 7-2, Help Template Menus](#) for available Template Menus.

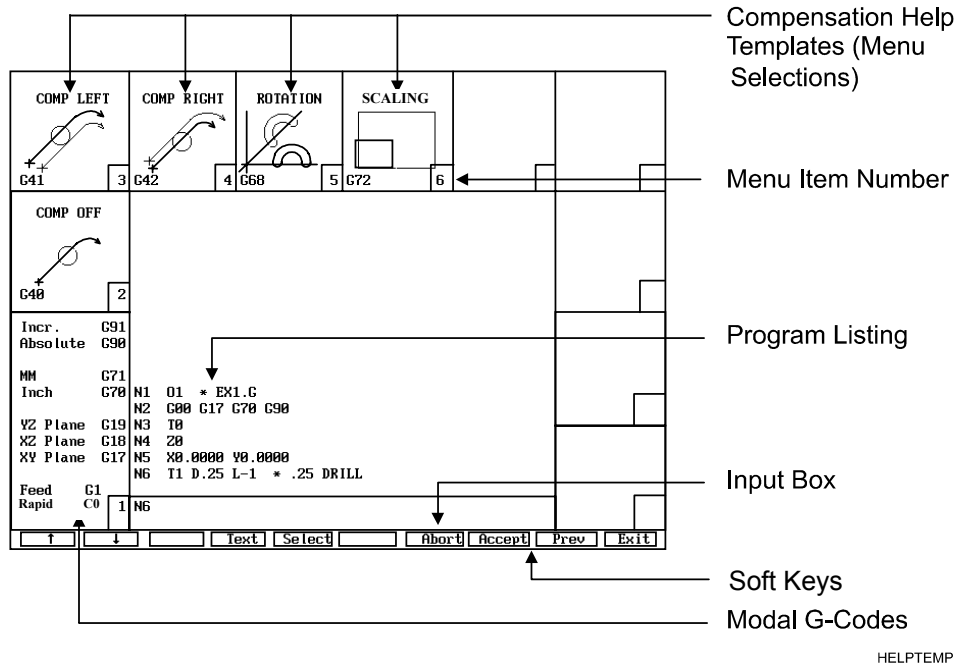

**Figure 7-3, Sample Help Template Menu**

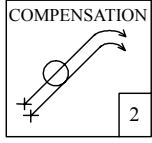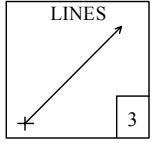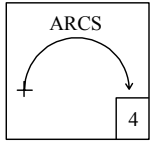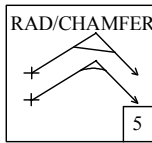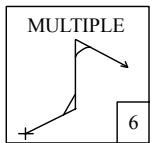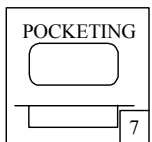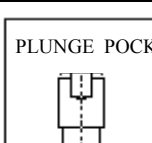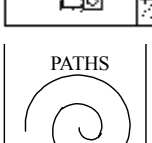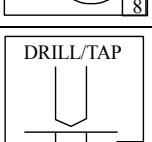**Table 7-2, Help Template Menus**

Template	Description	Reference Table
	<p>Compensated Moves</p> <ul style="list-style-type: none"> <li><input type="checkbox"/> Rotation</li> <li><input type="checkbox"/> Scaling</li> </ul>	<p><a href="#">Table 7-4, Compensation Help Graphic Templates</a></p>
	<p>Line Moves</p>	<p><a href="#">Table 7-5, LINE Move Types</a></p>
	<p>Arcs</p>	<p><a href="#">Table 7-7, ARCS Help Template Menu</a></p>
	<p>Radius or Chamfer Moves</p>	<p><a href="#">Table 7-8, RAD/CHAMFER Help Template Menu</a></p>
	<p>Moves Containing Multiple Radius and/or Chamfer Moves</p>	<p><a href="#">Table 7-9, MULTIPLE Help Template Menu</a></p>
	<p>Pocketing Cycles</p>	<p><a href="#">Table 7-10, POCKETING Help Template Menu</a></p>
	<p>Plunge Pocketing Cycles</p>	<p><a href="#">Table 7-11, PLUNGE POCKETING Help Template Menu</a></p>
	<p>Spirals, Ellipses, Facing, Circular Profile, Rectangle Profile</p>	<p><a href="#">Table 7-12, PATHS Help Template Menu</a></p>
	<p>Drill and Tapping Cycles</p>	<p><a href="#">Table 7-13, DRILL/TAP Help Template Menu</a></p>

### Help Graphic Screens

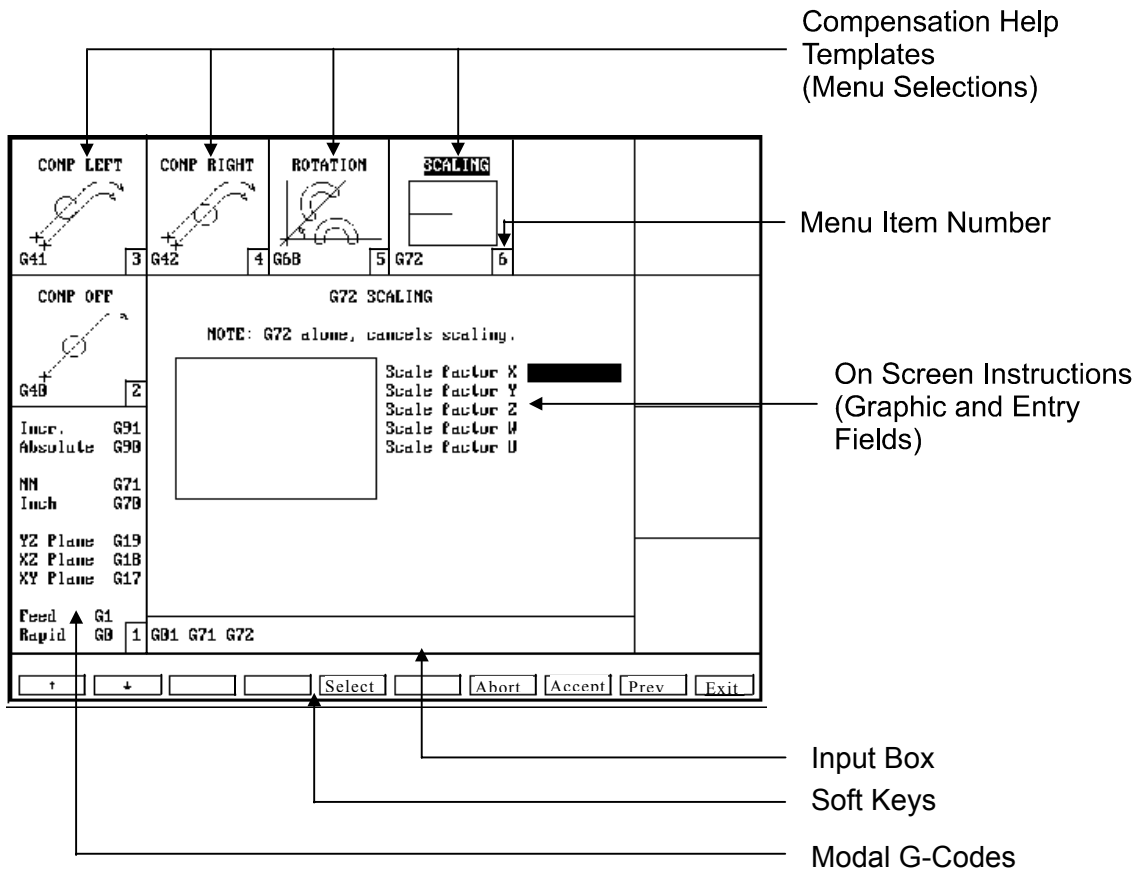


Figure 7-4, Sample Help Graphic Screen

## Edit Help Soft Keys

The Edit Help Menu contains the following soft keys. Refer to **Table 7-3**.

**Table 7-3, Edit Help Menu Soft Keys**

Soft Key Label and (Name)	Soft Key Number	Description
↑ (UP)	F1	Moves highlight to the next Help Template.
↓ (DOWN)	F2	Moves highlight to the previous Help Template.
Text	F4	Switches the text shown in the center of the Edit Help Menu between two choices. The CNC displays either: <ul style="list-style-type: none"> <li>□ the active program and input box</li> <li>– or –</li> <li>□ instructions for using the Edit Help Menu, when available.</li> </ul>
Select	F5	Selects the highlighted menu item.
ReEdit	F6	To edit an entered command (G-code or canned cycle), place the cursor on the appropriate block and press <b>ReEdit (F6)</b> . Once all the fields have been edited, press <b>Accept (F8)</b> .
Abort	F7	Deactivates the Edit Help Menu and returns you to the Program Listing.  <b>NOTE:</b> Press <b>Exit (F10)</b> to close the Edit Help Menu and save accepted edits.
Accept	F8	Inserts the block displayed in the Input Box into the program.
Exit	F10	Returns you to the Program Listing and saves accepted edits.

---

## Edit Help Menu

Refer to [Figure 7-3, Sample Help Template Menu](#). Help Template Menus access submenus of move types or G-codes. Refer to [Table 7-2, Help Template Menus](#) for available Template Menus. Each Help Template Menu contains the following features:

<b>Help Templates</b>	Labeled graphic of canned cycle or other command. Press the required menu item to activate the corresponding help graphic screen. (Help graphic screens contain instructions for inputting commands into the program.) For available help template menus, refer to <a href="#">Table 7-2, Help Template Menus</a> .
<b>Menu Item Number</b>	Press the required menu item to activate the corresponding help graphic screen. <b>NOTE:</b> To select a menu item: Press the menu item number, then press <b>ENTER</b> .
<b>Program Listing</b>	Listing of program being edited. <b>NOTE:</b> Press <b>TEXT (F4)</b> to replace the Program Listing with on-screen instructions for the active Help Template Menu. On-screen instructions may contain a description of each menu item or general instructions for Edit Help.
<b>Input Box</b>	Displays the block where the CNC will add programmed canned cycles or other commands to the program. <b>NOTE:</b> Before you press <b>Help (F1)</b> to activate the Edit Help Menu, place the cursor on the block you want displayed in the Input Box.
<b>Soft Keys</b>	Labeled function keys below the screen. Press the labeled soft key (F-key) to activate. The Help Template Menus contain the same soft keys as the Edit Help Menu, with the following exceptions: <b>ReEdit (F6)</b> is inactive in the Help Template Menu. <b>Prev (F9)</b> is active. Press <b>Prev (F9)</b> to return to the previous screen.
<b>Modal G-Codes</b>	Modal G-Codes do not program moves. These commands switch the Rapid/Feed Mode, Plane, Inch/MM Mode, and Absolute/Incremental Mode. Refer to " <a href="#">Modal G-Code Box</a> ."



Refer to [Figure 7-4, Sample Help Graphic Screen](#). Use the Help Graphic screens to enter parameters for canned cycles or other commands. When you close the help graphic screen, the CNC inserts the block into the program.

Help graphics screens are available for templates listed in [Table 7-4, Compensation Help Graphic Templates](#).

Help graphic screen features include:

<b>Menu Item Number</b>	Menu items 2 through 9 are inactive. To make a new selection, insert or cancel the block for the active Help Graphic screen.
<b>Help Templates</b>	The help templates displayed on the screen remain inactive.  Press <b>Abort (F7)</b> to cancel the block and exit Edit Help. Press <b>Accept (F8)</b> to accept the block and return to the Main Edit Help screen. Press <b>Prev (F9)</b> to cancel the block and return to the Help Template Menu. Press <b>Exit (F10)</b> to insert the block into the program and return to the Program Listing.
<b>On-Screen Instructions</b>	On-screen instructions include a description of the selected menu item (move, G-code or Canned Cycle) being programmed, the entry fields and graphic pertaining to the selected menu item.
<b>Input Box</b>	Displays the block where the CNC will add programmed canned cycles or other commands to the program.  <b>NOTE:</b> Before you press <b>Help (F1)</b> to activate the Edit Help Menu, place the cursor on the block you want displayed in the Input Box.
<b>Soft Keys</b>	Labeled soft keys describe the functions of the F-keys located on the console. The help graphic screens contain the same soft keys as the Edit Help Menu, with the following exceptions: <b>ReEdit (F6)</b> is inactive in the Help Template Menu. <b>Prev (F9)</b> is active. Press <b>Prev (F9)</b> to return to the previous screen.
<b>Modal G-Codes</b>	Modal G-codes switch the Rapid/Feed Mode, Plane, Inch/MM Mode, and Absolute/Incremental Mode. Refer to " <a href="#">Modal G-Codes Box</a> ."

## Using Help Graphic Screens to Enter Program Blocks

The Program Editor displays help graphic screens, in which you write and edit program blocks.

When the CNC activates a help graphic screen, its first entry field is highlighted. A highlight indicates that you can enter values in an entry field or make the appropriate selection. Press **ENTER** to move the highlight to the next entry field. In the last entry field of the help graphic screen, press **Accept (F8)** or **ENTER** to add the block to the Program Listing. Press the **ARROWS** to move the highlight between entry fields without entering values. Press **CLEAR** to clear an entry field.

There are two types of entry fields:

- Required entry fields    Contain **0.000**. You must type a value for operation of canned cycle or other command.
- Optional entry fields    Blank. Entry optional.

If a required entry field is left blank, the CNC writes the block using the 0.0000 default. This may generate an error message when the program runs.

Optional entry fields do not require a value. When left blank, a default value or position is usually assumed.







You must remember to type decimal points and negative signs where needed. The CNC assumes a positive value if no negative sign is typed.

Press the **(+/-)** key to insert a negative sign.

Compensation Moves, Rotation and Scaling

Press the **Clear** key to clear an entry.

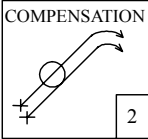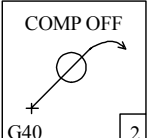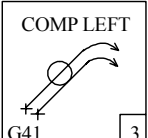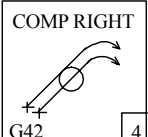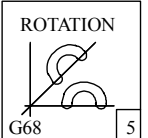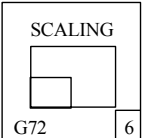
**Table 7-4, Compensation Help Graphic Templates**

 <b>COMPENSATION</b>	
Templates and Parameters	Description
 <p>Select the COMP OFF template and press <b>ENTER</b>. Inserts the G40 command into the Input Box.</p>	<p>Tool Radius Compensation canceled. Refer to <a href="#">“Section 9 - Tool Page and Tool Management”</a> for more information on tool compensation.</p>
 <p>Select the COMP LEFT template and press <b>ENTER</b>. Inserts the G41 command into the Input Box.</p>	<p>Tool Radius Compensation, left-of-path, activated. Refer to <a href="#">“Section 9”</a> for more information on tool compensation.</p>
 <p>Select the COMP RIGHT template and press <b>ENTER</b>. Inserts the G42 command into the Input Box.</p>	<p>Tool Radius Compensation, right-of-path, activated. Refer to <a href="#">“Section 9”</a> for more information on tool compensation.</p>
	<p>Refer to <a href="#">“Section 4 - Preparatory Functions: G-codes.”</a> <a href="#">“Axis Rotation (G68)”</a> for parameters and description.</p>
	<p>Refer to <a href="#">“Section 4”</a> for parameters and description.</p>

## Line Moves

Line moves can be vectored moves (motion in two axes, X and Y) or straight line moves (motion in one axis, X or Y). To program Line moves, type values for angles, endpoints and/or radii that define the move.

**Figure 7-5** shows the Line Help Template Menu, which contains the available line moves.

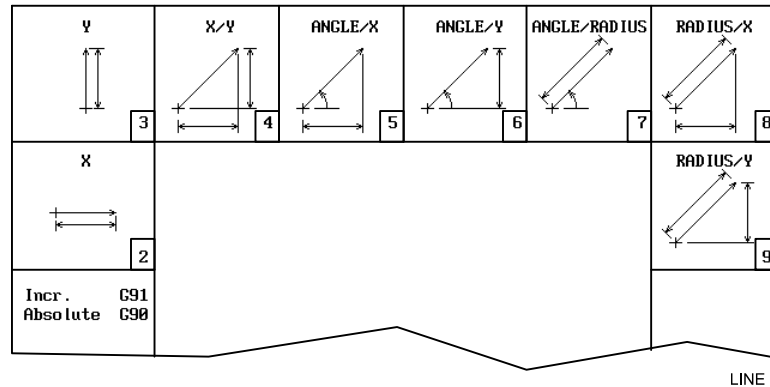


**Figure 7-5, LINE Help Template Menu**

To activate the Line Help Template Menu and program a line move:

1. In Edit Mode, open the appropriate program. Press **Help (F1)**. The Edit Help Menu activates. Refer to [Figure 7-2, Main Edit Help Menu](#).
2. From the Edit Help Menu, type **3** and press **ENTER**. The Line Help Template activates.
3. Select the appropriate menu item #2 to 9. Press **ENTER**. The appropriate Line Help Graphic screen activates.
4. Type the required values or settings in the entry fields on the screen. Press **Accept (F8)** or **ENTER** to insert the program block into the program.

### Endpoint and Angle Calculation

Given the X, Y, or XY endpoints, the CNC can calculate the missing endpoint(s) for line or rapid moves. Define the move as part of a right triangle with the components identified as in **Figure 7-6**.

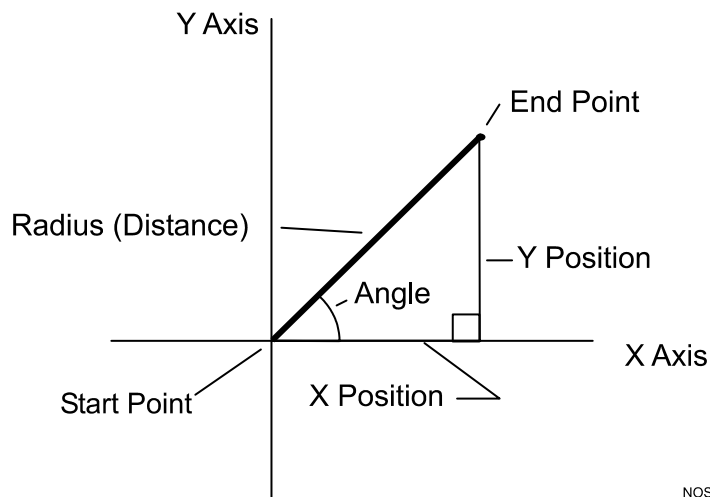

**Figure 7-6, Move Orientation**







Refer to **Table 7-5**. The CNC can calculate move endpoints, given:

- Angle and radius
- X position and angle
- Y position and angle
- X position and radius
- Y position and radius

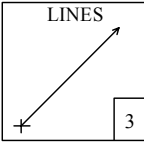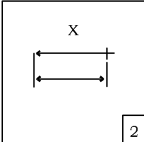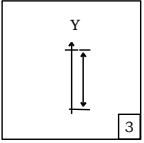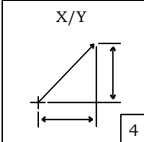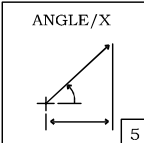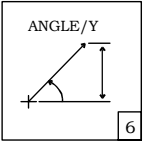**Table 7-5, LINE Move Types**

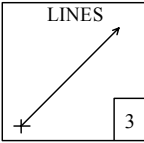
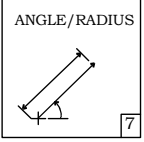
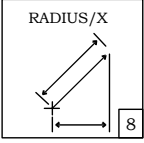
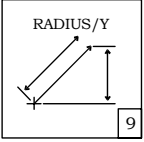
LINE Moves	Defined By
Straight Lines	<input type="checkbox"/> An X or Y endpoint (menu item 2 or 3, respectively)
Vectors	<input type="checkbox"/> An XY endpoint (menu item 4) <input type="checkbox"/> An angle measured from the Y axis and X or Y endpoint (menu item 5 or 6, respectively) <input type="checkbox"/> An angle measured from the Y axis and the arc radius (menu item 7) <input type="checkbox"/> The arc radius and an X or Y endpoint (menu item 9 or 8, respectively).

**Table 7-6, LINES Help Template Menu**

 <p><b>LINES</b></p>	
<p><b>Templates and Parameters</b></p>	<p><b>Move Description</b></p>
 <p><b>X:</b> X endpoint. Req.</p>	<p>Tool moves in a straight line along the X-axis.</p>
 <p><b>Y:</b> Y endpoint. Req.</p>	<p>Tool moves in a straight line along the Y-axis.</p>
 <p>All entries are required.  <b>X:</b> X endpoint.  <b>Y:</b> Y endpoint.</p>	<p>Tool moves along a vectored path from the current location to the X, Y endpoint.</p>
 <p>All entries are required.  <b>C:</b> Angle from X-axis (3 o'clock = 0).  <b>X:</b> X endpoint.</p>	<p>Tool moves along a vectored path from the current location to the X endpoint.</p>
 <p>All entries are required.  <b>C:</b> Angle measured from X-axis (3 o'clock = 0).  <b>Y:</b> Y endpoint.</p>	<p>Tool moves along a vectored path from the current location to the Y endpoint.</p>

(Continued...)


Table 7-6, LINES Help Template Menu (Continued)

 <b>LINES</b>	
Templates and Parameters	Move Description
 <p><b>C:</b> Angle measured from X-axis (3 o'clock = 0).  <b>R:</b> Radius.</p>	Tool moves along a vectored path from the current location to the endpoint.
 <p><b>R:</b> Radius.  <b>X:</b> X endpoint.</p>	Tool moves along a vectored path from the current location to the endpoint.
 <p><b>R:</b> Radius.  <b>Y:</b> Y endpoint.</p>	Tool moves along a vectored path from the current location to the endpoint.

## Arcs

Refer to [“Programming Concepts” in “Section 1 - Introduction”](#) for information on planes and arc directions. The CNC executes arcs in the XY (G17) plane by default. For an arc in the XZ (G18) or YZ (G19) plane, program the plane change before the arc move. After you make all the required moves in the XZ or YZ plane, return the CNC to the XY plane.

Refer to [Figure 7-7, Endpoint Radius Arc Types](#). There are two arcs that can intersect any two points: an arc with an included angle less than 180 degrees and an arc with an included angle greater than 180 degrees.

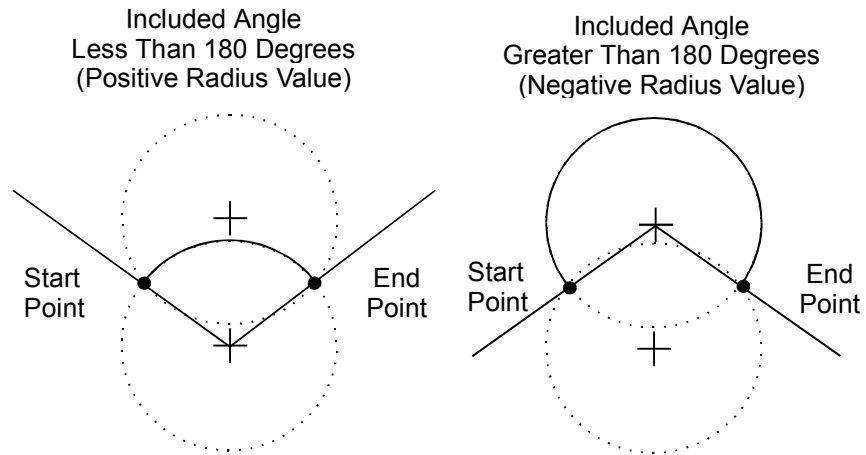


**Figure 7-7, Endpoint Radius Arc Types**

To program an arc with an included angle of less than 180 degrees, type a positive radius value. To program an Arc with an included angle of greater than 180 degrees, type a negative radius value. The CNC chooses which arc center to use, based on the sign of the entered value.


Refer to **Figure 7-8** and [Figure 7-9, Incremental Mode, Center-Angle Arc](#). Specify the appropriate Absolute or Incremental Mode for the angle and center point. The direction (Cw/Ccw) of the Arc and the sign (+/-) of the angle control the path of the tool.

If the Z-axis starting and end positions differ, the arc will be a helix.

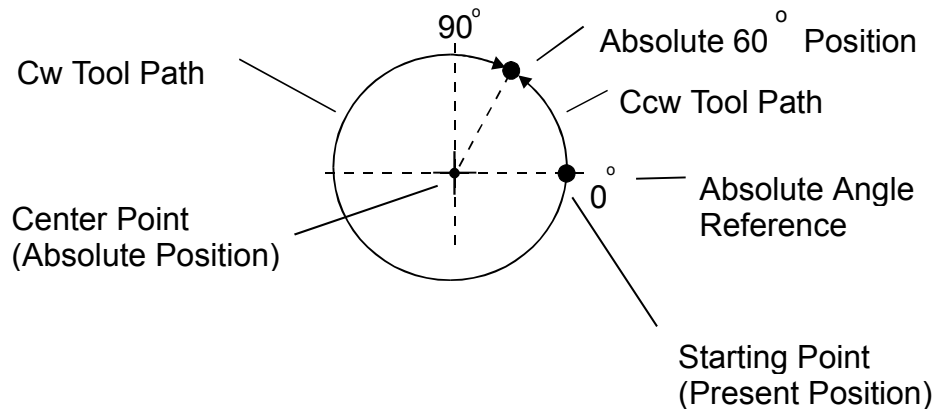

**Figure 7-8, Absolute Mode, Center-Angle Arc**






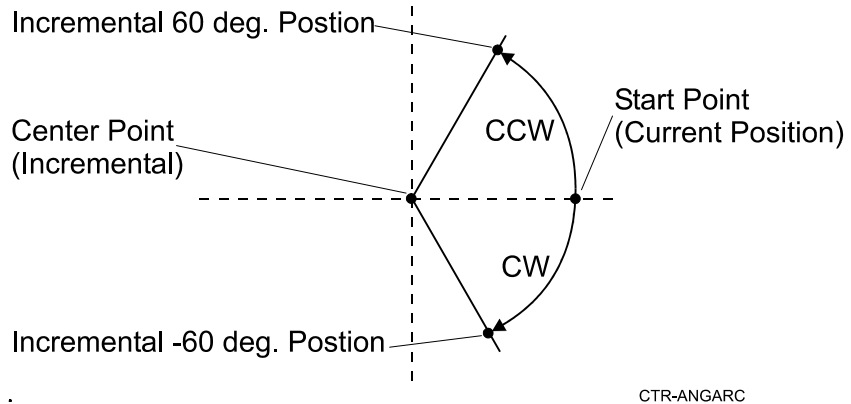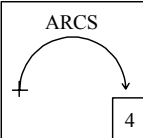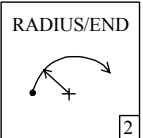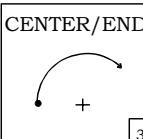

CTR-ANGARC

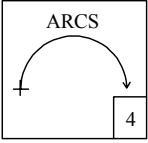
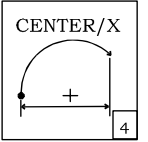
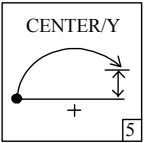
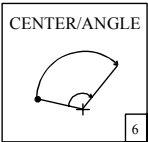
**Figure 7-9, Incremental Mode, Center-Angle Arc**

**Table 7-7, ARCS Help Template Menu**

 <p><b>ARCS</b></p>	
<p><b>Template and Parameters</b></p>	<p><b>Move Description</b></p>
 <p>All entries are required.  <b>X:</b> X endpoint.  <b>Y:</b> Y endpoint.  <b>R:</b> radius of arc.</p>	<p>Tool moves from the current location along the arc to the programmed XY endpoint.</p>
 <p>All entries are required.  <b>X:</b> X endpoint.  <b>Y:</b> Y endpoint.  <b>Z:</b> End depth.  <b>I:</b> X Horizontal circle center.  <b>J:</b> Y Vertical circle center.  <b>L:</b> Number of loops.</p>	<p>Tool moves from the current location along the arc to the programmed XY endpoint. Type the circle center coordinates (I,J). Use Z and L (optional) to produce helical interpolation.</p>

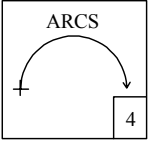
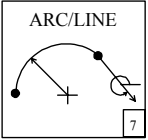
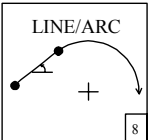
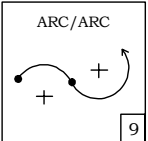
*(Continued...)*

**Table 7-7, ARCS Help Template Menu (Continued)**






 <p><b>ARCS</b></p>	
<p><b>Template and Parameters</b></p>	<p><b>Move Description</b></p>
 <p>All entries are required.  <b>I:</b> X Incremental arc center.  <b>J:</b> Y Incremental arc center.  <b>X:</b> X endpoint.</p>	<p>Tool moves from the current location along the arc to the programmed X endpoint. Type the circle center coordinates (I,J).</p>
 <p>All entries are required.  <b>I:</b> X Incremental arc center.  <b>J:</b> Y Incremental arc center.  <b>Y:</b> Y endpoint.</p>	<p>Tool moves from the current location along the arc to the programmed Y endpoint. Type the circle center coordinates (I,J).</p>
 <p>All entries are required.  <b>I:</b> X arc center.  <b>J:</b> Y arc center.  <b>C:</b> Angle measured from X-axis (3 o'clock = 0).</p>	<p>Tool moves from the current location along the arc to the calculated endpoint. Type the circle center coordinates (I,J) and an angle measured from the 3 o'clock position. The CNC calculates the endpoint.</p>

*(Continued...)*

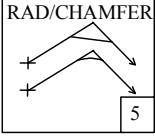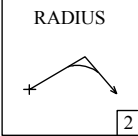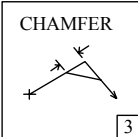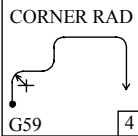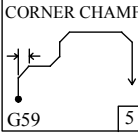**Table 7-7, ARCS Help Template Menu (Continued)**

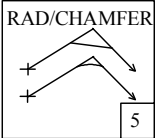
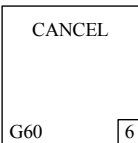
 <p><b>ARCS</b></p>	
<p><b>Template and Parameters</b></p>	<p><b>Move Description</b></p>
 <p>All entries are required.  <b>Q:</b> Radius.  <b>C:</b> Angle measured from X-axis (3 o'clock = 0).  <b>X:</b> X endpoint.  <b>Y:</b> Y endpoint.</p>	<p>The CNC performs an arc move to the tangent point of the line intersection and then moves at the specified angle (C) to the XY endpoint.</p>
 <p>All entries are required.  <b>C:</b> Angle measured from X-axis (3 o'clock = 0).  <b>Q:</b> Radius.  <b>X:</b> X endpoint.  <b>Y:</b> Y endpoint.</p>	<p>The CNC performs a LINE move to the tangent point of the ARC intersection and then moves at the specified radius to the XY endpoint.</p>
 <p>All entries are required.  <b>I:</b> 1st Horizon. X center of the first arc.  <b>J:</b> 1st Vert. Y center of the first arc.  <b>I:</b> 2nd Horizon. X center of the second arc.  <b>J:</b> 2nd Vert. Y center of the second arc.  <b>X:</b> End Horiz. X endpoint.  <b>Y:</b> End Vert. Y endpoint.</p>	<p>CNC performs an arc move into another arc move. The first arc ends and the second arc begins at the tangent point of the two arcs.</p>

**Table 7-8, RAD/CHAMFER Help Template Menu**

RAD/CHAMFER	
Templates and Parameters	Move Description
 <p><b>RAD/CHAMFER</b></p>	
 <p><b>RADIUS</b></p> <p>All entries are required.  <b>X:</b> Horizontal midpoint. (Intersection of lines).  <b>Y:</b> Vertical midpoint. (Intersection of lines).  <b>Q:</b> Radius of arc tangent to two lines.  <b>X:</b> Horizontal endpoint.  <b>Y:</b> Vertical endpoint.</p>	<p>The CNC performs a LINE move to the tangent ARC, moves around the arc and then moves along the second LINE to the XY endpoint.</p>
 <p><b>CHAMFER</b></p> <p>All entries are required.  <b>X:</b> Horizontal midpoint. (Intersection of lines).  <b>Y:</b> Vertical midpoint. (Intersection of lines).  <b>E:</b> Chamfer distance.  <b>X:</b> Endpoint in X.  <b>Y:</b> Endpoint in Y.</p>	<p>The CNC performs a LINE move to the intersecting CHAMFER, moves across the chamfer and then moves along the second LINE to the XY endpoint.</p>
 <p><b>CORNER RAD</b></p> <p>G59</p>	<p>The CNC performs an automatic corner rounding at all intersecting elements (lines, arcs) with the specified radius. Refer to <a href="#">“Modal Corner Rounding/Chamfering (G59, G60)”</a> in <a href="#">“Section 4 - Preparatory Functions: G-codes”</a> for parameters and description.</p>
 <p><b>CORNER CHAMF</b></p> <p>G59</p>	<p>The CNC performs an automatic corner chamfer at all intersecting elements (lines, arcs). Refer to <a href="#">“Modal Corner Rounding/Chamfering (G59, G60)”</a> in <a href="#">“Section 4”</a> for parameters and description.</p>

(Continued...)

**Table 7-8, RAD/CHAMFER Help Template Menu (Continued)**


	
RAD/CHAMFER	
Templates and Parameters	Move Description
 <p>Inserts a G60 command.</p>	<p>Cancels G59 Corner Rounding or Corner Radius. Refer to <a href="#">“Modal Corner Rounding/Chamfering (G59, G60)”</a> in <a href="#">“Section 4 - Preparatory Functions: G-Codes”</a> for parameters and description.</p>

**Multiple Move Commands**

**Figure 7-10** shows the Multiple Help Template Menu, accessed through the Edit Help Menu.

Multiple moves enable you to program more than one move on a single program block. The allowed combinations include line, arc and chamfer moves, in various combinations, as follows:

- Two consecutive line moves (menu item 2)
- Line to arc to line moves (menu item 3)
- Line to chamfer to line moves (menu item 4)
- Line-arc to line-arc-line moves (menu item 5) line-chamfer to line-chamfer-line moves (menu item 6)
- Line-arc to line-chamfer-line moves (menu item 7)
- Line-chamfer to line-arc-line moves (menu item 8)

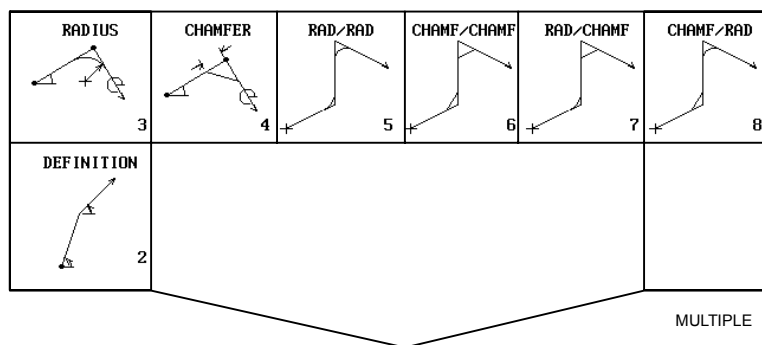


**Figure 7-10, Multiple Help Template Menu**

Menu item numbers reference the Multiple Help Template used to program the Multiple move described. Refer to [Table 7-4, Compensation Help Graphic Templates](#) for definitions and input instructions regarding these moves.

To use the Edit Help Menu to program a Multiple move:

1. Refer to [Figure 7-2, Main Edit Help Menu](#). In Edit Mode, open the appropriate program. Press **Help (F1)**. The Edit Help Menu activates.

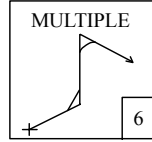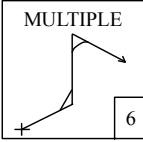
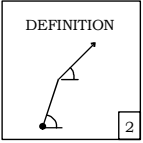
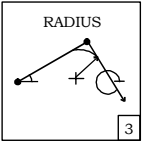
2. From the Edit Help Menu, type **6** and press **ENTER**. The Multiple



Help Template activates.

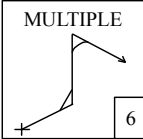
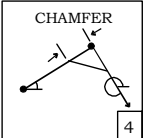
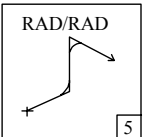
3. From the Multiple Help Template, type the menu item (#2 to 8) of the Multiple move to be added to the Program Listing. Press **ENTER**. The appropriate Graphic screen activates.
4. Fill in the entry fields on the screen. Press **Accept (F8)** or **ENTER** to insert the block into the program.

**Table 7-9, MULTIPLE Help Template Menu**

 <b>MULTIPLE</b>	
Templates and Parameters	Move Description
 <p><b>C:</b> First angle measured from X-axis (3 o'clock = 0).  <b>C:</b> Second angle measured from X-axis (3 o'clock = 0).  <b>X:</b> Horizontal endpoint.  <b>Y:</b> Vertical endpoint.</p>	<p>The CNC performs a line move along the first angle to the intersection of the second angle and then continues along the second angle to the specified XY endpoint.</p>
 <p><b>C:</b> First angle measured from X-axis (3 o'clock = 0).  <b>Q:</b> Radius of tangent arc.  <b>C:</b> Second angle measured from X-axis (3 o'clock = 0).  <b>X:</b> Horizontal endpoint.  <b>Y:</b> Vertical endpoint.</p>	<p>The CNC performs a line move along the first angle to the tangent arc, moves around the arc and then moves along the second angle to the specified XY endpoint.</p>

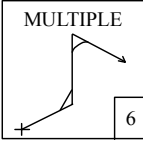
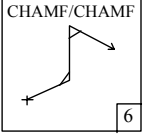
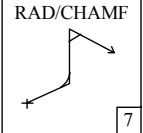
*(Continued...)*

**Table 7-9, MULTIPLE Help Template Menu (Continued)**

 <b>MULTIPLE</b>	
Templates and Parameters	Move Description
 <p><b>C:</b> First angle measured from X-axis (3 o'clock = 0).  <b>E:</b> Length of intersecting chamfer.  <b>C:</b> Second angle measured from X-axis (3 o'clock = 0).  <b>X:</b> Horizontal endpoint.  <b>Y:</b> Vertical endpoint.</p>	<p>The CNC performs a line move along the first angle to the intersecting chamfer, moves across the chamfer, and then moves along the second angle to the specified XY endpoint.</p>
 <p><b>C:</b> First angle measured from X-axis (3 o'clock = 0).  <b>Q:</b> First radius of arc tangent to 1st and 2nd Angles.  <b>C:</b> Second angle measured from X-axis (3 o'clock = 0).  <b>X:</b> Midpoint.  <b>Y:</b> Midpoint.  <b>Q:</b> Second radius of arc tangent to 2nd Angle and endpoints.  <b>X:</b> Endpoint.  <b>Y:</b> Endpoint.</p>	<p>The CNC performs a line move along the 1st angle to the tangent arc. After completing the arc, the CNC moves along the 2nd angle to the tangent of the 2nd arc. After completing the 2nd arc the CNC moves to the specified endpoint.</p>

*(Continued...)*

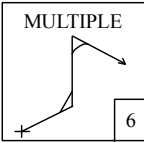
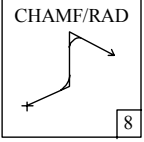
**Table 7-9, MULTIPLE Help Template Menu (Continued)**

 <b>MULTIPLE</b>	
Templates and Parameters	Move Description
 <p><b>C:</b> First angle measured from X-axis (3 o'clock = 0).  <b>E:</b> Chamfer length intersecting chamfer 1<sup>st</sup> and 2<sup>nd</sup> angles.  <b>C:</b> Second angle measured from X-axis (3 o'clock = 0).  <b>X:</b> Midpoint.  <b>Y:</b> Midpoint.  <b>E:</b> Chamfer length intersecting 2<sup>nd</sup> angle and endpoints.  <b>X:</b> Endpoint.  <b>Y:</b> Endpoint.</p>	<p>The CNC performs a line move along the 1st angle to the intersecting chamfer. After completing the chamfer, the CNC moves along the 2nd angle to the intersection of the 2nd chamfer. After completing the 2nd chamfer the CNC moves to the specified endpoint.</p>
 <p><b>C:</b> First angle measured from X-axis (3 o'clock = 0).  <b>Q:</b> Radius of arc tangent to 1<sup>st</sup> and 2<sup>nd</sup> angles.  <b>C:</b> Second angle measured from X-axis (3 o'clock = 0).  <b>X:</b> Midpoint.  <b>Y:</b> Midpoint.  <b>E:</b> Length of intersecting chamfer between 2<sup>nd</sup> angle and endpoints.  <b>X:</b> Endpoint.  <b>Y:</b> Endpoint.</p>	<p>The CNC performs a line move along the 1st angle to the tangent arc. After completing the arc, the CNC moves along the 2nd angle to the intersection of the chamfer. After completing the chamfer the CNC moves to the specified endpoints.</p>

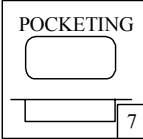
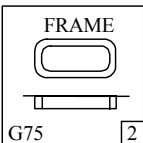
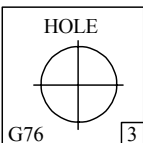
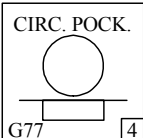
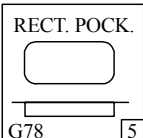
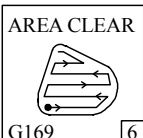
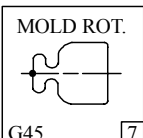
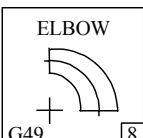
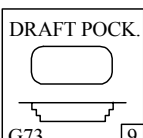
*(Continued...)*






**Table 7-9, MULTIPLE Help Template Menu (Continued)**

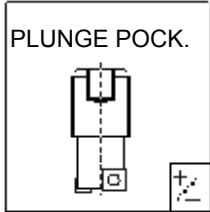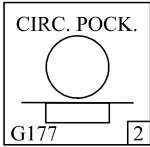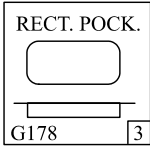	
Templates and Parameters	Move Description
<div style="display: flex; align-items: flex-start;"> <div style="margin-right: 10px;">  </div> <div> <p><b>C:</b> First angle measured from X-axis (3 o'clock = 0).</p> <p><b>E:</b> Length of intersecting chamfer between 1<sup>st</sup> and 2<sup>nd</sup> angles.</p> <p><b>C:</b> Second angle measured from X-axis (3 o'clock = 0).</p> <p><b>X:</b> Midpoint.</p> <p><b>Y:</b> Midpoint.</p> <p><b>Q:</b> Second radius of arc tangent to 2<sup>nd</sup> angle and endpoints.</p> <p><b>X:</b> Endpoint.</p> <p><b>Y:</b> Endpoint.</p> </div> </div>	<p>The CNC performs a line move along the 1st angle to the intersecting chamfer. After completing the chamfer, the CNC moves along the 2nd angle to the tangent arc. After completing the arc the CNC moves to the specified endpoint.</p>

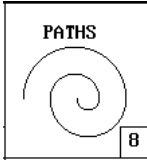
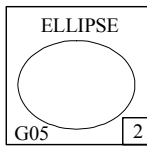
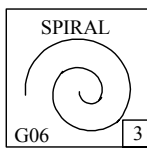

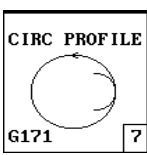
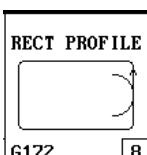
**Table 7-10, POCKETING Help Template Menu**

POCKETING	
Templates and Parameters	Move Description
 <p><b>Pocketing</b></p>	
	Canned cycle to machine a frame pocket. Refer to <a href="#">“Frame Pocket Milling (G75)”</a> in <a href="#">“Section 5 - Ellipses, Spirals, Canned Cycles, and Subprograms”</a> for parameters and description.
	Canned cycle to machine a hole. Refer to <a href="#">“Hole Milling (G76)”</a> in <a href="#">“Section 5”</a> for parameters and description.
	Canned cycle to machine a circular pocket. Refer to <a href="#">“Circular Pocket Milling (G77)”</a> in <a href="#">“Section 5”</a> for parameters and description.
	Canned cycle to machine a rectangular. Refer to <a href="#">“Rectangular Pocket Milling (G78)”</a> in <a href="#">“Section 5”</a> for parameters and description.
	Canned cycle to machine an irregular pocket. Refer to <a href="#">“Area Clearance (Irregular) Pocket Milling (G169)”</a> in <a href="#">“Section 5”</a> for parameters and description.
	Canned cycle to machine a convex or concave mold rotation. Refer to <a href="#">“Mold Rotation (G45)”</a> in <a href="#">“Section 5”</a> for parameters and description.
	Canned cycle to machine an elbow cavity or core. Refer to <a href="#">“Elbow Milling Cycle (G49)”</a> in <a href="#">“Section 5”</a> for parameters and description.
	Canned cycle to machine a draft angle pocket. Refer to <a href="#">“Draft Angle Pocket Cycle (G73)”</a> in <a href="#">“Section 5”</a> for parameters and description.









**Table 7-11, PLUNGE POCKETING Help Template Menu**

 <p><b>Plunge Pocketing</b></p>	
Templates and Parameters	Move Description
	<p>Select <b>PLUNGE POCK.</b> (+/-) from the Pocket Help Template Menu. Select <b>CIRC. POCK.</b> (2). Use for carbide tooling to plunge in Z (single axis) to the programmed depth. Refer to <a href="#">“Plunge Circular Pocket Milling (G177)”</a> in <a href="#">“Section 5 - Ellipses, Spirals, Canned Cycles, and Subprograms”</a> for parameters and description.</p>
	<p>Select <b>PLUNGE POCK.</b> (+/-) from the Pocket Help Template Menu. Select <b>RECT. POCK.</b> (3). Use for carbide tooling to plunge in Z (single axis) to the programmed depth. Refer to <a href="#">“Plunge Rectangular Pocket Milling (G178)”</a> in <a href="#">“Section 5”</a> for parameters and description.</p>

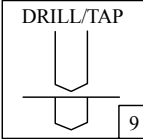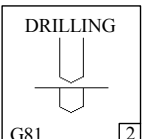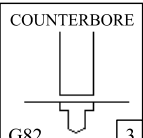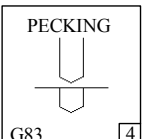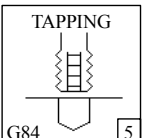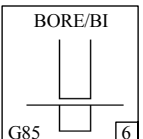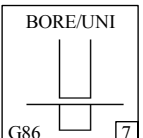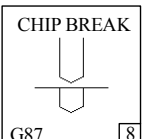**Table 7-12, PATHS Help Template Menu**

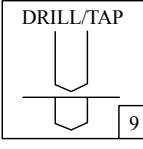
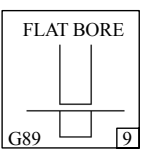
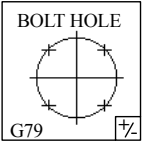
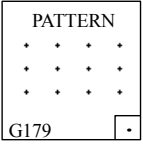
Templates and Parameters	Move Description
	
	<p>Sets CNC to Elliptical Interpolation Mode, executed at the current feedrate. Refer to <a href="#">“Ellipses (G5)”</a> in <a href="#">“Section 5 - Ellipses, Spirals, Canned Cycles, and Subprograms”</a> for parameters and description.</p>
	<p>Sets CNC to Spiral Interpolation Mode. Refer to <a href="#">“Spiral (G6)”</a> in <a href="#">“Section 5”</a> for parameters and description.</p>
	<p>Sets CNC to Facing Interpolation Mode. Refer to <a href="#">“Facing Cycle (G170)”</a> in <a href="#">“Section 5”</a> for parameters and description.</p>
	<p>Sets CNC to Circular Profile Interpolation Mode. Refer to <a href="#">“Circular Profile Cycle (G171)”</a> in <a href="#">“Section 5”</a> for parameters and description.</p>
	<p>Sets CNC to Rectangular Profile Interpolation Mode. Refer to <a href="#">“Rectangular Profile Cycle (G172)”</a> in <a href="#">“Section 5”</a> for parameters and description.</p>

**Table 7-13, DRILL/TAP Help Template Menu**

DRILL/TAP	
Templates and Parameters	Move Description
	
	Basic drill canned cycle. Refer to " <a href="#">Spot Drilling (G81)</a> " in " <a href="#">Section 5 - Ellipses, Spirals, Canned Cycles, and Subprograms</a> " for parameters and description.
	Counterboring canned cycle. Refer to " <a href="#">Counterboring (G82)</a> " in " <a href="#">Section 5</a> " for parameters and description.
	Peck drilling canned cycle. Refer to " <a href="#">Peck Drilling (G83)</a> " in " <a href="#">Section 5</a> " for parameters and description.
	Tapping canned cycle. Refer to " <a href="#">Tapping (G84)</a> " in " <a href="#">Section 5</a> " for parameters and description.
	Bi-directional boring cycle. Refer to " <a href="#">Boring, Bi-Directional (G85)</a> " in " <a href="#">Section 5</a> " for parameters and description.
	Unidirectional boring cycle. Refer to " <a href="#">Boring, Unidirectional (G86)</a> " in " <a href="#">Section 5</a> " for parameters and description.
	Chip break cycle. Refer to " <a href="#">Chip Breaker Peck Cycle (G87)</a> " in " <a href="#">Section 5</a> " for parameters and description.

*(Continued...)*


**Table 7-13, DRILL/TAP Help Template Menu (Continued)**

DRILL/TAP	
Templates and Parameters	Move Description
	
	Flat bore cycle. Refer to " <a href="#">Flat Bottom Bi-Directional Boring (G89)</a> " in " <a href="#">Section 5 - Ellipses, Spirals, Canned Cycles, and Subprograms</a> " for parameters and description.
	Bolt hole circle. Refer to " <a href="#">Bolt Hole Circle (G79)</a> " in " <a href="#">Section 5</a> " for parameters and description.
	Hole pattern drill cycle. Refer to " <a href="#">Hole Pattern (G179)</a> " in " <a href="#">Section 5</a> " for parameters and description.

### Modal G-Code Box

**NOTE:** Refer to "[G-Code Listing](#)" for more information on programming G-codes in Edit Help.

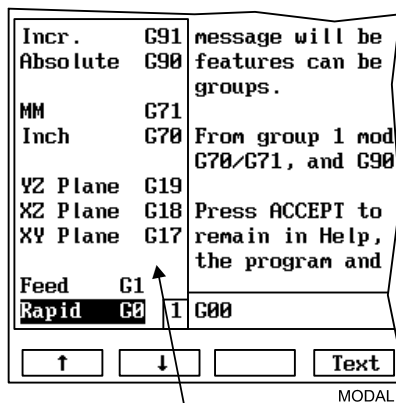**Figure 7-11** shows the portion of the Edit Help Menu that displays Modal G-Codes. Modal G-Codes define the way the CNC will interpret commands.



Modal G-Codes

**Figure 7-11, Modal G-Codes**

When the Edit Menu is activated, **Rapid G0** is active. Press the **ARROWS** to select Modal G-Codes. Press **ENTER** or **Select (F5)** to insert the G-code into the Program Listing.

### G-Code Listing

Refer to [Figure 7-2, Main Edit Help Menu](#). The Main Edit Help Menu contains a G-Code Listing. When a G-code is selected from the list, an input screen activates. It contains instructions and entry fields that pertain to the selected G-code. Use the screens to input G-codes. Refer to **Table 7-14**.


**Table 7-14, Most Common Modal G-Codes**

G-Code	Function
<b>Rapid G0</b>	Axis moves made at rapidrate.
<b>Feed G1</b>	Axis moves made at feedrate.
<b>CW Interpolation G2</b>	Sets clockwise circular interpolation.
<b>CCW Interpolation G3</b>	Sets counterclockwise circular interpolation.
<b>XY Plane G17</b>	Sets default plane.
<b>XZ Plane G18</b>	Sets default plane.
<b>YZ Plane G19</b>	Sets default plane.
<b>Inch G70</b>	Sets CNC to Inch measurements.
<b>MM G71</b>	Sets CNC to MM measurements.
<b>Absolute G90</b>	Sets CNC to Absolute Mode.
<b>Incremental G91</b>	Sets CNC to Incremental Mode.

### Entering a G-Code

To program a G-code from the G-Code Listing:

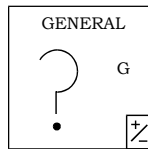1. In the Main Edit Help Menu, highlight the G-Code Help Template



. Press **ENTER**. The G-Code Listing activates.

2. Highlight a G-code selection. Press **ENTER**. The CNC displays input instructions and/or entry fields that pertains to the selected G-code.
3. Highlight a G-code selection. Press **ENTER**. The CNC inputs the selected G-code into the program.

– or –

The CNC prompts for any necessary values or setting selections.

4. Read any instructions provided on the screen. Fill in the entry fields.
5. Press **Accept (F8)** or **ENTER**. The CNC inputs the G-code into the active Program Listing.

**NOTE:** If you enter two G-codes that cannot be used on the same block, the CNC generates an error message.



Table 7-15 describes the G-codes in the menu.

**Table 7-15, Edit Help G-Code Menu**

G-Code	Label and Description
<b>G4</b>	<b>Dwell.</b> Programs a timed or infinite dwell.
<b>G9</b>	<b>Exact Stop (Single Block).</b> Non-modal exact stop check. Activates exact stop check for a single block.
<b>G22</b>	<b>Stroke Limit.</b> Activates/deactivates software limits.
<b>G28</b>	<b>Reference Point Return.</b> Return to Machine Home directly or through an intermediary point.
<b>G29</b>	<b>Return from Reference Point.</b> Return from Machine Home to the coordinates specified. (G29 Xn Zn)
<b>G53</b>	<b>Fixture Offset(s). (Coord. Syst. Select)</b> Shifts the location of Absolute Zero to a preset location. The preset location is the specified fixture offset, measured from Machine Home and stored in the Fixture Offsets Table.
<b>G61</b>	<b>Exact Stop Mode (Contouring Mode OFF).</b> Modal Exact Stop Check. Activates In-Position Mode.
<b>G64</b>	<b>Contouring Mode (Exact Stop Mode OFF).</b> Modal Contouring Mode. De-activates In-Position Mode.
<b>G65</b>	<b>Macro Call, Single (Non-Modal).</b> Used in a program to call a stored macro. Macros can be entered after the main program (subprogram) or in another file (must use file inclusion to call to active program). In non-modal macro (G67) call, the variables can be changed at each call.
<b>G66</b>	<b>Macro Call, Modal.</b> Used in a program to call a macro. Macros can be entered after the main program (subprogram) or in another file (must use file inclusion to call to active program). In Modal macro (G66) call, the variables will always contain the same values.
<b>G67</b>	<b>Cancel Modal Macro.</b> Cancels a G66 Modal Macro call.
<b>G92</b>	<b>Preset Zero.</b> Shifts the location of Absolute Zero to a preset location. The preset location, measured from Machine Home, is specified in the G92 command.

## Entry Fields

When a G-code is selected from the G-Code Listing, instructions and entry fields are listed on the screen. Type values for the required parameters.

## M-Code Listing

Refer to [Figure 7-2, Main Edit Help Menu](#). The Edit Help Menu contains an M-Code Listing. You can program M-codes by selecting them from the list. If the M-code requires a parameter, the software displays the Help Graphic for the entered M-code. Only M30, M98, and M100 require parameters. Fill in the entry fields for these M-codes. Press **Accept (F8)** to insert the selected code in the block or **Prev. (F9)** to cancel.

For other M-Codes, select the code and press **Accept (F8)** to insert the code in the block. Press **Prev. (F9)** to cancel.

**Table 7-16** describes the M-Codes in the menu.


**Table 7-16, Edit Help M-Code Listing**

M-Code	Function
<b>M0</b>	Program stop.
<b>M2</b>	End of program.
<b>M3</b>	Spindle ON FWD.
<b>M4</b>	Spindle ON REV.
<b>M5</b>	Spindle OFF.
<b>M8</b>	Coolant ON.
<b>M9</b>	Coolant OFF.
<b>M30</b>	Jump to new program.
<b>M98</b>	Call subprogram.
<b>M99</b>	End subprogram.
<b>M100</b>	Mirror image.
<b>M105</b>	Dry-run, all axes.
<b>M106</b>	Dry-run, NO Z axis.
<b>M107</b>	Dry-run off (cancels M105 or M106).

## Entering an M-Code

To program an M-Code from the M-Code Listing:

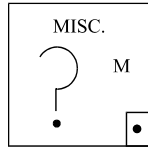1. In the Main Edit Help Menu, highlight the M-Code Help Template



Press **ENTER**. The M-Code Listing activates.

2. Highlight an M-code. Press **ENTER**. The CNC inputs the selected M-Code into the program.

– or –

The CNC prompts for any necessary values or setting selections.

3. Press **Accept (F8)** or **ENTER**. The CNC inputs the M-Code into the active Program Listing.

**NOTE:** If you enter two M-Codes that cannot be used on the same block, the CNC generates an error message.

## Typing in Address Words

You can manually type in most address words without exiting Edit Help. Address words that can be typed into the program via Edit Help include: dimension coordinates (**XYZUW**); spindle codes (**S**); feedrates (**F**); tool codes (**T**); and preparatory codes (**G**). Use the following procedure:

1. From the Main Edit Help screen or from a Help Template Menu, type the required commands. Edit Help displays the typed commands in the center of the screen. If the address word requires a parameter, the software displays an entry field in which you type the appropriate value or selection.
2. Type the value or selection, if required. You can accept or cancel commands just as you would in the Help Graphic Menus. Press **Accept (F8)** to enter the block into the program. Press **Prev (F9)** to cancel your entry and clear the screen. Accepted commands are inserted in the program.

### Example: Entering G-Codes

From the Main Edit Help screen, type **G77**. Press **ENTER**. The CNC activates the Help Graphic for Circular Pocket Milling (G77).

## Typing in M-Codes

You can manually type in M-codes listed in the table. Refer to [Table 7-16, Edit Help M-Code Listing](#). Most of these M-codes (except M30, M98, and M100) do not require additional parameter settings. Press **Accept (F8)** to insert the entered M-code into the program.

For M-codes that do require additional parameter settings (M30, M98, M100), Edit Help displays the Help Graphic for the M-code. Type the required parameters, and press **Accept (F8)** to insert the M-code into the program.

1. From the Main Edit Help screen or from a Help Template Menu, Type the entire M-code. (Example: M2, M100, etc.) The Edit Help displays the entered M-code.

<p><b>NOTE:</b> If the M-code requires a parameter, the software displays the Help Graphic for the entered M-code. Only M30, M98, and M100 require parameters. Fill in the entry fields for these M-codes.</p>
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

2. Press **Accept (F8)** to enter the block into the program. Press **Prev (F9)** to cancel your entry and clear the screen. Accepted commands are inserted in the program.

## Section 8 - Viewing Programs with Draw

Draw Graphics (part graphics) is a method by which to prove a program before you cut any material. It allows you to view the part edge and/or tool path from different angles, zoom in on a particular area of the part and generally, inspect the moves the machine is programmed to make, without necessarily moving the axes. This reduces waste and the chance of damaging a part.

The CNC has two Draw Modes: Draw Simulation Mode and Real-Time Draw Mode. This section explains how to use Draw Simulation Mode to view programs. It also explains how to set the display for a detailed inspection of the programmed moves.

**NOTE:** Draw (lowercase letters with an uppercase D) refers to the CNC's Draw Simulation Mode, DRAW (all uppercase letters) refers to the CNC's Real-Time Draw Mode.

- ❑ In Draw Simulation Mode, the CNC runs programs and simulates machine movements in the viewing area. The machine does not move.
- ❑ In the Real-Time DRAW Mode, the CNC displays the machine moves in the viewing area as it runs the program in Auto or Single Step Mode.

Draw Simulation Mode soft keys change the viewing settings for both modes. Refer to ["Section 11 - Running Programs"](#) for instructions on how to run DRAW while cutting a part.

**NOTE:** You can change the display settings at any time in Draw Simulation Mode. You cannot change the display settings in Real-Time DRAW Mode.

When you select **Draw (F7)** from the Program Directory, Draw Simulation Mode is activated. The CNC draws the part without machine movement. When you start DRAW from Auto or S.Step Modes, Real-Time Draw Mode is activated. The CNC draws the part while it is machining it.

### Starting Draw

Draw Simulation Mode is started from the Program Directory. The **DISPLAY (F5)** and **Parms (F9)** settings determine how Draw looks and runs. You can make some changes from the soft keys while a simulation is running. However, it is better to adjust viewing settings before starting the simulation. In Draw Simulation Mode, the CNC does not hold the operation of the program for Dwells and tool mounts.

To activate Draw Simulation Mode:


1. In the Program Directory, highlight a program and press **Draw (F7)**. The Draw graphic screen activates.
2. Press **DISPLAY (F5)**. A pop-up displays. **Fit** highlights.
3. Press **ENTER**. **Fit** scales image to fit in the viewing area.
4. Press **Run (F3)**. The soft key menu changes to display the available simulation operation modes: **Auto (F1)**, **S.Step (F2)**, or **Motion (F3)** and related settings.

Choose an operation mode:

- Auto Mode runs the entire program without pause.
  - S.Step Mode executes the program one block at a time.
  - Motion Mode executes the program one move at a time, without pausing on non-motion blocks.
5. Draw runs the highlighted program, the tool path is displayed in viewing area and the machine remains idle.

### Draw Screen Description

Information is displayed on the screen. In the Status Area on the left side of the screen, axis position, feedrate, tool number, and other status items are displayed. Refer to **Figure 8-1**.

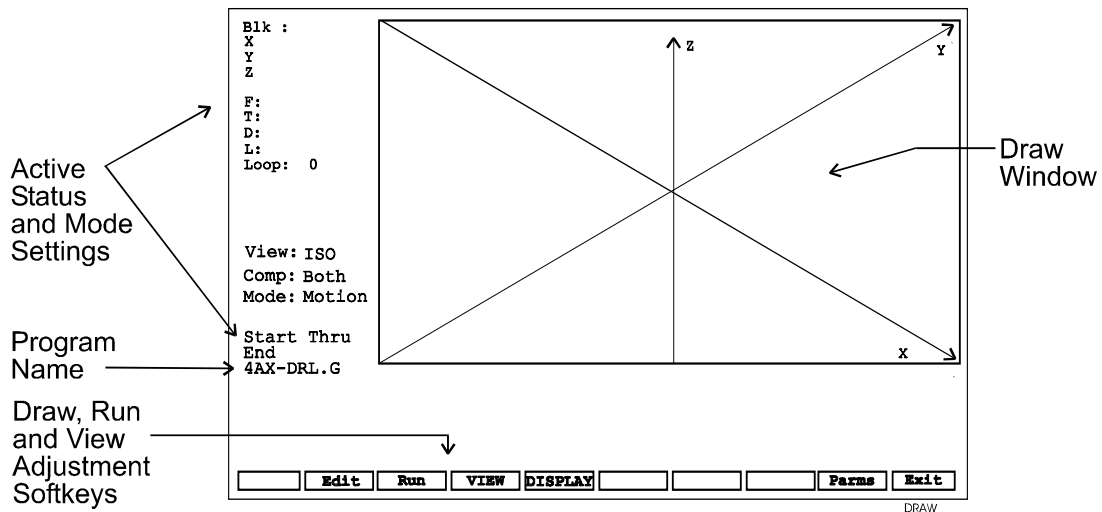

**Figure 8-1, Draw Simulation Mode**

At the bottom of the screen, blocks of the program being run are displayed if the display is set for Text ON. This setting is in the **Perms (F9)** pop-up. Soft keys are also displayed.

Programmed moves appear in four separate colors:

<b>Rapid moves:</b>	Dotted red line.
<b>Feed moves:</b>	Solid white line or arc.
<b>Compensated moves:</b>	Solid or dotted green, depending on feed or rapid.
<b>Drilled holes:</b>	A yellow cylinder shows the programmed diameter of the tools and the depth of the hole(s).

Status items are represented as follows:

<b>Blk:</b>	Block Number currently being simulated.
<b>X</b>	X Current Position.
<b>Y</b>	Y Current position.
<b>Z</b>	Z Current Position.
<b>F:</b>	Currently active feed rate.
<b>T:</b>	Currently active tool number.
<b>D:</b>	Currently active tool diameter.
<b>L:</b>	Currently active tool length offset.
<b>Loop:</b>	Loop countdown, if loop is programmed.
<b>Feed:</b>	Type of current movement (rapid, feed, arc CW, arc CCW).
<b>View:</b>	Graphics view (XY, XZ, YZ, ISO).
<b>Comp:</b>	Compensation setting (Both, Ignore or Use).
<b>Mode:</b>	Current operating mode: S.Step, Motion or Auto.
<b>Start Thru End:</b>	Range of block numbers to run in DRAW Mode.
<b>4AX-DRL.G</b>	Program Name.

## Putting Draw in Hold

To pause Draw, press **Hold (F8)** or **HOLD**.


When Draw is in hold, press **Start (F7)** or **START** to continue.

## Canceling Draw

To cancel the execution of a program in Draw Simulation Mode, press **Cancel (F9)**.

### Draw Parameters

Viewing parameters are set two ways. Before the program is run, set the parameters from the **Parms (F9)** Pop-Up Menu. Refer to **Figure 8-2**. While the program is running, change the parameters from the soft key menu. Some options appear in both places, some do not. Soft keys switch the labeled feature ON or OFF. Active soft key features are highlighted.

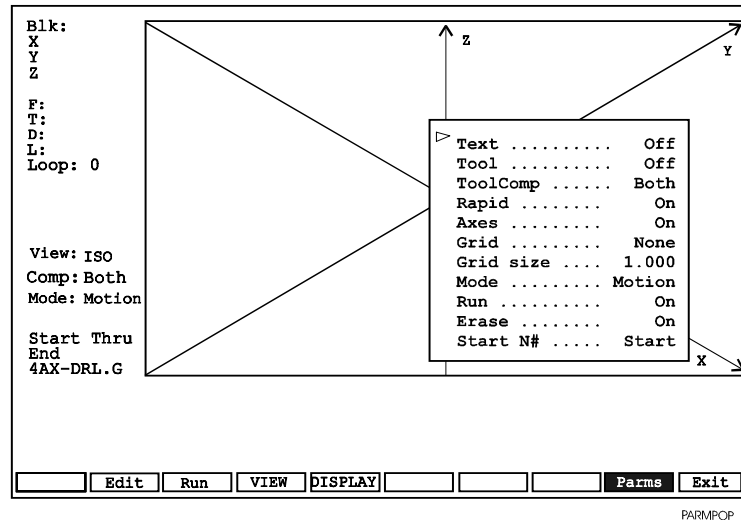

**Figure 8-2, Draw Parameters Pop-Up Menu**

### Tool On or Off

When you run Draw with **Tool On**, a display shows the tool as it moves through the part. A tool must be active and have a Diameter entered on the Tool Page in order to be displayed. The size of the tool is scaled to the tool's Diameter. Draw runs faster with **Tool Off**.

[Default: **On**]

To switch **Tool On** or **Off**:

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **Tool** and press **ENTER**. **Tool** switches between **On** and **Off**.
3. Press **Parms (F9)**. The **Parms** Pop-Up closes.

**NOTE:** Press **Tool (F5)** to change the **Tool** parameter while Draw is running.



## Drawing Compensated Moves

The **ToolComp** setting controls if and how Draw handles compensated moves. This allows you to see the effects of compensation on the moves in a program. The Draw **ToolComp** setting does not affect program execution.

There are three **ToolComp** options:

- ❑ **Ignore** a program's compensated moves.
- ❑ **Use (display)** a program's compensated moves.
- ❑ **Both** runs the program twice. (First without compensation then with **compensation**.) The moves from both are displayed simultaneously.

**Both** is the only selection that allows a direct comparison between compensated and uncompensated modes. [Default: **Both**]

To set the compensation parameter:

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **ToolComp** and press **ENTER**. A pop up is displayed.
3. Highlight the desired selection and press **ENTER**. The pop up closes.
4. Press **Parms (F9)**. The **Parms** Pop-Up closes.

## Showing Rapid Moves

Draw displays Rapid moves as dotted lines. You can turn off displayed rapid moves to eliminate screen clutter. This parameter has no effect on program execution. [Default: **ON**]

To switch **Rapid On** or **Off**:

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **Rapid** and press **ENTER**. **Rapid** switches between **ON** and **OFF**.
3. Press **Parms (F9)**. The **Parms** Pop-Up closes.

<b>NOTE:</b> In Draw Mode, press <b>Rapid (F6)</b> to change the settings.
----------------------------------------------------------------------------

### Setting Grid Line Type

Draw can display a two dimensional grid with dots or solid lines.

[Default: **None**]

To set the **Grid** parameter:

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **Grid** and press **ENTER**. The **Grid** Pop-Up Menu is displayed.
3. Highlight the desired selection and press **ENTER**. The **Grid** Pop-Up closes.
4. Press **Parms (F9)**. The **Parms** Pop-Up closes.

### Setting Grid Size

The grid size is adjustable. The units are determined by the CNC's current mode. [Default: **1.00**]

To set the **Grid size**:

1. In Draw Mode, press **Parms (F9)**. The **Parameter** Pop-Up Menu is displayed.
2. Highlight **Grid size** and press **ENTER**. The CNC displays a number entry field.
3. Type the desired size and press **ENTER**. The new value is displayed on the pop-up menu.
4. Press **Parms (F9)**. The **Parms** Pop-Up closes.

### Putting Draw in Motion, S.Step, or Auto Mode

Draw Simulation Mode executes programs three ways:

- In Automatic Mode (**Auto**)
- In Single Step Mode (**S.Step**)
- In Motion Mode (**Motion**)

In Automatic Mode, blocks are executed sequentially without pause until the program is finished, the CNC is put in a hold, or an error stops the program.

**NOTE:** Press **Auto (F1)** to switch to Automatic Mode.

In the Single Step Mode, one block of the program is executed each time **START** is pressed. This allows you to run the program one block at a time.

**NOTE:** Press **S.Step (F2)** to switch to Single Step Mode.

In Motion Mode, a program is executed from one motion to the next, executing one motion each time **START** is pressed.

**NOTE:** Press **Motion (F3)** to switch the CNC into Motion Mode.

Select the default mode as follows:

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **Mode** and press **ENTER**. The Mode Pop-Up Menu is displayed.
3. Highlight the desired mode and press **ENTER**. The pop-up closes.
4. Press **Parms (F9)**. The **Parms** Pop-Up closes.

**NOTE:** If you are using an off-line keyboard and running Draw in Single Step or Motion Modes, press **SPACEBAR** to continue the program after each hold.

### Automatic Draw Restart

The **Run** parameter determines whether Draw automatically restarts after a **DISPLAY** setting change. This allows you to make more than one setting change before you restart Draw.

Press **Run (F3)** to restart Draw when **Run** is **OFF**.

When **Run** is **ON**, Draw automatically starts after each **DISPLAY** change.

[Default: **ON**]

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **Run** and press **ENTER**. **Run** switches between **ON** and **OFF**.
3. Press **Parms (F9)**. The pop-up closes.

## Erasing the Draw Display

The **Erase** parameter sets Draw to clear the display when it starts a program. When **Erase** is **OFF**, the old drawing remains in the viewing area and new moves are drawn over it. [Default: **ON**]

Set the **Erase** parameter as follows:

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **Erase** and press **ERASE**. **ERASE** switches between **ON** and **OFF**.
3. Press **Parms (F9)**. The pop-up closes.

## Running Draw for Selected Blocks

**NOTE:** Program blocks must have block numbers to use this feature.

Draw can run any part of a program or a subprogram. To run part of a program, specify the **Start N#** and **End N#** block settings on the **Parms** Menu. [Defaults: **Start** and **End**]

To run part of a subprogram, both the starting and ending blocks must be within the subprogram. To run an entire subprogram select starting and ending blocks that include the subprogram call from the main program.

If a starting block is inside a subprogram and the ending block is in the main program, the CNC will stop and generate an Error message at the end subprogram block because it cannot find the subprogram starting block.

## Starting Draw at a Specific Block

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **Start N#** and press **ENTER**. The Start N# Pop-Up Menu is displayed.
3. Highlight the desired selection and press **ENTER**. If **Start Of Program** is selected, Draw will start at the first block of the program. If **Other Block** is selected, type the block number and press **ENTER**.
4. Press **Parms (F9)**. The pop-up closes.

### Ending Draw at a Specific Block

1. In Draw Mode, press **Parms (F9)**. The Parameter Pop-Up Menu is displayed.
2. Highlight **End N#** and press **ENTER**. The End N# Pop-Up Menu is displayed.
3. Highlight the desired selection and press **ENTER**. If **End Of Program** is selected, Draw will stop at the last program block. If **Other Block** was selected, type the block number and press **ENTER**.
4. Press **Parms (F9)**. The pop-up closes.

### Adjusting Draw Display

Draw has several display settings that allow you to customize the graphic in the viewing window. Activate these settings from the **DISPLAY (F5)** Pop-Up Menu. Refer to **Figure 8-3**.

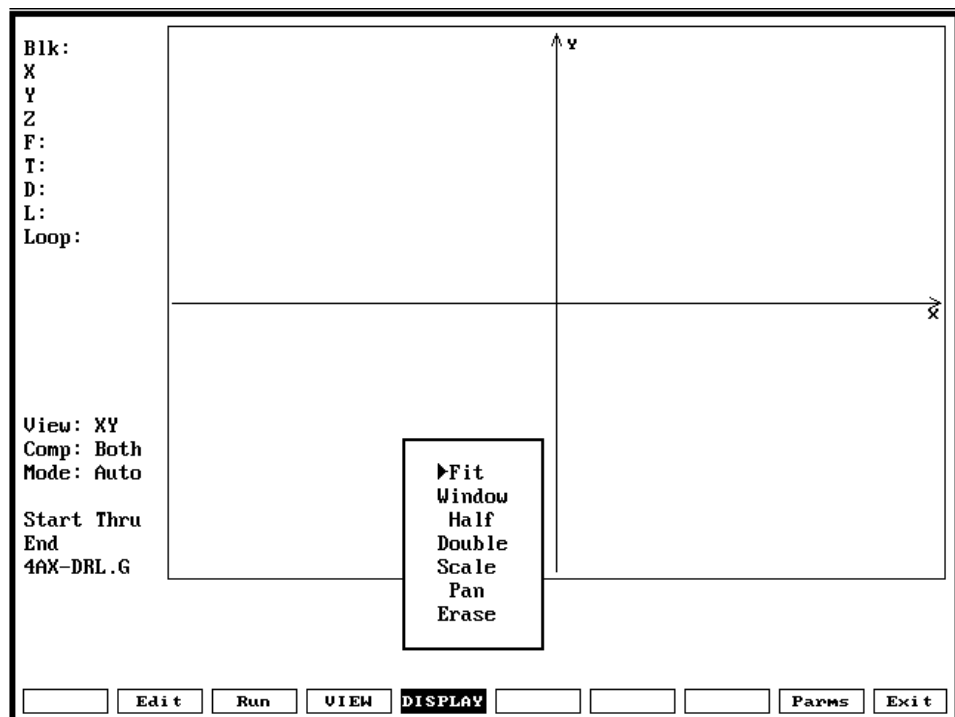


Figure 8-3, Display Pop-Up Menu

### Fitting the Display to the Viewing Window

Draw can automatically scale the display to fit into the viewing area.

To fit the display in the viewing area:

1. In Draw Mode, press **Display (F5)**. A pop-up menu is displayed.
2. Highlight **Fit** and press **ENTER**. The pop-up closes and the display adjusts to fit into the viewing window.

### Scaling the Display by a Factor

Draw can enlarge or reduce the display size by a factor.

To scale the Draw display:


1. In Draw Mode, press **Display (F5)**. A pop-up menu is displayed.
2. Highlight **Scale** and press **ENTER**. The pop-up closes and the CNC prompts to enter the scale factor.

<p><b>NOTE:</b> Type a decimal number to reduce the size, type a whole number to increase the size.</p>
---------------------------------------------------------------------------------------------------------

3. Type the desired factor and press **ENTER**. The prompt disappears. The next time Draw runs, the display will be scaled by the factor entered.

## Using the Window Zoom

Draw allows you to zoom in on any part of the display. Refer to **Figure 8-4**.

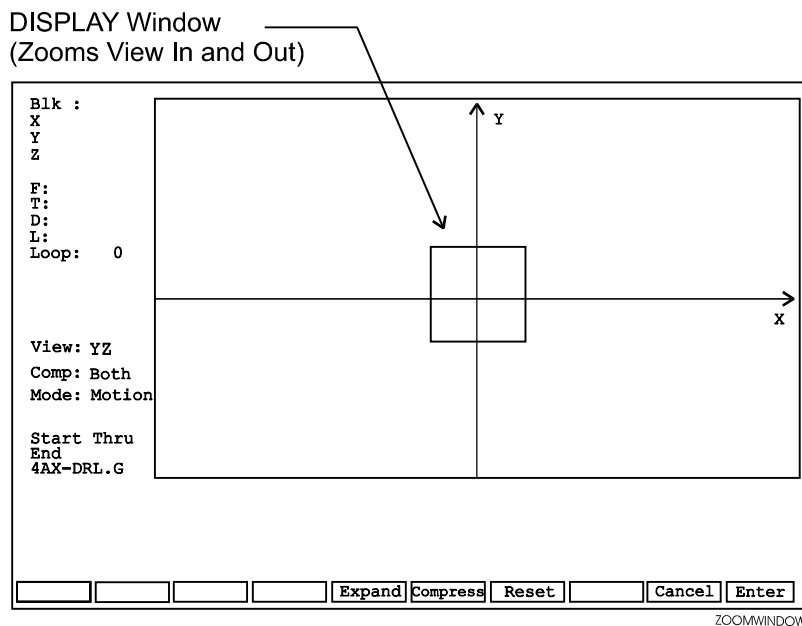

**Figure 8-4, DISPLAY Window (Zoom)**

To zoom in on part of the display:

1. In Draw Mode, press **Display (F5)**. A pop-up menu is displayed.
2. Highlight **Window** and press **ENTER**. A window is displayed inside the viewing window.
3. Use **ARROWS** to center the window over the area of interest.
4. Press **Expand (F5)** or **Compress (F6)** to increase or reduce the size of the window.

**NOTE:** Press **Reset (F7)** to restore window to its original size. Press **Cancel (F9)** to cancel the Window command.

5. Once the window is sized and positioned, press **Enter (F10)**. The window closes. The next time **Draw** is run, the part of the display framed by the window will fill the viewing window.

### Halving Display Size

Draw can reduce the size of the display to half the existing size.

To reduce the display size by half:

1. In Draw Mode, press **Display (F5)**. A pop-up menu is displayed.
2. Highlight **Half** and press **ENTER**. The pop-up closes. The next time Draw runs, the display will be half its present size.

### Doubling Display Size


Draw can double the size of the display.

To double the size of the display:

1. In Draw Mode, press **Display (F5)**. A pop-up menu is displayed.
2. Highlight **Double** and press **ENTER**. The pop-up closes. The next time Draw runs, the display will be twice its present size.

### Changing the Viewing Area without Changing the Scale

To shift part of the screen in a desired direction without changing the scale factor, use the **Pan** command. Refer to **Figure 8-5**. This is especially useful on long parts that do not entirely fit in the Draw window.

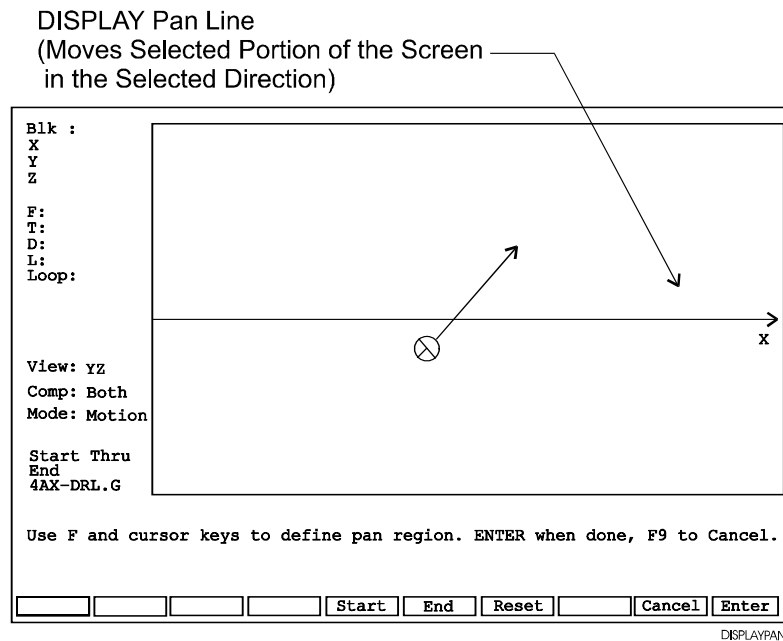

**Figure 8-5, DISPLAY Pan**



When the Pan command is activated from the Display Pop-Up Menu, the Pan line is displayed on the screen and the soft keys change. Press **Start (F5)** to place the beginning of the Pan line (circle) on the part of the screen to be shifted. Press **End (F6)** to point the End of the Pan line (arrow) in the direction and distance the screen will be shifted.

To change the viewing area without changing the Scale factor:

1. In Draw Mode, press **Display (F5)**. The **Display** Pop-Up Menu is displayed.
2. Highlight **Pan** and press **ENTER**.
3. The Pan line is displayed on the screen. Press **Start (F5)** and use **ARROWS** to place the start of the Pan line (circle) on a part of the screen.
4. Press **End (F6)** and use **ARROWS** to place the tip of the arrow to indicate the appropriate direction and distance in which the view will be shifted.
5. Press **Enter (F10)**. The CNC shifts the selected part of the screen in the selected direction.

<p><b>NOTE:</b> Press <b>Reset (F7)</b> to restore the graphic to its original size (size when <b>Pan</b> selected). Press <b>Cancel (F9)</b> to cancel the Pan command.</p>
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

## Erasing Display

To erase the display:

1. In Draw Mode, press **Display (F5)**. The Display Pop-Up Menu is displayed.
2. Highlight **Erase**, and press **ENTER**. The display is erased.

## Section 9 - Tool Page and Tool Management

The Tool Page stores data on tools, such as: tool number, diameter, length offset, diameter wear, length wear and tool type.

Functions of the Tool Page include: cursor movement, tool search, clear, and calibrate. Refer to **Figure 9-1**.

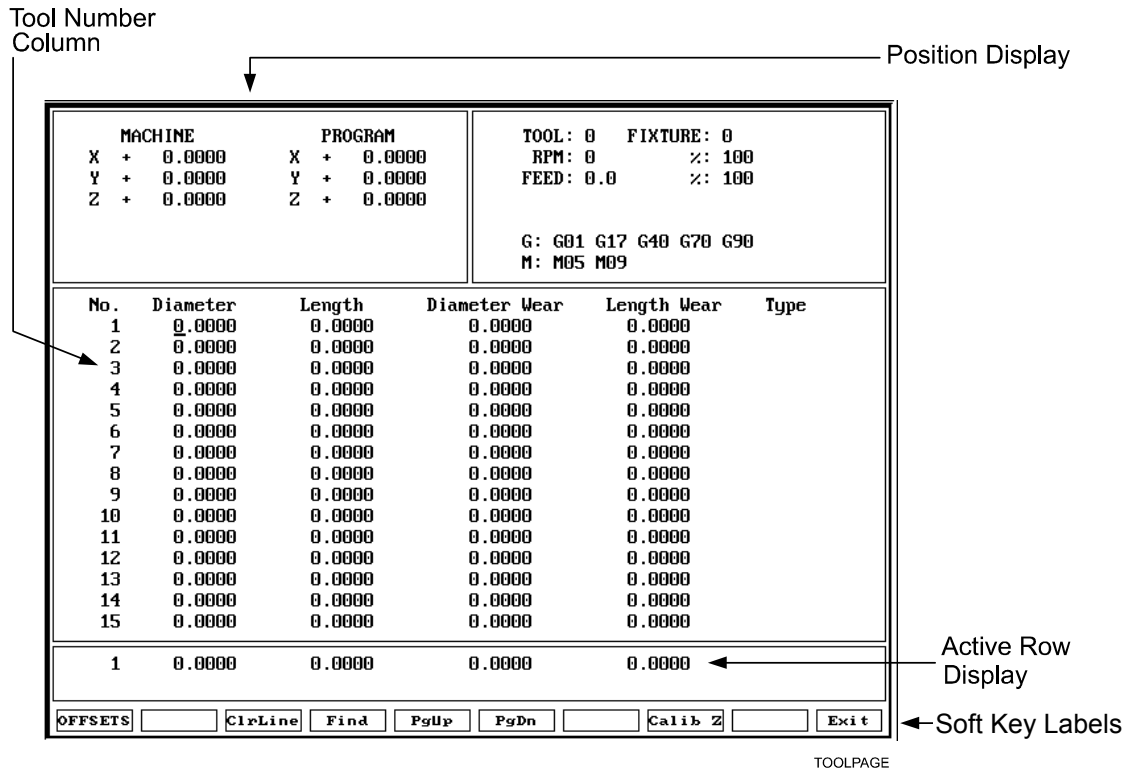


Figure 9-1, The Tool Page

### Activating the Tool Page

Activate the Tool Page as follows:

1. Go to the Manual screen.
2. In the Manual screen, press **TOOL (F9)**. The Tool Page activates.

### Using the Tool Page

Press **UP** and **DOWN** arrows to highlight and select tool numbers (row numbers). You can enter tool information only in a highlighted row. Highlight the appropriate row and enter the values. The information on the highlighted row is also displayed at the bottom of the screen (Active Row Display) for easy reading. The cursor marks the location of information to be entered.

Numbered rows correspond to tool numbers. When the CNC executes a program block that activates a tool number, the values on that row of the Tool Page are activated.

Press **RIGHT** and **LEFT** arrows to move from column to column. Tool Page values are automatically converted to their inch or millimeter equivalents when you change the CNC's unit mode. Values must match the CNC's unit mode.

**NOTE:** The Tool Page is the only place where the CNC converts values from Inch Mode to MM Mode, and vice-versa. Programmed positions are not converted when you change the unit mode.

Press **PgUp (F5)** or **PgDn (F6)** to scroll through the tool table one page at a time.

When you activate Tool #0, you cancel the active diameter and length offset of the CNC. The Tool #0, Z0 position is usually set as the fully retracted position of the quill.

All of the CNC's Jog features can be run from the Tool Page. The handwheels (if installed) can also be used.

The following features appear on the Tool Page:

<b>No.</b>	Row Numbers link the values on a row of the Tool Page to a tool number. A program block that activates a tool number activates the values and settings on that row of the Tool Page.
<b>Position Display</b>	Displays information regarding current machine position and active Units Mode (Inch/MM).
<b>Diameter</b>	Tool diameter(s) applied when you activate tool diameter compensation.
<b>Length</b>	Tool length offset(s), which enable the CNC to adjust the Z-axis position and position the tool tip.
<b>Diameter Wear</b>	Diameter wear offset(s), which compensate for wear on the tool or an incorrectly sized tool.
<b>Length Wear</b>	Length wear offset(s), which compensate for wear on the tool or an incorrectly sized tool.
<b>Type</b>	Press <b>1</b> or <b>2</b> to indicate a flat or end type mill, respectively.
<b>Active Row Display</b>	Displays the row on which the cursor is located.
<b>Soft Key Labels</b>	Identify the functions of the active soft keys.

### Finding Tools by Number

To find a specific tool number in the Tool Page:

1. Press **Find (F4)**. The CNC displays the following prompt, **Enter tool number:** and the cursor displays.
2. Type a tool number, and press **ENTER**. The cursor moves to the selected tool number.

### Changing Tool Page Values

1. In the Tool Page, highlight the desired row. Position the cursor on the desired column.

<p><b>CAUTION:</b> Ensure that the CNC is in the same unit mode, <b>MM</b> or <b>Inch</b>, as the value you enter. To verify the unit setting, look at the <b>G-Code</b> area of the Tool Page where either <b>G70 (Inch)</b> or <b>G71 (MM)</b> is displayed.</p>
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

2. Type the new value with all appropriate decimal values, and press **ENTER** (or press any **ARROW**). The value will be entered.

### Clearing a Tool (Whole Row)

To clear a row:

1. In the Tool Page, highlight the row to be cleared.
2. Press **ClrLine (F3)**. All values in the row return to zero.

### Clearing a Single Value

To clear a single value:

1. In the Tool Page, highlight an entire row.
2. Position the cursor on the value you wish to clear and press **Clear**, or **ALT + C** on an external keyboard. The value changes to zero.

### Adjusting a Single Value

To adjust a single value:

1. In the Tool Page, highlight the desired row. Position the cursor on the desired column.
2. Press the letter **A** key to display the message, "Enter adjustment value."
3. Type the amount of the adjustment. The adjustment value may be positive or negative.
4. Press **ENTER** to adjust the value, and display the adjusted value on the table.

### Tool Page Soft Keys and Secondary Soft Keys

Press **SHIFT** while in the Tool Page to activate the secondary soft key functions. Refer to **Table 9-1**.

**Table 9-1, Tool Page Soft Keys and Secondary Soft Keys**

Label	Soft Key	Soft Key Label and Function
<b>Offsets</b>	<b>F1</b>	Enables entry to the G53 Offset pop-up menu. Refer to Fixture Offsets (Work Coordinate System Select), (G53).
<b>ClrLine</b>	<b>F3</b>	Clears the entire single line.
<b>Find</b>	<b>F4</b>	Enables "search" of a tool number
<b>Page Up</b>	<b>F5</b>	Moves the cursor one page backward
<b>Page Down</b>	<b>F6</b>	Moves the cursor one page forward
<b>Calibrate Z</b>	<b>F8</b>	Inputs Z dimension (in reference to Machine Home) into the highlighted length offset and advances the cursor.
<b>Exit</b>	<b>F10</b>	Exits the Tool Page and saves any changes.
<b>ClrTabl</b>	<b>SHIFT + F3</b>	Clears the entire Tool Table after confirmation.
<b>Quit</b>	<b>SHIFT + F10</b>	Enables you to exit the Tool Page without saving any changes that you have made.

## T-Codes and Tool Activation

To activate a tool, program a T-code followed by the tool number. The tool number corresponds to the row of the Tool Page that contains the Tool Length Offsets (TLOs) and other required values for the active tool.

**Format:** Txxxx

**Format:** Txx

Two-digit T-codes are used if the machine tool is not equipped with an automatic tool changer (ATC). If the machine is equipped with an ATC, then the four-digit T-code system can be used.

In the Txxxx format – The first two digits select the tool number (bucket in the ATC from which the tool is retrieved); the last two digits select the offset from the Tool Page. The CNC uses the last two digits as the active tool number (whose offset is activated).

Examples:

T0101	Pick up tool from Bucket #1 and use Offset #1
T0207	ATC Bin #2 and Offset #7
T1210	ATC Bin #12 and Offset #10
T9999	ATC Bin #99 and Offset #99
T0100	ATC Bin #1 and CANCEL OFFSETS

## Tool Definition Blocks

Example: N3 T1 R1.25 L-1

A tool definition block defines the tool radius in the program, rather than via the Tool Page. The block assigns Tool 1 a radius of 1.25 (diameter equals 2.50).

**Note:** When using the Random Tool Replacement setting, the Tool Page will have these differences:

- A column headed Bin (displays the number of the bin that the tool is in).  
Bin T0: xx. Information in the top-right box of screen showing the bin that holds the tool that is currently in use. The **F2** soft key labeled **Bin T0** allows editing of this value.
- A column headed Fix (Yes or No). When the cursor is in this column, the bottom of the screen displays 1) YES 2) NO. Entering 1 or 2 will display YES or NO in this column. If YES is displayed, then the tool in that bin is always returned to that bin. If NO is displayed, then the tool in that bin can be returned to another bin. The CNC software automatically tracks the bins of tools that are returned to random bins.


### Tool-Length Offsets

Tool-length offset is the distance from Z0 Tool #0 to the tip of the tool at the part Z0 (usually the surface of the work). Refer to **Figure 9-2**.

Tool-length offsets allow each tool used in the part program to be referenced to the part surface. In an idle state, the CNC does not have a tool-length offset active. Therefore, Tool #0 (T0) is active. When T0 is active, all Z dimensions are in reference to the Z Home position. When you program T1, all Z dimensions become referenced to the surface on which the tool-length offset was activated.

You must set the Z0 position of the quill. Usually, it is the fully retracted position of the quill. Tool-Length Offsets are referenced to this position.

Because tools differ in length, Z0 axis (Part Zero) is not set the same way as X0 or Y0. The tool-length offset is the distance from the tip of the tool to the top of the part. Enter a length offset for each tool in the Tool Page.

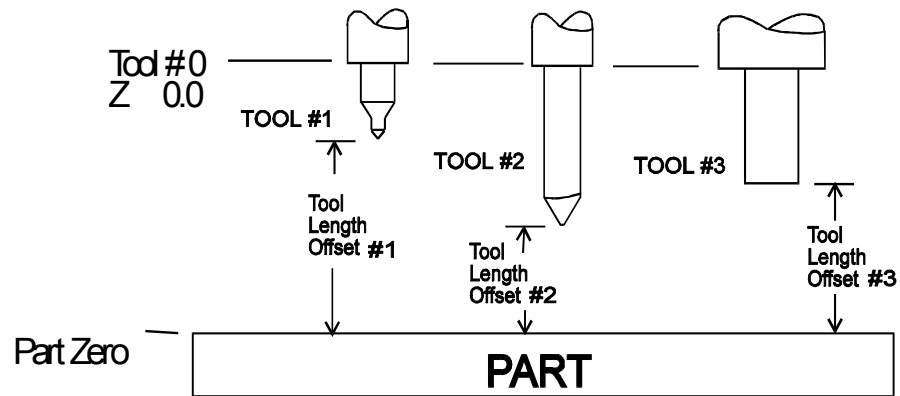

**Figure 9-2, Tool-Length Offset**

With tool-length offsets active, the Z-axis position display reads 0.00 when the active tool moves to Part Zero. Tool-length offsets simplify programming.

### Entering Offsets in the Tool Page

After you choose the type of tools and the order of their use in the program, and you know the diameter and length offsets of tools, enter the data into the Tool Page.

1. In Manual Mode, press **TOOL (F9)** to enter the Tool Page.
2. In the Tool Page, you must highlight a line before you can edit it.

Typically, you enter diameter offsets in the Tool Page directly, after measuring the tool with a micrometer.

To measure length offset:

1. In Manual Mode, put the tool in the spindle and carefully jog the tool down until it touches surface (top of the work).
2. In the Tool Page, highlight that tool's tool number, and press **Calib Z (F8)**. This will take the dimension from Z Machine Home position, and input it into the Length Offset column for that tool.
3. Exit the Tool Page, raise the Z-axis and continue.

– or –

Jog the tool(s) as described above, write down each offset(s) and enter it into the Tool Page.



### Setting Tool-Length Offsets

Before you run a job in production, perform the following steps:

1. Review the part drawing.
2. Make a machining plan. Include fixturing, tooling and machine sequence.
3. Write the program on a program sheet.
4. Input the program.
5. Set the tool offsets.

The following sequence describes tool offsets for a job that center-drills, drills and mills a part:

Tools:	#1	No. 3 center drill
	#2	0.3750 diameter Twist drill
	#3	0.5000 diameter End-mill

Typically, you would perform the following steps to activate TLOs:

1. Insert and tighten all tools in their appropriate holders.
2. Set the CNC to Manual Mode.
3. Type **G28 Z** and press **START** to home the Z-axis.
4. If the machine is a vertical knee mill, place the longest tool in the spindle and raise the knee until the tip of the tool is approximately half an inch from the top of the work.
5. Place Tool #1 in the spindle.
6. Jog the tool over the work.
7. Carefully jog the tip of the tool down to meet the top of the work. Use MDI moves and/or the Manual Panel Jog selections.
8. Press **TOOL** (F9) to enter the Tool Page.
9. Ensure that the cursor is on Tool #1 (row 1).
10. Press **Calib Z (F8)** to input the Z value in the Length column.
11. Press **Exit (F10)**.
12. Raise the tool from the work to Z Home (Z0).
13. Repeat Steps 7 to 12 for all tools.
14. Use a micrometer to measure tool diameters and type those values in their respective columns.
15. Press **Exit (F10)** to return to Manual Mode.

### Entering the Z Position Manually

1. Retract the Z-axis to the Tool #0, Z0 position.
2. Load the tool and manually position its tip at the Part Z0 position.
3. Manually type the plus or minus Z position as it is displayed in the position display. Press **ENTER**. Type the Z position in the offset column.

**NOTE:** The value of a tool length offset is usually a negative number.

### Diameter Offset in Tool Page

When you activate a tool, you automatically activate the length offset and diameter values recorded on the Tool Page. When a tool is activated, the length offset is applied immediately to provide an accurate Z-axis position display.

The active diameter value is important when you program compensated moves and use cycles with built-in tool compensation. If tool diameter is correct, compensated moves and cycles will be executed accurately too.

Type tool length offsets and tool diameter values on the numbered lines of the Tool Page. The numbered lines on the Tool Page identify the tool number (T-code) that activates those values.

You can program a tool activation as a separate block or include it within the block for most moves and cycles. Tool activations programmed as separate blocks are easier to find in a Program Listing.

The Tool Page can store information for up to 99 tools.

On machines equipped with collet-type tool holders, it is impractical to use the Tool Page to store tool length offsets. You can set tool length offset at tool change. Tool Page diameters are still required for compensated moves and when using cycles that have built-in compensation. You can run all Jog features from the Tool Page.

Tool Page offsets activate when you program a T-code.

For example:

```
N3 T1  
N4 G0 G41 XnYn  
N5 etc...
```

Block N3 activates Tool #1 length offset. N4 activates tool compensation for the following blocks.

**NOTE:** In Block N4, the G41 command must be accompanied by a move (XYZ) to take effect. The motion must be in rapid (G0) or feedrate (G1). The tool diameter activates when the CNC executes the move programmed on the block. G40 and G42 must also be accompanied by moves, and activate in the same manner.

### Tool Path Compensation (G41, G42)

**NOTE:** Be familiar with basic CNC principles before you attempt to write compensated moves.

When tool compensation is not active, the CNC positions the tool's center on the programmed path. This creates a problem when programming a part profile because the cutting edge is half a diameter away from the path. Use tool diameter compensation to overcome this problem.

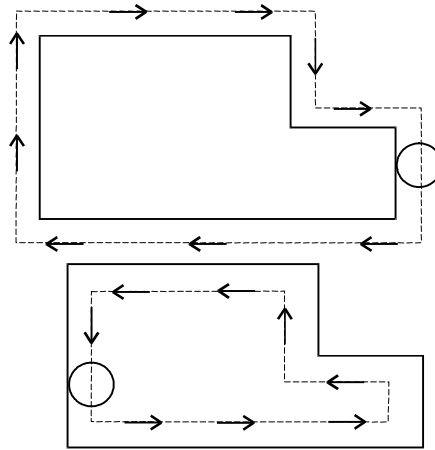
When tool compensation is active, the CNC offsets the tool by half a diameter to position the cutting edge of the tool on the programmed path.

This enables you to program the coordinates along the part profile. You do not need to adjust the path to compensate for tool diameter.

Most moves can be compensated. Specify right-hand or left-hand compensation. "Right" or "left" refers to the side of the path to which the tool offsets, as viewed from behind a moving tool. If the tool is to the left of the work, use G41. If the tool is to the right of the work, use G42.

**NOTE:** Use tool compensation with lines and arcs only.

With left-hand tool diameter compensation (G41) active, the tool offsets to the left of the programmed path (as viewed from behind a moving tool). Refer to **Figure 9-3**.



———— Programmed Path

----- Tool Path


○ Tool

Left Hand Tool Compensation

LHCOMP

**Figure 9-3, Left Hand Tool Compensation**

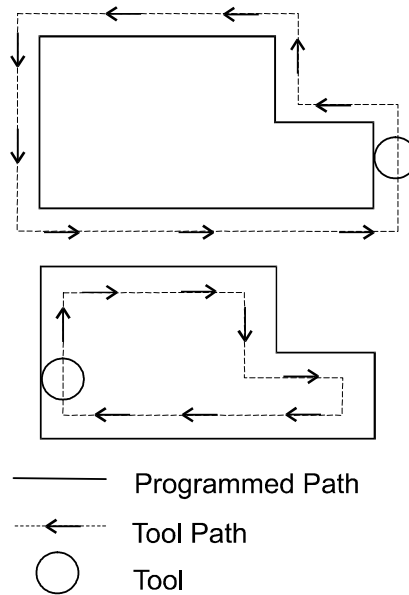With right-hand tool diameter compensation (G42) active, the tool offsets to the right of the programmed path (as viewed from behind a moving tool). Refer to **Figure 9-4**.




Right Hand Tool Compensation

RHCOMP

**Figure 9-4, Right Hand Tool Diameter Compensation**

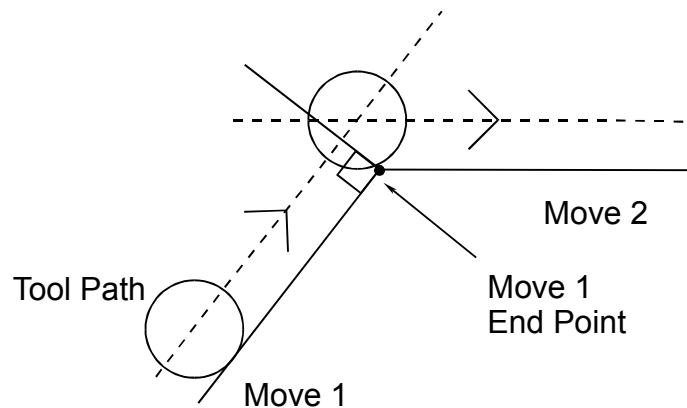
When the CNC encounters two consecutive, compensated moves, the tool follows the offset path for the first move until it reaches the offset path for the second move. The tool may intersect the offset path for the second move, either before or after the endpoint of the first move, depending on the geometry. Refer to **Figure 9-5**.



COMP2

**Figure 9-5, Consecutive Compensated Moves**

The moves to and from compensated moves are called ramp moves. Ramp moves give the CNC time to position the tool. The ramp move must be at least half the active tool's diameter in length. Refer to [Figure 9-6, Ramping into a Compensated Move](#).

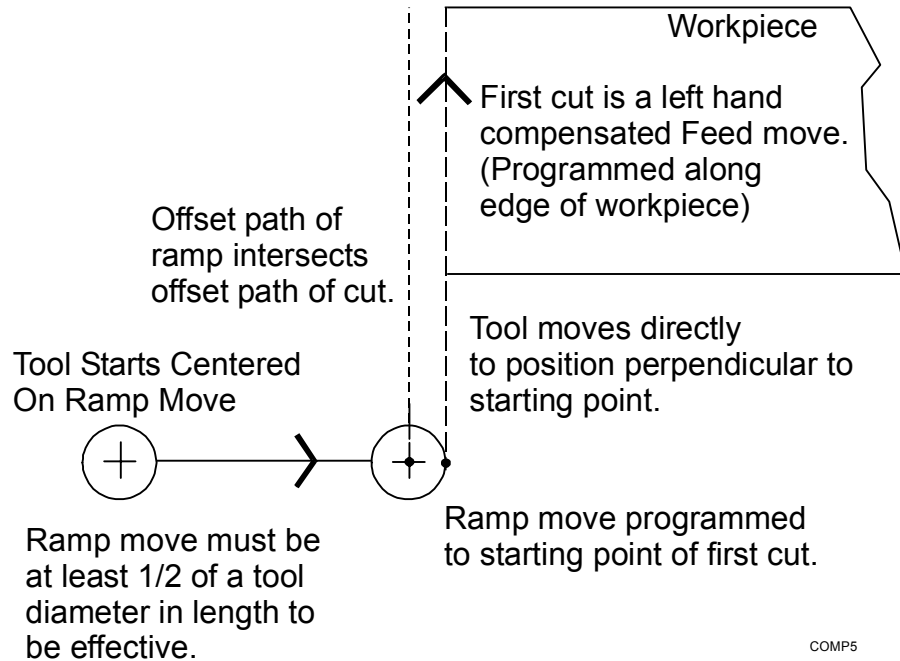


**Figure 9-6, Ramping into a Compensated Move**

At the start of a ramp move, the tool centers on the programmed path. At the end of the ramp move (starting point of the compensated move), the tool centers perpendicular to the starting point, offset by half the tool's diameter.


When a compensated move starts and stops in a corner, the tool gouges the work because the tool offsets to a position perpendicular to the endpoint. Begin ramp moves at the side to avoid gouging the work. Refer to [Figure 9-7, Ramp On/Off Choices for Milling Inside a Square](#).

**NOTE:** Use canned cycles to cut profiles and pockets, when possible. The CNC automatically selects Ramp On/Off positions in a canned cycle.

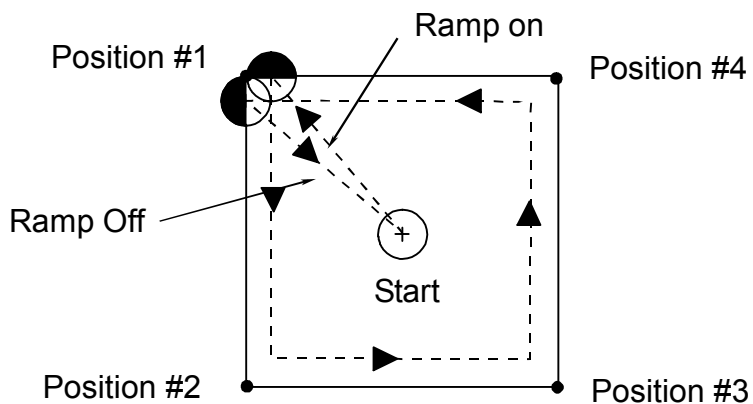Black Area Gouged



Poorly Chosen Starting & End Points.

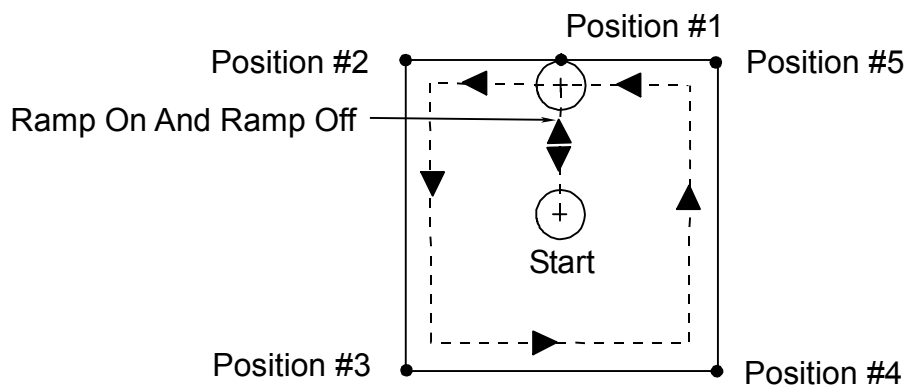

Preferred Method


COMP4

**Figure 9-7, Ramp On/Off Choices for Milling Inside a Square**

### Using Tool Diameter Compensation and Length Offsets with Ball-End Mills

When you use a ball-end mill to cut contoured surfaces, use tool diameter compensation and tool length offset together, if at all. Unlike an end tool, the tool length offset for a ball-end mill is not set to the tip of the tool.

Set the tool length offset for a ball-end mill half the tool's diameter back from the tip. Refer to **Figure 9-8**.

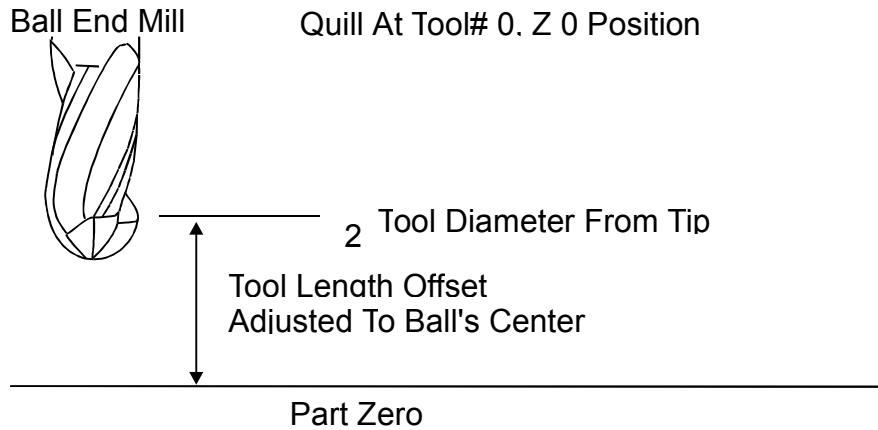

**Figure 9-8, Setting Tool Length Offset for Ball End Mill**

### Compensation (G40, G41, G42)

#### Cancel Mode in Tool Compensation: G40

At the end of a cutting sequence that performs tool compensation (G41 or G42), you must use G40 to cancel compensation. The following example describes a part programmed in the XY plane using G41.

**NOTE:** You must make an X and/or Y move with or after G40, before changing the active tool number.

**Example:**


```
N4   G17 G0 G41 Xn Yn
N5   etc...
.
.
N20  G0 G40 Xn Yn
N21  etc...
```

Program G40 on a line with G0 or G1 (unless G0 or G1 is already active). G40 programmed with or immediately following G2 or G3 will generate an alarm message.

## Change of Tool Compensation Direction

It is possible, and sometimes advantageous, to change tool compensation from G41 to G42, or from G42 to G41.

To change the direction of compensation, program the compensation change with G0 or G1 in the motion to the new cutting position. After outside milling with G41 (Move 1), program a G42 with the motion to the new cutting position for the inside milling (Move 6). Refer to **Figure 9-9**.

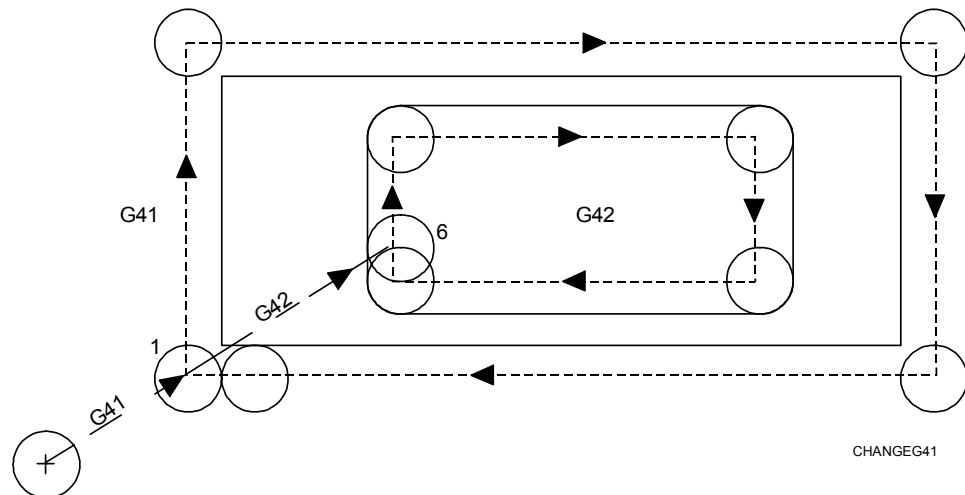

**Figure 9-9, Change of Tool Compensation Direction**

## Startup and Movement in Z-axis

The CNC “looks ahead” far enough to determine the next planar intersection. Z-axis moves, even many consecutive Z moves, are permitted at any time after a compensation block.

Refer to Example 1. N10 contains compensation block, properly accompanied by an XY move. N11 contains a Z move.

Refer to Example 2. N10 contains the compensation block. N11 and N12 contain two consecutive Z moves.

### Example 1: Single Z move in a compensated program

```

N10 G0 G41 X0 Y-.5
N11 G1 Z-.125 F3
N12 Y3.625 F7.5
N13 X5.5
N14 etc...

```



**Example 2:** Two Z moves in a compensated program

```
N10 G0 G41 X0 Y-.5
N11 Z.1
N12 G1 Z-.125 F3
N13 Y3.625 F7.5
N14 X5.5
N15 etc...
```

**Temporary Change of Tool Diameter**

To change the tool radius in order to leave stock for a finish pass, program the "stock-variable". The variable assigned for this function is #1030.

Example: N120 #1030 = .015

When the CNC reads the above block, .015 will be added to the active tool radius. The value in the Tool Page for that tool # will not be updated, and tool compensation will be affected only until the tool is cancelled. #1030 is temporary.

When the tool is cancelled (T0), #1030 is also cancelled.

Example: N120 #1030 = -.015

In this case, .015 will be subtracted from the active tool's radius.

You must program the variable after the tool is activated.


You can program the variable regardless of whether G41 or G42 is active. If compensation is not active at the time you program #1030, the value will come into effect when compensation is activated.

#1030 is ignored for pocket canned cycles.


If compensation is active at the time the variable is read, the compensation will go into effect immediately. The axis or axes will re-compensate by making a move perpendicular to the next move programmed in that plane (G17, G18, G19). Also, if the variable is read with tool compensation active, you cannot program the variable directly before or after an arc (it must occur between two linear moves in the respective plane).

## Motion of Tool During Tool Compensation

In linear-to-linear or linear-to-circular moves, the position at the end of the startup block (block with G41 or G42) will be perpendicular to the next programmed move in the plane. Refer to **Figure 9-10** and **Figure 9-11**.

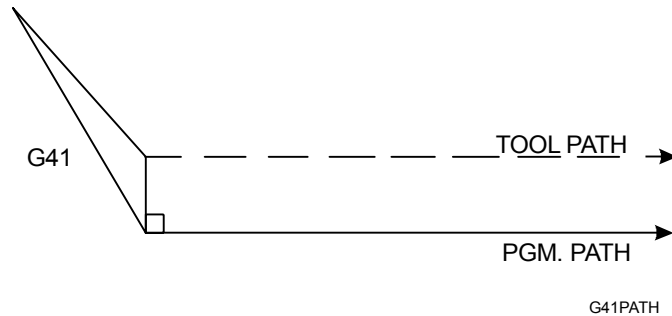

**Figure 9-10, A Linear-to-Linear Move**

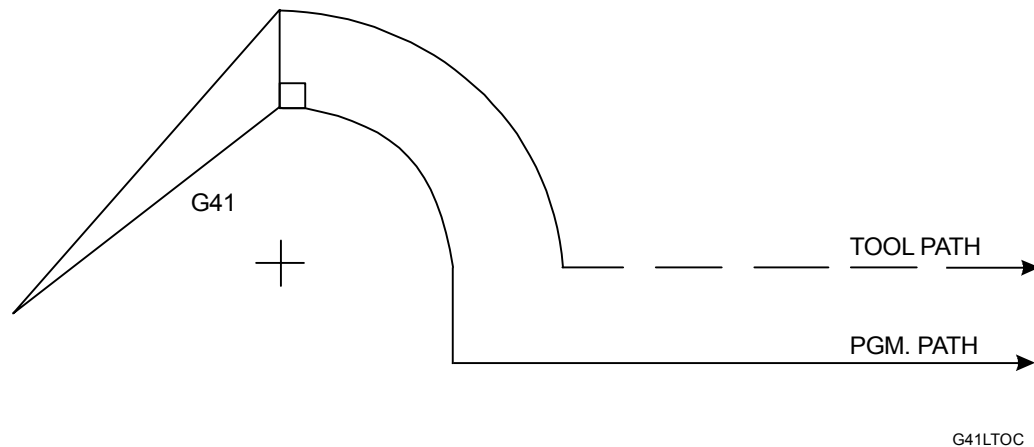

**Figure 9-11, A Linear-to-Circular Move**

In either case, the axes will move to a point perpendicular to the next move during the startup block.


The length of the XY move that activates compensation must be equal to or greater than the tool radius value. Example: If tool radius equals .3750", the vector length of the XY move that activates compensation must be .3750" or greater.

The same applies to the G40 (comp-off) move.

Refer to [Figure 9-12, Paths During Tool Compensation](#). During tool compensation, the CNC performs offset correctly and automatically. Non-positioning moves such as dwells, coolant, or other auxiliary functions are allowed. Moves in the third-axis are also allowed during compensation.

You cannot program a plane change (G17, G18 or G19) during tool compensation. However, a 2-axis move off the currently active plane is allowed.

For example: G17 is the active plane (compensation in XY). You program an XZ or YZ move. The Z-axis will reach the programmed target as X/Y reaches its compensated target. Helical moves in the active plane are also allowed. Do not program 3-axis moves during tool compensation.

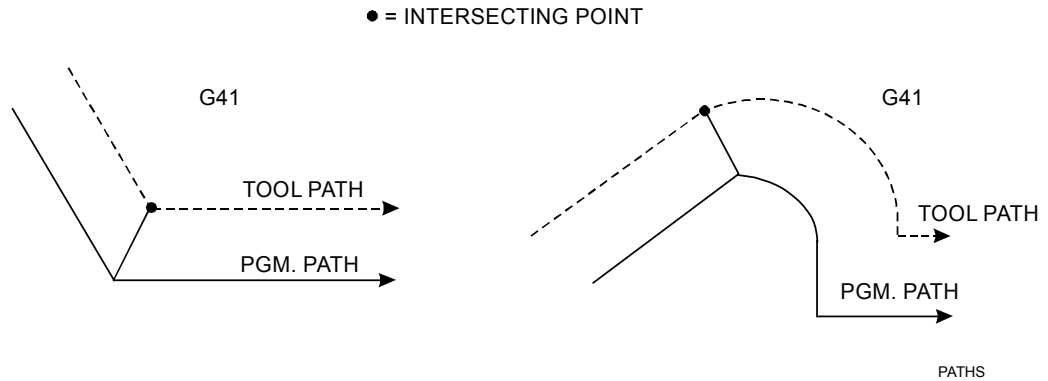


**Figure 9-12, Paths During Tool Compensation**

Program G40 (cancel compensation) alone or with a move in the active plane. The move must be in rapid (G0) or feedrate (G1). Deactivation with G2/G3 is not permitted. The move must be at least the tool radius in length.

The CNC "looks ahead" to following blocks in order to compensate correctly. When it 'sees' an upcoming G40 block, the CNC positions the tool perpendicular to the last move before the G40 block.

**Figure 9-13** shows tool movement as compensation is deactivated.

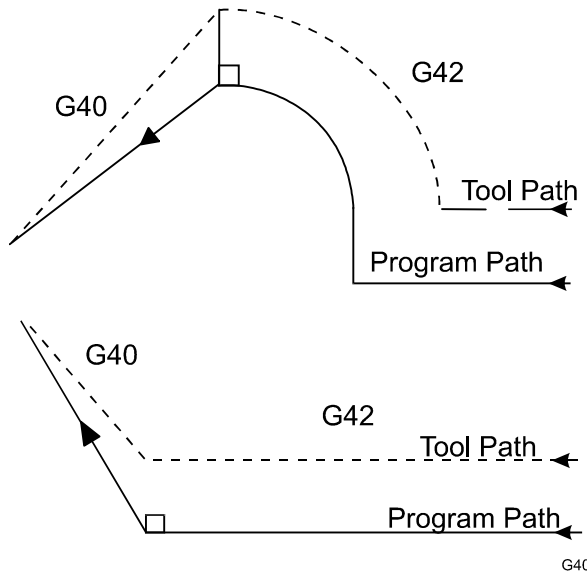

**Figure 9-13, Offset Cancel**

The tool moves to a point perpendicular to the last move before the G40 (deactivation) move.

## Compensation Around Acute Angles


Refer to "[Temporary Change of Tool Diameter.](#)" During compensation, the CNC finds the compensated intersection of moves and travels to that point.

On very sharp angles, this is not always desirable. For example, if you compensate along the outside of a 15-degree corner angle, the compensated intersection point will be far away from the actual point on the work. Time is wasted by "cutting air" until the compensated point is reached. To save time, the CNC creates an arc around the end of the point on the work.

The CNC applies the arc where there are angles of 15 degrees or less. This can be set in the Setup Utility or in the program. To change the angle via program, set #1031.

Example: to change an angle to 10 degrees, program: #1031=10. Re-program this value to 15 degrees (default) when finished.

The bottom part of **Figure 9-14** shows how the CNC will automatically "round" the compensated intersection. The work will remain a sharp corner.

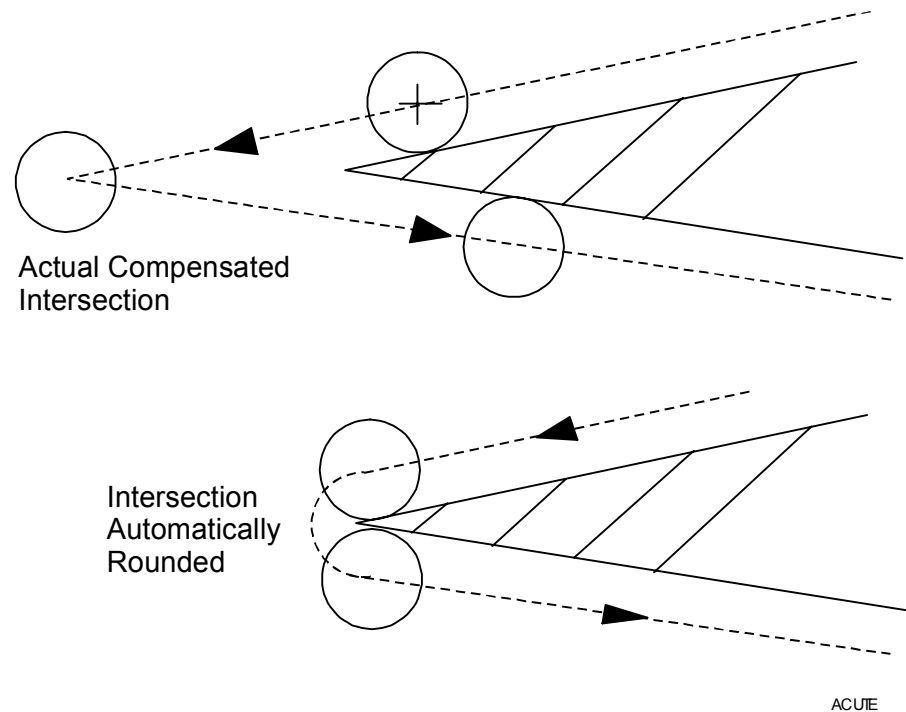


**Figure 9-14, Compensation around an Acute Angle**


### Change of Offset Direction

In Offset Mode, you can change the offset direction in special cases without cancellation by G40. Refer to **Figure 9-15** and **Figure 9-16**. The change is not available in the startup block, in the block that follows it, in the cancel block, or in the one previous to the cancel block.

The offset amount is assumed to be positive.

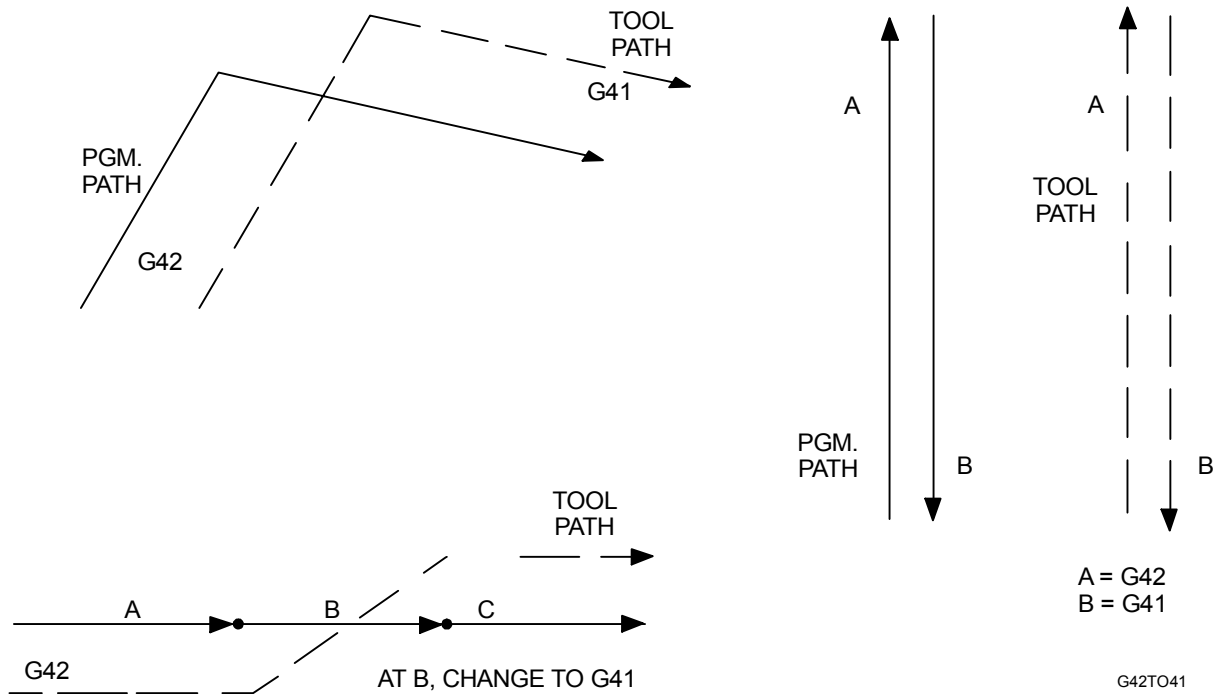

**Figure 9-15, G42 to G41**

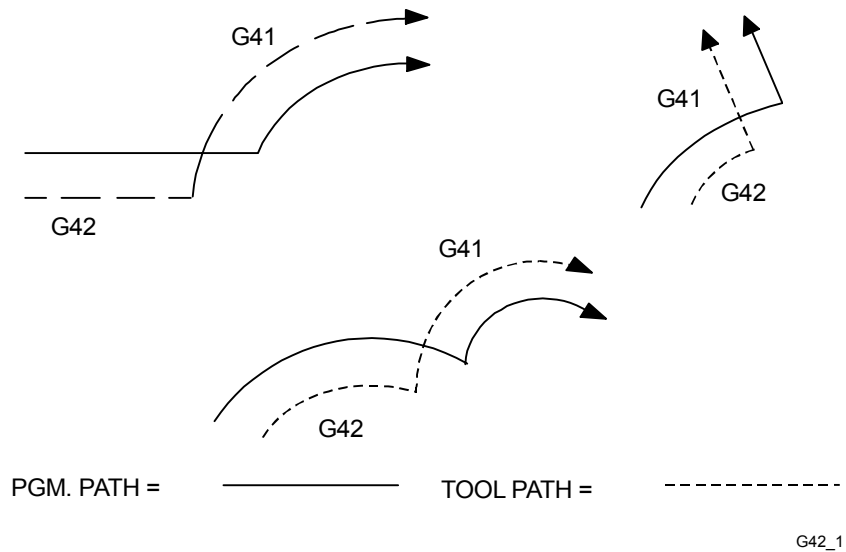

**Figure 9-16, G42 to G41, Curved Paths**


**General Precautions**

1. When you program tool path instead of part edge, a negative diameter in the Tool Page effectively changes G41 to G42 in the moves during compensation.
2. Third-axis moves (not in the active plane) are permitted during compensation.
3. The CNC automatically rounds off the compensated intersection of acute angles of 15 degrees or less. To change this value, program #1031.
4. It is possible to change the tool diameter currently in use with "stock" variable #1030.
5. Startup (Ramp On) and cancellation (Ramp Off) blocks must be of G0 or G1 type, and must be at least the tool radius in length.
6. You must enter proper diameter value in the Tool Page before you use tool compensation.
7. Compensated arcs must be on the active plane (G17 = XY, G18 = XZ, G19 = YZ).
8. G53, G92 are permitted during compensation.
9. In Manual Mode, any active compensation deactivates.
10. **Jog/Return** is permitted during compensation.
11. System variable #1032 is available to change the number of blocks the CNC can "look-ahead" while in tool-comp.

**CAUTION: Changing this value can change the compensated tool path. This variable enables further look ahead to prevent undercut (excessive tool diameter). At default, the CNC looks ahead far enough to find a valid intersection between the current and next move. Set the variable #1032 before you turn on the compensation (G40, G41 or G42).**

### G41 Programming Example

Tool compensation can be activated with G41 or G42. Therefore you can program the part-edge directly, rather than having to calculate the offset manually. Refer to **Figure 9-17** and **Table 9-2**. On a 3/8" diameter end mill, the diameter value in the Tool Page for Tool #1 is .3750".

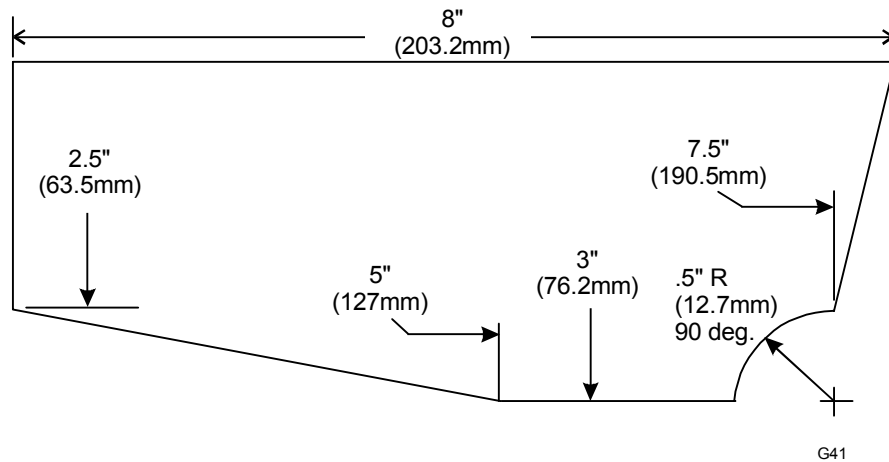

**Figure 9-17, Motion Example using G41: Absolute (G90)**

**Table 9-2, Motion Example Using G41**

Standard	Metric
N1 O1010 * COMP-EX-1	N1 O1010 * COMP-EX-1
N2 G90 G70 G0 T0 Z0	N2 G90 G71 G0 T0 Z0
N3 X-3.0 Y1.0	N3 X-76 Y25
N4 T1 * .375 MILL	N4 T1 * 9.52 MILL
N5 G41 X-.5 Y0	N5 G41 X-12 Y0
N6 Z.1	N6 Z2
N7 G1 Z-.125 F5.0	N7 G1 Z-3.175 F125
N8 X8.0 F12.0	N8 X203.2 F300
N9 X7.5 Y-2.5	N9 X190.5 Y-63.5
N10 G3 X7.0 Y-3.0 I0 J-.5	N10 G3 X177.8 Y-76.2 I0 J-12.7
N11 G1 X5.0	N11 G1 X127
N12 X0 Y-2.5	N12 X0 Y-63.5
N13 Y.5	N13 Y12
N14 G0 Z.1	N14 G0 Z2
N15 G40 X-3.0 Y1.0	N15 G40 X-76 Y25
N16 T0 Z0	N15 T0 Z0
N17 M2	N17 M2


Refer to **Table 9-3** for details on N-words.

**Table 9-3, N-Codes and their Functions**

N-Code	Function
N1	Establishes program # and name.
N2	Sets Absolute, Inch, Rapid; cancels tool offset, raises Z-axis.
N3	Moves to tool change position.
N4	Activates tool length comp., also contains comment (*).
N5	Activates tool diameter compensation and positions tool.
N6	Positions Z above part.
N7	Feeds Z to depth, at feedrate of 5.
N8	Feeds first element of contour at new feedrate.
N9	N9 to N13 feeds around contour.
N14	Rapids Z above part.
N15	Disables diameter compensation during rapid move to X-3.0 Y1.0.
N16	Cancels tool, moves Z to home position.
N17	Ends program, resets CNC to N1.

**G42 Program Example**

Refer to **Figure 9-18** and [Table 9-4, Milled Pocket Using G42](#) for an example of a milled pocket created using G42.

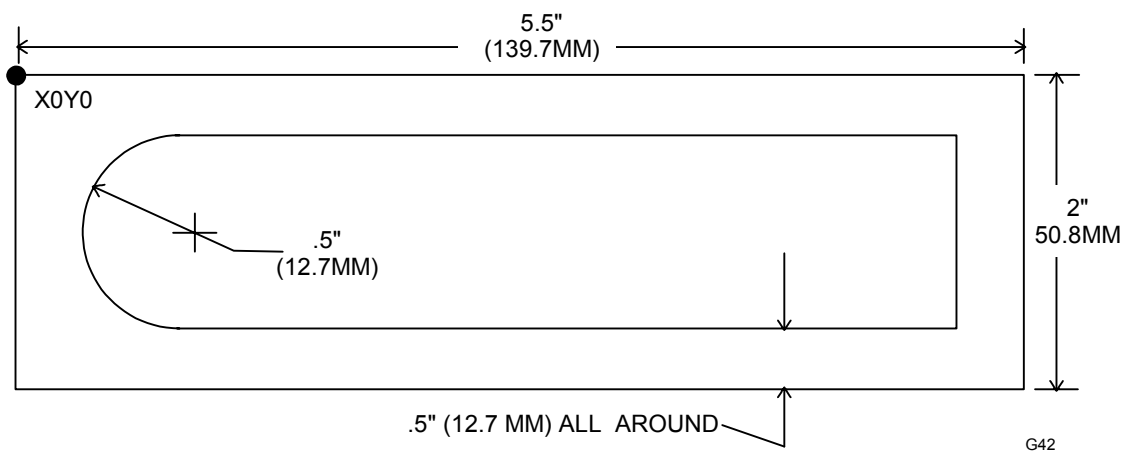

**Figure 9-18, A Milled Pocket Using G42**



**Table 9-4, Milled Pocket Using G42**

Standard	Metric
N1 O1011 * COMP-EX-2	N1 O1011 * COMP-EX-2
N2 G90 G70 G0 T0 Z0	N2 G90 G71 G0 T0 Z0
N3 X-2 Y2	N3 X-50 Y50
N4 T1 * .5000 MILL	N4 T1 * 12.7 MILL
N5 X1.5 Y-1.0	N5 X38.1 Y-25.4
N6 Z.1	N6 Z2
N7 G1 Z-.25 F5	N7 G1 Z-6.35 F127
N8 G42 X.5 F12	N8 G42 X.5 F300
N9 G2 X1 Y-.5 I.5 J0	N9 G2 X25.4 Y-12.7 I12.7 J0
N10 G1 X5.0	N10 G1 X127
N11 Y-1.5	N11 Y-38.1
N12 X1	N12 X25.4
N13 G2 X.5 Y-1 I0 J.5	N13 G2 X12.7 Y-25.4 I0 J12.7
N14 G40 G1 X4.7	N14 G40 G1 X119
N15 T0 G0 Z0	N15 T0 G0 Z0
N16 X-2 Y2	N16 X-50 Y50
N17 M2	N17 M2

Table 9-5 describes N-Codes and their functions.

**Table 9-5, N-Codes and their Functions**

N-Code	Function
N1	Establishes program # and name.
N2	Sets Absolute, Inch, Rapid, cancels tool offset, raises Z-axis.
N3	Moves to tool change position.
N4	Activates tool length comp., block also contains comment (*).
N5	Positions to inside of pocket.
N6	Position Z above part.
N7	Feeds Z to depth at feedrate of 5.
N8	Initiates compensation during feed move to arc start point.
N9 to N13	N9 to N13 feeds around slot's contour.
N14	Deactivates comp during move to clean-up center of pocket.
N15	Cancels tool offset and rapids Z home.
N16	Moves to tool (part) change position.
N17	Ends program, resets CNC to N1.

### Activating Offsets via the Program

In a program, T1 (by itself) calls the Tool Page diameter offset for the specified tool. T1 with D, R, and L address words programs a temporary diameter/radius and length offset independent of the Tool Page. The entered D (diameter) or R (radius) and L (tool length) offsets remain active until you cancel the active tool. Refer to **Table 9-6**.

**Table 9-6, Activating Offsets Using T1**

T1 Format	Description
<b>T1</b>	Activates Tool #1 diameter offset listed in the Tool Page.
<b>T1 D.5000 L-1.2500</b>	Applies a diameter offset of .5000 and length offset of -1.2500 to the active tool.
<b>T1 R.2500 L-1.2500</b>	Applies a tool radius value of .2500 and length offset of -1.2500 to the active tool.

The diameter offset takes effect when you program G41 or G42. All dimensions are in reference to the work surface.

**CAUTION:** If you use T1 to activate a tool later in the program, the Tool Page offsets for Tool #1 will be used (not the values programmed via T1 Dn/Rn Ln).

**NOTE:** ANILAM recommends that you use the Tool Page to avoid confusion or possible entry errors on the offsets.

### Setting RefProg Offset

Activate the **RefProg** key by pressing **Tool (F9)**, **Offsets (F1)**, then **RefProg (F1)**. Refer to **Figure 9-19**.

<p style="text-align: center;"><b>MACHINE</b></p> <p>X + 1.00000 Y + 1.00000 Z - 2.00000</p>	<p style="text-align: center;"><b>PROGRAM</b></p> <p>X + 2.00000 Y + 2.00000 Z - 1.00000</p>	<p>TOOL: 0    FIXTURE: 0 RPM: 0     100% FEED: 0.0   100%</p> <hr/> <p>G: G01 G17 G40 G70 G90 M: M05 M09</p>
------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------

No.	Di	G53 Offset				Type
		X	Y	Z	U	
1	0	2.00000	2.00000	-1.00000	0.00000	
2	0					
3	0					
4	0	1.				
5	0	2.				
6	0	3.				
7	0	4.				
8	0	5.				
9	0	6.				
10	0	7.				
11	0	8.				
12	0	9.				
13	0	10.				
14	0	11.				
15	0	12.				
		13.				

RefProg			CalibX	CalibY	CalibZ	CalibU	Exit
---------	--	--	--------	--------	--------	--------	------

REFPROG

**Figure 9-19, RefProg “Fixture Offsets” Pop-up**

When **RefProg** is highlighted, use the calibration keys: **CalibX (F5)**, **CalibY (F6)**, or **CalibZ (F7)** to calibrate an axis work coordinate offset, the calibration value is in reference to the current active offset verses the machine home. With soft key **RefProg** not highlighted, the value placed in the axis register offset table is the value you see displayed under the label “Machine” that is in reference to the machine home. Refer to **Figure 9-19** for the “Machine” label in the top-right corner of the Tool Page.

Three-axis example:

1. Set up all your tools with their offsets coming from machine zero in the Z-axis to the top of the part.
2. To machine the same parts on the reverse side (or an edge), flip the part over onto another vise. At this point all of your tool length offsets have changed, so you have two choices:
  - Reset all the tools
  - Shift the Z in a work offset

If you shift the Z-axis in the work offset, you do not need to reset all your tools. To shift the Z-axis in the work offset:


1. Call up any tool and jog it to the top of the now flipped over part.
2. Go to the work coordinate table, press **RefProg** key and then **CaibZ** to set the Z shift register for the difference between the two setups:
  - When you want to do machining on the first set up, you call up one work offset and use all the tools as normal.
  - Then when you want to machine on the other side and the other fixture, you call up the other work offset and all the tools will now be in reference to the top of the part without having to change every tool offset.

## Section 10 - Program Management

The Program Directory provides access to all of the program management and floppy disk utilities. These functions include creating, loading, deleting, restoring and copying programs. The Program Directory also provides access to the floppy disk drives and the communications utilities.

Press **PROGRAM (F2)** to activate the Program Directory from the Manual screen.

The Program Directory's **USER** listing lists the programs stored in the CNC. Refer to **Figure 10-1**. All CNC programs have **.G** extensions after their names. Change the display mode to view programs with other formats.

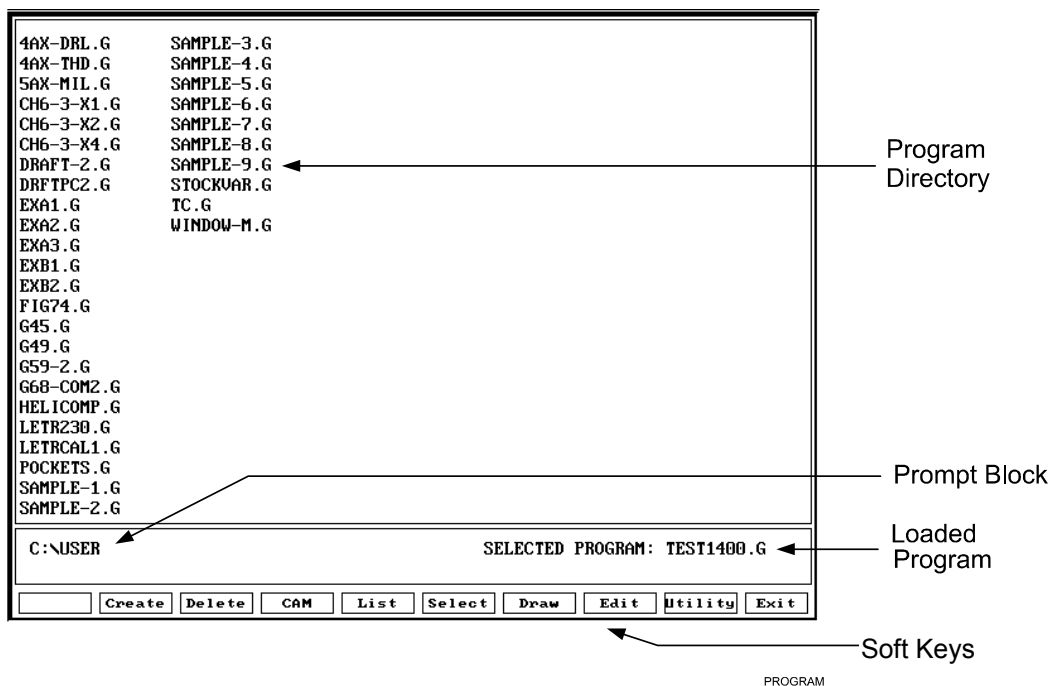

**Figure 10-1, Program Directory**

### Changing the Program Directory

You can change the Program Directory display to one of the following modes:

- Display only part program names (ending with **.G** extensions).
- Display only part program names (ending with **.G** extensions) along with size, date, and time of last edit.
- Display all program names (ending with **.G**, **.S**, and **.?** extensions).

To change the Program Directory display mode, press **Display** (**SHIFT + F9**). The display setting that shows only part program names is usually the easiest to use.

### Viewing All Programs of All Formats

To list all programs of all formats (including **.G** and **.S**):

1. In the Program Directory, press **SHIFT**. The soft key menu changes.
2. Press **Log (F7)**. A pop-up is displayed.
3. Highlight **Other**, and press **ENTER**. The following prompt is displayed:  
**Log to:**
4. Type **\*.\*** and press **ENTER**. The CNC displays all programs of all formats.

<p><b>NOTE:</b> To display only part programs, type <b>*.G</b> (part program extension) at the prompt.</p>
------------------------------------------------------------------------------------------------------------

<p><b>CAUTION:</b> The Program Directory can provide access to internal CNC programs. Tampering with internal programs can cause the control to malfunction.</p>
------------------------------------------------------------------------------------------------------------------------------------------------------------------

## Creating a New Part Program

To create a new part program:

1. In Manual Mode, press **PROGRAM (F2)**. The Program Directory activates.
2. Press **Create (F2)**. The control displays the prompt, **NEW PROGRAM: \_**.
3. Type the new program name.
4. Press **ENTER**. The new program name is inserted in the Program Directory.

## Choosing Program Names

A name cannot be longer than eight characters. If more than eight characters are entered, only the first eight will be used. The CNC displays program names in uppercase letters. No two programs can have the same name. The CNC automatically places the **.G** extension after the name.

## Loading a Program for Running

You must load a program before you can run it. Only one program can be loaded at a time.

To Load a program:

1. In the Program Directory, use **ARROWS** to highlight a program.
2. Press **Select (F6)**. The CNC loads the program. The name of the currently loaded program is displayed next to the **SELECTED PROGRAM** label at the bottom of the screen.

## Selecting a Program for Editing and Utilities

When the required program is highlighted, press **Edit (F8)** to activate the Editor.

<b>NOTE:</b> If the Program Editor is activated in Manual Mode, the Editor will open the loaded program.
----------------------------------------------------------------------------------------------------------


To select a program for editing:

1. In the Program Directory, use **ARROWS** to highlight the program name.
2. Press **Edit (F8)**. The Program Editor activates. The CNC displays the listing for the selected program.

### Maximizing Program Storage Space

The CNC has a fixed amount of space available for program storage. Use the System Information screen to check the availability of space. Refer to **Figure 10-2**.

- ❑ **Total Space Available for the System** is the total amount of program storage space built into the CNC.
- ❑ **Total Free User Space** is the available space for new programs.

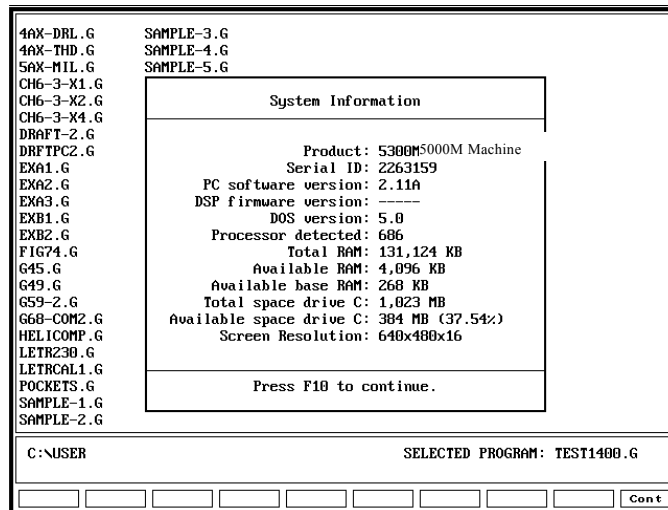

**Figure 10-2, System Information Screen**

When you run a program on the machine (or in Draw), the CNC generates a second program of the same name followed by **.S**. The **.S** programs contain information required by the CNC. Normally, an **.S** program is larger than its associated part program. When you delete a part program, the associated **.S** file is also deleted.

Periodically copy part programs to floppy disks for backup. ANILAM recommends that you do not use the CNC for long-term storage of part programs.

If many outdated programs are allowed to accumulate, the CNC could run out of memory. To make room temporarily, delete the **.S** files of programs that are not currently being used. The CNC will automatically regenerate the **.S** files the next time the programs are run.



## Displaying Program Blocks

List displays the blocks of a selected program. The displayed program cannot be edited. The List feature only works on CNC part programs (.G extension programs).

To list the contents of a program:

1. Select the program from the Program Directory.
2. Press **List (F5)**. The CNC displays the program blocks and the List Soft Key Menu activates. Refer to **Table 10-1**.

**Table 10-1, List Feature Soft Keys**

Soft Key Label	Soft Key	Soft Key Label and Function
<b>PgUp</b>	<b>F5</b>	Scrolls backward through the Program Listing one page at a time.
<b>PgDn</b>	<b>F6</b>	Scrolls forward through the Program Listing a page at a time.
<b>Home</b>	<b>F7</b>	Moves the cursor to the beginning of a program.
<b>End</b>	<b>F8</b>	Moves the cursor to the end of a program.
<b>Find</b>	<b>F9</b>	Enables you to search for specific text or numbers in the program.
<b>Exit</b>	<b>F10</b>	Returns you to the Program Directory.
<b>Next</b>	<b>SHIFT + F9</b>	Finds the next occurrence of the <b>Find</b> selection.

## Deleting a Program

To delete a program:

1. Highlight a program in the Program Directory.
2. Press **Delete (F3)**. The CNC prompts to confirm the deletion and the soft keys change for your response.
3. Press **Yes (F1)**. The CNC deletes the selected program.  
     *– or –*  
     Press **No (F2)**. The Delete command is canceled.

**NOTE:** Deleting a program automatically deletes the associated **.S** file.

## Logging On to Other Drives

The Program Directory displays the programs in the C:\USER directory by default. However, it can be set to show programs stored in other drives or subdirectories. Press **Log (SHIFT + F7)** to activate the pop-up menu. The pop-up lists the following choices: **A:**, **C:**, or **Other**. Select **A:** to display programs stored on a floppy drive. Select **C:** to display user part programs.

To list the programs in another drive or directory, choose **Other**. A prompt is displayed. Enter the full pathname of the drive and directory whose programs will be listed.

To display only the programs in a selected drive or directory:

1. In the Program Directory, press **Log (SHIFT + F7)**. The Log Pop-Up is displayed with the following selections: **A:**, **C:**, or **Other**.
2. Highlight **Other**, and press **ENTER**. The CNC displays the following prompt: **Log to:**
3. Type the full pathname (including drive) of the directory, and press **ENTER**. The CNC displays the programs stored in the specified directory.

## Marking and Unmarking Programs

You can perform some operations on more than one program at a time. The Program Directory enables you to select (Mark) one, some or all of the programs in the **USER** listing.

### Marking Programs

To mark a program:

1. Highlight a program in the Program Directory.
2. Press **ENTER**. The marked program highlights and the highlight bar advances to the next program.
3. Press **ENTER** to mark the next program.

– or –

Press **ARROWS** to highlight another program in the list, and press **ENTER**.

4. Repeat these steps to mark as many program as required.

### Unmarking Marked Programs

To unmark a program:

1. Highlight any marked program, and press **ENTER**. The program is no longer marked.

### Marking All Programs

To mark all programs in the Program Directory:

1. In the Program Directory, press **Utility (F9)**. The Utility Pop-Up Menu is displayed.
2. Highlight **More**, and press **ENTER**. The second page of the Utility Pop-Up is displayed.
3. Highlight **Mark All**, and press **ENTER**. The CNC marks all programs in the Program Directory. (Programs are highlighted.)

### Unmarking All Marked Programs

To unmark all programs in the Program Directory:

1. In the Program Directory, press **Utility (F9)**. The Utility Pop-Up is displayed.
2. Highlight **More**, and press **ENTER**. The second page of the Utility Pop-Up is displayed.
3. Highlight **Unmark All**, and press **ENTER**. The CNC unmarks all programs in the Program Directory. (Programs are no longer highlighted.)

## Deleting Groups of Programs

1. From the Program Directory, mark all of the programs to be deleted.
2. Press **Delete (F3)**. The CNC prompts to confirm the deletion and the soft keys change for your response.
3. Press **Yes (F1)** to delete the selected programs.  
– or –  
Press **No (F2)** to cancel.

## Restoring Programs

A deleted program can be restored if the memory it occupied has not been reused. Sometimes, only a portion of a deleted program can be restored.

To restore a program:

1. From the Program Directory, press **Utility (F9)**. The Utility Pop-Up is displayed.
2. Highlight **Restore**, and press **ENTER**. If the CNC finds programs to restore, it displays a pop-up menu. If the CNC does not find any deleted programs, a **No programs available for restore.** message is displayed.
3. When it finds deleted programs, the CNC lists them in a pop-up menu. Highlight a deleted program, and press **ENTER**. The CNC prompts for the first letter of the deleted program's name.
4. Type the letter, and press **ENTER**. The CNC displays a message indicating whether the program can be restored.
5. Press **Cont (F10)** to restore the program.

<p><b>NOTE:</b> Restored programs might not contain all of the original information. Review any restored programs for accuracy before you attempt to use them.</p>
--------------------------------------------------------------------------------------------------------------------------------------------------------------------

## Copying Programs to Floppy Disks

Copy programs to floppy disks for storage or transfer to other machines.

To copy programs to floppy disks:

1. In the Program Directory, highlight the program or mark all programs to be copied.
2. Press **Utility (F9)**. The Utility Pop-Up Menu is displayed. **Copy** is highlighted. Press **ENTER**. The **Copy to:** Pop-Up is displayed.
3. Highlight the target drive, and press **ENTER**. The CNC copies marked programs to the target drive.

## Renaming Programs

To rename a program:

1. In the Program Directory, highlight a program.
2. Press **Utility (F9)**. The Utility Pop-Up is displayed.
3. Highlight **Rename**, and press **ENTER**. The CNC prompts: **DEST. PROGRAM:**
4. Type new program name, and press **ENTER**. The new name replaces the old name.

## Printing Programs

The CNC can print to any standard IBM PC compatible printer. Use **Print** to make paper copies of part programs. All marked programs are sent to the printer.

To print one or more programs:

1. In the Program Directory, highlight the program or mark all the programs to be printed.
2. Press **Utility (F9)**. The Utility Pop-Up is displayed.
3. Highlight **Print**, and press **ENTER**. The CNC prompts to confirm the command and the soft keys change for your response.
4. Press **Yes (F1)** to print the program(s).

– or –

Press **No (F2)** to cancel.

### Checking Disks for Lost Program Fragments


Computer disks sometimes contain lost program fragments. This might happen if a computer loses power while it is saving a program. Program fragments do not appear in the Program Directory, but they take up valuable program space.

To check for lost program fragments:

1. From the Program Directory, press **Utility (F9)**. The Utility Pop-Up is displayed.
2. Highlight **More**, and press **ENTER**. The second page of the pop-up is displayed.
3. Highlight **Check Disk**, and press **ENTER**. The CNC prompts you to select a drive.
4. Highlight the required drive, and press **ENTER**. The CNC checks the disk. If lost clusters are found, the CNC prompts for recovery instructions and the soft keys change for your response.
5. Press **Yes** to recover lost disk space; press **No (F2)** to cancel.
6. If you choose **Yes (F1)**, the CNC attempts to recover lost disk space. At the end of the procedure, press **Cont (F10)** to return to the Program Directory.

### Displaying System Information

The System Information screen displays specific details about the CNC and software package. Refer to **Figure 10-3**. Most information on this screen is required only at setup or during troubleshooting.

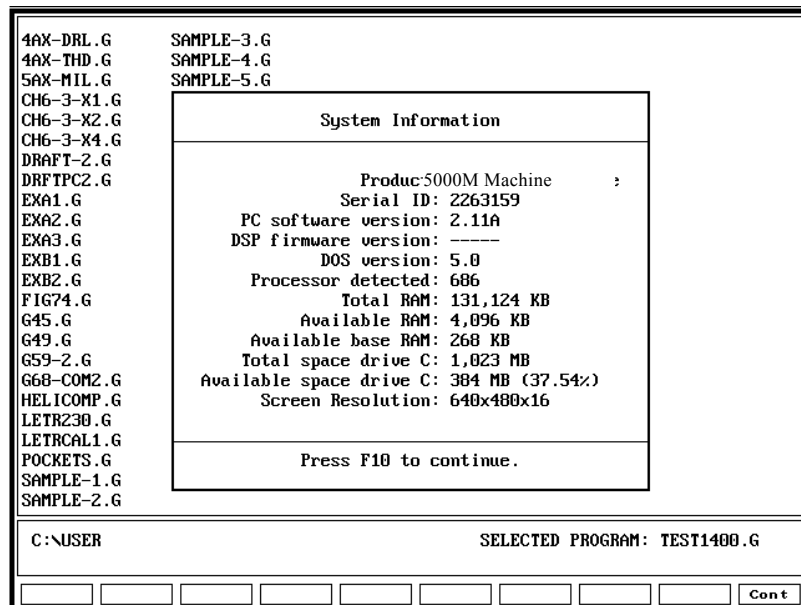

**Figure 10-3, System Information Screen**

To display the System Information screen:

1. In the Program Directory, press **Utility (F9)**. The Utility Pop-Up is displayed.
2. Highlight **More**, and press **ENTER**. The second page of the pop-up menu is displayed.
3. Highlight **System Info**, and press **ENTER**. The System Information screen displays.

### Using Wildcards to Find Programs

The software supports the use of wildcards **?** and **\*** with the following functions:

<b>Copy ?</b>	<b>Del ?</b>
<b>Rename ?</b>	<b>List ?</b>
<b>Print ?</b>	<b>Load ?</b>

**NOTE:** These functions are described in detail later in this section.

**Table 10-2** describes the functions of the wildcards. For most functions that support wildcards (except **Del ?**), when you include a wildcard in the program name, the CNC displays a pop-up listing all filenames that match your entry. Press the **ARROWS** to highlight a program from the list, and then press **ENTER** to select that program.

When you use wildcards with the **Del ?** command, the CNC displays each file matching the description in a separate pop-up. You can delete or skip each program using labeled soft keys.

**NOTE:** Experiment with various wildcard formats to learn the most efficient ways to use wildcards.

**Table 10-2, Wildcard Examples**

Wildcard	Function	You enter:	CNC displays a pop-up that:
<b>?</b>	Replaces one character.	<b>?ROG.G</b>	Lists all <b>.G</b> filenames containing <b>ROG</b> preceded by one character.
		<b>PROG?.G</b>	Lists all <b>.G</b> filenames containing <b>PROG</b> followed by one character.
		<b>P??G.G</b>	List all <b>.G</b> filenames containing <b>P--G</b> with any two characters between.

*(Continued...)*

**Table 10-2, Wildcard Examples (Continued)**

Wildcard	Function	You enter:	CNC displays a pop-up that:
*	Replaces one or more characters in a filename.	<b>PR*.G</b>	Lists all <b>.G</b> filenames starting with <b>PR</b> and followed by other character(s).
		<b>PROG.*</b>	Lists all files named <b>PROG</b> regardless of file format (extension).
		<b>PRO*.*</b>	Lists all filenames starting with <b>PRO</b> and followed by other character(s) of any file format (extension).

### Copying Programs from/to Other Directories

Use **Copy ?** to copy programs to or from another directory, such as a subdirectory or a floppy. **Copy ?** supports wildcards.

To copy programs to or from another directory:

1. In the Program Directory, press **Utility** . The Utility Pop-Up is displayed.
2. Highlight **More**, and press **ENTER**. The second page of the pop-up menu is displayed.
3. Highlight **Copy ?**, and press **ENTER**. The CNC prompts for the name and location of the source program.
4. Type the name and location (complete path) of the program, and press **ENTER**. A pop-up prompts for the destination drive or **Other** destination.
5. Highlight **Other**, and press **ENTER**. The CNC prompts for destination.
6. Type the new location (complete path), and press **ENTER**. The program is copied into the new location.

**Tip:** It is easier to log on to the floppy disk drive that contains the program, mark the program and use the **Copy to:** feature.



## Renaming Programs from/to Another Directory

Use **Rename ?** to rename programs in another directory, such as a subdirectory or a floppy. **Rename ?** supports wildcards.

To rename a program in another directory:

1. In the Program Directory, press **Utility**. The Utility Pop-Up is displayed.
2. Highlight **More**, and press **ENTER**. The second page of the pop-up is displayed.
3. Highlight **Rename**, and press **ENTER**. The CNC prompts for the name and location of the source program.
4. Type the name and location (complete path) of the program to be renamed, and press **ENTER**. The CNC prompts for new name and location.
5. Type the new name and location (complete path) of the program, and press **ENTER**. The CNC renames the program.

**Tip:** The **Rename ?** feature can be used to move a program to a different drive by entering a different program destination.

**Tip:** Sometimes, it is easiest to log on to the floppy drive that contains the program, mark the program and use the **Rename ?** feature.

## Printing Programs from Another Drive/Directory

Use **Print ?** to print programs from another directory, such as a subdirectory or a floppy. **Print ?** supports wildcards.

The CNC can print to any a standard IBM PC-compatible printer.

To print programs from another directory:

1. In the Program Directory, press **Utility**. The Utility Pop-Up is displayed.
2. Highlight **More**, and press **ENTER**. The second page of the pop-up menu is displayed.
3. Highlight **Print ?**, and press **ENTER**. The CNC prompts for name and location of source program.
4. Type the name and location (complete path) of the program to be renamed, and press **ENTER**. The CNC prompts to confirm the instruction and the soft keys change for your response.
5. Press **Yes** to send the program to the printer.

– or –

Press **No (F2)** to cancel the print job.

**Tip:** Sometimes, it is easiest to log on to the floppy drive that contains the program, mark the program and use the **Print** feature.

## Creating Subdirectories

Press **Sub Dir (SHIFT + F2)** to create subdirectories. Ensure that the CNC is in the desired drive before you create a subdirectory.

[Default: **C:\USER**]

To create a subdirectory:

1. In the Program Directory, press **SHIFT**.
2. The soft key menu changes. Press **Sub Dir (F2)**.
3. The CNC prompts for the new subdirectory. Type the subdirectory name. Press **ENTER**. The CNC creates the subdirectory.

## Deleting Programs on Another Drive

You can delete programs on another drive without logging on to that drive via the **Del ? (SHIFT + F3)** command. The command supports wildcards.

To delete a program in another drive:

1. In the Program Directory, press **SHIFT**. The soft key menu changes.
2. Press **Del ? (F3)**. The CNC prompts for the name of the program to be deleted.
3. Type the name and location of the program (complete path), and press **ENTER**. The CNC requests confirmation of the delete command and the soft key menu changes for your response.
4. Press **Yes (F1)** to delete the program.

– or –

Press **No (F2)** to cancel the command.

## Listing a Program in Another Drive/Directory

Press **List ? (SHIFT + F5)** to list a program in another directory. It enables you to list programs in another drive without logging on to that drive. Listing a program enables you to review the program without editing it. The command supports wildcards.

The **List ? (SHIFT + F5)** soft key activates the same soft keys as **List (F5)**. Refer to "[Displaying Program Blocks](#)" in this section.

To list a program in another directory:

1. In the Program Directory, press **SHIFT**. The soft keys change.
2. Press **List ? (F5)**. The CNC prompts for the name of the program to be deleted.
3. Type the name and location of the program (complete path), and press **ENTER**. The CNC displays the Program Listing for the entered program.

## Editing a Program in Another Directory

Press **Edit ? (SHIFT + F5)** to edit a program in another directory. You can edit programs stored in another drive without logging on to that drive. The command supports wildcards.

To edit a program in another directory:

1. In the Program Directory, press **SHIFT**. The soft keys change.
2. Press **Edit ? (F5)**. The CNC prompts for the name of the program to be deleted.

Type the name and location of the program (complete path), and press **ENTER**. The CNC displays the Program Listing for the entered program and activates Edit Mode.

## Optimizing Your Hard Disk

When data is stored on a hard disk, it is stored in areas known as tracks and sectors, similar to those on a CD. As more and more programs are created, deleted, copied, renamed, etc., the hard disk becomes fragmented. Information is stored in random unoccupied spaces. Fragmentation slows down the performance of the hard disk. Therefore, it will take longer to access information. To minimize fragmentation, you must optimize your hard disk periodically. Your CNC has a built-in disk optimizer. ANILAM recommends that you optimize your hard disk bi-monthly, or at the very least, once every six months.

### Accessing the Disk Optimizer

To access the Disk Optimizer:

1. In Manual Mode, press **Program (F2)**. Press **Utility (F9)**. A pop-up is displayed.
2. Highlight **MORE....** Press **ENTER**. The first entry in the window, Disk Optimize highlights.
3. Press **ENTER**. The Optimizer automatically scans the hard disk directories and examines the hard disk. This process takes up to three minutes.
4. When the process is complete. A pop-up is displayed. You can **Begin Optimization** or **Exit Optimizer**.

<p><b>NOTE:</b> Optimization is an automatic process; do not interfere with it while it is running. If an emergency arises, press <b>Cancel (F9)</b> to halt optimization.</p>
--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

5. The optimization process normally takes fifteen to ninety minutes, depending on the size of the hard disk. To minimize run time, optimize your hard disk as recommended.

6. During optimization, the CNC displays the various processes that are taking place.
7. When optimization is complete, the CNC displays: **OPTIMIZATION COMPLETE...Press any key to exit.**
8. Press any key to return to the Program Directory.

## Section 11 - Running Programs

**NOTE:** Verify all programs in Draw before you run them. Refer to [“Section 8 - Viewing Programs with Draw.”](#)

There are three modes of programmed operation:

- ❑ **Single-Step Mode** Runs a program one block at a time.
- ❑ **Motion Mode** Runs a program from motion to motion, without stopping on non-move blocks (such as G41).
- ❑ **Automatic Mode** Runs a program automatically, without pausing.

The screens for all three modes resemble the Manual screen. Use the soft key labels to distinguish between modes. The CNC highlights the label for the active mode.

You must load a program before you can run it to cut a part. Load programs from the Program Directory. Refer to [“Section 10 - Program Management”](#) for information on how to load programs.

The Manual Data Input Mode (MDI) enables you to program a few quick moves without having to create and save a program. MDI is usually used for manual operation. It is available only in Manual Mode.

All programming tools, moves and cycles are available in MDI.

Refer to [“Section 3 - Manual Operation and Machine Setup”](#) for additional information.

### Running a Program One Step at a Time

The Single-Step screen accesses two execution modes: the Single-Step Mode (**S.STEP**) and the Motion Mode (**MOTION**). Single-Step Mode runs a program block by block; Motion Mode runs a program from motion to motion. Both of these modes enable you to step through the program and verify the moves before you cut an actual part.

Refer to [Figure 11-1, Single-Step/Motion Screen](#). The S.STEP screen looks like the Manual screen, but with fewer soft keys and **S.STEP (F5)** highlighted.

To run a program in Single-Step Mode:

1. Go to the Program Directory, select a program and press **Load (F6)** to load the required program.
2. Press **Exit (F10)** to return to the Manual screen.
3. In Manual Mode, press **S.STEP (F5)** to activate Single-Step Mode.
4. Press **START** to execute each block or motion.

**NOTE:** In Auto Mode, press **S.STEP (F5)** to activate Single-Step Mode.

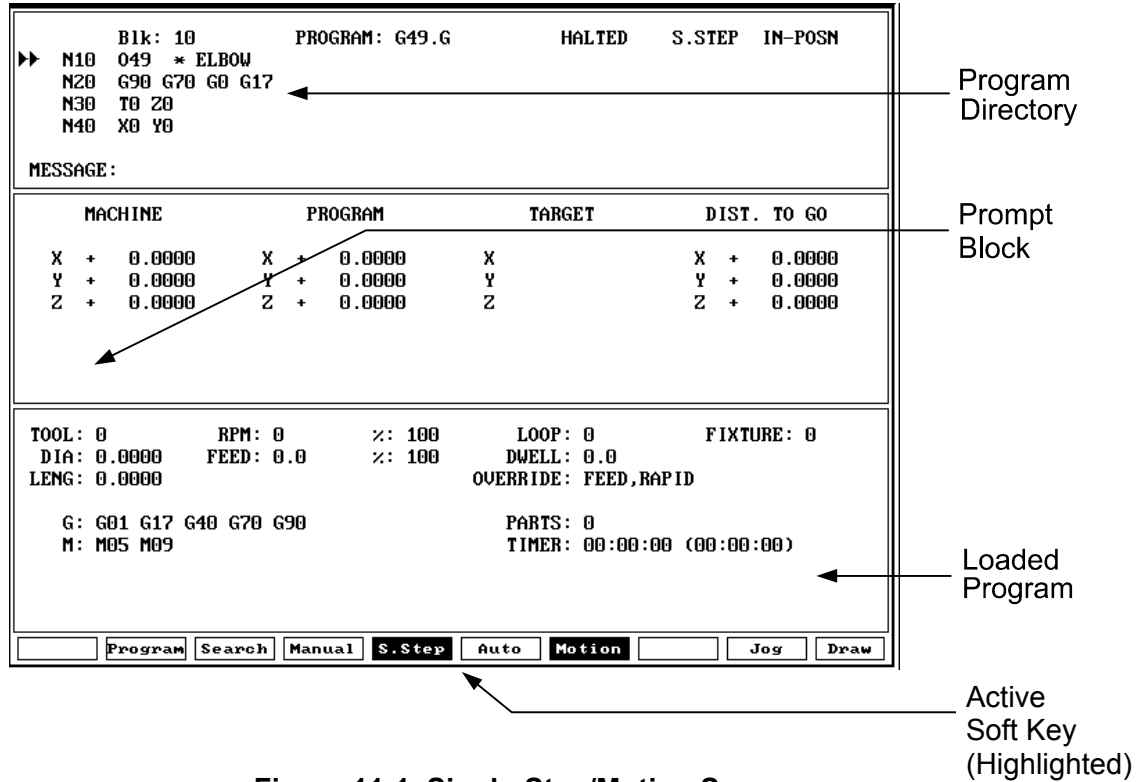


Figure 11-1, Single-Step/Motion Screen

### Switching Between Motion and Single-Step Mode

Press **MOTION (F7)** to switch between Single-Step (**S.STEP**) and Motion Mode (**MOTION**). When Motion Mode is active, **MOTION (F7)** highlights.

- ❑ In Single-Step Mode, the CNC holds before it executes each block. Press **START** to execute each block.
- ❑ In the Motion Mode, the CNC holds before it executes each machine move, but not before non-motion blocks. Press **START** to execute each machine move.

### Holding or Canceling a Single-Step Run

Press **HOLD** to halt the execution of the program. Press **START** to restart a program that is on hold. Press **MANUAL (F4)** to cancel a program that is on hold. When you cancel a program, the CNC terminates tool compensation and canned cycles. All other modal settings remain active.

## Single-Step Execution of Selected Program Blocks

### Using Arrows to Select a Starting Block

Select the starting block before you start program.

1. Load the required program and return to the Manual screen.
2. Press **S.STEP (F5)** to activate Single-Step Mode.

**NOTE:** To switch to Manual Mode, press **MOTION (F7)**.

3. Highlight the desired starting block using the **ARROWS**.
4. Press **START** to execute the next block or motion.

### Using SEARCH to Select a Starting Block

Use **SEARCH** to locate a specific block number or entered text. The CNC highlights the first block found that contains the specified information. **SEARCH** only searches forward in the program. Begin the search from the starting block to search through the entire program.

1. From the Program Directory, load the required program and return to the Manual screen.
2. Press **S.STEP (F5)** to activate Single-Step Mode.
3. Press **SEARCH (F3)**. The CNC prompts for search number or text.
4. Enter the required number or text and press **ENTER**. The CNC runs the search and highlights the first block it finds that contains the number or text.
5. Press **START** to run the program from the highlighted block.

**NOTE:** After you start the program, it will execute normally.

### Switching from Single-Step Mode to Auto Mode

To switch from Single-Step Mode to Auto Mode:

1. In Single-Step Mode, press **AUTO (F6)** to complete the current move, then hold.
2. Press **START** to restart the CNC and run the rest of the program in Auto Mode.

### Position Display Modes

Position Displays for X, Y, Z, U, and W show:

- ❑ **Machine**            Movement to the programmed (commanded) position in reference to Machine Home.
- ❑ **Program**            Movement to the programmed (commanded) position in reference to Machine Home.
- ❑ **Target**              The commanded position.
- ❑ **Distance to Go**    Distance to go to reach the commanded position.


### Automatic Program Execution

The Auto Mode is the CNC's production mode. All or any part of a program can be executed in the Auto Mode. Put the CNC in Auto Mode from either the Manual or Single-Step Modes.

The Auto screen is similar to a Manual screen, but has fewer soft keys. The **AUTO (F6)** soft key label highlights when the Auto Mode is active. Refer to **Figure 11-2**.

To run a program in Auto Mode:

1. In the Program Directory, load the required program and return to the Manual screen.
2. Press **AUTO (F6)** to activate Automatic Mode.
3. Press **START**. The CNC begins to execute program blocks.

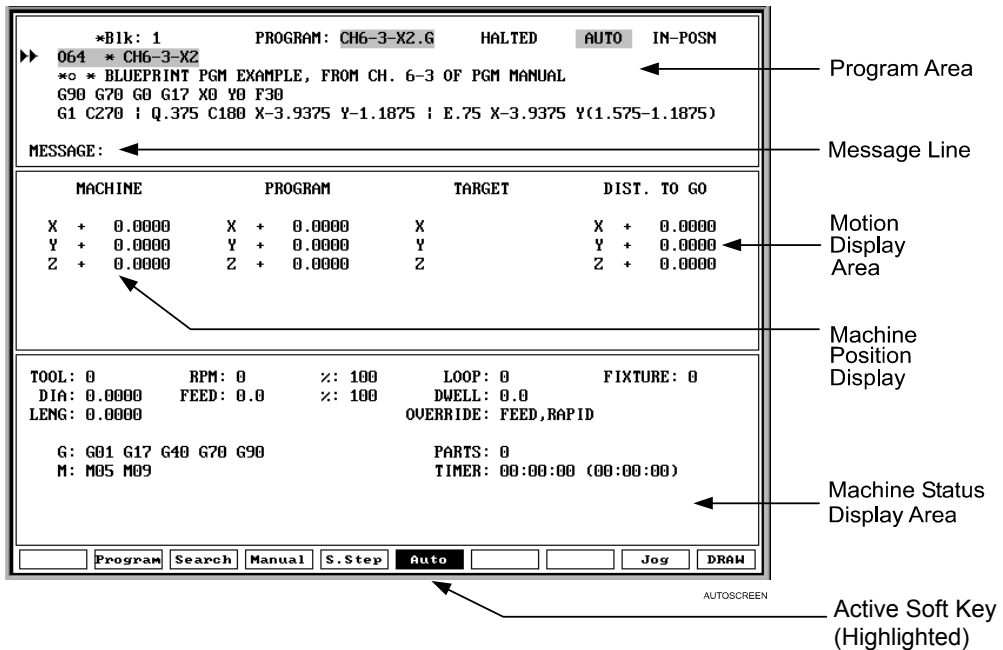

**Figure 11-2, Auto Screen**



### Holding or Canceling an Auto Run

Press **HOLD** to halt the program. To restart a program on hold, press **START**. To cancel a program that is on hold, press **MANUAL (F4)**. The CNC cancels any active tool compensation and canned cycles. Modal settings (such as Absolute Mode or Inch Mode) remain active.

### Starting at a Specific Block

#### Using Arrow Keys to Select Starting Block

1. From the Program Directory, select the required program and return to the Auto screen.
2. Use the **ARROW** keys to highlight the required starting block.
3. Press **START** to begin automatic program execution from the selected block.

#### Using SEARCH to Select Starting Block

**SEARCH** directs the CNC to search the program for a block number, a block that contains a number, or a block that contains specific text. The CNC highlights the first block it finds that contains the search text.

**SEARCH** searches forward in the program until it reaches the end of the program and then wraps to the beginning. Perform the search before you run the program for production.

1. From the Program Directory, load the required program and return to the Manual screen.
2. Press **AUTO (F6)** to activate Auto Mode.
3. Press **SEARCH (F3)**. The CNC prompts for search number or text.
4. Enter the number or text and press **ENTER**. The CNC runs the search and highlights the first block it finds that contains the number or text.
5. Press **START** to begin to execute the program from the highlighted block.

<b>NOTE:</b> After you start the program, it will execute normally.
---------------------------------------------------------------------

### Clearing a Halted Program

When the CNC encounters a program block that generates an error, it displays a Warning or error message and halts the program. Go back to Manual Mode to correct the problem.

A program error could generate more than one message. Refer to "[Section 2 - CNC Console and Software Basics](#)" for instructions on reviewing undisplayed error messages.

After you correct the program, load and restart it at the appropriate block.

### Using Draw while Running Programs


In Real Time Draw the CNC displays moves as it executes them. The active **S.Step (F5)** or **Auto (F6)** highlights as does **DRAW (F10)**. Refer to **Figure 11-3**.

All display options in Draw Simulation Mode are available in the Real Time Draw Mode. Make all changes from Draw Simulation Mode before you run the program.

**NOTE:** Press **CLEAR** to clear the Draw display.

To activate **Draw** while running a program:

1. Load the required program and put the CNC in **S.STEP** or **AUTO** Mode.
2. Press **DRAW (F10)** to activate the Real Time Draw screen and change the soft keys.
3. Press **START** to run the program. The CNC displays moves as it executes them.

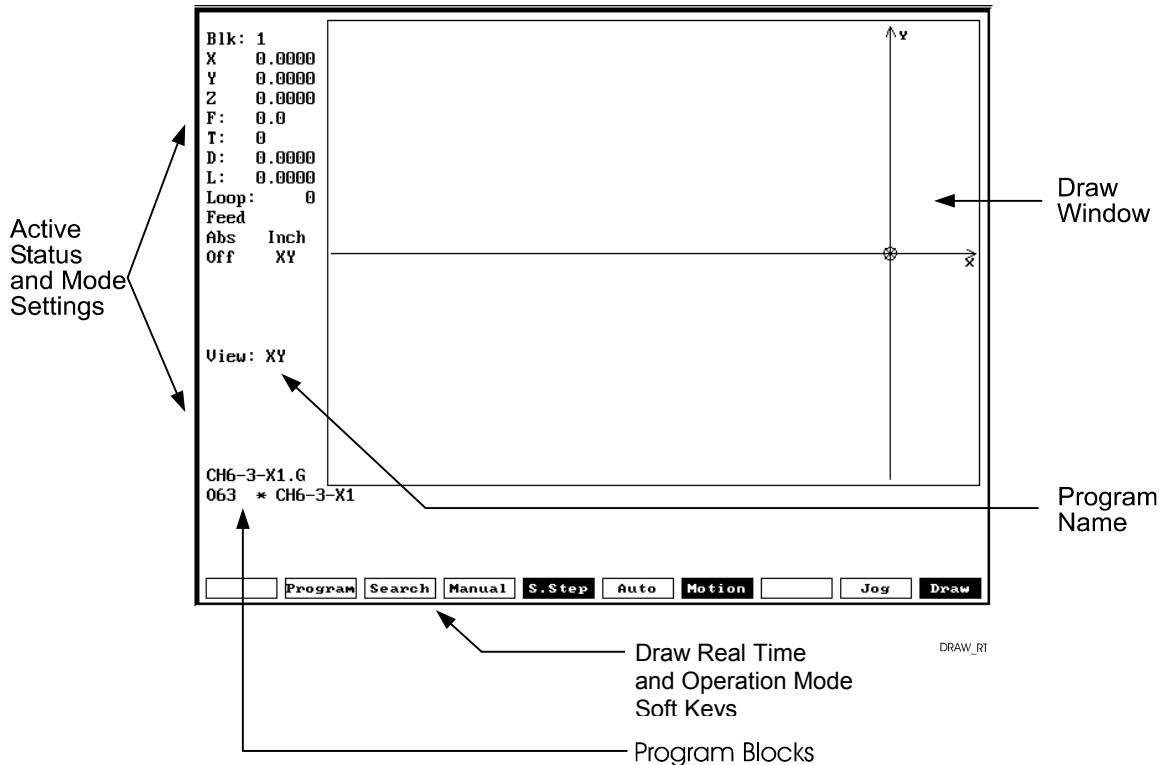

**Figure 11-3, Draw (Real Time Mode)**

## Setting the CNC to Display an Enlarged Position Display

In the Manual, Auto, and S.Step Modes, you can set the CNC to display an Enlarged Position Display. The Enlarged Position Display is displayed in middle of the screen and shows motion to programmed positions. Refer to **Figure 11-4**.

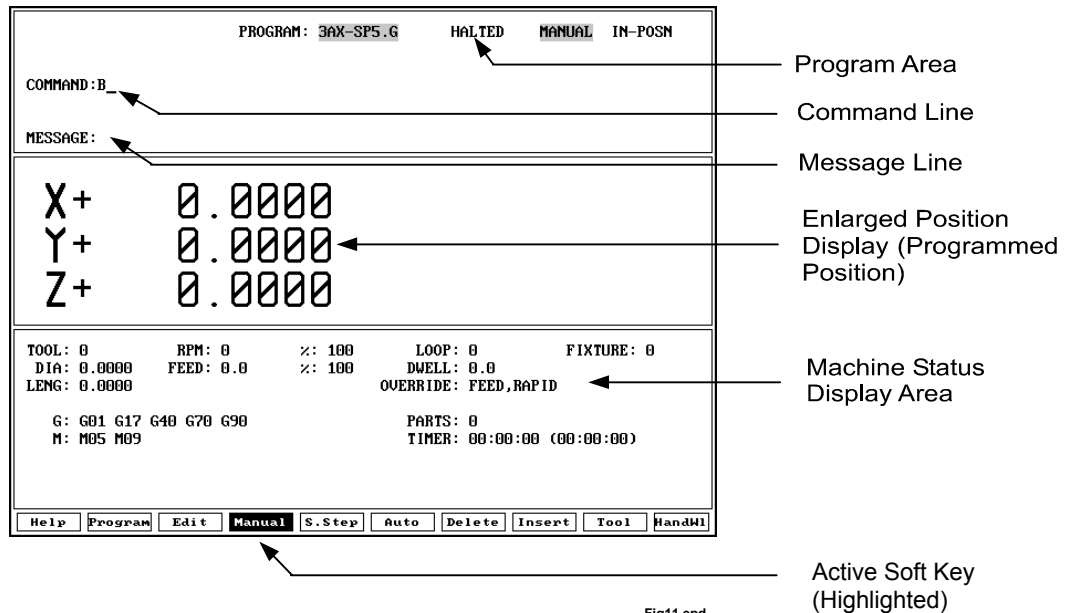


Fig11 epd

### Figure 11-4, Enlarged Position Display

To switch the display between the Enlarged Position Display and the default position display, in Manual Mode at the command line, type **B**. Press **ENTER**.

To switch the display between the Enlarged Position Display and the default position displays, in the S.Step/Auto Mode, press **B**.

## Teach Mode

Use Teach Mode to input data to the program file from Manual Mode. You can input axis positions, change modal status and input MDI commands directly to the program.

A series of manual moves or positions can be made into a program, or added to an existing program. Teach Mode is generally used to input data when the desired tool position cannot be easily calculated. Jog commands are also available in Teach Mode.

To store Teach Mode data in another program, you must create the program first. You can also insert Teach Mode data into an existing program.

### Initiating Teach Mode

Select a program. In Manual Mode, press **TEACH (SHIFT + F5)** to put the CNC in Teach Mode. After you press **TEACH, Manual (F4)** and **TEACH (F5)** highlight, showing the active mode. The mode designator in the upper-right area of the screen indicates that Teach Mode is active. This screen display is similar to the Auto and S.Step screens. The top area will display the current program name with three lines of the program and a highlighted command line (where data is typed and executed-stored), and the mode of operation. The middle area will display the axes positions, target and distance to go (or Big number display). The bottom area will display the CNC status.

The three lines of program shown will default to the first three blocks of the current program. The **COMMAND:** line will be the third line. This way, you can see the two previous and one subsequent block in case of teaching moves into the middle of a program body. Press the **UP/DOWN ARROWS** to move to a specific block. You can access **Help (F1)** at any time.

### Teach Mode Soft Keys

To activate the Teach Mode Soft Key menu, press **TEACH (SHIFT + F5)** in Manual Mode. Refer to **Table 11-1**.

**Table 11-1, Teach Mode Soft Keys**

Label	Soft Key	Function
<b>Help</b>	<b>F1</b>	Activates Help.
<b>Manual</b>	<b>F4</b>	Activates Manual Mode.
<b>Teach</b>	<b>F5</b>	Activates Teach Mode.
<b>Delete</b>	<b>F7</b>	Deletes text.
<b>Insert</b>	<b>F8</b>	Inserts text.
<b>Quit</b>	<b>F10</b>	Exits Teach Mode and returns to Manual Mode without saving changes.

In Teach Mode, **TEACH (F5)** highlights.

### Inputting Data with Teach Mode

In Teach Mode, the CNC can run data or store it. The highlighted block denotes cursor position. If you input a move at that point, all subsequent blocks will move down in the program structure. If you wish to add blocks at the end of a program, press the **ARROWS** to move the cursor to the last block in the program and input the blocks from there.

Press **START** (not **ENTER**) to input and activate MDI blocks into the program.

Ways to store data include:

**Command data** G-codes, F-codes.

**Axis data** XYZUW positions.

1. If you type **NO COMMAND** or **AXIS DATA** in the command line and press **START**, the CNC will store all axis positions with a G90 code (and switch mode to G90, if necessary).
2. If you type **NO AXIS** or **ONLY COMMAND** in the command line and press **START**, the command data will be stored with the axis positions and a G90 code, and switch mode to G90, if necessary.

**Example:** G1 F.007

When you type the above line in the command line and press **START**, that information and the axes' positions will be input into the program (with G90). G91 will give error if used here.

3. If you type **AXIS DATA WITH or WITHOUT COMMAND DATA** on the command line and press **START**, the block will be executed and stored in the program simultaneously. The mode will change to G91, as shown by active G-codes at bottom of screen. If axis data only is typed, the current modals (G90-G91) will remain in use.

**Example:** G91 G1 X1.5 F.005

## Using Teach Mode

The positional data stored via Teach Mode is always referenced to the current zero point (Program Zero).

1. Press **ENTER** to activate the following switch functions:

**B** Big (Large) number display

**R** Rapid override

**P** PLC status.

For example, press **B + ENTER** to switch to the large number display.

If you press **START** with no data on the command line, the CNC inserts a G90 command with current axis positions.

If you press **START** with command data inputs, the CNC inserts a command to move to the current axis positions and G90 code.

2. Press **START** to activate an axis or execute moves and inputs.

**Command data** is any data other than axis moves or locations. For example, G-codes and F-codes.

**Axis data** is any axis move or location (such as X/Z).

The **Handwheel (F10)** soft key must be active before you initiate Teach Mode. The handwheel cannot be turned on or off while in Teach Mode.

S, M, and T codes can be entered, but they will not be executed in Teach Mode. They must be entered on a block by themselves.

No canned cycles can be executed in Teach Mode.

G91 will change the mode status, displayed at the bottom of the screen in the active G-codes. Press **START** to activate G90.


To end the move without exiting Teach Mode, while a move is being executed press **Manual (F4)**.

## Exiting Teach Mode

To exit Teach Mode and save changes to the program, press **Manual (F4)**. To exit without saving changes, press **Quit (F10)**. The CNC returns to Manual Mode.

## Parts Counter and Program Timer

The CNC keeps track of program run-time (**TIMER**) and the number of completed parts (**PARTS**). The CNC displays Run-time in hours, minutes, and seconds. These two features are available in the Manual, Auto, and S.Step Modes. Refer to **Figure 11-5**.

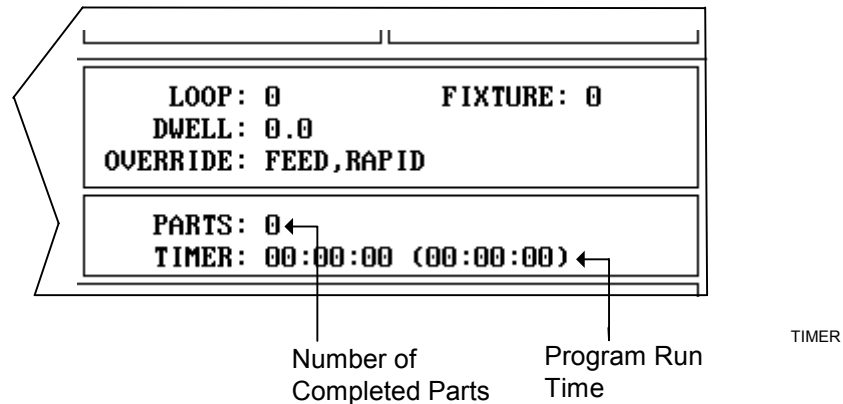

**Figure 11-5, Program Timer and Parts Counter**

The Timer begins timing the program run when you press **START** and stops when it encounters an **M2** block. Therefore, ensure that an **M2** block has been included at the end of the program.

The timer pauses if the CNC holds. The timer stops if you switch to Manual Mode. If you re-run the program before going back to Manual, the total time for all runs is displayed. The Timer values remain the same until you switch to Auto or S.Step Mode again. Then, the timers reset to zero.

The Parts counter starts at zero and increments by one every time the CNC runs an **M2** block. Therefore, ensure that an **M2** block has been included at the end of the program. The CNC continues to count parts when you re-run the program in Auto or Single-Step. The parts counter value is maintained when you switch to Manual Mode, but will reset to 0 when you switch back to Auto or Single-Step Mode. The Parts Counter value can be modified via M-Codes. Refer to [Table 11-2, M-Codes Used with Parts Counter and Program Timer](#).

**Table 11-2, M-Codes Used with Parts Counter and Program Timer**

M-Code	Function
<b>M9355 X0</b>	Prevents the parts counter from resetting to zero.
<b>M9356 X0</b>	Disables the Timer and Counter.
<b>M9376 Xx</b>	Presets any value into the parts counter register. For example, program M9376 X5 to preset 5 in the parts counter register.
<b>M9377 Xx</b>	Adds entered number to the parts counter. For example, if the current parts counter value is 4 and you then program M9377 X6, the new parts counter value will be 10.

### Jog/Return

Jog/Return is a function in the CNC that allows the tool to be removed from the cut while in Auto or S.Step Modes, without switching the CNC to Manual. It has an 'automatic return' capability that will return the tool to its departure point.

It is generally used to check to tool's wear and to change a cutting tool/offset in case of tool breakage or excessive wear in the middle of an operation, or inspect a critical dimension or cut.

#### Initiating Jog/Return

The Jog/Return function may be initiated from the Auto or S.Step modes of the CNC.

To use the Jog/Return feature, the **HOLD** key must be pressed first, before pressing **JOG (F9)**. This ensures that the machine cannot be stopped accidentally while cutting by pressing **JOG (F9)**. In this way, the axes must be halted before the Jog/Return feature may be used.

#### Operations Allowed While "In" Jog/Return

Several motions/functions are allowed after the CNC has been put into "Jog/Return". The axes may be moved using the Manual Panel or by the soft keys. Manual Date Input (MDI) moves are not allowed.

Any Tool-Length Offset can be changed while in Jog/Return mode. Diameter offsets **SHOULD NOT** be altered with in Jog/Return mode (if the current diameter offset is altered, the new value **WILL NOT** take affect until the next time it is activated). **ONLY THE CURRENT TOOL LENGTH OFFSET** should be altered with in this special mode. In this way, if a tool breaks while in an operation, the user may replace the tool, re-set the tool length offset, and "return" the tool to the cut without aborting the program.

This is very useful and saves a great deal of time, if a tool breaks while in the middle of a canned cycle or an extremely long cut.



### Jog/Return Soft Keys

After the axes are halted by the **HOLD** key, and **JOG (F9)** is pressed, a new strip of soft keys related to the Jog/Return function is displayed:

<b>AUTOJOG (F1)</b>	Sends the axes to a pre-determined point, set by the builder (in the Setup Utility)
<b>ZHOME (F3)</b>	Sends the axes to the HOME position
<b>MANUAL (F4)</b>	Cancel the Jog/Return mode, and sets the CNC to Manual mode
<b>RETURN (F6)</b>	Returns the axes to the position they were in when Jog/Return mode was first entered into
<b>COOL ON (F7)</b>	Turns the coolant ON
<b>COOLOFF (F8)</b>	Turns the coolant OFF
<b>TOOL (F9)</b>	Displays the CNC's Tool Page

### AUTOJOG (F1)

**F1 (AUTOJOG)** when pressed sends the axes to a pre-determined point, set by the builder (in the Setup Utility). The default position is Machine Home (X0, Y0, Z0, U0, W0). This is normally a position where a physical tool change can be easily performed.

The order in which the axes retract to the pre-defined position is as follows:

<b>First:</b>	Z retracts to home position
<b>Second:</b>	Y retracts to pre-defined position
<b>Third:</b>	X retracts to pre-defined position
<b>Fourth:</b>	U retracts to pre-defined position (if present)
<b>Fifth:</b>	W retracts to pre-defined position (if present)
<b>Sixth</b>	Z moves to pre-defined position

### ZHOME (F3)

**F3 (ZHOME)** when pressed sends the axes to the HOME position. This is a quick way to retract the tool from a cut, without hitting an overtravel-limit switch. Z Home position is normally at the top of the Z travel.

**WARNING: Check the Z display of MACHINE zero before pressing this key.**

### MANUAL (F4)

**F4 (MANUAL)** when pressed cancels the Jog/Return mode, and sets the CNC to Manual mode.

**RETURN (F6)**

**F6 (RETURN)** when pressed returns the axes to the position they were in when Jog/Return mode was first entered into.

The order in which the axes move to position is as follows:

- First:** Z retracts to home position
- Second:** Y returns to position
- Third:** X returns to position
- Fourth:** U returns to position (if present)
- Fifth:** W returns to position (if present)
- Sixth:** Z returns to position

After all axes return to position, the machine will HALT, and the **START** key must be pressed to continue the program.

**COOL ON (F7), COOLOFF (F8)**

**F7** and **F8** when pressed turn the coolant ON and OFF, respectively. The coolant should be returned to its programmed status before **F6 (RETURN)** is pressed.

**TOOL (F9)**

**F9 (TOOL)** when pressed displays the CNC's Tool Page. This allows the operator to make a change to the CURRENT tool length or wear offset. Only the CURRENT tool length or wear offset should be changed, as it is the only value that will be invoked upon pressing **RETURN (F6)**.

If the CURRENT tool length or wear offset is changed, the new value will be invoked/activated with **F6 (RETURN)** is pressed. If any other values in the Tool Page are changed, the new values WILL NOT be invoked until that tool is (re-) activated at a later time.


**HANDWHEEL (F10)**

Enable or disables handwheel moves.

**EXAMPLES:**

The following are typical scenarios as to how and when to use the Jog/Return function. Assume the CNC is running the program in Auto or S.Step Modes.

**SITUATION 1:**

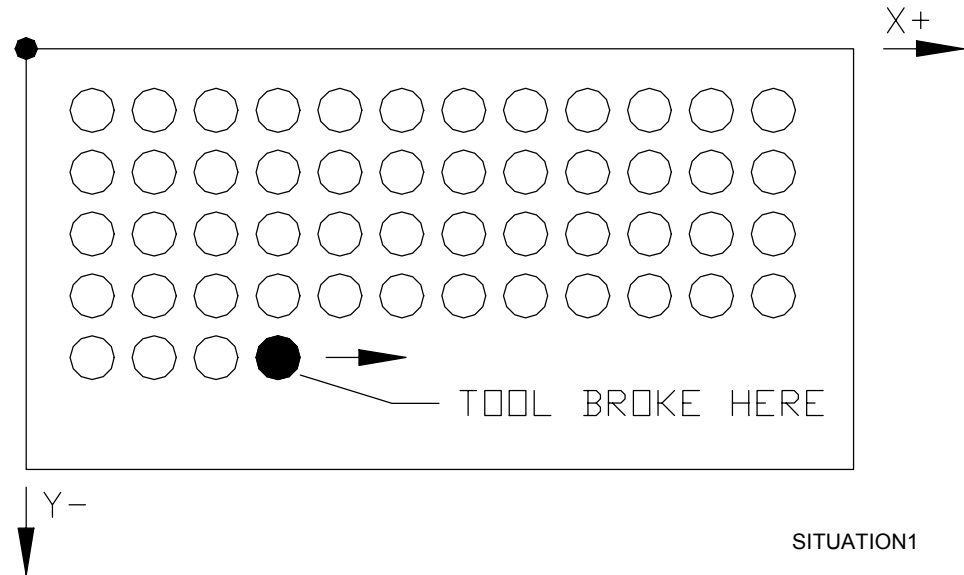

**Figure 11-6, Drilling Illustration**


Refer to **Figure 11-6**. The tool is drilling in an X+ row of holes in a workpiece. The tool becomes dull and breaks.

Keystrokes/operations:

1. **HOLD**
2. **JOG (F9)**
3. **F3 (ZHOME)** to raise Z
4. Press **SPINDLE OFF** to stop spindle
5. Press **F8 (COOLOFF)** to stop coolant
6. Remove drill from holder
7. Place new drill in holder
8. Jog tool over workpiece with Manual Panel
9. Jog tool down to offset surface
10. **TOOL (F9)**
11. **CALIB Z (F8)**
12. **EXIT (F10)**
13. Jog Z+ with Manual Panel [or press **F3 (ZHOME)**]
14. Restart spindle by pressing **SPINDLE FWD**
15. Restart coolant by pressing **F7 (COOL ON)**
16. Press **RETURN (F6)**
17. Press **START** to continue program

The axes will return to the position they were jogged from when the Jog/Return function was initiated, in the described path.

**SITUATION 2:**

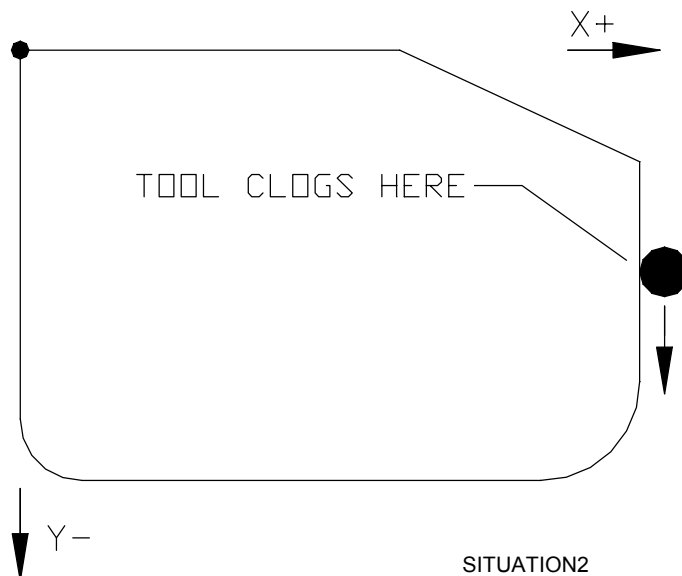

**Figure 11-7, Cutting Illustration**

Refer to **Figure 11-7**. The tool is feeding along a Y- cut on the right side of a workpiece. The tool becomes clogged with materials and is no longer able to cut.

## Keystrokes/operations:

1. **HOLD**
2. **JOG (F9)**
3. **F3 (ZHOME)** to raise Z
4. Press **SPINDLE OFF** to stop spindle
5. Press **F8 (COOLOFF)** to stop coolant
6. Remove end mill from holder
7. Place new end mill in holder
8. Jog tool over workpiece with Manual Panel
9. Jog tool down to offset surface
10. **TOOL (F9)**
11. **CALIB Z (F8)**
12. **EXIT (F10)**
13. Jog Z+ with Manual Panel [or press **F3 (ZHOME)**]
14. Restart coolant by pressing **SPINDLE FWD**
15. Restart coolant by pressing **F7 (COOL ON)**
16. Press **RETURN (F6)**
17. Press **START** to continue program

The axes will return to the position they were jogged from when the Jog/Return function was initiated, in the described path.

**Notes on Jog/Return**

- ❑ Jog/Return is generally only used in trouble situations, where a tool breaks or a tolerance must be checked. It allows the program to be interrupted in AUTO or S.STEP mode, without having to switch to Manual.
- ❑ The **HOLD** key must be pressed prior to **JOG**.
- ❑ Manual Panel moves are allowed while in Jog/Return.
- ❑ Manual Data Input (MDI) moves are not allowed.
- ❑ Tool length or wear offset on the **CURRENT** tool may be altered while in Jog/Return. Care must be taken when updating offsets. The user is responsible for entering tool data correctly. The new **CURRENT** tool length value will be in effect upon pressing **RETURN**.
- ❑ If a limit switch is encountered, the CNC will cancel the Jog/Return mode and switch to Manual mode.
- ❑ The mode can be cancelled at any time by pressing **F4 (MANUAL)**.
- ❑ The Manual Panel is fully active (Handwheel also if present).

## Section 12 - S and M Functions

This section covers S- and M-code formats. Refer to **Table 12-1**. The codes are included in the part program or activated in Manual Mode.

**Table 12-1, S- and M-Codes**

Code	Function
<b>S (Spindle)</b>	Commands spindle speeds (S).
<b>M (Miscellaneous)</b>	Performs miscellaneous (M) functions such as spindle ON/OFF and coolant ON/OFF.

### Speed Spindle Control (S-Function)

**Format:** Sxxx or Sxxxx

Spindle speed is programmed via S-code. The RPM range of the machine determines the S-code rang.

In determining spindle speeds there also may be gear ranges selected by M-codes. For example, you may be able to select four ranges of speed by programming the corresponding M-code for the required range. The machine tool builder specifies the range. Refer to **Table 12-2**.

**Table 12-2, M-Function Selected Ranges**

M-Code	Range Selected
<b>M40 =</b>	Open gear range
<b>M41 =</b>	1 <sup>st</sup> Gear range
<b>M42 =</b>	2 <sup>nd</sup> Gear range
<b>M43 =</b>	3 <sup>rd</sup> Gear range
<b>M44 =</b>	4 <sup>th</sup> Gear range

Check your machine tool manual for details.

### Miscellaneous Functions (M-Code)

Miscellaneous codes control a variety of machine tool functions. Refer to **Table 12-3**. These are assigned by the machine builder. Be familiar with the M-codes available on your machine-control combination. M-function availability varies from one machine to another. Refer to your machine tool manual for a complete list of M-codes.

**Table 12-3, M-Code Controlled Functions**

M-Code	Function
<b>M2 =</b>	Program end
<b>M3 =</b>	Spindle on forward
<b>M4 =</b>	Spindle on reverse
<b>M5 =</b>	Spindle off
<b>M8 =</b>	Coolant on
<b>M9 =</b>	Coolant off
<b>M19 =</b>	Spindle orientation
<b>M20 =</b>	Disable feed hold (machine will not feed without spindle on)
<b>M21 =</b>	Enable feed hold (machine will feed without spindle on)

### Control M-Codes

Control M-codes execute or alter certain CNC functions, such as program end, subprogram call, mirror image, etc.

These M-codes are part of the CNC software. To use them, write the appropriate M-code into the program. Refer to **Table 12-4**.

**Table 12-4, Control M-Codes**

M-Code	Function
<b>M00</b>	<b>Program stop.</b> Program stops indefinitely. Press <b>START</b> to resume.
<b>M01</b>	<b>Optional program stop.</b> If corresponding hardware switch is ON, M01 acts as M00. If switch is OFF, program will ignore M01. <b>NOTE:</b> Appropriate hardware is required for M01.
<b>M02</b>	<b>Program end.</b> At M02, the program stops and returns to the first program block.
<b>M30</b>	<b>Program end.</b> Return to other program. M30 O75 programmed as the last block of a main program will return the CNC to program #75. O75 must be in the same file.
<b>M98</b>	<b>Subprogram call.</b> A block in the main program with M98 P100 will execute subprogram 100. O100 must be in the file after the end of the main program.

Table 12-4, Control M-Codes (Continued)


M-Code	Function
<b>M99</b>	<b>Return from subprogram.</b> M99 ends a subprogram and returns to the main program at the block preceding the last executed program call.
<b>M100</b>	<b>Mirror image.</b> M100 programmed with axis (M100 X) activates “mirror image” (ON) for that axis. Mirror image reverses the sign (+/-) of subsequent numbers. More than one axis can be mirrored at once (M100 XY). To cancel mirror image, program M100 on a block by itself. <b>NOTE:</b> Cutter compensation is mirrored, so switching from G41 to G42 is unnecessary.
<b>M105</b>	<b>Dry-Run, all axes.</b> Program M105 in a program file or in MDI to set Dry Run Mode. CNC executes all feed moves at a rate set by the builder. It enables you to run programs through quickly to check for mistakes. M107 disables Dry-Run. <b>NOTE:</b> Making and saving a change to the Setup Utility will cancel M105.
<b>M106</b>	<b>Dry-Run, NO Z-axis.</b> M106 in a program file or in MDI sets Dry-Run (No Z) Mode. All feed moves are executed at a rate set by the builder, and all Z moves are ignored during the dry-run. This enables you to run through a program quickly, without Z-axis movement. M107 disables Dry-Z-Run. <b>NOTE:</b> Making and saving a change to the Setup Utility will cancel M106.
<b>M107</b>	<b>Dry-Run OFF.</b> Cancels M105 or M106. This returns the CNC to normal operating mode.
<b>M700</b>	<b>Deactivate or set advanced scaling.</b> <b>Example:</b> M700 X2 Y1.5 will deactivate advanced scaling, and set the advanced scale factor to 2x for X and 1.5x for Y.
<b>M701</b>	<b>Activate Advanced scaling.</b> The advanced scaling function allows the scaling factor to be different for the two axes (the plane) involved in arcs or circles. In standard scaling (G72), factors must be the same when cutting arcs. Only program axes are to be scaled. <b>Example:</b> M701 XY will activate scaling for X- and Y-axes, at previously set factors (set by M700). <b>NOTE:</b> Tool diameter compensation is not allowed with M700 and M701.

(Continued...)



**Table 12-4, Control M-Codes (Continued)**

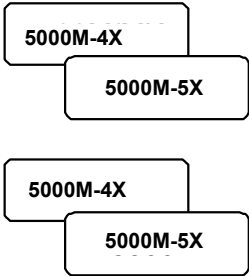M-Code	Function
<b>M800</b>	<b>Deactivate Plane Rotation and Set Angle.</b> You must program the axis of rotation. <b>Example:</b> M800 C15 will deactivate plane rotation about the Z-axis, but set the angle to 15 degrees.
<b>M801</b>	<b>Activate Plane Rotation at Pre-Set Value.</b> (Value set with M800) You must also program the axis of rotation. <b>Example:</b> M801 Cxx will activate plane rotation about the Z-axis at whatever angle was set in C with M800.
<b>M900</b>	<b>Activate 4<sup>th</sup> (U) and/or 5<sup>th</sup> (W) axis synchronization.</b> Axes to be synchronized must also be programmed. <b>Example:</b> M900 U will synchronize the U-axis with XYZ feedrate. All moves' feedrates will be vectored.
<b>M901</b>	<b>Deactivate 4<sup>th</sup> (U) and/or 5<sup>th</sup> (W) axis synchronization.</b> Indicate axes to deactivate synchronization. <b>Example:</b> M901 U will unsynchronize the U-axis with XYZ feedrate.
<b>M1000</b>	<b>Override Continuous Path parameter.</b> Use M1000 to override the "Continuous Path" tolerance parameter in the Setup Utility with a new value. This can be useful if the CNC hesitates between small moves, such as a 3-D surface output from CAD-CAM. <b>Example:</b> M1000 X.125 Y.125 Z .125.
<b>M9244</b>	<b>Servo shut-off code.</b> Typically used if machine is left unattended for a long period of time. You can place this code at the end of the program (before M02) to disable the servos automatically. It is equivalent to pressing <b>E-STOP</b> . <b>NOTE:</b> ANILAM recommends that you place a G04 T2.0 in the block before M9244. This enables the servos to reach definite position before deactivation.
<b>M9247</b>	<b>Readout axis preset.</b> Set axis position for specified DRO port. Used for readout axis – Where, X is the DRO port and Y is the Offset value. <b>Example:</b> M9247 Xx Yy
<b>M9351</b> <b>X302</b>	<b>Clear.</b> Use to clear the Draw Graphics screen at any time. No other code is allowed on this block.



### Order of Execution

The order of execution for available codes is as follows:

T, M, S, F, G, XYZ (M98 P {sub call} is the exception)

**NOTE:** Subprogram call (M98 Pn) will always execute last.

## Section 13 - Communication and DNC

### Communication

The CNC can exchange data with other RS-232 devices. The baud, parity, data bits, stop bits and software parameters of the CNC and other device must agree.

Default communication parameters are entered in the Setup Utility during machine set up. You can change these parameters from the Communication screen. Parameter changes made from the Communication screen are not permanent.

**CAUTION:** Only qualified personnel should attempt to alter settings in the Setup Utility. Incorrect settings could disable the machine.

**NOTE:** The CNC reloads the setup file at power-on.

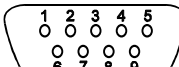
### Installing the RS-232 Cable

RS-232 communication requires a cable connection between the sending and receiving machines. Connect the cable to DE-9 connectors on the CNC chassis and the other machine.

**NOTE:** The machine builder determines the location of the DE-9 connector.

Use a cable designed for RS-232 communication. On cables designed for RS-232 Communication, the wires between Pins 2 and 3 are internally crossed. Data sent from Pin 3 (transmit) of one machine must go to Pin 2 (receive) of the other. Refer to **Figure 13-1**.

RS-232 Connector  
(Male DE-9)



Pin 2 - Data Recieve Pin  
Pin 3 - Data Transmit Pin

DE-9

**Figure 13-1, RS-232 Communication Connector**

**NOTE:** The same requirements apply for Pins 2 and 3 when one of the connectors is a DB-25 serial connector.

Computer cables designed as extension cords for computer peripherals cannot be used for RS-232 Communication because Pins 2 and 3 are not crossed.


### Accessing the Communication Software

To access the Communication screen:

1. In Manual Mode, press **PROGRAM (F2)**. The Program Directory activates.
2. Press **Utility (F9)**. The Utility Pop-Up Menu is displayed.
3. Refer to **Figure 13-2**.
4. Highlight **Communications**, and press **ENTER**. The Communication screen is displayed.

**NOTE:** The default program is highlighted when the Communication screen is activated.

### RS-232 Serial Communication Parameters

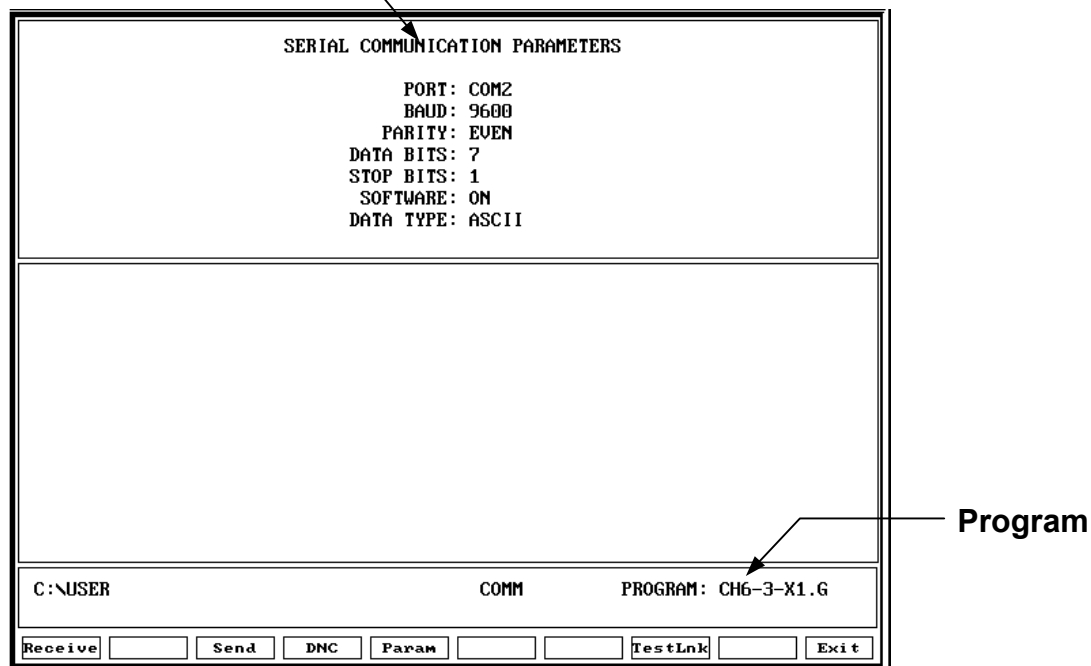

**Figure 13-2, Communication Screen**

#### PROGRAM

The program selected for transmission.

#### SERIAL COMMUNICATION PARAMETERS

Settings required for the two machines to send and receive programs.

## Setting Communication Parameters

This manual does not discuss the merits of the different parameter choices. Refer to an appropriate computer communication guide for more detailed information.

### Selecting the Communication Port

Most CNC installations have at least one RS-232 connector. The connector is usually mounted somewhere on the cabinet and labeled **RS-232**. The CNC is set up to send signals from one of its available RS-232 ports to the RS-232 connector. This setting cannot be changed. Personal computers running the off-line software can use **COM1** or **COM2** if the hardware supports it. .

To select the communication port:

1. In the Communication screen, press **Param (F5)**. The Parameter Settings menu activates.
2. Select **Port**. The Settings pop-up menu displays COM1, COM2.
3. Select one.

### Setting the Baud

The CNC supports the following bauds: 110, 150, 300, 600, 1200, 2400, 4800, 9600, and 19200.

To set the baud:

1. Select **Baud** to display the available options. The current setting is displayed on the Communication screen.
2. In the Communication screen, press **Param (F5)**. The Parameter Settings menu activates.
3. Select **Baud (F2)**. A pop-up menu displays the available options. Select one using the arrow keys, **F3**, **F4**, and select **F5**.
4. Set another parameter the same way, or press **Exit (F10)** to exit to the previous screen.

### Setting Parity

The CNC supports the following parity settings: **Odd**, **Even**, and **None**.

To set the parity:

1. Select **Parity** to display the available options. The current setting is displayed on the Communication screen.
2. In the Communication screen, press **Param (F5)**. The Parameter Settings menu activates.
3. Select **Parity (F3)**. A pop-up menu displays the available options. Select one.
4. Set another parameter the same way, or press **Exit (F10)** to exit to the previous screen.

### Setting Data Bits

The CNC supports the following data bit settings: 7 and 8.

To set the number of data bits:

1. Select **Data Bits** to cycle through the available options. The current setting is displayed on the Communication screen.
2. In the Communication screen, press **Param (F5)**. The Parameter Settings menu activates.
3. Select **Data Bits** to scroll through the available options. Using **Select (F5)**, select one.
4. Set another parameter the same way, or press **Exit (F10)** to exit to the previous screen.

### Setting Stop Bits

The CNC supports the following stop bit settings: 0 and 1.

To set the number of stop bits:

1. Select **Stop Bits** and press **Select (F5)** to cycle through the available options. The current setting is displayed on the Communication screen.
2. In the Communication screen, press **Param (F5)**. The Parameter Settings menu activates.
3. Move the cursor to **Stop Bits** and press **Select (F5)** to scroll through the available options. Select one.
4. Set another parameter the same way, or press **Exit (F10)** to exit to the previous screen.

### Software Setting

The CNC supports the following protocol settings: On and OFF.

Software protocol is frequently referred to as “Xon” or “Xoff”. In commercial communication packages, this is known as “handshaking.”

To set the protocol:

1. Select **Software** to cycle through the available options. The current setting is displayed on the Communication screen.
2. In the Communication screen, press **Param (F5)**. The Parameters Settings menu activates.
3. Move the cursor to **Software** and press **Select (F5)** to scroll through the available options. Select one.
4. Set another parameter the same way, or press **Exit (F10)** to exit to the previous screen.

### Setting Data Type

The CNC supports the following data display types: ASCII and Binary.

This setting does not affect the data exchanged; only how it is displayed on the screen during transmission.

To set data type:


1. Select **DataType** to cycle through the available options. The current setting is displayed on the Communication screen.
2. From the Communication screen, press **Param (F5)**. The Parameters Settings menu activates.
3. Move the cursor to **DataType** and press **Select (F5)** to toggle between the two options. Select one.
4. Set another parameter the same way, or press **Exit (F10)** to exit to the previous screen.

### Testing the Data Link

The CNC has a utility with which to test the data link. For testing, the CNC must be connected to another machine. Set the parameters on both machines. If the other machine has a manual test screen, activate it.

### Activating the Test Link Screen

With the Communication screen active, press **TestLnk (F8)**. The Test Link screen activates. Refer to **Figure 13-3**.

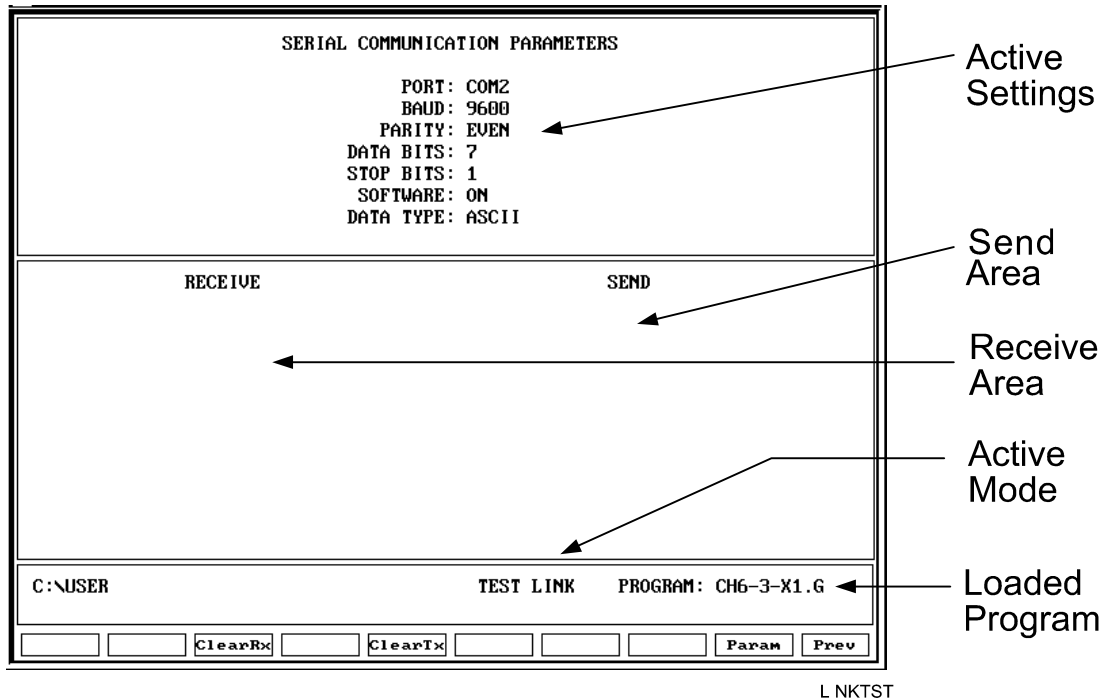

**Figure 13-3, Test Link Screen**

### Setting Test Link Display Modes

To test the link, visually verify that the test data sent matches the test data received. The **Data type** setting determines how characters appear on the screen.

If **Data type** is set to ASCII, letters and numbers are displayed. If the data type is set to **Binary**, the hexadecimal equivalent is displayed. Set both machines to use the same data display type.

**NOTE:** Hexadecimal characters appear as pairs of numbers or numbers and letters.

To change the Link Test screen data display:

1. From the Link Test screen, press **Param (F9)** to switch between ASCII and Binary Modes. The current mode is displayed in the settings area of the Link Test screen.

### Testing the Link

1. Set up an RS-232 connection with another machine (or computer).
2. Set the other machine to receive.
3. With the Link Test screen active, use the CNC's keypad to enter any series of numbers. This data will appear in the transmit area.
4. Verify that the other machine has received the data correctly.
5. Set the other machine to transmit.
6. Manually transmit data from the other machine.
7. Verify the CNC receives the data in the Receive Area. The test is complete.

### Clearing the Receive Area

Press **ClearRx (F3)** to clear the Receive Area.

### Clearing the Transmit Area

Press **ClearTx (F5)** to clear the Transmit Area.

### Sending a Program

The name of the program highlighted when the Communication screen was activated is listed next to the **PROGRAM** label on the screen. The CNC sends this program unless you select another program. The CNC prompts to select another program during the sending process.

1. With the Communication screen active, the parameters set and the link tested, press **Send (F3)**. The CNC prompts to send the selected program or to change the program being sent.
2. Press **Select (F1)**. The CNC sends the program.

– or –

Press **Other (F3)**. Enter the name of the desired program.

### Receiving a Program

You must enter a name for received programs before you receive them from the other machine.

To receive a program:

1. With the Communication screen active, the parameters set and the link tested, press **Receive (F1)**. The CNC prompts to enter a name for the incoming program.
2. Type the desired name, and press **ENTER**. The CNC displays a **READY TO RECEIVE . . .** message.
3. Start transmitting from the sending machine.



### Setting the Transmission and Receiving Display

If the CNC is transmitting or receiving with the Text Mode active, the exchanged program will be displayed on the screen. If the Text Mode is off, the display area will remain blank.

**Text (F6)** is highlighted when the Text Mode is active.

The “Transfer In Progress” symbol (just above the soft key line) cycles when data is exchanged.

Press **Text (F6)** while transmitting or receiving to switch the CNC in and out of Text Mode.

### Holding Transmission/Receiving Operations

When sending or receiving programs the operation can be paused by Press **Hold (F1)** to pause an operation while sending or receiving programs. Press **Resume (F2)** to continue the exchange.

**NOTE:** If the CNC is receiving a program and either machine’s software parameter (Xon/Xoff) is set to **OFF**, there is a possibility a hold will overload the CNC’s buffer, causing portions of the program to be lost. ANILAM recommends that you operate with the software parameter (Xon/Xoff) set to **ON**.

### Using Data Control (DC) Codes

Data Control (DC) codes are sometimes required to automate the operation of a paper tape reader or punch.

Refer to **Table 13-1** for the available DC Codes. The **ASCII** column lists the codes required to perform the corresponding “Function.” The **Hex Code** is the hexadecimal equivalent of the ASCII code. The **CNC Key** column lists the key you press on the CNC keypad or a PC keyboard to transmit the required DC code.

**Table 13-1, DC Codes**

ASCII	Function	Hex Code	CNC Key
<b>DC1</b>	Reader Start	0x11	1
<b>DC2</b>	Punch Start	0x12	2
<b>DC3</b>	Reader Stop	0x13	3
<b>DC4</b>	Punch Stop	0x14	4

A reader or punch will turn ON (start) or OFF (stop) in response to these codes. To test reader or punch communication, activate the Communication screen and press any of these keys. The paper tape reader or punch should respond appropriately.

### Using DC Codes in Receive Mode

Usually a receive operation involves the paper tape reader. You must start the reader, thereby initiating the reading of the paper tape. Do this after the CNC has been set up to receive the file.

1. Set up to the CNC to receive a program.
2. Press **1** to send the DC1 code to the reader. The reader starts.
3. After the CNC has read the tape, press **3** to stop the reader, if necessary. The CNC sends the DC3 code to the reader and the reader stops.

### Using DC Codes in Send Mode

Usually, a send operation involves the paper tape punch. Set up and start the punch prior to initiating the send operation.

1. Select the program that will be sent to the tape punch.
2. Press **2** to send the DC2 code to the punch. The punch starts.
3. Press **Send (F3)** to start sending the program. If necessary, change the name of the program.
4. When the program has been completely transferred to the punched tape, press **4** to stop the punch, if necessary. The CNC sends the DC4 code to the punch and the punch stops.

## Running in DNC

Direct Numeric Control (DNC) is also known as Continuous Downloading. This function is used only when it is necessary to run a program that is larger than the CNC's available memory.

**NOTE:** Before you use the DNC function, ensure that all setup procedures are completed. Set Part Zero and make necessary Tool Page Entries.


**NOTE:** To quit the DNC function after it has started, press **DNC (F4)** then press **Exit (F10)** twice. The CNC will revert to Manual Mode.

The **DNC** screen is similar to other operating screens, but with communication information added. Refer to [Figure 13-4, DNC Screen](#).

### Accessing DNC

1. In the Program screen, press **Utility (F9)**. A pop-up menu is displayed.
2. Highlight **Communications**, and press **ENTER**. The Serial Communication Parameters screen is displayed.
3. Press **DNC (F4)**. Press **Receive (F1)**. The CNC is now ready to begin receiving a program from an off-line (host) computer.

Once the transmission is started from the off-line machine, the CNC performs as usual. Tool changes, Single-Step Mode, and Real Time Draw function as described in other sections.

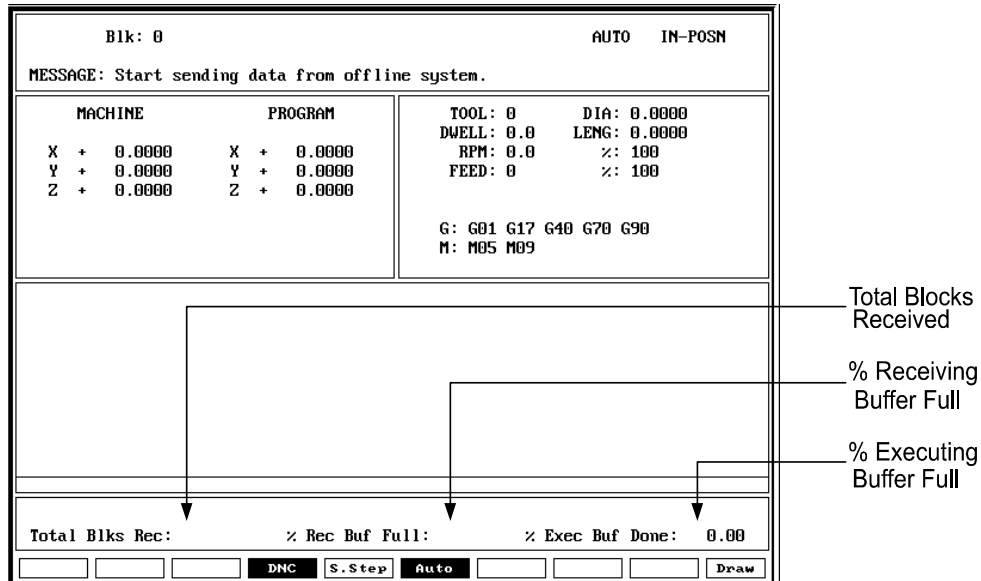

**Figure 13-4, DNC Screen**

- Total Blks Rec:** The total number of program blocks the CNC has received at that point.
- % Receiving Buffer Full** Percentage of receiving buffer used.
- % Executing Buffer Full** Percentage of executing buffer used.

Via RS-232, programs are transmitted faster than they can be executed. This makes it necessary to manage the memory and timing between the two machines.

The CNC uses two buffers. One buffer receives the incoming program while the contents of the second buffer is executed. When the executing buffer is empty, they swap. The CNC executes the contents of the full buffer while the empty buffer receives additional data.

When the software protocol (Xon/Xoff) is used, the CNC can signal the sending machine to pause until it has a buffer with room to receive.

**NOTE:** Most machines default to the buffer mode for DNC operations. Some machines may be set to default to the Drip Feed Mode for DNC. In Drip Feed Mode, program blocks are transmitted and executed one at a time, without buffering.

To put the CNC in Direct Numeric Control Mode:

1. With the Communication screen active, parameters set and the link tested, press **DNC (F4)**. The **DNC** soft key labels are displayed.
2. Press **Receive (F1)**. The **DNC** screen activates and the message line prompts to begin transmitting from the other machine. Once the receive buffer is full, the CNC prompts to press **START**.
3. Press **START**. The CNC runs the incoming program.

## Section 14 - Machine Software and Peripherals Installation

### Machine Software Installation

The CNC software is installed when the machine is set up and during software updates.

To install the machine software:

1. In Manual Mode, press [**SHIFT + EXIT (F10)**]. The CNC's startup screen is displayed.
2. Highlight **Setup Utility**, and press **ENTER**. The Setup Menu is displayed.
3. Highlight **Builder Setup**, and press **ENTER**. The **Builder Setup** Menu is displayed.
4. Highlight **Software Update**, and press **ENTER**. The installation sequence begins.
5. Follow the instructions on the screen.

### Software Option Kit Installation

A Software Option Kit contains new or optional features for the CNC. Each kit typically consists of:

- Installation Procedure
- Installation Disk
- Hardware Key

To install purchased option software:

1. Use the shipping document to verify that the kit contains the ordered options.
2. Install the hardware key on the female DB-25 printer port on the computer chassis. Remove any previously installed hardware keys.
3. In Manual Mode, press **SHIFT**. The softkeys change. Press **Exit (F10)**. The CNC's startup screen activates.
4. Highlight **Setup Utility**, and press **ENTER**. The **Setup Options** Menu activates.
5. Highlight **Builder Setup**, and press **ENTER**. The **Builder Setup** Menu activates.
6. Highlight **Software Update**, and press **ENTER**. The installation sequence begins.
7. Follow the on-screen instructions.

**NOTE:** After you install the software, additional setup may be required to enable the purchased option. Refer to the [5000M CNC Setup Utility Manual, P/N 70000509](#), you received with the CNC.

### Printer Installation

To connect a printer, you must provide the cable and connect it to the DB-25 printer port on the computer chassis. If there is a hardware key on the connector, do not remove it. Plug the printer into the back of the hardware key.

### Keyboard Installation (Option)

The machine builder determines whether the system will support a keyboard option. If the system supports a keyboard, plug the keyboard DIN connector into the side of the computer chassis, in the connector labeled **Keyboard**. While the keyboard is installed, the console keypad remains inactive.



 




**WARNING:** There is no keyboard equivalent for the E-STOP. Therefore, emergency shutdowns (E-STOP) cannot be performed via keyboard.

**NOTE:** Industrial grade keyboards are recommended for shop environments.

### Keypad Equivalent Keyboard Keys








Refer to **Table 14-1**.

**Table 14-1, Keyboard Equivalents**

Function	CNC Key Face	Keyboard Keystroke Equivalent
<b>CLEAR</b>		<b>(ALT + C)</b> – or – <b>DELETE</b>
<b>ARROWS</b>		<b>ARROWS</b>
<b>ENTER</b>		<b>ENTER</b>
<b>X (axis)</b>		<b>(X)</b>
<b>Y (axis)</b>		<b>(Y)</b>
<b>Z (axis)</b>		<b>(Z)</b>
<b>U (axis)</b>		<b>(U)</b>

(Continued...)

**Table 14-1, Keyboard Equivalents (Continued)**

Function	CNC Key Face	Keyboard Keystroke Equivalent
V (axis)		(V)
W (axis)		(W)
START		(ALT + S)
HOLD		(ALT+ H)
Activate System Information Screen	Refer to " <a href="#">Displaying System Information</a> " in " <a href="#">Section 10 - Program Management</a> ."	(ALT+ I)
Activate Enlarged Position Display		(B)
Switch to Rapid Override		(R + ENTER)
Activate PLC Monitor		(P)

## Section 15 - Off-line Software

### Introduction

The off-line version of the software requires an [\\*\\*Intel®](#) based Personal Computer (PC) or 100% compatible. A minimum of 4MB of RAM is required. The hard disk drive must have a minimum of 4MB of space available.

The off-line software is also compatible with [\\*\\*Microsoft®](#) [\\*\\*Windows®](#) Operating Systems, such as [\\*\\*Windows NT®](#), Windows 95, Windows 98, or Windows 2000.

### Passwords

Access to some parameters is restricted. Refer to **Table 15-1**. When required, the CNC prompts you to enter a password.

To access protected parameters:

1. Enter the service password and press **ENTER**. The CNC allows you to change the protected settings.
2. Passwords protect four access levels. Operators are assigned limited passwords, which enable them to set parameters used in normal machine operations. Service passwords enable a higher level of access. The factory password is not used outside the manufacturer's plant.

**Table 15-1, Off-line Passwords**

Restriction Level	Password
Limited access	Q1
Service access	Q2
IPI access	Q3

### Exiting the Software

Press **ESC** to exit the software from the Main Menu selection screen.

-----  
 \*\* Intel® is a registered trademark of Intel Corporation in the United States and/or other countries.

\*\* Microsoft®, Windows®, and Windows NT® are registered trademarks of Microsoft Corporation in the United States and/or other countries.



### Windows Off-line Software Installation

1. Insert the installation disk in the floppy drive.
2. Go to the task bar, and click on the **Start** button. Select **Run**. The Run window activates.
3. In the **Open** entry field, type "**A:setup**". Click on **OK**. The installation procedure will then begin.
4. Follow the on-screen prompts as they appear.

**NOTE:** Substitute "**B:setup**" for "**A:setup**" if your 3.5 inch floppy is in the B:-drive.

### Running Off-line Software from Windows

1. If you selected "Desktop Icon" (recommended) during the installation, click the 5000M icon on your desktop.
2. If you selected Start Menu, start from there.

### System Settings

#### Maximum Memory Allocated

In the Setup Utility, you can adjust the amount of memory allocated to the CNC software. Set the **Maximum Memory Allocated** parameter between 2 MB and 18 MB. This feature limits the amount of memory available to the software, preventing the CNC program from tapping into Windows' large virtual memory supply. Allocating too much memory to the control software will dramatically increase startup time and make the software run slower.

To change the **Maximum Memory Allocated** parameter:

1. In the CNC startup screen, select **Setup Utility**, and press **ENTER**. The Setup Options menu is displayed.
2. Select **Operator Setup**, and press **ENTER**. The General Software menu is displayed.
3. Select **Control Software**, and press **ENTER**. The Control Software menu is displayed.
4. Select **Maximum Memory Allocated**, and press **ENTER**. Type the appropriate value, and press **ENTER**.

The only time it might be necessary to increase this parameter is when editing a program that is larger than this value. In this case the CNC will generate an error message indicating that there is not enough memory to edit the program. To correct this problem, change this parameter to the size of program plus 1MB.

## Disabled Features

 
The following software features, found in the Program Directory's **Utility (F9)** pop-up are not available under any Windows operating system:

- Check Disk
- Floppy Format
- Disk Optimization
- Program Restore

If you select one of these features, the CNC displays a message to inform you that the feature is disabled.

## Section 16 - Four- and Five-Axis Programming

### Axis Types



The machine builder sets up the fourth and fifth axes as linear, rotary or readout axes. The three basic axes are X, Y, and Z. The additional axes are designated as U (four-axis systems) or U and W (five-axis systems). This section will discuss the rotary axis option in detail.

Below are the programming formats for linear or rotary additional axes:

**Linear:** Program as Feed Mode (G1) or Rapid (G0) moves. Only rapid and linear feed moves can be programmed. You must set an individual feedrate if a move is non-synchronous (Format: FU 20.0 or FW 20.0). U and W can be programmed along with X, Y, and Z-axis in rapid, linear, and circular moves. You can make U and W synchronous or non-synchronous to the XYZ moves. Program Sync codes:

**M900 U** (for synchronous U)

**M900 W** (for synchronous W)

**M901 U** (for non-synchronous U)

**M901 W** (for non-synchronous W)

on a block alone. No other code is allowed on the sync block.

**Rotary:** Program rotary moves in degrees. The typical resolution is 0.001 degrees (set by builder). Minutes and seconds cannot be programmed. Therefore, you must convert minutes and seconds to a decimal value.

Conversion formula for minutes, seconds to decimal degrees:

Minutes to decimal:  $\text{min}/60 = \text{decimal degrees}$ .

**Example:**  $15 \text{ min}/60 = 0.25 \text{ degrees}$

Seconds to decimal:  $\text{sec}/3600 = \text{decimal degrees}$

**Example:**  $30 \text{ sec}/3600 = 0.008 \text{ degrees}$

**Example:**

$$\begin{aligned} &5 \text{ deg. } 30 \text{ min. } 15 \text{ sec. } = \\ &5 + (30/60) + (15/3600) = \\ &5 + 0.5 + 0.004 = \\ &5.504 \text{ degrees} \end{aligned}$$

You must program feedrates for non-synchronous moves. Program the feedrate in degrees per minute (dpm).

**Format:** FU 500.0 = 500 dpm for the U-axis.

## Rotary Axis Programming Conventions

A rotary axis (typically, U) will program differently based on the setting of the **Reset Rotary at 360** parameter, which is determined by the builder. The default for this parameter is **No**; in which case, the U-axis behaves like a linear axis. If set to **Yes**, the behavior of the rotary axis (U) is described below.

If programming the U-axis in Absolute:

The rotary axis will never rotate more than 180 degrees in one move. So, if a move of greater than 180 degrees is programmed, the control will resolve the number to a positive value less than 360 degrees and move to that target, taking the shortest distance (always less than 180 degrees). A move of exactly 180 degrees will always move positive and a move of exactly 360 degrees will not move at all.

If programming the U-axis in Incremental:

The rotary axis will move the exact amount of degrees programmed and in the direction indicated with the plus or minus sign. The display will reset to zero every time 360 degrees is crossed so that the highest value in the U-axis display will be 359.999 degrees depending on the displayed resolution.

## Non-Synchronous or Synchronous Auxiliary Axis

You must decide whether the fourth or fifth axis move will be synchronous or non-synchronous. A synchronous move is defined as a move in which all axes programmed (XYZU and/or W) reach target simultaneously. Use synchronous moves to thread-mill along a rotary axis or to machine an impeller part. Many parts that require 5-axis machining also require synchronous motion among the axes. Usually, the programmer uses an M-Code to set synchronization ON (Sync-On) or OFF (Sync-Off) for the designated axes. [Default: **Sync-Off**]

**Format:** M900 U or M900 W

**Example:** N110 M900 U sets Sync-On for U-axis only. If a U dimension is programmed on the same block as any rapid, linear feed, or circular XYZ move, the U-axis will reach target simultaneously with the other axes. The feedrate (Fn) programmed for the XYZ move (X, Y, Z, XY, XZ, YZ, or XYZ) will be applied along the vector of the cut. If you program 10 IPM (F10), the CNC adjusts the feedrates along each axis so that tool movement equals 10 IPM (vector speed). The feedrate displayed on the CNC screen is the vector feedrate.

Synchronous moves are used only when necessary. For example, you want to thread mill a part, with the centerline of the rotary axis parallel to the X-axis. Synchronize X and U. Turn sync OFF when not in use.

**Format:** M901 U or M901 W

**Example:** N110 M901 U will set Sync-Off for U-axis only. If a U dimension is programmed on the same block as any rapid, linear feed, or circular XYZ move, the U-axis will not reach target simultaneously with the other axes. The feedrate (Fn) programmed for the XYZ move (X, Y, Z, XY, XZ, YZ, or XYZ) will be applied along the vector of the cut. A separate feedrate is programmed for U (FUn). The feedrate programmed for XYZ (Fn) will be applied to those axes.

Generally, Nonsynchronous moves are used for indexing work such as milling a side of a part or drilling at various rotary locations.

**NOTE:** Sync-ON and Sync-OFF can be set together or individually. M900 UW will set both ON. M901 W (or U) will set only W (or U) OFF.

Nonsync fourth and fifth axes moves require a separate feedrate for the additional axes (FUn /FWn). If you do not program a separate feedrate, the U or W feedrate will be based on the vectored feedrate of Fn.

Feedrate display is either XYZ (Sync-Off) or vectored (Sync-On).

In a 4-axis setup, the rotary table is set so the centerline of the rotary axis is parallel to the X-axis.

5-axis setups are often a combination rotary/tilt table mounted similar to the 4-axis setup. The rotary range is +/- 360 degrees, and the tilt range is 0 to 90 (flat to vertical).

If programmed with Ellipse (G05) or Spiral (G06), the fourth or fifth axes must be positioned in the block after the XYZ coordinates and before the IJK coordinates.

## Programming Examples

All programming examples are for 4-axis machining with the rotary table mounted on the left end of the mill table, with the centerline of the rotary axis parallel to the X-axis. The face of the rotary table faces X+.

The examples contain both milling and drilling applications. Modal cycles G81 to G89 and G66 can be executed at rotary locations as in XYZ locations. Non-modal canned cycles can be executed at rotary locations. Use sync-OFF and position the rotary axis before you execute the cycle.

**Example 1: Drill (Sync-Off)**

Mount the fourth axis as described above. Mount a part 6-inches wide and 8-inches long on the face of the rotary table. **Reset Rotary at 360** is set to **No**.

**Table 16-1** shows a drilling example with No Sync. You must drill ten 0.375-inch holes 36-degrees apart, 1-inch deep, 0.75-inches in from the end of the cylinder. Then, starting at X-2 U0, drill a spiral series of holes 36-degrees and X-0.500 inches apart each. Set X0 at the right end, Y0 at the cylinder's centerline, U0 at a pre-milled keyway on the cylinder. Measure tool offsets from the top of the cylinder, with Y-axis at 0.

**Table 16-1, Four-Axis Example 1**

```
* 4-AX-DRL
* SET RESET ROTARY AT 360 TO "NO"
G90 G70 G0 T0 Z0 U0 M5
X0 Y0
T1 *#3 CENTERDRILL
M3 S2400
G81 Z-.22 R.1 F12
M98 P1
T2 * 3/8" DRILL
M3 S1850
G87 Z-1 R.1 F14 I.18 J.012 K.1 U.3334
M98 P1
M2

O1 * ROTARY HOLE LOCATIONS
G0 G90 X-.75 Y0 U0
LOOP 9
G0 G91 U36
END
G0 G90 X-2 U0
LOOP 9
G0 G91 X-.5 U-36
END
G80
M5
G0 G90 Z0 T0
X0 Y0 U0
M99
```

**Example 2: Mill (Sync-On)**

Mount the fourth axis as described above. Mount a part 3 inches in diameter and 5 inches long on the face of the rotary table. The part has a 0.25-inch radius turned on the end. **Reset Rotary at 360** is set to **No**.

**Table 16-2** shows a milling example only. Assume that a series of six 0.25-inch wide grooves must be milled 60-degrees apart, 0.25-inch deep at the start, tapering up to 0.125-inch deep and rotating 15 degrees at the far end. The groove must follow the end contour of the part (radius). Set X0 at the right end, Y0 at the cylinder centerline, U0 at a pre-milled keyway on the cylinder. Set the tool offset so that the centerline of the .25-inch ball-end mill is at the centerline of the 3-inch diameter part (with Y-axis at 0).

**Table 16-2, Four-Axis Example 2**

```
* 4-AX-MILL
* SET RESET ROTARY AT 360 TO "NO"
G90 G70 G0 T0 Z0 U0 M5
X0 Y0
T1 *.25 BALL-END-MILL
S2400
M3
M98 P1 L6
G90 G0 T0 Z0 M5
G0 X0 Y0 U0
M2

O1 * GROOVE
G90 G0 X.225
G0 Z2.625
G1 X.125 F5
M900 U
G18 G91 G2 X-.25 Z.25 I-.25 K0 U-2.
G17 G1 X-3.25 Z.125 U-13
M901 U
G90 G0 Z3.225
G0 X.225
G91 G0 U-45
M99
```

**Example 3: Mill (Sync-On)**

Mount a fourth axis as described above. Mount a part 4-inches in diameter and 8-inches long on the face of the rotary table. Support the part on the X+ end by a live center. The part has a 0.25-inch, 45-degree chamfer on one end. **Reset Rotary at 360** is set to **Yes**. This will prevent the need to unwind the U-axis, saving operation time.

**Table 16-3** shows a thread-milling example. Assume that a 4-8 UN 2A thread must be milled from the right end, 6-inches long. The tool is tapered to conform to the thread. Set X0 at the right end, Y0 at the cylinder's centerline, U0 at a pre-milled keyway on the cylinder. Measure the tool offset from the top of the part (with Y-axis at 0).

The X start position will be one pitch (0.125 in.) to the right of X0, so that the tool enters the work smoothly.

**Table 16-3, Four-Axis Example 3**

```
* 4-AX-THD
* SET RESET ROTARY AT 360 TO "YES"
G90 G70 G0 T0 Z0 U0 M5
X0 Y0
T1 * SPECIAL THD-TOOL
S3500
M3
G0 X.125 Y0 U0
Z.1
G1 Z-.075 F80
M900 U
* SET RESET ROTARY AT 360 TO "YES"
* THIS IS TO PREVENT THE NEED TO UNWIND U
* U AXIS MOVE IS
* (360 X 8 PITCH X 6" LONG)
* + 360 FOR 1 TURN X.125 LEAD-IN
* U MOVE WILL BE 17,640.00 DEGREES
* OR 49 TURNS
G91 G1 X-6.125 U((360*8*6)+360)
M901 U
G90 G0 T0 Z0 M5
X0 Y0 U0
M2
```



## Section 17 - DXF Converter Feature

The DXF Converter feature allows information in a Drawing Exchange File (.DXF extension) to be used to create a CNC conversational (.M extension) or G-code (.G extension) file.

Contours and drill hole locations in the DXF file can be put in the CNC file in the form of subroutines, using a mouse and “point and click” approach.

The DXF Converter feature creates a CNC program that must be edited to be usable, but most of the program creation is already done.

### Requirements

#### Off-line Software

The Personal Computer (PC) must have a mouse installed. The Anilam Off-line Software is required. The Anilam Off-line Software will run in an MS-DOS or Windows environment. (See [“Section 15 - Off-line Software.”](#))

#### Machine Software

A mouse or other pointing device (for example, track ball) must be installed to properly operate the DXF converter on the machine. As part of installing a mouse, it is necessary to install a driver. A suitable driver should be included with the mouse when purchased. Follow the manufacturer's instruction to install an MS-DOS compatible driver. Typically, this will require editing AUTOEXEC.BAT and adding a line to load the mouse driver before the CNC software starts running. See sample AUTOEXEC.BAT below. The mouse can be a serial mouse or a PS/2 style mouse (PS/2 style mouse only supported on systems manufactured after January 1, 2003). The serial mouse must be connected to the RS-232 port. If using a PS/2 style mouse, it must be connected to the keyboard connector on the console through a PS/2 Y-splitter cable. The mouse will only be operational while in the DXF Converter. Depending on the mouse and mouse driver, it may be necessary to have the mouse connected before turning the CNC on.

```
ECHO OFF
PROMPT $P$G
PATH C:\;C:\DOS
ECHO Loading CNC software
SET P5MSYS=C:\P5M
C:
CD \P5M
\MSMOUSE\MOUSE      <<<< Line added to load mouse driver
P5M
```

## Entry to the DXF Converter

To open the DXF Converter:

1. Open the Anilam Off-line Software
2. Gain access to the Program page and highlight the DXF file you wish to convert. For details on how to work with the Program page see [“Section 10 - Program Management.”](#)
3. Select the **Utility** soft key to display a pop-up menu
4. Select DXF Converter on the pop-up menu to bring the drawing into the DXF Converter.

The drawing display screen shows the file name in the upper-left border, the current X Y position of the mouse pointer at the upper-right corner, a message and information area along the bottom border, and several soft keys along the bottom edge.

## Creating Shapes

The part drawing is used to create shapes. Shapes are then output to CNC programs as subroutines. There are many features to make the drawing screen easier to use. Layers may be turned on or off. Any area of the screen can be zoomed in or out. Refer to [Table 17-1, Mouse Operations](#) and [Table 17-2, DXF Hot Keys](#).

Each shape is given a sequential number. The number is displayed on the screen at the beginning of the shape. Press **F1** to toggle Select mode on. With Select mode on, entities can be selected to be part of a shape. Left click with the mouse to make selections. When an entity is selected, it will change color.

When selecting entities, direction is determined by where the mouse pointer is positioned. If nearer the left side of a line, direction will be left to right.

There are two types of shapes:

- One used for contouring or feed motion
- One for drilling a series of holes

## Contours

Pick an entity where the shape will begin. Pick the last entity in the shape. All entities that are connected will be chained together and change color to verify this. Some shapes have to be selected one entity at a time. This is determined by the way the part was drawn in the DXF file.

If an entity is selected that is not connected to the previous one, a message is displayed, "Entity not connected, connect anyway (Y/N)?" Answering Yes will join and allow the shape to be continued. This is sometimes needed when the drawing was not properly made. The same message is displayed when a shape is finished and a new shape is started. Answering No produces a second message, "Create new shape (Y/N)?" If this is answered Yes, a new shape number is displayed.

Entities in a shape can be un-selected by clicking them again. This un-selects everything previously selected to that point. To delete a shape, click on the first entity.

## Drilling

When circle entities are selected, they are assumed to be drilling hole locations. As circles are selected, a dotted line shows the rapid path between holes. Selecting anything other than a circle, ends the drilling shape and produces the message, "Create new shape (Y/N)?"

If you wish to create a second drilling shape, select the first hole of the next shape by right clicking the mouse. The message, "Create new shape (Y/N)?" is displayed.

## CNC Code

Each shape that is created is made into a subroutine. If the option was selected as a setup parameter, for each subroutine, there is a call in the main program. (Refer to [Table 17-4, Output Menu Descriptions.](#)) Running the CNC program in Draw mode allows the tool paths to be seen.

The file must be edited to add tool numbers, feed rates, cutter comp on or off, and so forth.

The tool paths are only as accurate as the DXF drawing file used.

The Output Parameter pop-up menu contains a Shift X and Shift Y entry. The purpose of these entries is to shift the X Y coordinate system of the CNC program. This is usually done, since the coordinates in the drawing file are based from some corner of the drawing and it is preferable to use some feature of the part as the X0 Y0 position. Refer to "[Shift X, Shift Y Descriptions](#)" later in this section.

Additionally, each DXF shape can be saved as a CAM Shape for use in the CNC's CAM utility. If the Output format parameter (Refer to [Table 17-4, Output Menu Descriptions](#)) is set to CAM Shape, the DXF shapes are saved as CAM shape files. One CAM shape file is created for each DXF shape being saved. Any existing shape file is overwritten. These files can then be imported into a CAM program by using the **Recover Shapes** feature under **Misc** in CAM. Complete CNC code can then be generated using the imported shapes and the Motion features in the CAM utility.

### Mouse Operations

Refer to [Table 17-1](#) and [Table 17-2, DXF Hot Keys](#).

**Table 17-1, Mouse Operations**

Button	Event	Function
Left	Press–Drag–Release	Zoom Window
Right	Press–Drag–Release	Pan
Left	Double click	Zoom Fit
Left	Click Top Edge	View XY Plane
Left	Click Right Edge	View YZ Plane
Left	Click Bottom Edge	View XZ Plane
Left	Click Left Edge	View ISO
Left	SHIFT + Click	Zoom In
Right	SHIFT + Click	Zoom Out
Left	Click (Select mode on)	Select Entity
Right	Click (Select mode on)	Link Unconnected Entities or Create New Shape
Left	CTRL + Click	Basic Entity Information is displayed on the bottom of the screen.

## DXF Hot Keys

Refer to **Table 17-2**.

**Table 17-2, DXF Hot Keys**

Hot Key	Event	Hot Key	Event
<b>ALT + A</b>	Zoom Fit	<b>ALT + N</b>	All Layers On
<b>ALT + B</b>	Redo View Change	<b>ALT + O</b>	View Plane ISO
<b>ALT + C</b>	Erase Text	<b>ALT + P</b>	Toggle Axes
<b>ALT + D</b>	Zoom In	<b>ALT + Q</b>	Quit / Exit
<b>ALT + E</b>	Set Chain Delta	<b>ALT + R</b>	Redraw
<b>ALT + F</b>	Toggle Entity Endpoints	<b>ALT + S</b>	Save Shape to Output Filename
<b>ALT + G</b>	Toggle Dotted Grid	<b>ALT + T</b>	Paste Entity Info to Shift Field
<b>ALT + H</b>	Zoom Out	<b>ALT + U</b>	Undo View Change
<b>ALT + K</b>	Cycle Tracking Resolution	<b>ALT + X</b>	View Plane XY
<b>ALT + L</b>	Toggle Layers	<b>ALT + Y</b>	View Plane YZ
<b>ALT + M</b>	Invert Layers	<b>ALT + Z</b>	View Plane XZ

### Toggle Entity Endpoints (ALT + F)

This hot key places a small X at the end of every entity. If a shape is not chaining as expected, using this feature helps determine the problem. Look for X's in unexpected positions. Two lines may be overlapped, for example.

Using the mouse (**CTRL + left click**) with endpoints on will 'flash' each entity and also provide more information. Zoom the problem area for the best view.

### DXF Soft Keys

Refer to **Table 17-3**.

**Table 17-3, Soft Key Descriptions**

Soft Key	Function	Description
<b>F1</b>	Toggle Select Mode	Select mode must be on when chaining shapes.
<b>F3</b>	Layers Menu	<p>Pop-up menu has:</p> <ul style="list-style-type: none"> <li>▪ All Layers on</li> <li>▪ Invert Layers</li> <li>▪ Toggle Layers</li> </ul> <p>Layers can be turned on or off as desired.</p> <p><b>NOTE:</b> The mouse (<b>CTRL</b> + left click), that is hold down the <b>CTRL</b> key while left clicking an entity, provides the layer name of the clicked entity at the end of the basic entity information displayed at the bottom of the screen. This is helpful to determine which layers to turn on and/or off.</p>
<b>F4</b>	View Menu	Pop-up menu has: XY, XZ, YZ, and ISO selections.
<b>F5</b>	Display Menu	Pop-up menu has: Fit, Window, Redraw, Half, and Double. Select the desired display.
<b>F6</b>	Misc.	Pop-up menu has: Entity Info, Set Shift, Toggle Endpoints, and Link or New Shape. Select the desired option. See " <a href="#">Miscellaneous DXF Soft Key, F6</a> " for details.
<b>F8</b>	Save	Creates CNC code. The message, "Successfully created (filename) (.M or .G)." is displayed when Save is activated. If no shapes are defined, a warning message is displayed.
<b>F9</b>	Setup	Pop-up menu provides access to Output or Display parameters. Refer to <a href="#">Table 17-4, Output Menu Descriptions</a> and to <a href="#">Table 17-5, Display Menu Descriptions</a> .

(Continued...)

Table 17-3, Soft Key Descriptions (Continued)

Soft Key	Function	Description
<b>F10</b>	Exit	<p><b>F10</b> exits the Setup menus, exits the DXF Converter, and returns to the Program page.</p> <p>Be sure to Save (<b>F8</b>) any work done before exiting. Anything not saved will be lost.</p> <p>If shapes have been created, a message, "Exit (Y/N)?" is displayed. This is a reminder to be sure you have saved your work.</p>

### Miscellaneous DXF Soft Key, F6

Press **Misc. (F6)** to display the miscellaneous DXF pop-up menu with the following options:

- |                          |                                                                                                                                                                                                                                                                                                                     |
|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Entity Info</b>       | <p>Displays entity information at the bottom of the screen. (See <a href="#">Table 17-1, Mouse Operations</a>. This option is equivalent to pressing (CTRL + left click).</p> <p>On the off-line or using an auxiliary keyboard, the Entity Info is displayed by holding the CTRL key when you pick the entity.</p> |
| <b>Set Shift</b>         | <p>Pastes the Entity Info onto the Shift field. (See <a href="#">Table 17-2, DXF Hot Keys</a>. This option is equivalent to pressing (ALT + T).</p>                                                                                                                                                                 |
| <b>Toggle Endpoints</b>  | <p>Toggles entity endpoints. (See <a href="#">Table 17-2, DXF Hot Keys</a>. This option is equivalent to pressing (ALT + F).</p>                                                                                                                                                                                    |
| <b>Link or New Shape</b> | <p>When creating a shape, select this option to terminate the current shape or to add new entities to the current shape. When a new entity is selected, the "Connect to existing shape (Y/N)?" message is displayed. To continue, press <b>Yes (F1)</b> or <b>No (F2)</b>.</p>                                      |

### Output Menu Options

Refer to **Table 17-4**.

**Table 17-4, Output Menu Descriptions**

Parameter	Default	Input Definition
<b>Output program name</b>	DXF filename	Different filename. No extension required.
<b>Shift X</b>	0.000	X position offset value (See " <a href="#">Shift X, Shift Y Descriptions.</a> ")
<b>Shift Y</b>	0.000	Y position offset value (See " <a href="#">Shift X, Shift Y Descriptions.</a> ")
<b>Output dim.</b>	Absolute	Incremental or Absolute.
<b>Create mode</b>	Smart	Overwrite or Smart. Overwrite replaces existing program file. Smart replaces duplicate subs only.
<b>Starting sub number</b>	1	Beginning sub number. To keep previously created subs, use next higher number.
<b>Output format</b>	G-code	G-code/ISO, Conversational, or CAM Shape
<b>Output warnings</b>	Yes	Yes or No. A setting of Yes outputs warnings in the program.
<b>Re-calc Intersections</b>	Yes	Yes or No. A setting of Yes re-calculates the intersections in the DXF file.
<b>Output resolution</b>	5	Number of decimal digits ( 3 to 6 )
<b>Create main in new</b>	Yes	Yes or No  No will not create main to call subs in new programs.
<b>Convert values</b>	None	None or (to)Metric or (to)Inch
<b>Convert polyline</b>	None	None, To Arc, or Prompt (See " <a href="#">Convert Polyline Descriptions.</a> ")

#### Shift X, Shift Y Descriptions

The end of an entity or center of a circle can be used to automatically make this point the X0 Y0 of the program. To select the desired point:

1. Use the mouse (CTRL + left click) to display Basic entity information.
2. Press (ALT + T) to paste the coordinates into the Shift XY fields.

A line or arc entity uses the end closest to the mouse pointer.



### Convert Polyline Description

Some DXF files have arcs as polylines. Set the parameter **Convert to Arc** to **Yes** to have an arc output in the CNC program.

Polylines that are not converted to arcs are executed as a series of short line moves.

Circles that have been converted to polylines by the DXF file creation software cannot be used for hole drilling or circle center information. Hence, given the option, it is the best choice that arcs and circles not be converted to polylines when creating the DXF file.

### Display Menu Options

Refer to **Table 17-5**.

**Table 17-5, Display Menu Descriptions**

Parameter	Default	Input Definition
<b>Mouse position resolution</b>	4	Number of places to display
<b>Axes</b>	Off	Toggle display of axes
<b>Grid</b>	None	None, Solid, Dotted
<b>Grid size</b>	1	In current units
<b>Chaining accuracy</b>	.0001	Maximum separation between chainable entities
<b>Picking accuracy</b>	3	Pixel distance from pointer to selected entity
<b>Shape color</b>	Green	Choose color
<b>Entity flash color</b>	Yellow	Choose color

### DXF Entities Supported

See **Table 17-6** for the DXF entities supported.

**Table 17-6, DXF Entities Supported**

Entities	Drawing	Transformation	Chaining	Information
Line	X	X	X	X
Point	X	X		X
Circle	X	X	X	X
Arc	X	X	X	X
Trace	X	X		X
Solid	X	X		X
Text	X	X		
Shape	X	X		
Insert	X	X		
Attdef	X	X		
Attribute	X	X		
Vertex	X	X		X
Polyline	X	X	X	X
Line3d	X	X	X	X
Face3d	X	X		X

### Drawing Entities Not Supported

See **Table 17-6**. Note that the Extrusion, Dimension, and Viewpoint entities are not supported. Dimensions may be seen on the displayed DXF file. Some DWG (an AutoCad drawing file) to DXF converters convert the dimension entities into lines and arcs, which are supported entities.

## Files Created

The DXF Converter creates the CNC file, .G for G-code and .M for conversational, or the associated CAM Shape files (.1, .2, etc.) based on the setting of the **Output format** parameter.

A file is also created with the extension .fxd. This file saves the status of parameter settings that were used in Setup.

## DXF Examples

From the Program listing open the DXF file. Refer to **Figure 17-1**.


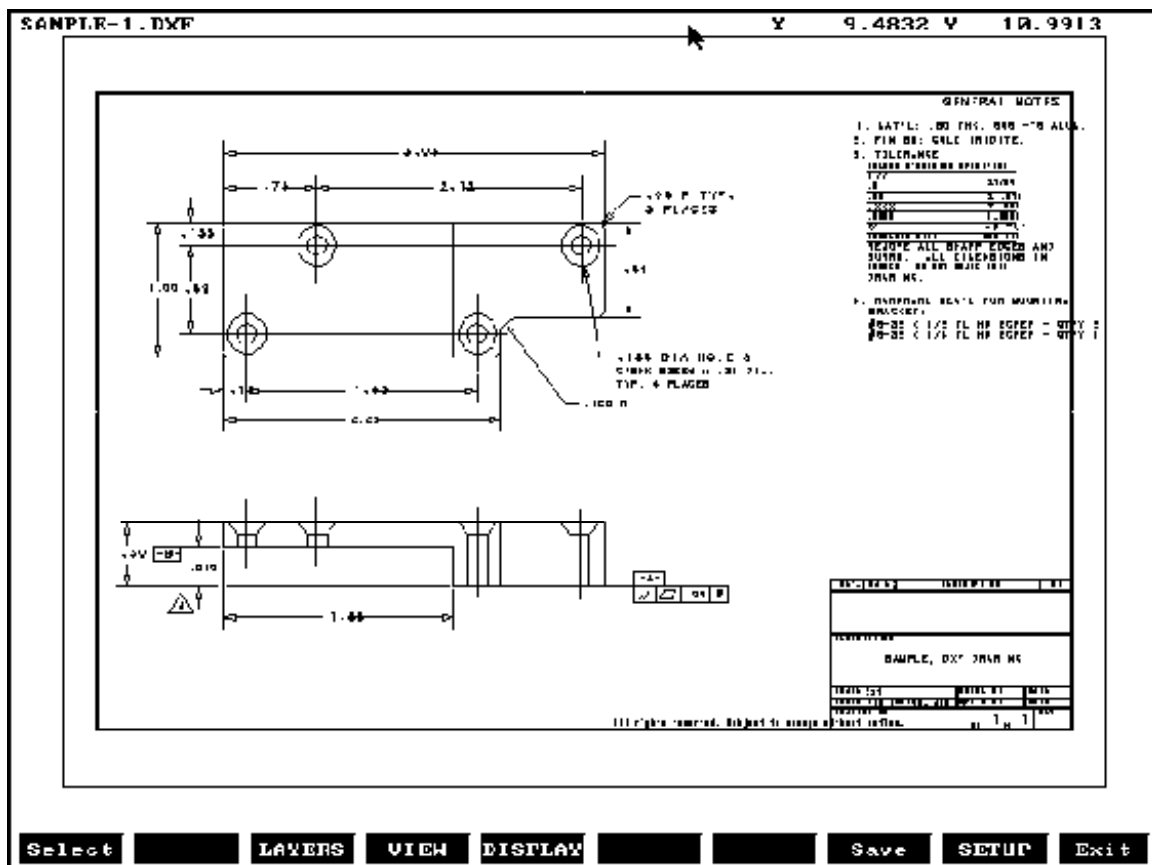


Figure 17-1, Example DXF File

Refer to **Figure 17-2**. All unneeded layers have been turned off. The Figure shows the drill locations and the contour selected.

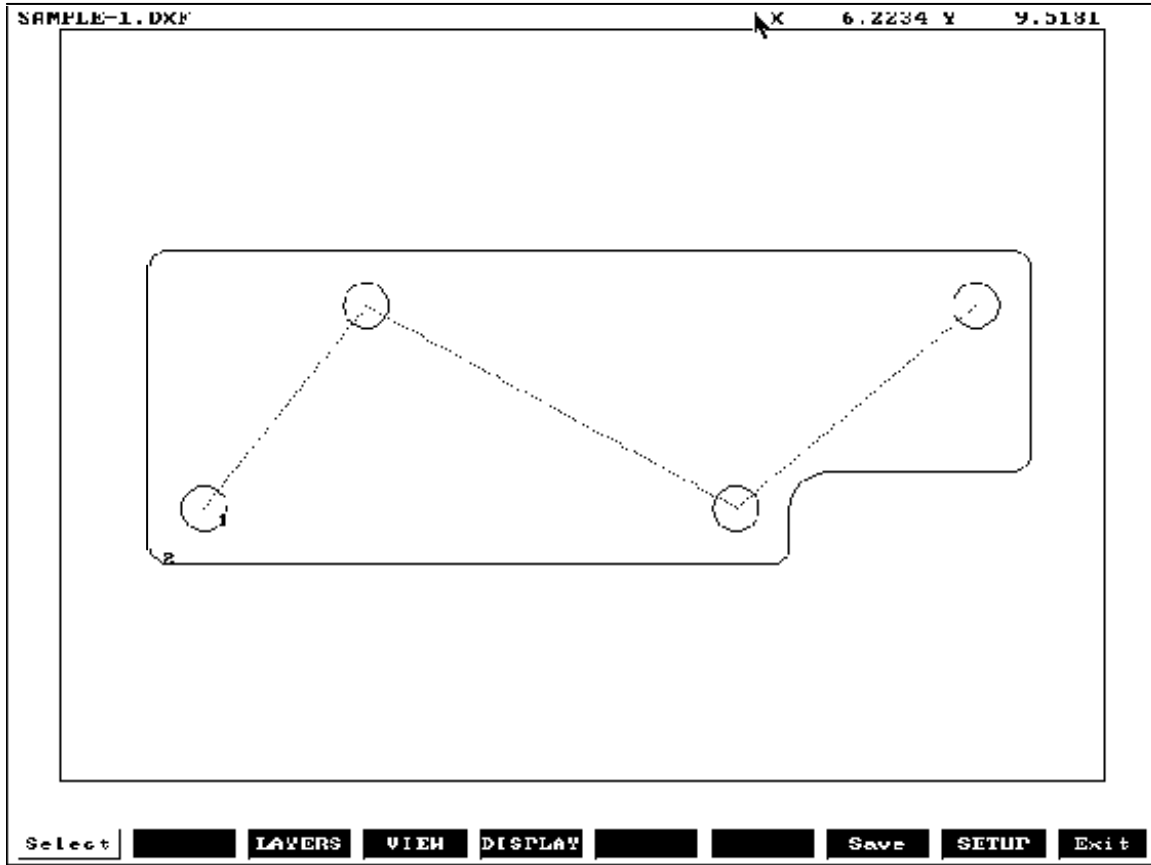

**Figure 17-2, Zoomed Part with Unneeded Layers Turned Off**

From **Figure 17-2**, the Output Menu (see [Table 17-4, Output Menu Descriptions](#)) would display as follows:

**Table 17-7, Output Menu for Figure 17-2**

Output program name . . . .	SAMPLE-1
Shift X. . . . .	2.41174
Shift Y. . . . .	6.16598
Output dimensions . . . . .	Absolute
Create Mode. . . . .	Smart
Starting sub number. . . . .	1
Output format. . . . .	G-Code/ISO
Output warnings. . . . .	Yes
Re-calc Intersections. . . . .	Yes
Output resolution. . . . .	5
Create main in new . . . . .	Yes
Convert values. . . . .	None
Convert polyline. . . . .	None

## Unedited Conversational Program Listing

The CNC conversational program is created that must be edited to be usable. An unedited conversational program created from [Figure 17-2, Zoomed Part with Unneeded Layers Turned Off](#) follows. See [Table 17-8](#).

– or –

An unedited G-code program created from the **Figure 17-2** example is listed in [Table 17-9, Unedited G-code Program Listing](#).

**Table 17-8, Unedited Conversational Program Listing**

```

Call 1
Call 2
EndMain

Sub 1
Dim Abs
Rapid X 0.00000 Y 0.00000
Rapid X 1.12400 Y 1.37000
Rapid X 3.70000 Y 0.00000
Rapid X 5.36800 Y 1.37000
EndSub

Sub 2
Dim Abs
Rapid X -0.37600 Y -0.25000
Line X -0.37600 Y 1.62000
Arc Cw X -0.25100 Y 1.74500 Radius 0.12500
Line X 5.61900 Y 1.74500
Arc Cw X 5.74400 Y 1.62000 Radius 0.12500
Line X 5.74400 Y 0.37000
Arc Cw X 5.61900 Y 0.24500 Radius 0.12500
Line X 4.32500 Y 0.24500
Arc Ccw X 4.07500 Y -0.00500 Radius 0.25000
Line X 4.07500 Y -0.25000
Arc Cw X 3.95000 Y -0.37500 Radius 0.12500
Line X -0.25100 Y -0.37500
Arc Cw X -0.37600 Y -0.25000 Radius 0.12500
EndSub

```

The conversational program must be edited to add tool numbers, feed rates, cutter comp on or off, and so forth. When the edits are complete, use Draw to check the tool path. See [Figure 17-3, Edited G-code Tool Path](#).

## Unedited G-code Program Listing

The CNC G-code program is created that must be edited to be usable. An unedited G-code program created from [Figure 17-2 Zoomed Part with Unneeded Layers Turned Off](#) follows. See [Table 17-9](#).

**Table 17-9, Unedited G-code Program Listing**

```
M98 P1
M98 P2
M2

O1
G90 G0 X 0.00000 Y 0.00000
G0 X 1.12400 Y 1.37000
G0 X 3.70000 Y 0.00000
G0 X 5.36800 Y 1.37000
M99

O2
G90 G0 X -0.37600 Y -0.25000
G1 X -0.37600 Y 1.62000
G2 X -0.25100 Y 1.74500 R 0.12500
G1 X 5.61900 Y 1.74500
G2 X 5.74400 Y 1.62000 R 0.12500
G1 X 5.74400 Y 0.37000
G2 X 5.61900 Y 0.24500 R 0.12500
G1 X 4.32500 Y 0.24500
G3 X 4.07500 Y -0.00500 R 0.25000
G1 X 4.07500 Y -0.25000
G2 X 3.95000 Y -0.37500 R 0.12500
G1 X -0.25100 Y -0.37500
G2 X -0.37600 Y -0.25000 R 0.12500
M99
```

The edited program listings are shown in the following Tables:

- [Table 17-10, Edited Conversational Program Listing](#)
- [Table 17-11, Edited G-code Program Listing](#)

**Edited Conversational Program Listing**See **Table 17-10**.**Table 17-10, Edited Conversational Program Listing**

```

Dim Abs
Unit Inch
Rapid X -1.0000 Y 0.0000
MCode 5
RPM 2000
Tool# 1
MCode 3
BasicDrill ZDepth -0.6000 StartHgt 0.1000 Feed 20.0
Call 1
DrillOff
Rapid X -1.0000 Y 0.0000
MCode 5
RPM 1500
Tool# 2
MCode 3
Feed 15.0
Call 2
Rapid Z 1.0000
MCode 5
EndMain

Sub 1
Dim Abs
Rapid X 0.00000 Y 0.00000
Rapid X 1.12400 Y 1.37000
Rapid X 3.70000 Y 0.00000
Rapid X 5.36800 Y 1.37000
EndSub

Sub 2
Rapid Y -0.2500
Z -0.6000


Dim Abs
Rapid X -0.3760 Y -0.2500 ToolComp Left
Line X -0.37600 Y 1.62000
Arc Cw X -0.25100 Y 1.74500 Radius 0.12500
Line X 5.61900 Y 1.74500
Arc Cw X 5.74400 Y 1.62000 Radius 0.12500
Line X 5.74400 Y 0.37000
Arc Cw X 5.61900 Y 0.24500 Radius 0.12500
Line X 4.32500 Y 0.24500
Arc Ccw X 4.07500 Y -0.00500 Radius 0.25000
Line X 4.07500 Y -0.25000
Arc Cw X 3.95000 Y -0.37500 Radius 0.12500
Line X -0.25100 Y -0.37500
Arc Cw X -0.37600 Y -0.25000 Radius 0.12500

```

```
Line X-1.0000 ToolComp Off
EndSub
```

### Edited G-code Tool Path

The edited G-code tool path is illustrated in **Figure 17-3**.

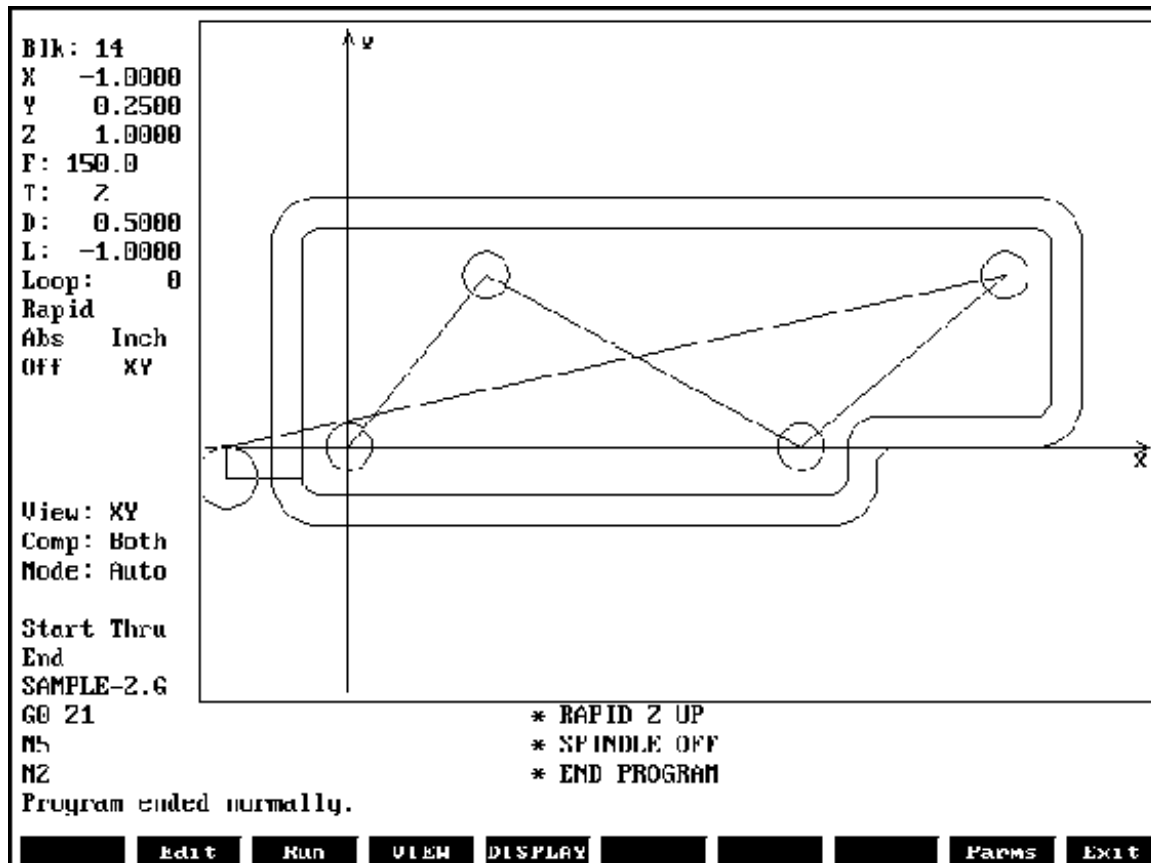

**Figure 17-3, Edited G-code Tool Path**

The edited G-code program used for the **Figure 17-3** is listed in [Table 17-11, Edited G-code Program Listing](#).



## Edited G-code Program Listing

Table 17-11, Edited G-code Program Listing

G90 G70 G0 T0 Z0	* ADD DEFAULTS
X-1 Y0	* MOVE TO START POSITION
M5 S2000	* SPINDLE OFF, SET RPM
T1 M3	* CALL TOOL, START SPINDLE
G81 Z-0.6000 R0.1000 F20.0	* ENABLE DRILL CYCLE
M98 P1	* CALL DRILLING SUB
G80	* DRILLING OFF
G0 X-1 Y0	* RETURN TO START POSITION
M5 S1500	* SPINDLE OFF, SET RPM
T2 M3 F15	* CALL TOOL, START SPINDLE
M98 P2	* CALL COUNTOURING SUB
G0 Z1	* RAPID Z UP
M5	* SPINDLE OFF
M2	* END PROGRAM
O1	* DRILLING SUB
G90 G0 X 0.00000 Y 0.00000	
G0 X 1.12400 Y 1.37000	
G0 X 3.70000 Y 0.00000	
G0 X 5.36800 Y 1.37000	
M99	
O2	* COUNTOURING SUB
G0 Y-.25	* ADD Y START POSITION
Z-.6	* Z TO CUTTING DEPTH
G41	* COMP TOOL LEFT
G90 G0 X -0.37600 Y -0.25000	
G1 X -0.37600 Y 1.62000	
G2 X -0.25100 Y 1.74500 R 0.12500	
G1 X 5.61900 Y 1.74500	
G2 X 5.74400 Y 1.62000 R 0.12500	
G1 X 5.74400 Y 0.37000	
G2 X 5.61900 Y 0.24500 R 0.12500	
G1 X 4.32500 Y 0.24500	
G3 X 4.07500 Y -0.00500 R 0.25000	
G1 X 4.07500 Y -0.25000	
G2 X 3.95000 Y -0.37500 R 0.12500	
G1 X -0.25100 Y -0.37500	
G2 X -0.37600 Y -0.25000 R 0.12500	
G1 G40 X-1	* COMP OFF MOVE
M99	

### Using DXF for Pockets with Islands (G162)


Refer to “[Section 5, Pockets with Islands \(G162\)](#).” In DXF, make outside profile shape #1 or lowest number. Then all islands thereafter, the order is not important. When saving these, use Cam Shape. Refer to **Figure 17-4**.

1. Highlight the DXF filename, and press **Utility (F9)**.
2. Highlight **DXF Converter**, and press **ENTER**.
3. Press **SETUP**, select **OUTPUT format**, press **ENTER**.
4. Select **CAM Shape**, and press **ENTER**. Refer to **Figure 17-4**.
5. Select to **Convert values**, and press **ENTER**.
6. Select **Metric**, and press **ENTER**.
7. Press **Exit** twice.



**Figure 17-4, DXF Output format, CAN Shape Pop-up Menu Illustration**


Using [Figure 17-5, DXF Pockets with Islands Example Workpiece](#) as an example:

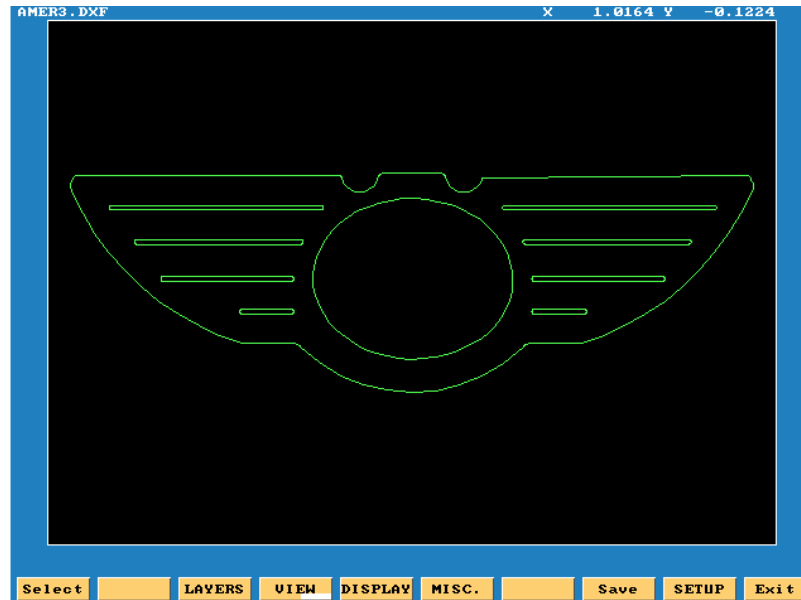

**Figure 17-5, DXF Pockets with Islands Example Workpiece**

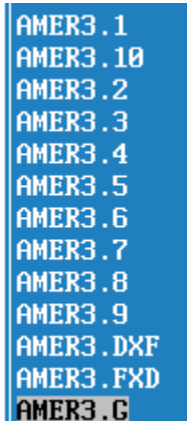1. Select a start point on outer profile and make shape #1. A good point on the workpiece illustrated is just below the radius top left.
2. Select next shape, until all 10 shapes are selected.
3. Press **Save (F9)**, it will save all 10 CAM shapes.
4. Press **Exit (F10)**.
5. Press **Yes (F1)** to exit.

An AMER3.G program needs to be created. Then the AMER3.G program is created, a pop-up list of programs is displayed. See **Figure 17-6**.

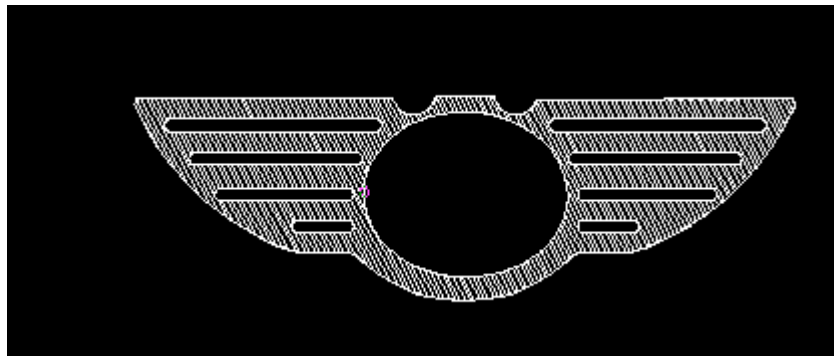


**Figure 17-6, DXF Program Listing Pop-up Menu Illustration**

**DXF Program Example****Table 17-12, DXF Pockets with Islands Programming Example**

N1	G0 G70 G90
N2	G53 O1
N3	T1
N4	G162 A2 B3 C4 D5 E6
N5	G162 A7 B8 C9 D10
N6	G169
N7	G0 Z2.0
N8	X0.0 Y0.0
N9	M2

The completed DXF Pockets with Islands example is illustrated in **Figure 17-7**. The rapid moves are turned off in this illustration.

**Figure 17-7, DXF Pockets with Islands Completed Example Workpiece**

## Creating CAM Shapes

When “CAM Shape” is selected as the “Output format,” you will need to know if the input DXF file is formatted in Inch or Metric. (See [Figure 17-4, DXF Output format, CAN Shape Pop-up Menu Illustration](#).) If the DXF file is in Metric, you must choose “None” from the “Convert Values” field. If the DXF file is in Inch format, you must choose “Metric” from the “Convert Values” field. This is because the CAM is always expecting Metric input.

Once you have created the shapes in the DXF converter and then saved them using the **F8 (Save)** function, you need a “.G” program with the same name as is listed in the Output menu of the DXF converter. If that program name does not already exist (See “[Section 1, Getting Started](#)” for program creation from the Program Directory), then go into the CAM with that “.G” file highlighted. Once in CAM, you press **F6 (Misc.)** and select **Recover Shapes**, then press **F5 (Display)** and select **Fit** to view the CAM shapes.

## Section 18 - CAM Programming

### CAM Mode

CAM Mode is very different from the standard G-code method of part programming. With CAM programming, you create part programs with the help of icons. These icons prompt you for necessary information.

To use CAM programming, you must know the XYZ (Cartesian) coordinate system, the polar coordinate system, and machining sequences. You must make a machining plan, decide which type of tools to use and when to use those tools in the program.

You can use CAM programming to generate toolpaths from “shapes.” These shapes are generated from the icon tools. Icon tools enable the moves to be put directly into the shapes or create construction geometry. Construction geometry can then be “chained” to generate moves for the shapes.


To create the geometric elements required for a part program, such as lines, arc, and points, click on the appropriate icon, and press **ENTER**. The CNC prompts you to enter a dimension, such as the length of a line or the radius of an arc. These entries, combined with the **Motion (F7)** soft key, enable the system to perform the desired machine sequences. As you program lines, arcs, and points, they are displayed on the Graphics screen.

CAM Mode enables you to generate part programs without using G-codes. Before you use CAM Mode, become familiar with CNC programming techniques, including G-codes.

Refer to **Table 18-1**. The CAM Mode screen displays the following information:

**Table 18-1, CAM Mode Screen Displays**

<b>Cursor Coordinates</b>	<b>XYZ position of the cursor.</b>
<b>Abs/Inc Mode Indicator</b>	Dimensioning Mode: Absolute or Incremental. <b>NOTE:</b> The resulting subprogram will execute moves using absolute dimensions.
<b>Inch/MM Mode Indicator</b>	Inch or MM Mode.
<b>Cursor</b>	Selects specific points for editing.
<b>Display Area</b>	Viewing area.
<b>Drawing Tools</b>	Create and edit shapes.
<b>Soft Keys</b>	The default soft keys provide tools to change the setup, adjust the display, and manage shapes.
<b>Program Name</b>	Name of program linked to the shapes.

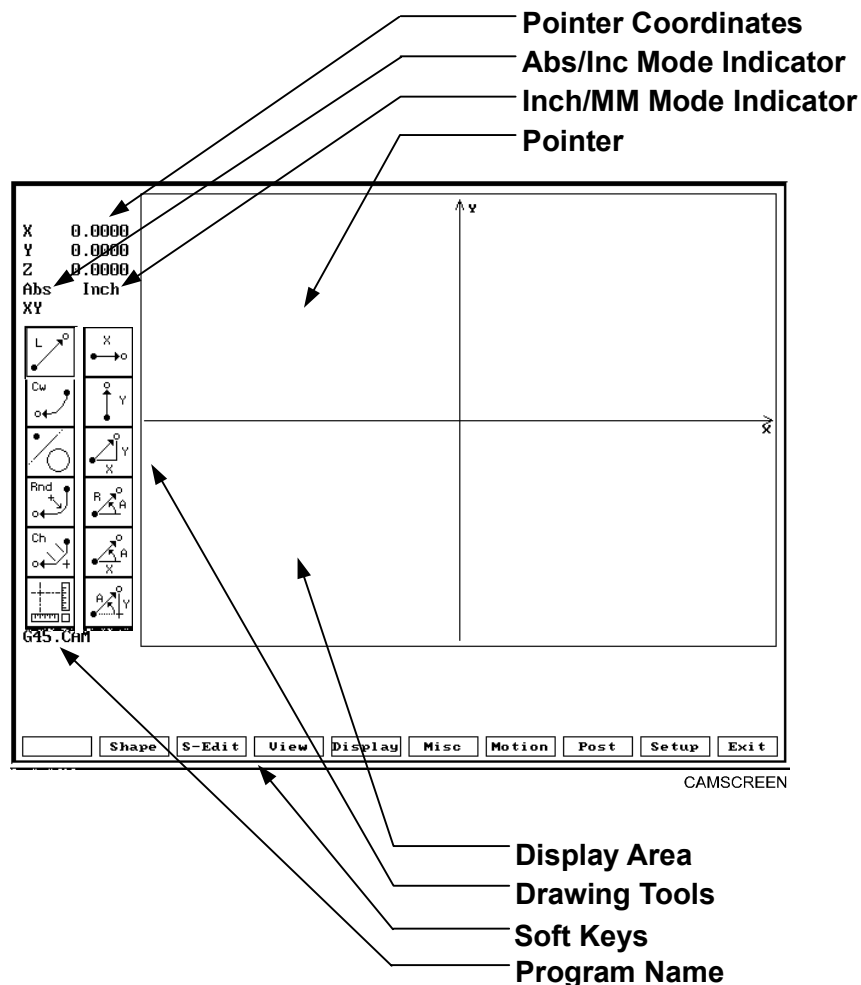

**Figure 18-1, CAM Mode Screen**

### CAM Mode Soft Keys

To activate the CAM Mode soft keys:

1. In Manual Mode, press **Program (F2)** to activate the Program Directory. Highlight an existing program, then press **CAM (F4)**.
2. The CAM screen activates and the active soft key highlights.

Refer to **Table 18-2, CAM Mode Soft Keys**.

There are two soft key menus in CAM Mode:

- The Main soft key display is displayed when you enter CAM Mode.
- The Secondary soft key display, or **Shape (F2)** soft keys, are displayed when you press **SHAPE (F2)**.

Table 18-2, CAM Mode Soft Keys

Label	Soft Key	Function
SHAPE	F2	Turns ON Shape soft keys.
S-EDIT	F3	Use to create, delete, edit, and import shapes.
VIEW	F4	Changes the view (XY, XZ, YZ, and ISO). For details on <b>View</b> , refer to <b>Draw Mode</b> .
DISPLAY	F5	Zooms in on an area of a part, scales it to fit the screen.
MISC	F6	Enables you to inspect data relating to shapes and geometry.
MOTION	F7	Generates a cutting tool path.
POST	F8	Selects the post-processing function of the CAM software and creates a G-code program.
SETUP	F9	Configures the POST processor, turns Shapes, Paths, and Geometry ON/OFF, sets attributes and switches between Absolute and Incremental Modes.
Exit	F10	Saves all program data and returns to the Program Directory.

### Shape (F2) Soft Keys

From the CAM Mode screen, press **Shape (F2)**. The soft keys change allowing you to create, delete, edit, and import shapes. Refer to **Table 18-3**.

Table 18-3, Shape (F2) Soft Keys

Label	Soft Key	Function
SHAPE	F2	Turns OFF Shape soft keys.
S-EDIT	F3	Use to create, delete, change, and import shapes.
Back	F4	Moves cursor one step in the opposite direction of the shape input.
Forw	F5	Moves cursor one step forward in the direction of the shape input.
Prev-S	F6	Moves cursor to the previous shape in the program.
Next-S	F7	Moves cursor to the next shape in the program.
DelMove	F8	Deletes a move from the current shape. <b>WARNING: If you delete a move other than the last move of a shape, the previous and next moves will be connected. To avoid this, move the cursor to the last move of a shape), then press DelMove (F8) until the required move is deleted.</b>
DelGeom	F9	Deletes a piece of Construction Geometry from the current program file.



## Shape Edit Menu

Press **S-EDIT (F3)** to create a shape, delete a shape, join and project lines/arcs, merge a shape from another program file (import), and join elements of a shape. **S-EDIT (F3)** is displayed in both the main and secondary **SHAPE (F2)** soft key displays to allow you to create a shape from either display. In **S-EDIT**, the pop-up displays the following options:

**Create, Copy, Move, Delete, Rev Arc, Project, Join, and Import.**

**IMPORTANT:** Before you can program the cursor (described earlier) to move around a shape using Line, Arc or Chain, you must first create a shape. To create a shape, program an XY start position.

### Create

Shapes are the basic units of the CAM Mode. They will be used later to generate the actual tool paths, such as Contour, Pocket, and Drill. When programming shapes, program the part-edge, or perimeter. The CAM software will compensate for tool radius when the tool paths are generated.

To create a shape:

1. Press **S-EDIT (F3)**. **Create** highlights.
2. Press **ENTER**. The CNC prompts you to select a point definition tool. The right-hand column of icons now shows point definitions. Select one of these to define the XY start position of the shape.
3. After you choose and enter the point definition, the shape cursor is displayed on the screen at the specified start point. Now you can program Lines, Arcs, Geometry, or Chain moves to make the shape.

In some cases, the part will require you to create more than one shape. The CNC will automatically number each shape, starting with 1.

For example, you can program the perimeter of a part (Shape 1), to be contoured later, and then program another shape (Shape 2) to mill a pocket.

## Copy

To copy an existing shape:

1. Ensure that the cursor is on the shape.
2. Press **S-EDIT (F3)**. A pop-up activates.
3. Highlight **Copy**, and press **ENTER**.
4. The CNC prompts you to **Select point definition...**
5. Press **ENTER**. The CNC prompts you to **Enter X value**: Type the X-axis start position of the new shape, and press **ENTER**.
6. The CNC prompts to **Enter Y value**: Type the Y start position, and press **ENTER**.

**NOTE:** The prompt could be different based on the point definition tool selected.

7. The new shape is displayed on the screen. To make changes to the drawing, press **S-EDIT (F3)**. To deactivate the pop-up, press **DISPLAY (F5)**. The **DISPLAY** key is described later in this section.

## Move

The **Move** feature enables you to move a shape to a different location.

To move a shape:

1. Press **S-EDIT (F3)**. A pop-up activates.
2. Highlight **Move**, and press **ENTER**.
3. The CNC prompts to **Select point definition...** Select the first point definition tool from the right-hand column of the CAM screen.
4. Press **ENTER**. The CNC prompts to **Enter X value**: Type the X point of origin for the new shape, and press **ENTER**.

**NOTE:** The prompt could be different based on the point definition tool selected.

5. The CNC prompts to **Enter Y value**: Type the Y point of origin for the new shape, and press **ENTER**.
6. The new shape is displayed on the screen. To make changes to the drawing, press **S-EDIT (F3)**. To deactivate the pop-up, press **DISPLAY (F5)**. The **DISPLAY** key is described later in this section.

## Rev Arc

Occasionally, you might program an Arc move in the wrong direction. Instead of deleting the segment and redrawing it, you can reverse the Arc's direction. Arcs at the end of a shape or between any two segments can be reversed. To reverse an Arc's direction:

1. Move the cursor to the Arc's forward node, and press **S-Edit (F3)**. The S-Edit Pop-Up menu is displayed.
2. Highlight **Rev Arc**, and press **ENTER**. The arc will be redrawn in the reverse direction.

## Delete

When necessary, an entire shape can be deleted.

To delete an entire shape:

1. Use **Prev-S (F6)** and **Next-S (F7)** to move the cursor to occupy any node within the shape to be deleted.
2. Press **S-EDIT (F3)**. The **S-EDIT** Pop-Up Menu is displayed.
3. Highlight **Delete**, and press **ENTER**. The CNC will prompt to confirm the deletion.
4. Press **Yes (F1)** or **No (F2)** as required. **Yes** causes the shape to be deleted. **No** cancels the process.

Sometimes small bits of a shape will remain on the screen after deletion. Press **R**, which functions as a hot key, to refresh the screen.

## Project

Use the **Project** feature to remove blend radii and restore the sharp corners. This operation is called "projecting" because projections are added to line segments on both sides of a removed radius.

To remove a radius and restore a sharp corner:

1. Move the cursor to the forward node of the radius being removed.
2. Press **S-EDIT (F3)**. The **S-EDIT** Pop-Up Menu is displayed.
3. Select **Project**, and press **ENTER**. The radius will be removed and line projections forming a sharp angle are added. The editor will prompt to join the lines.
4. Press **Yes (F1)** to join the projections. The collinear line segments are joined into a single straight-line segment.

**NOTE:** Collinear lines are end-to-end lines that lie in the same direction.

## Join

Sometimes what is displayed to be a single line segment is more than one line segment drawn end-to-end. To detect the presence of the extra nodes within the segment, move the cursor along the segment.

Collinear segments do not affect the execution of the move. Usually, it is desirable to join collinear lines to keep the subprogram and future editing sessions as simple as possible.

Join collinear lines as follows:

1. Position the cursor at the node between the collinear lines.
2. Press **S-EDIT (F3)**. The **S-EDIT** Pop-Up Menu is displayed.
3. Highlight **Join**, and press **ENTER**. The unnecessary node is removed from the line.

## Import

Sometimes, the same shape is used in more than one program. Instead of programming the shape more than once, you can import the shape from its original program.

To import an existing shape from another program:

1. Press **S-EDIT (F3)**. The **S-EDIT** Pop-Up Menu is displayed.
2. Highlight **Import**, and press **ENTER**. The CNC prompts for the name of the program containing the shape to be imported.
3. Type the program name, and press **ENTER**. The CNC displays a list of the shapes contained in the source program.
4. Highlight the desired shape, and press **ENTER**. The editor will prompt to determine if the origin of the shape should be changed.
5. Press **Yes (F1)** and key in a new origin as prompted, or press **No (F2)** to import the shape at its original position.

## View (F4)

Use the **View** function to change the plane view. Options are **XY**, **XZ**, **YZ**, and Isometric (**Iso**) views. For details on **View**, refer to **Draw Mode**.

---

## MOTION (F7)

Use **MOTION** to generate tool paths for Contour, Pocket, and Drill moves. You can use **Motion (F7)** only after a shape has been input into the program.

To generate a tool path:

1. From the CAM Mode screen, press **MOTION (F7)**. A pop-up menu is displayed. Menu options are: **Contour, Pocket, Drill, Edit, and Delete**.
2. Highlight a selection, and press **ENTER**.
3. Enter cutting parameters so that CAM software can generate a path. The **Calc** (calculate) key is displayed.
4. Press **Calc**. The CNC calculates the tool path and shows it on the screen. Choose whether to save the path.

After the toolpath is calculated, press **POST (SHIFT+F7)** to generate a CNC program. This program will be a G-code program that the CNC can use to produce the parts.

Use **Edit** to change an existing tool path. Use **Delete** to delete a toolpath. In all cases, parameters are changed by highlighting the field, and pressing **ENTER**.

## Del Move (F8)

**DelMove (F8)** deletes a move from the current shape. The cursor must be at the end of the move to be deleted.

<p><b>WARNING:</b> If you delete a move other than the last move of a shape, the previous and next moves will be connected. To avoid this, move the cursor to the last move of a shape, then press DelMove (F8) until the required move is deleted.</p>
---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

## Contour

**Contour** highlights when you press **MOTION (F7)**.

Use this feature to cut a profile for:

- A part perimeter (outline).
- A perimeter pass to finish a pocket, slot or other type of contour.

The shape does not need to be closed.

Refer to [Figure 18-2, Contour Parameters Menu](#). With **Contour** highlighted, press **ENTER**. Contours Parameters Menu 1 is displayed.

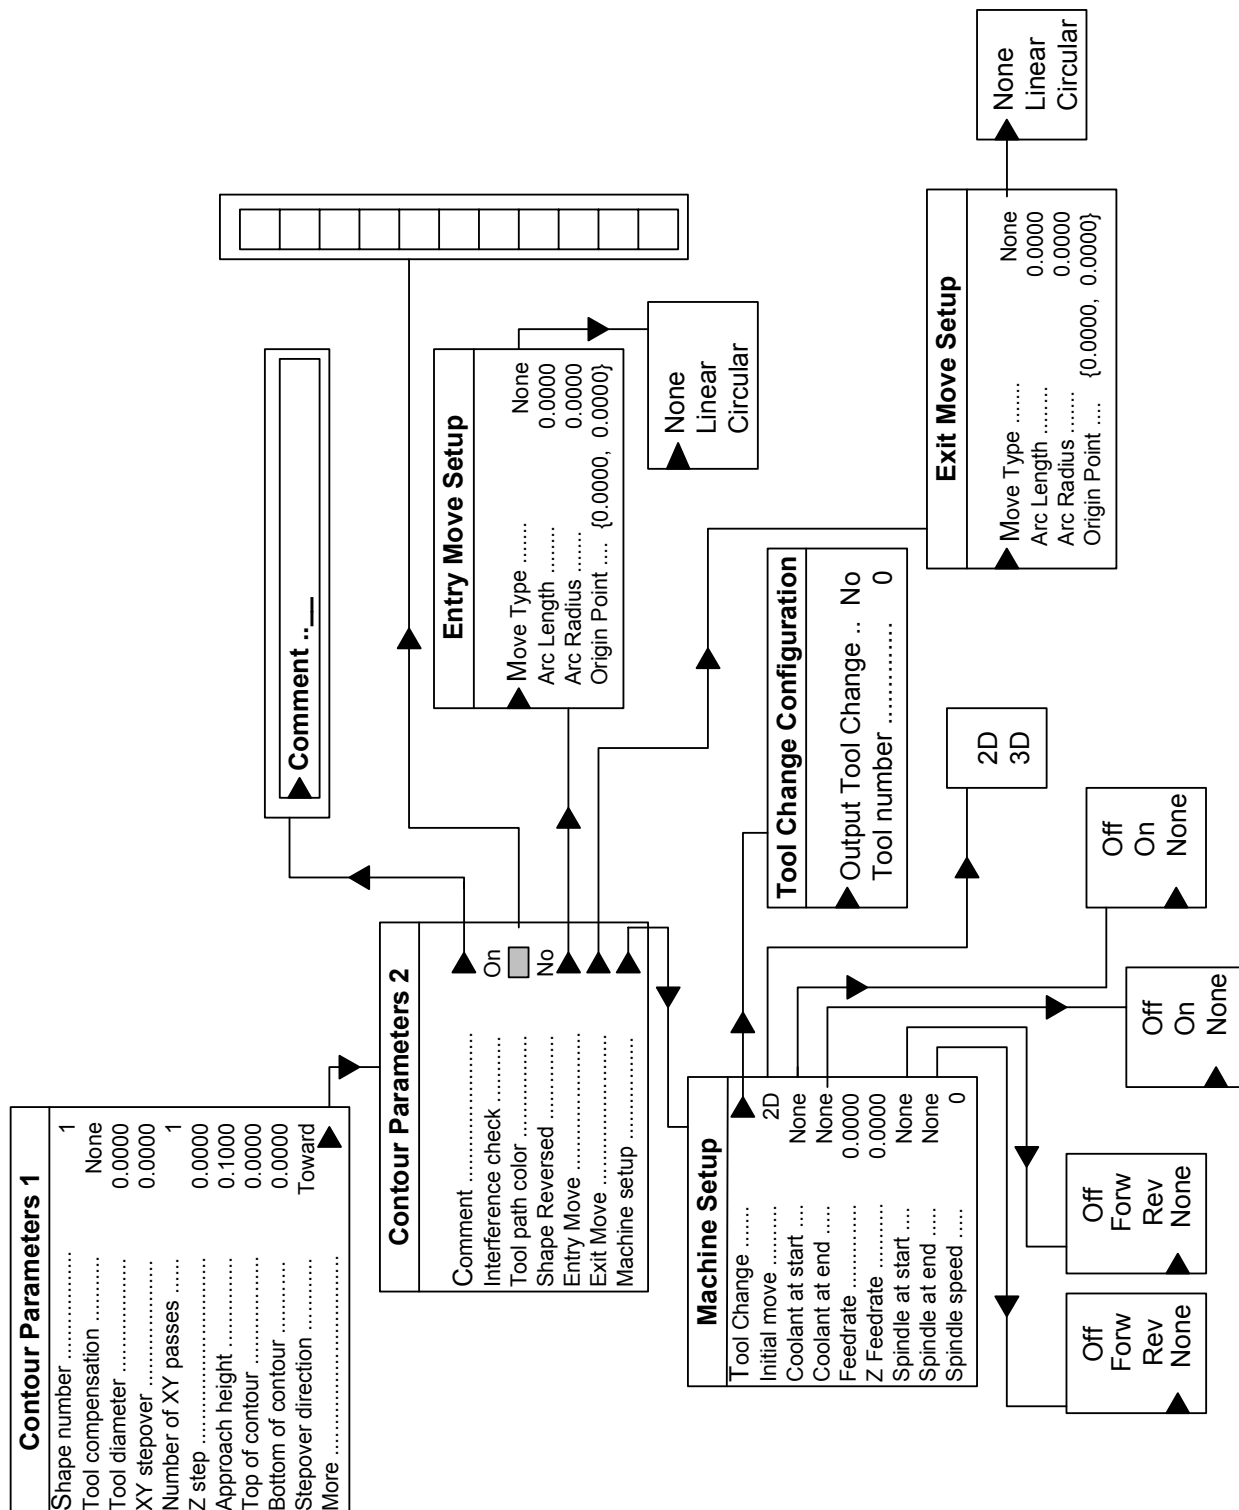


Figure 18-2, Contour Parameters Menu

Refer to **Table 18-4**. Contour Parameters 1 Menu lists the following:

**Table 18-4, Contour Parameters 1 Menu Options**

Parameter	Description and Options
<b>Shape number</b>	Chooses which shape of the program you wish to contour. To select a shape, highlight a Shape Number, and press <b>ENTER</b> . Type the number of the desired shape, and press <b>ENTER</b> .
<b>Tool Compensation</b>	<p>Chooses the compensation direction. Highlight and press <b>ENTER</b> to choose <b>CAM left</b>, <b>CAM right</b>, or <b>None</b>. The direction of compensation is equal to the side of the programmed shape on which the tool is to cut. View the Left - Right direction in the direction of the first move in the shape. The end of the first move of each shape has an arrow attached, which indicates the direction in which the shape was programmed.</p> <p>Options:</p> <p><b>CAM Left</b> or  <b>CAM Right:</b> The tool path is placed on the appropriate side of the shape.</p> <p><b>None:</b> No compensation takes place and the tool path equals the shape.</p>
<b>Tool diameter</b>	<p>Enters the tool diameter. Press <b>ENTER</b> to choose <b>Direct</b> or <b>Tool table</b>.</p> <p>Options:</p> <p><b>Direct</b> Type the tool diameter directly.</p> <p><b>Tool table</b> The values in the tool table for diameter length only will be displayed. (Length offsets must be entered at setup). Highlight a value in the table, and press <b>ENTER</b> to enter that value into the Tool diameter parameter.</p>
<b>XY stepover</b>	<p>Enters a stepover distance. This parameter applies only if the next parameter, "<b>Number of XY passes</b>", is programmed to be greater than one (1). For example: If programmed to .0500, and programmed to three 'XY passes' (in next parameter), the tool path is generated with three complete passes around the profile.</p> <p>Start point is automatically calculated, based on the start point of the shape and the compensation value.</p> <p>This parameter should be 0.0000 if only one pass is required. To set this parameter, highlight it, press <b>ENTER</b>, and select the tool stepover value.</p>
<b>Number of XY passes</b>	<p>Makes several passes around a contour. This can be advantageous if a large amount of stock must be removed, but cannot be taken in a single pass. If programmed to be greater than one (1), you must also program XY stepover. To set this parameter, highlight it, type the number of XY passes, and press <b>ENTER</b>.</p>

*(Continued...)*

**Table 18-4, Contour Parameters 1 Menu Options (Continued)**

Parameter	Description and Options
<b>Z step</b>	Cuts contour in Z levels. If a contour's depth cannot be machined in one depth-of-cut, use this to "step" the Z-axis down in levels. It works in conjunction with the <b>Bottom of contour</b> parameter. For example: if <b>Z step</b> is set to .5000, and the <b>Bottom of contour</b> parameter is set to -1.0000, the contour will be cut twice (once at Z-0.5000, and once at Z-1.0000). It is possible to use both XY stepover and Z step for the same contour path.
<b>Approach Height</b>	Sets the position to which the Z-axis will rapid before it begins the first feed move. Generally, if Z0 is set at the top of the workpiece, approach height is set to 0.1000 inches (0.1 above the part). The default value is preset to 0.1000. If the top of the workpiece is not Z0, reset this parameter to ensure a safe, rapid clearance height.
<b>Top of contour</b>	Defines the location of the top of the contour in reference to Z0. Generally, this is set to 0.0000, but can be set to any value to enable a contour to be cut at any Z depth.
<b>Bottom of contour</b>	Sets the final depth of the contour. You must set this parameter to a value less than the previous parameter (Top of contour) or an Error message will occur. If the top of the workpiece is Z0, this will be a negative value.
<b>Stepover direction</b>	Reverses the XY stepover direction (if programmed). This parameter refers to the direction in which the stepover will occur. Normally, this will be toward the shape. Generally, this parameter should be set to <b>Toward</b> . Options: <b>Toward:</b> Stepover will occur toward the shape. <b>Away:</b> The first pass of the sequence will take place next to the shape, then step away from the shape. <b>NOTE:</b> This parameter does not apply if only one XY pass is programmed above.

Highlight **More**, and press **ENTER** to activate the Contour Parameters 2 Menu. Refer to **Table 18-5**. This menu enables you to set the following parameters:

**Table 18-5, Contour Parameters 2 Menu Options**

Parameter	Description and Options
<b>Comment</b>	Enters a comment block into the program. This comment will be output into the program when you execute the <b>POST</b> function. Refer to <b>POST</b> . A comment block is not essential, but it can be helpful. If you use a comment block, * should be the first character, so that CNC will see it as a comment, not an executable block. Without the * you can enter code other than a comment.

(Continued...)



**Table 18-5, Contour Parameters 2 Menu Options (Continued)**

Parameter	Description and Options
<b>Interference check</b>	<p>When ON, forces the CAM software to "look" for tool interference while it calculates the tool path. Generally, this should be set to the default setting, ON. Interference could occur if the tool path cannot be calculated with the chosen tool radius.</p> <p>Options: <b>ON, OFF</b></p>
<b>Tool path color</b>	<p>Assigns a color to the path that will be generated when you press <b>Calc</b>. Since more than one path can be generated in a program, it is best to distinguish one path from another by color. Assign a separate color to each path to distinguish one from another easily. Press <b>Tool path color</b> to activate a color bar. To select a tool path color, highlight the color of choice, and press <b>ENTER</b>.</p> <p>Options: Choose from color menu.</p>
<b>Shape Reversed</b>	<p>Sets the path to mill around the shape in the direction opposite to the one in which the shape was programmed. (For example, CW/CCW).</p> <p>Each shape has a direction, indicated by an arrow at the end of the first move of the shape.</p> <p><b>NOTE:</b> If set to <b>Tool comp</b>, adjust LEFT or RIGHT accordingly.</p> <p>Options:</p> <p><b>No:</b> The shape is used in the same direction as it was generated.</p> <p><b>Yes:</b> The shape is used in the opposite direction that it was generated.</p>
<b>Entry/Exit Moves</b>	<p>Enters or exits the path with a linear or circular move. If not used, the tool will plunge in (entry) and Z-out (exit) with the tool directly on the path of the shape. This is sometimes undesirable, because a tool mark could be left on the part, especially on the exit move. To eliminate the tool mark, the entry/exit moves are provided.</p> <p>Options:</p> <p><b>Move Type:</b> Set whether the move is a line, arc, or if there will be no entry/exit move (<b>None</b>). Lines require that Entry #4 (origin point) be programmed. Arcs require that Entries #2 and #3 (arc length, arc radius) be programmed.</p> <p><b>None:</b> specifies no entry/exit move.</p> <p><b>Arc Length:</b> Determines arc output (90°, 180°, etc.) All arcs are output tangent to the first/last move of the path. Not applicable if #1 is set to Linear.</p> <p><b>Arc Radius:</b> A radius value for the entry/exit arc. Used only if #1 is set to Arc. Origin Point: Used only if #1 is set to Linear. This is the absolute XY dimension to which the "linear" entry/exit moves go from/to when entering/exiting the path.</p>

Table 18-5, Contour Parameters 2 Menu Options (Continued)

Parameter	Description and Options
<b>Machine setup</b>	<p><b>Tool change</b></p> <p>Enables a tool change and assigns a tool number to the tool that will machine the contour. This tool number is output to the program with the <b>POST</b> function. It is not affected by the tool diameter, even if selected from the Tool Page.</p> <p>Options:</p> <p><b>Initial move:</b></p> <p><b>Output</b> (yes or no) Tool change code will/will not be output to the program when posted. Set type of tool change (G28 Z, or G0 T0 Z0) in <b>POST</b> settings.</p> <p><b>Tool Number:</b> enables a T# to be output to the program when posted.</p> <p><b>2D:</b> on the first move of the PATH, the XY axes rapid position first, then the Z-axis rapid positions to the "Approach height" set previously. [Default: <b>2D</b>]</p> <p><b>3D:</b> the rapid positioning move will be a 3-axis XYZ move to the start point.</p> <p><b>Coolant at start:</b></p> <p><b>ON</b> places a coolant ON command in the program before the FIRST cut in the contour.</p> <p>Options:</p> <p><b>OFF:</b> A coolant OFF command is issued.</p> <p><b>NONE:</b> No coolant command will be given. <b>None</b> could be used if coolant was already issued in a previous contour, or if no coolant is desired.</p> <p><b>Coolant at end:</b></p> <p><b>OFF:</b> Places a Coolant OFF command in the part program after the last cut in the contour.</p> <p><b>ON:</b> An ON command is issued.</p> <p><b>NONE:</b> No coolant command is given.</p>
	<p><b>Feedrate:</b> Enters the cutting feedrate of the contour. Press <b>ENTER</b> to clear the current value. Type the new value, and press <b>ENTER</b> to set it.</p>

(Continued...)

**Table 18-5, Contour Parameters 2 Menu Options (Continued)**

Parameter	Description and Options
	<b>Z-Feedrate:</b> Enters the plunge feedrate of the Z-axis. Press <b>ENTER</b> to clear the current value. Type the new value, and press <b>ENTER</b> to set it.
	<b>Spindle at start:</b> Sets the spindle at the start of the contour. Press <b>ENTER</b> while the cursor is on the Spindle line to activate a pop-up that displays options.
	<b>Spindle at end:</b> Sets the spindle at the end of the contour. Press <b>ENTER</b> while the cursor is on the Spindle line to activate a pop-up that displays options.  Options: <b>OFF, FWD, REV, and NONE.</b> <b>NONE</b> could be used if the spindle was already turned ON in a previous contour, pocket, or drill menu.
	<b>Spindle speed:</b> Enters direct speed in RPMs into the menu. This is the speed to which the spindle will be set when you issue the ON command.

Refer to **Table 18-6.** Soft keys in the Contour Menus are as follows:

**Table 18-6, Contour Screen Software**


Label	Soft Key	Function
<b>F8</b>	<b>Calc</b>	Calculates and displays tool path. When path is displayed, the CNC prompts, <b>Save tool path? _</b> . <b>Yes (F1)</b> saves the path. <b>No (F2)</b> deletes the path. In either case, all the parameters of the contour menu(s) will be saved, until overwritten with new values.  If <b>Yes</b> , the path can still be changed at a later time/date with the <b>EDIT</b> function of the <b>MOTION</b> soft key. You can also <b>Delete</b> the path later.
<b>F10</b>	<b>Cont</b>	Backs-up or continues through the windows (until <b>Calc</b> is displayed) or to change a previous setting.

**NOTE:** If your machine tool does not have programmable spindle and coolant functions, ignore the items that pertain to "Coolant" and "Spindle".

**Pocket**

Pocket is accessed from the **MOTION (F7)** Pop-Up. Use it to cut a pocket of any shape. Pocket shapes must be closed.

Refer to **Figure 18-3**. In the Motion screen, highlight **Pocket**, and press **ENTER**. The Pocket Parameters Menu is displayed.

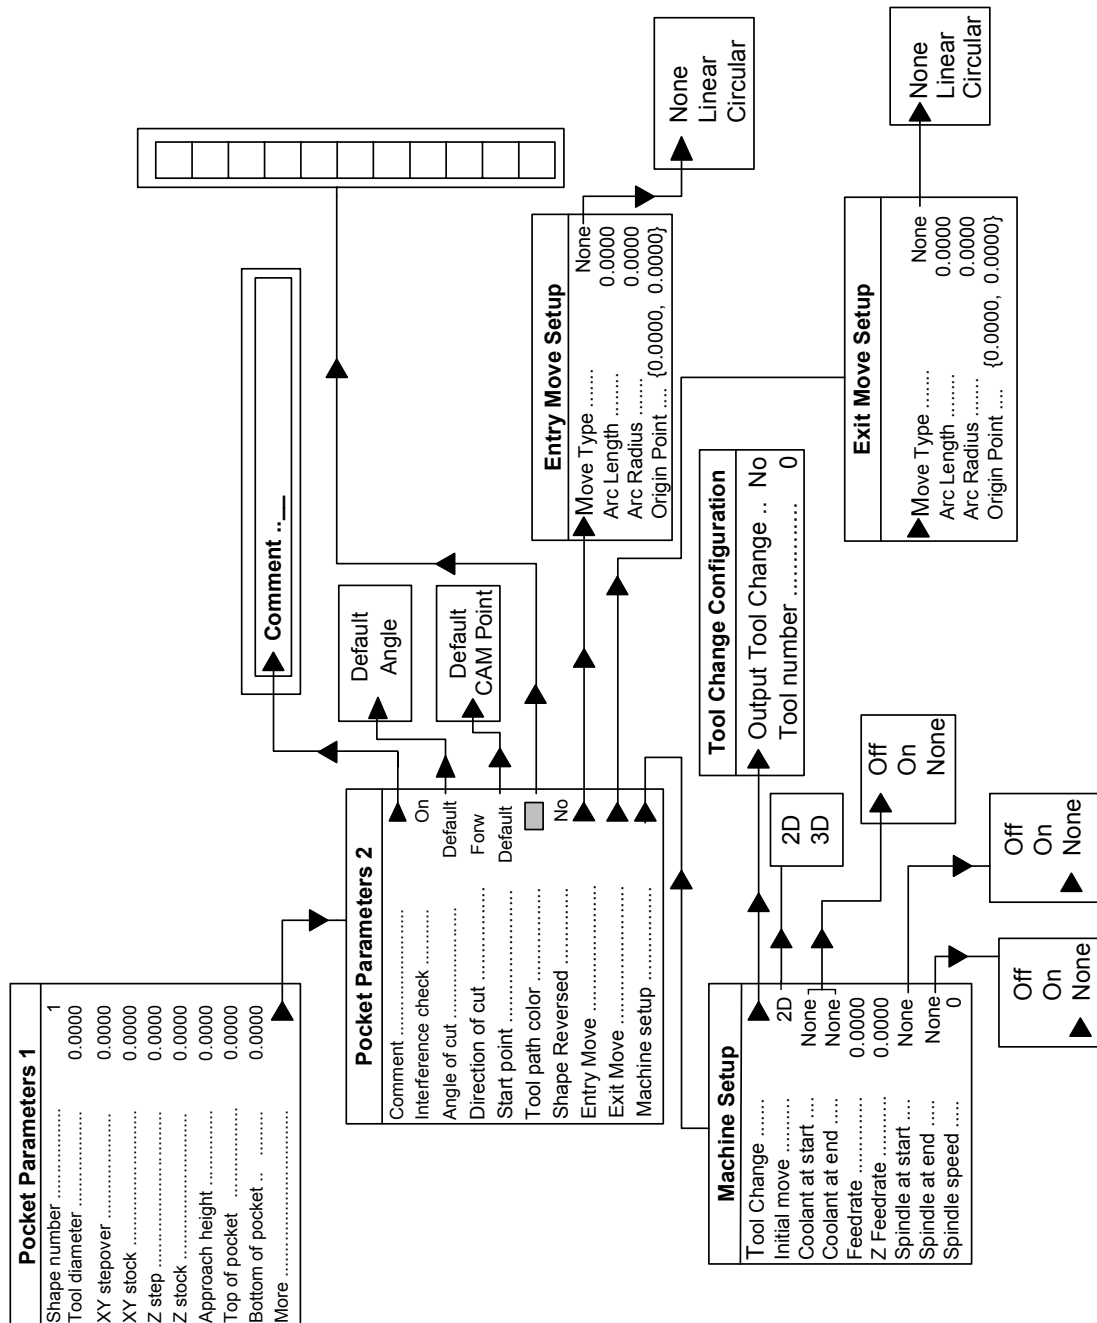

**Figure 18-3, Pocket Parameter Menus**

Refer to **Table 18-7**. Pocket Parameters 1 Menu lists the following:

**Table 18-7, Pocket Parameters 1 Menu**

Parameter	Description and Options
<b>Shape number:</b>	Chooses which shape of the program you wish to contour. To enter a shape, highlight a Shape Number, and press <b>ENTER</b> . Type the number of the desired shape, and press <b>ENTER</b> .
<b>Tool diameter:</b>	Enters the tool diameter. Press <b>ENTER</b> to choose <b>Direct</b> or <b>Tool table</b> . Options: <b>Direct</b> Type the tool diameter directly. <b>Tool table</b> The values in the tool table for diameter length only will be displayed. (Length offsets must be entered at setup). Highlight a value in the table, and press <b>ENTER</b> to enter that value into the Tool diameter parameter.
<b>XY stepover</b>	Inputs a stepover distance. This parameter is the 'width of cut' the tool will use while it clears the pocket.
<b>XY stock</b>	Leaves extra stock on the perimeter of the pocket, so that a finish pass can be made using the <b>Contour</b> feature. <b>NOTE:</b> ANILAM recommends that you leave some amount of XY stock for a finish pass, then make a contour pass around the perimeter of the pocket. To set this parameter, highlight it, press <b>ENTER</b> , type the amount of stock to be left (per side), and press <b>ENTER</b> .
<b>Z step</b>	Cuts a pocket in Z levels. If a pocket's depth cannot be machined in one depth-of-cut, use this parameter to "step" the Z-axis down in levels. It works in conjunction with the <b>Bottom of pocket</b> parameter. For example: If 'Z step' is set to .5000, and <b>Bottom of pocket</b> is set to -1.0000, the pocket will be cut twice (once at Z-0.5000, and once at Z-1.0000).
<b>Z stock</b>	Leaves extra stock on the bottom of the pocket. If you use this parameter, you must set up another pocket to reach the final depth.
<b>Approach height</b>	Sets the position to which the Z-axis will rapid before it begins the first feed move. Generally, if Z0 is set at the top of the workpiece, approach height is set to 0.1000 inches (.1 above the part). The default value is preset to 0.1000. If the top of the workpiece is not Z0, reset this parameter to ensure a safe, rapid clearance height.
<b>Top of pocket</b>	Defines the location of the top of the pocket in reference to Z0. Generally, this is set to 0.0000, but can be set to any value to enable a contour to be cut at any Z depth.

(Continued...)

**Table 18-7, Pocket Parameters 1 Menu** (Continued)

Parameter	Description and Options
<b>Bottom of pocket</b>	Sets the final depth of the pocket. You must set this parameter to a value less than the previous parameter (Top of pocket) or an Error message will occur. If the top of the workpiece is Z0, this will be a negative value.
<b>Islands setup</b>	See " <a href="#">Section 5, Pockets with Islands (G162).</a> "
<b>More</b>	Highlight this parameter, and press <b>ENTER</b> to activate Pocket Parameters 2 Menu.

Refer to **Table 18-8**. This menu enables you to set the following parameters:

**Table 18-8, Pocket Parameters 2 Menu**

Parameter	Description and Options
<b>Comment</b>	Enters a comment block into the program. This comment will be output into the program when you execute the <b>POST</b> function. Refer to <b>POST</b> . A comment block is not essential, but it can be helpful. If you use a comment block, * should be the first character, so that CNC will see it as a comment, not an executable block. Without the * you can enter code other than a comment.
<b>Interference Check</b>	When ON, forces the CAM software to "look" for tool interference while it calculates the tool path. Generally, this should be set to the default setting, ON. Interference could occur if the tool path cannot be calculated with the chosen tool radius.  Options: <b>ON, OFF</b>

(Continued...)

**Table 18-8, Pocket Parameters 2 Menu (Continued)**

Parameter	Description and Options
<p><b>Angle of Cut</b></p>	<p>Usually set to <b>Default</b>. If so set, the angle of the first cut will be in the direction of the first element of the shape used for the pocket operation. The first element of each shape has an arrow at its end that indicates the direction in which the shape was programmed.</p> <p>The tool will step over the defined amount (XY stepover), then cut in the opposite direction, toward the start point. The process will continue until no further cuts are required.</p> <p>You can choose to type the angle of cut, instead of the 'Default' option. To apply a programmed angle, highlight <b>Angle of cut</b>, and press <b>ENTER</b>.</p> <p><b>NOTE:</b> Any angle described is in reference to the polar coordinate system: 0 degrees is the 3-o'clock position (CCW = positive, CW = negative). In some cases, setting the angle will result in better pocket clearance, depending on the geometry of the shape used.</p> <p>Options:</p> <p><b>Default:</b> Automatically set the angle of cut.</p> <p><b>Angle:</b> Type the angle.</p> <p><b>NOTE:</b> If the first element of the shape is an arc, the angle of cut usually needs to be set.</p> <p>Some experimentation with the angle may be necessary, to achieve maximum material removal.</p>

*(Continued...)*

Table 18-8, Pocket Parameters 2 Menu (Continued)

Parameter	Description and Options
<b>Direction of Cut</b>	<p>Describes the direction the tool path will take on its first XY stepover move after it contacts the programmed Shape.</p> <p>Options:</p> <p><b>Forward:</b> The first 'XY stepover' will be in the direction of the shape's element the path first contacts.</p> <p><b>Reverse:</b> The tool will move in the opposite direction of the Shape's element, if possible.</p>
<b>Start Point</b>	<p><b>Default:</b> CAM software calculates the start point automatically. Generally, this point will be at the compensated intersection of the first and last elements of the shape.</p> <p><b>CAM Point</b></p> <p>The "points" definition column of icons is displayed. Choose one to define the CAM Point. The point programmed must lie on or inside the path to be generated; That is, tool diameter and XY stock (if any) must be taken into consideration when you program this point.</p> <p>Use <b>CAM point</b> if you wish to start the machining at a different place than where the shape was begun.</p> <p>Other parameters such as <b>Angle of cut</b> and <b>Direction of cut</b> may need consideration if you select <b>CAM point</b>.</p>
<b>Tool Path Color</b>	<p>Assigns a color to the path that will be generated when you press <b>Calc</b>. Since more than one path can be generated in a program, it is best to distinguish one path from another by color. Assign a separate color to each path to distinguish one from another easily. Press <b>Tool path color</b> to activate a color bar. To select a tool path color, highlight the color of choice, and press <b>ENTER</b>.</p> <p>Options: Choose from color menu.</p>
<b>Shape Reversed</b>	<p>Sets the path to mill around the shape in the direction opposite to the one in which the shape was programmed. (For example, CW/CCW).</p> <p>Each shape has a direction, indicated by an arrow at the end of the first move of the shape.</p> <p><b>NOTE:</b> If set to <b>Tool comp</b>, adjust LEFT or RIGHT accordingly.</p> <p>Options:</p> <p><b>No:</b> The shape is used in the same direction as it was generated.</p> <p><b>Yes:</b> The shape is used in the opposite direction that it was generated.</p>

(Continued...)



**Table 18-8, Pocket Parameters 2 Menu (Continued)**

Parameter	Description and Options
<p><b>Entry / Exit Moves</b></p>	<p>Enters or exits the path with a linear or circular move. If not used, the tool will plunge in (entry) and Z-out (exit) with the tool directly on the path of the shape. This is sometimes undesirable, because a tool mark could be left on the part, especially on the exit move. To eliminate the tool mark, the entry/exit moves are provided.</p> <p>Options:</p> <p><b>Move Type:</b> Set whether the move is a line, arc, or if there will be no entry/exit move (<b>None</b>). Lines require that Entry #4 (origin point) be programmed. Arcs require that Entries #2 &amp; #3 (arc length, arc radius) be programmed.  <b>None:</b> specifies no entry/exit move.</p> <p><b>Arc Length:</b> Determines arc output (90°, 180°, etc.) All arcs are output tangent to the first/last move of the path. Not applicable if #1 is set to <b>Linear</b>.</p> <p><b>Arc Radius:</b> A radius value for the entry/exit arc. Used only if #1 is set to Arc.  <b>Origin Point:</b> Used only if #1 is set to <b>Linear</b>. This is the absolute XY dimension to which the "linear" entry/exit moves go from/to when entering/exiting the path.</p>
<p><b>Machine Setup</b></p>	<p>Highlight this parameter, and press <b>ENTER</b> to activate the final Pocket Parameters Menu. This menu is exactly the same as Contour Menu Parameters 3.</p>

## Pocket Menu Soft Keys

Refer to **Table 18-9** for Pocket Menu soft key descriptions.

**Table 18-9, Pocket Menu Soft Keys**

Label	Soft Key	Function
<b>F8</b>	<b>Calc</b>	Calculates and displays on the screen. After path is displayed, the CNC prompts: <b>Save tool path? _</b> . <b>Yes (F1)</b> saves the path. <b>No (F2)</b> causes the path to be deleted. In either case, all the parameters of the contour menu(s) will be saved, until overwritten with new values. If <b>Yes</b> , the path can still be changed at a later time/date with the <b>EDIT</b> function of the <b>MOTION</b> soft key. You can also <b>Delete</b> the path later.
<b>F10</b>	<b>Cont</b>	Backs-up to previous setting.

## Pockets with Islands (G162)

Refer to “Example #12 Using CAM for Pockets with Islands (G162).”

## Drill

Drill highlights when you activate the **MOTION (F7)** pop-up. Use this function is to drill holes. A shape must be present in order to use the **Drill** function. Holes are be drilled at the end of each separate element of an open or closed shape.

Many of the parameters in **Drill** are the same as those in **Contour** and **Pocket**, described previously. Where this is the case, this manual refers to previous sections.

Refer to [Figure 18-4, Drill Parameters Menus](#). In the **MOTION** screen, highlight **Drill**, and press **ENTER**. The Drill Parameters Menu 1 is displayed.

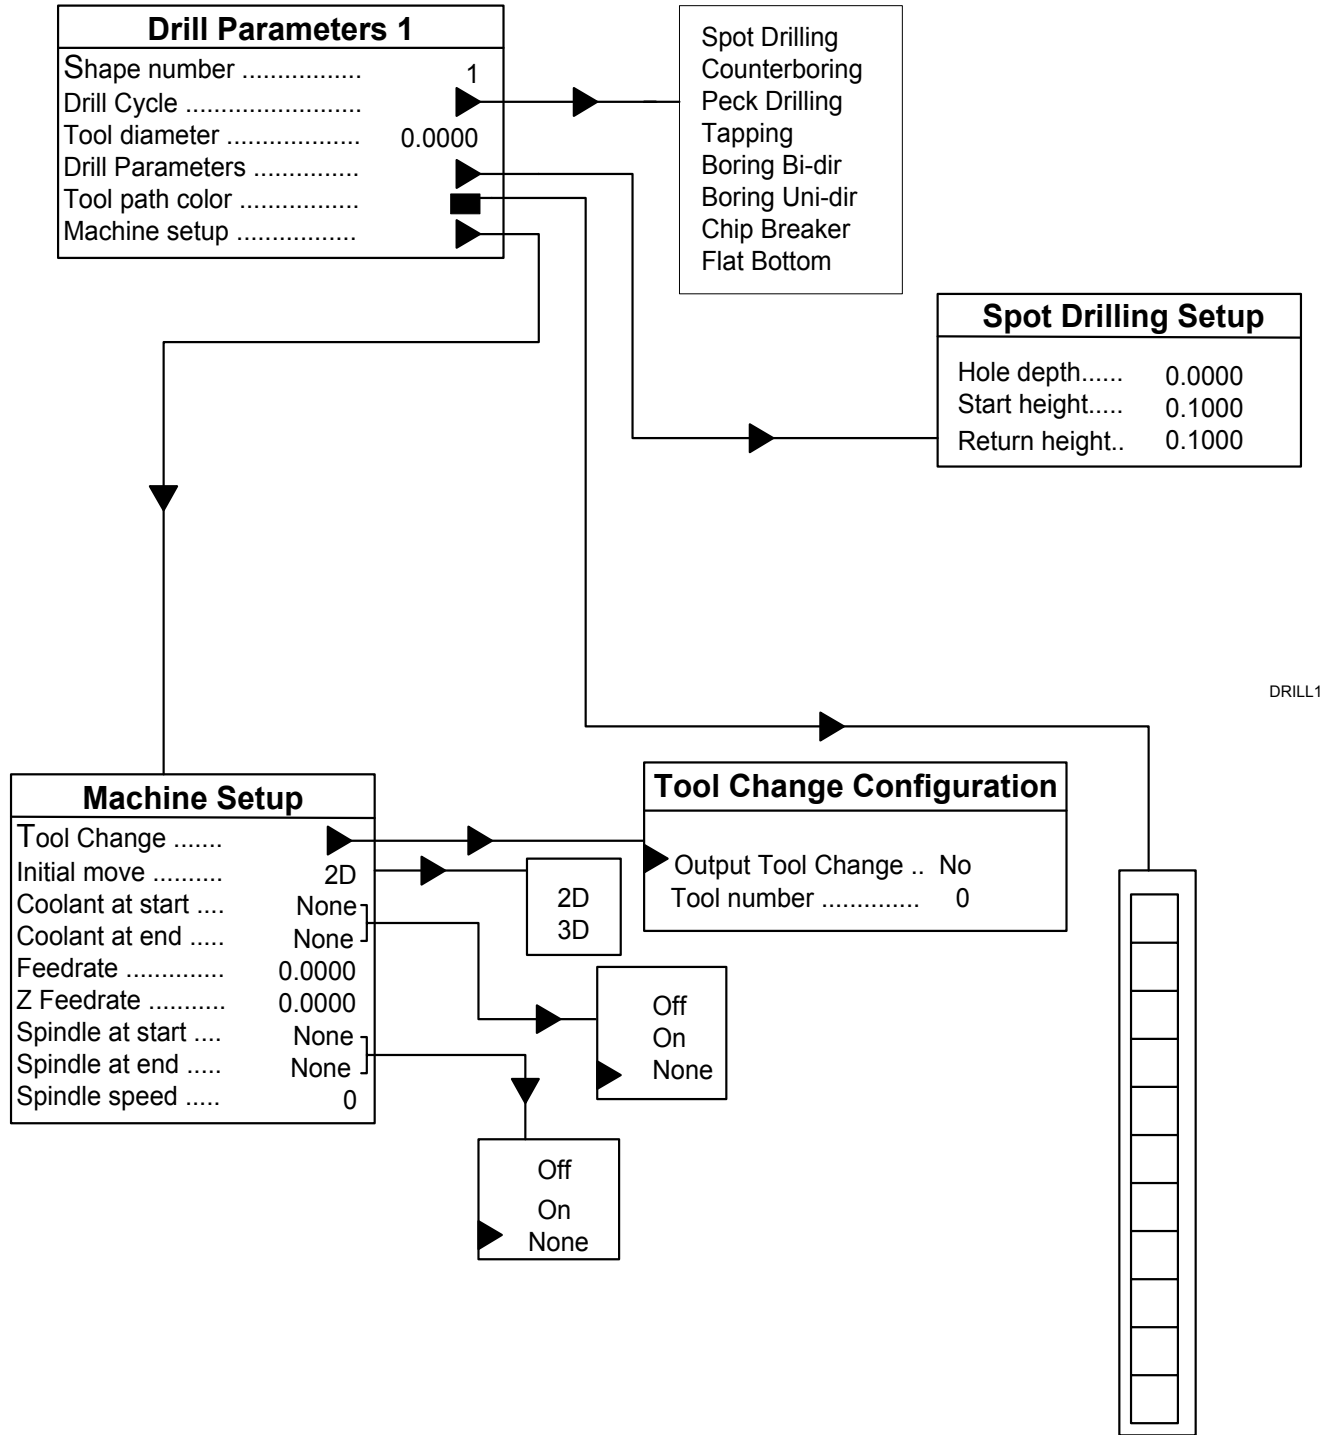


Figure 18-4, Drill Parameters Menus

Refer to **Table 18-10**. This menu enables you to set the following parameters:

**Table 18-10, Drill Parameters 1 Menu**

Parameter	Description and Options
<b>Shape number</b>	Chooses which shape of the program you wish to contour. To select a shape, highlight a Shape Number, and press <b>ENTER</b> . Type the number of the desired shape, and press <b>ENTER</b> .
<b>Drill Cycle</b>	<p>Selects a drill canned cycle to activate in the program. Highlight this parameter, and press <b>ENTER</b>. A pop-up is displayed that shows all of the CNC's canned drilling cycles and a general description of each.</p> <p>Highlight a drill cycle, and press <b>ENTER</b>. You must set drilling parameters in the Drill Parameters area of the pop-up.</p> <p>Options:</p> <ul style="list-style-type: none"> <li><b>Spot Drilling (G81)</b>[Default]</li> <li><b>Counterboring (G82)</b></li> <li><b>Peck Drilling (G83)</b></li> <li><b>Tapping (G84)</b></li> <li><b>Boring Bi-dir (G85)</b></li> <li><b>Boring Uni-Dir (G86)</b></li> <li><b>Chip Breaker (G87)</b></li> <li><b>Flat Bottom (G89)</b></li> </ul>
<b>Tool diameter</b>	<p>Enters the tool diameter. Press <b>ENTER</b> to choose <b>Direct</b> or <b>Tool table</b>.</p> <p>Options:</p> <ul style="list-style-type: none"> <li><b>Direct</b> Type the tool diameter directly.</li> <li><b>Tool table</b> The values in the tool table for diameter length only will be displayed. (Length offsets must be entered at setup). Highlight a value in the table, and press <b>ENTER</b> to select that value into the Tool diameter parameter.</li> </ul> <p><b>NOTE:</b> Drill diameters are generally used only as a reference, as no diameter compensation is required. ANILAM recommends that you program a diameter to serve as a reference for every drill.</p>
<b>Drill Parameters</b>	<p>The Spot Drilling Setup Menu activates. Use this menu to enter all necessary parameters for the drill cycle selected with the Drill cycle feature.</p> <p>Options:</p> <ul style="list-style-type: none"> <li><b>Hole Depth</b></li> <li><b>Start Height</b></li> <li><b>Return Height</b></li> </ul> <p>Start height and Return height are set to the default value of 0.1000".</p>

(Continued...)

**Table 18-10, Drill Parameters 1 Menu (Continued)**

Parameter	Description and Options
<b>Tool path color</b>	<p>Chooses the color that the CNC will use to describe the tool path on the screen.</p> <p>Options: Choose one of sixteen colors from the pop-up.</p>
<b>Machine setup</b>	<p>Highlight this parameter, and press <b>ENTER</b> to activate the last pop-up menu in the Drill cycle. All functions in this menu are exactly the same as those in Contour Parameters Menu 3, with the exception of Feedrate. The feedrate in Drill Parameters Menu #2 refers to the Z-axis feedrate output to the drill canned cycle.</p>

Refer to [Table 18-9, Pocket Menus Soft Keys](#). Soft keys and notes on soft keys in **Drill** are the same as those in **Contour** and **Pocket**.

### Edit

Highlight **Edit** when you press **MOTION (F7)**. Use this function to edit or change an existing path (Contour, Drill or Pocket operation).

Highlight **Edit**, and press **ENTER**. All path numbers for the current program are shown. They are numbered, beginning with 1, in the order in which they were programmed, regardless of whether they were Contour, Drill or Pocket paths. Highlight the desired path number, and press **ENTER**.

The parameters for that path will be displayed to enable you to make changes. After you set the parameter(s), press **Calc (F8)** to calculate the new path.

This function enables you to change a toolpath, such as stepover, tool diameter, spindle speed or path color without having to reprogram all the parameters.

### Delete

Delete is another selection of the **MOTION (F7)** pop-up. Delete removes an existing path (Contour, Drill or Pocket) from the program.

Highlight **Delete**, and press **ENTER**. All path numbers for the current program are shown. They are numbered, beginning with 1, in the order in which they were programmed, regardless of whether they were Contour, Drill, or Pocket paths. Highlight the desired path number, and press **ENTER**. The parameters for that path will be re-displayed to enable you to make changes. Those paths will be deleted from the program.

## POST (F8)

Press **POST (F8)** in the CAM Mode screen to select the post processing function of the CAM software. The CNC cannot run a CAM program; it must create a G-code program from the CAM program. The **POST** key will accomplish this task. This is the final step in the CAM programming process.

Press **POST (F8)**. The CNC automatically creates a G-code file. In most cases, the program name will already exist (because you created the program before you entered CAM Mode), and the **POST** feature will allow you to overwrite the existing program.

**NOTE:** Press **Setup (F9)** to set aspects of the **POST** processor, such as Incremental/Absolute output, Inch/MM output, and file names.

When you have processed the CAM file as a G-code file, press **Exit (F10)** to return to the Program Directory. Run the program in **Draw Graphics** to test it. Press **Select (F6)** to load the program. Enter tool offsets, zero setting, perform dry run(s), and any other machine setup procedures now, before you run the program to produce parts.

## SETUP (F9)

Use **SETUP (F9)** in the CAM Mode screen to configure the **POST** processor; turn **SHAPES**, **PATHS**, and **GEOMETRY** ON/OFF; set attributes such as arrows ON/OFF, labels, axes lines, and axes grid ON/OFF. **SETUP** also allows you to switch between Absolute and Incremental programming. You can set the screen to show only the Paths, Shapes, and Geometry desired. This minimizes screen clutter.

Refer to **Table 18-11**. In the **SETUP (F9)** menu, highlight **Settings** to determine how the image on the screen is displayed.

**Table 18-11, Setup Options Settings**

Parameter	Description and Options
<b>Dimensions</b>	<p>Dimensions are in reference to Absolute zero, or where the XY axes intersect. For angles, 0 degrees is the 3 o'clock position. A positive degree is CCW.</p> <p>Incremental dimensions are dimensions in reference to the current shape cursor position. Each position can be considered a new "zero point" when programming in Incremental. For angles, 0 degrees is the point reference.</p> <p>Options:</p> <p><b>Absolute</b></p> <p><b>Incremental</b></p>

(Continued...)

**Table 18-11, Setup Options Settings (Continued)**

Parameter	Description and Options
<b>Input Units</b>	Switches modes while programming. The G-code output by the <b>POST</b> is not affected by this setting. Options: <b>Inch</b> <b>Millimeter</b>
<b>Arrows</b>	Turns ON/OFF the arrows that is displayed on the first move of any shape. Arrows indicate the direction of the shape. Options: <b>ON [Default]</b> <b>OFF</b>
<b>Labels</b>	Turns ON/OFF the labels that is displayed with each shape, path, and geometry element. The labels refer to the numbers of each shape, path, or geometry element, (1, 2, 3, etc.) Options: <b>ON [Default]</b> <b>OFF</b>
<b>Axes</b>	Turns ON/OFF the axes lines (X,Y,Z). Options: <b>ON [Default]</b> <b>OFF</b>
<b>Grid</b>	Sets the Grid ON/OFF. When ON, the grid is displayed at the spacing defined in the next parameter (Length). The grid is displayed as either dots or solid lines, depending on the parameter in the CNC Setup Utility. Grid does not display in <b>Iso</b> view.
<b>Grid Size</b>	Sets grid spacing.

### Shapes

**Shapes**, an option in the **SETUP (F9)** pop-up, turns off programmed shapes. Highlight **Shapes**, and press **ENTER**. A pop-up displays the shape numbers. Highlight the desired shape number, and press **ENTER**. The shape will be removed from the display. It is not deleted, only removed from view. To restore a shape to the screen, turn it ON.

## Paths

An option in the **SETUP (F9)** pop-up, turns off programmed paths. Highlight **Paths**, and press **ENTER**. A pop-up displays the path numbers. Highlight the desired path number, and press **ENTER**.

The path will not be deleted, only hidden. To restore a path to the screen, turn it ON.

**IMPORTANT:** If a Path is turned OFF when the **POST** function is executed, that path will not display in the G-code program. Therefore, you can eliminate a path from the program without deleting.

## Geometry

The **Geometry** setting in the **SETUP (F9)** pop-up enables you to turn OFF construction geometry by groups. Highlight **Geometry**, and press **ENTER**. Refer to **Table 18-12**. If construction geometry exists, a pop-up displays the following options:

**Table 18-12, Geometry Options**

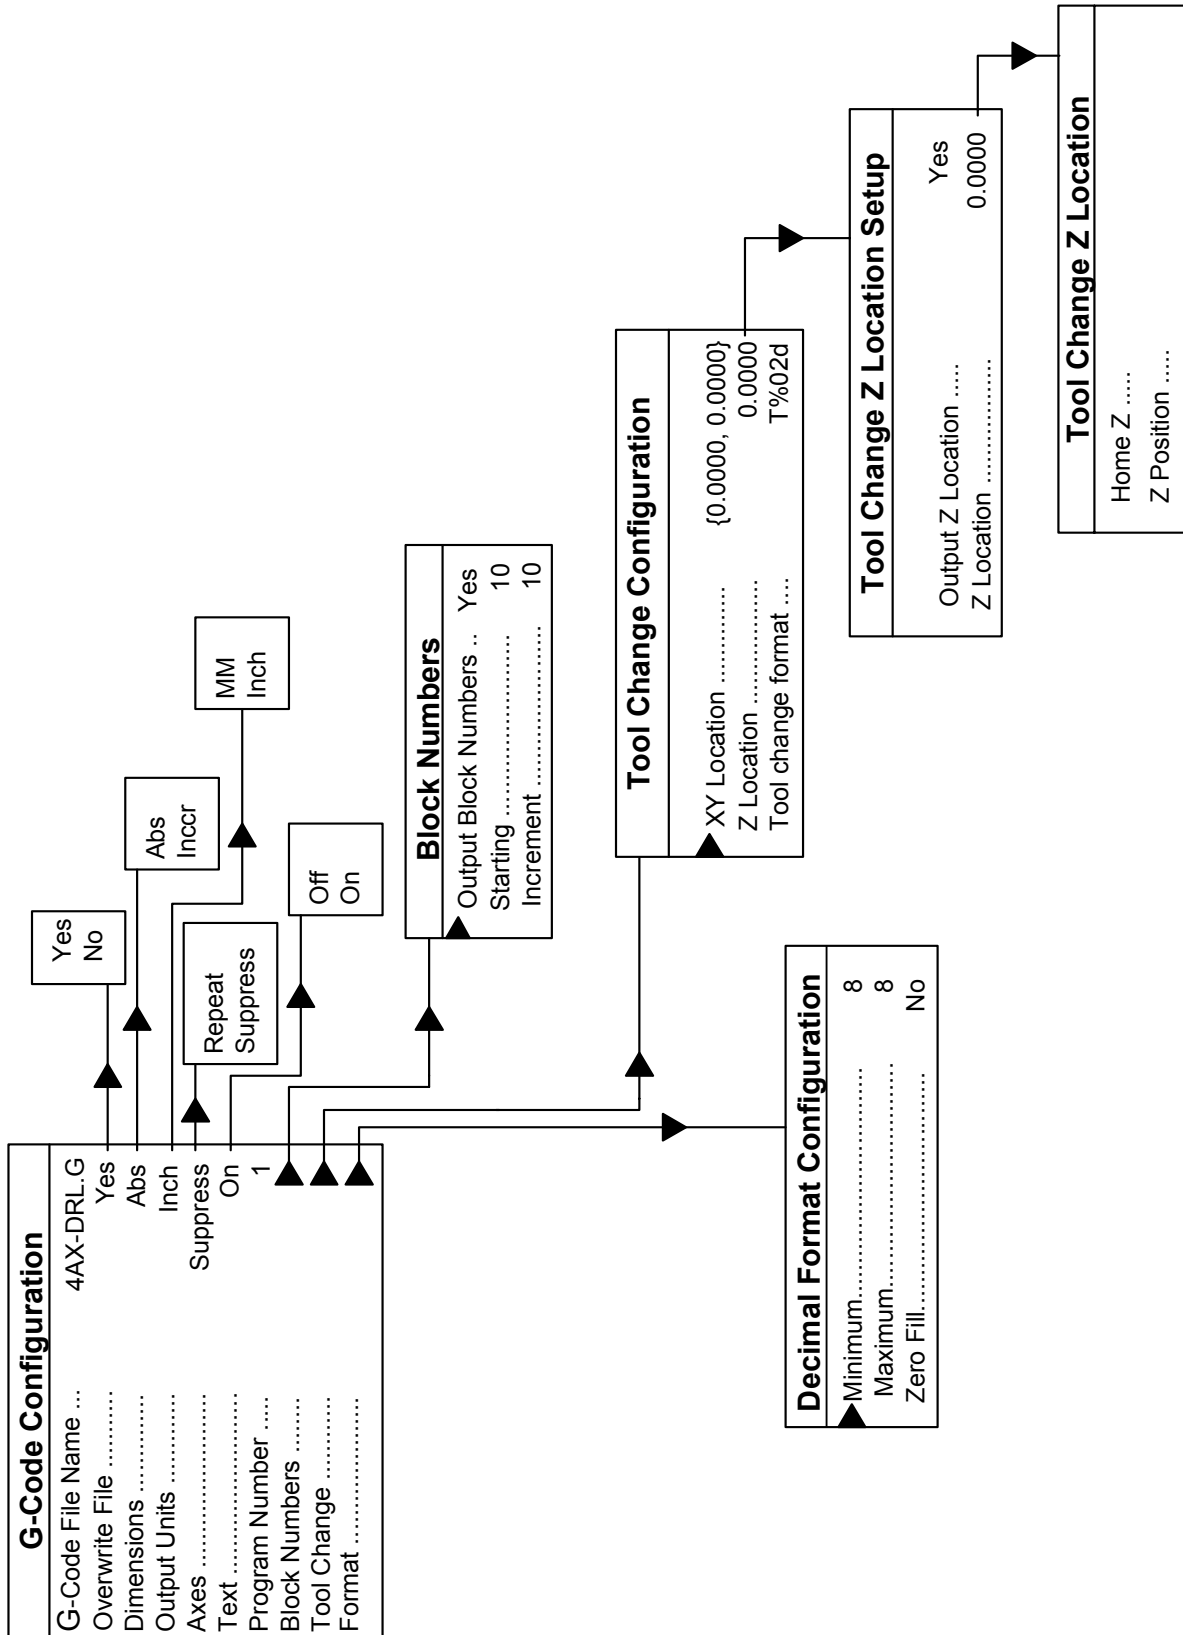
<b>All</b>	Construction geometry turns ON/OFF (points lines and circles).
<b>Lines</b>	Only construction geometry lines turn ON/OFF.
<b>Circles</b>	Only construction geometry circles turn ON/OFF.
<b>Points</b>	Only construction geometry points turn ON/OFF.

After you have used the Chain function on the existing construction geometry, you may delete all or some elements. This allows a clearer view for path programming (Contours, Pockets, Drills). When turned OFF the construction geometry is not deleted, only removed from the screen. To restore construction geometry, turn ON the above elements.

## Post

Refer to [Figure 18-5, POST Menu Options](#) and [Table 18-13, POST Menu Options](#). Press **POST (F8)** to configure the **POST** processor with the following settings:





POST1

Figure 18-5, POST Menu Options

Table 18-13, POST Menu Options

Parameter	Description and Options
<b>G-code filename</b>	Enters a new file name to which you can output G-code. The default name is the one highlighted when you entered CAM Mode.
<b>Overwrite file</b>	Refer to <b>Contour</b> . Options: <b>No:</b> Enables the CNC to prompt for overwriting when you press <b>POST (F8)</b> . <b>Yes:</b> The existing .G file will be automatically overwritten. [Default: <b>Yes</b> ].
<b>Dimensions</b>	Sets G-code output. Options: <b>Absolute</b> or <b>Incremental</b> dimensions. [Default: <b>Absolute</b> ]
<b>Output units</b>	Sets G-code output. Options: <b>Inch</b> or <b>Millimeter</b> . [Default: <b>MM</b> ]
<b>Modal</b>	The CNC can <b>Suppress</b> or <b>Repeat</b> G-code output data (axes positions only). Options: Set to <b>Repeat</b> , if two sequential points have the same X or Y dimension. Both dimensions will always be output. [Default: <b>Suppress</b> ]
<b>Text</b>	The CNC can prevent the G-code text from showing on the screen when you initiate <b>POST</b> . Options: <b>On, Off</b> [Default: <b>On</b> ]
<b>Program number</b>	Selects a program number. This is the "0" that displays when you initiate <b>POST</b> . This feature is not a requirement.
<b>Block numbers</b>	The CNC can output block (N) numbers to the G-code file, and set their increments. Highlight <b>Block numbers</b> , and press <b>ENTER</b> . A pop-up displays with the parameters <b>Output Block Numbers</b> , <b>Starting</b> , and <b>Increment</b> . Options: [Default Settings: <b>Yes, 10,10</b> ]

(Continued...)

**Table 18-13, POST Menu Options (Continued)**

Parameter	Description and Options
<b>Tool change</b>	<p>Selects the type and location of the tool change. (Set <b>Yes</b> or <b>No</b> for tool change in the <b>Machine Setup Menus of Contour, Pocket and Drill.</b>) Highlight <b>Tool change</b>, and press <b>ENTER</b>. A pop-up displays: <b>XY location</b> is the location of the tool change. This value displays before each tool change.</p> <p>Options:</p> <p>[Default Setting: <b>X0 Y0</b>] <b>Z Location</b> specifies where/how Z-AXIS will be handled during tool change. If set to <b>HOME Z</b>, the CNC will output a G28 Z to the G-code file. If set to <b>Z Location</b>, a T0 and the location given, (usually 0) will be output to the G-code file.</p>
<b>Format</b>	<p>Selects the minimum and maximum number of decimal places, and to specify if <b>Zero-fill</b> is ON or OFF.</p> <p><b>NOTE:</b> ANILAM recommends that you set the maximum number of decimal places to at least eight places. <b>Zero fill</b> specifies whether or not leading/trailing zeros will occur.</p> <p>[Default Settings: <b>8, 8, No</b>]</p>

If a path is OFF during the **POST** function, the CNC will not output that path to the G-code file. In this way, a path can be eliminated from the output file without actually deleting it from the CAM program.

**NOTE:** Ensure that all paths you need for the G-code program turn ON.

**NOTE:** These parameters can be set as a default by copying the “.cam” file in the **c:\user\** directory to the **c:\p5m\** directory renaming the file to **defaults.cam**.

### Posting Output Automatic Tool Changes

The following instructions modify the CAM post processor to output the automatic tool changes.

1. Enter **CAM** mode.
2. Select **F9 Set Up**.
3. Select **Post**.
4. If M06 is required for a tool change, cursor down to **Tool**. It will read **T%02d** as a default. Change this to read **T%02dM06**.
5. If there are any other changes the user would like to make to the post processor, such as number of decimal places output, these can also be changed at this time.
6. Exit the post processor settings by pressing **F10** twice and then **F9**.
7. With the cursor, highlight the **.Cam** file that has just been generated.

8. Select **F9** Utilities, then **Copy**
9. Go to **Other**, type **C:\P5M\DEFAULTS.CAM** then press **ENTER**.
10. **CAM** mode should now use the new defaults when post processing.

Manual machines use only "T1" or "T5" to call for a tool change. This stops the machine on this tool number so that the operator can insert a new tool into the spindle.

Automatic tool changing machines typically require that "M6" be added to the tool line. For example: "T1 M6" or "T5 M6"

This "T1" tells the machine that a new tool is going to be used, and the "M6" tells it to run the macro and get the tool automatically.

## Exit (F10)

After you finish the CAM program and have used the **POST** function described above to create a G-code program, press **Exit (F10)** to save all program data. The CNC returns to the Program Directory. Press **Exit** to leave CAM Mode. If you select **CAM** again, with the same program highlighted, all data is restored.

**NOTE:** Press **Quit (SHIFT + F10)** to exit without saving changes.

If all aspects of a program are to be deleted, press **SHIFT+F3** in the Program screen, then type **Program.\***. The CNC prompts for file deletion. This feature enables certain files to be saved, if desired.

## Hot Keys

Hot Keys are available in CAM Mode, if you are using a PC keyboard on the CNC or the off-line software. Refer to **Table 18-14**.

**Table 18-14, Hot Keys in CAM Mode**

Hot Key	Function
<b>A</b>	Auto Fit (zoom)
<b>D</b>	Double size
<b>H</b>	Half size
<b>W</b>	Window
<b>M</b>	Absolute/Incremental switch
<b>R</b>	Redraw
<b>ALT-X</b>	XY view
<b>ALT-Y</b>	YZ view
<b>ALT-Z</b>	ZX view
<b>U</b>	Unit switch
<b>ALT-O</b>	Iso view

### Using the Shape Cursor

You can position the shape cursor only on nodes or endpoints. Use the cursor to select items.

The forward end of a shape is the end away from the origin (starting point). The origin is always the back endpoint of the shape. Use **Back (F4)** and **Forw (F5) SHAPE** (- and + keys respectively on off-line keyboards) to move the cursor from node to node along a shape.

The shape cursor must be positioned at the forward end of a shape to add a segment. Shape segments cannot be added to the back end of a shape. Use the cursor to select nodes for chamfering, rounding or deleting.

### Selecting Editing Tools


Use editing tools to create or edit shapes. Select an editing tool from the two columns of templates. Templates in the left column determine a new segment's shape. Templates in the right column determine how the new segment will be created.

Templates use a standard convention to describe moves. Each template depicts a segment with a hollow circle at one end and a solid circle at the other. The solid circle represents the cursor. The hollow circle is the endpoint of the segment being added. CAM Mode prompts for the letter values shown in **Table 18-15**.

**Table 18-15, Template Lettering Conventions**

Letter	Definition
<b>X</b>	X-axis endpoint (usually a diameter).
<b>Y</b>	Y-axis endpoint (usually a diameter).
<b>I</b>	X-axis coordinate of a circle or radius center.
<b>J</b>	Y-axis coordinate of a circle or radius center.
<b>R</b>	Radius value
<b>A</b>	An included or absolute angle.
<b>C</b>	Circle
<b>D</b>	Distance

Refer to [Figure 18-6, Shape Editing Tools](#). To select the shape of a new segment, use **ARROWS** to move up and down the left column of templates. After you highlight the desired shape, use the right arrow to select the method by which to define the new segment. Only the line and the arc have more than one description method. (The Geometry tool is described later.)

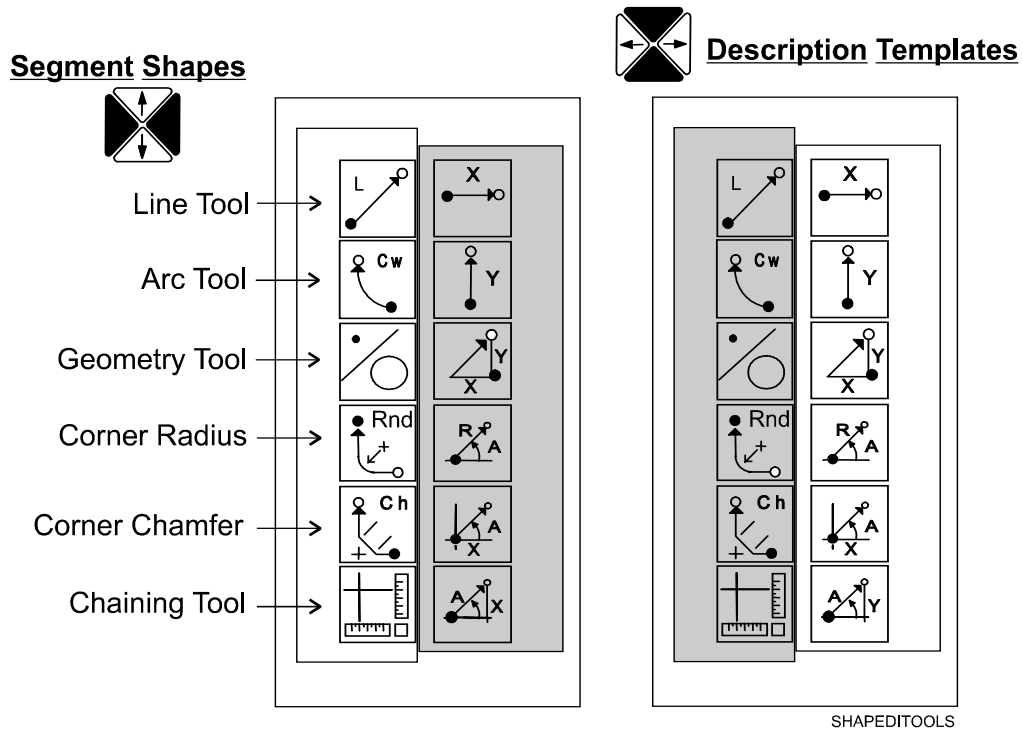

 
 
 
 
 
 

**Figure 18-6, Shape Editing Tools**

The Line tool and the Arc tool are used to rough out the main features of the shape. After you have drawn the major features, go over the shape and add chamfers and corner rounding, as needed.








### Line Tools

In addition to the six templates in the right column, the endpoint of a line can be described with endpoint definition tools. To select this option, highlight the Line template, and press **ENTER**. This activates the point definition templates, displayed in the right template column. Refer to [Table 18-16, Line Segment Tools](#) and [Table 18-17, Line Segment Endpoint Definition Tools](#).

**Table 18-16, Line Segment Tools**

Line Segment Template	Line Definition Templates	Values Required
 <p>RIGHT ARROW enables use of these line definition templates.</p>	 <p>LINE from cursor to endpoint parallel to X-axis. Defined by X POSITION.</p>	<p>Use absolute or INCREMENTAL X-axis endpoint.</p>
	 <p>Line from cursor to endpoint PARALLEL to Y-axis. Defined by Y position.</p>	<p>Use ABSOLUTE or INCREMENTAL Y-axis endpoint.</p>
	 <p>LINE from cursor to endpoint in any direction. Defined BY X Y endpoint.</p>	<p>Use absolute or INCREMENTAL X and Y-axis COORDINATES to define endpoint.</p>
	 <p>Line from cursor to endpoint in any direction. Defined by radius and angle (polar coordinates).</p>	<p>Use RADIUS and ABSOLUTE angle.</p>
	 <p>Line FROM cursor to endpoint in ANY direction. Defined by X endpoint coordinate and absolute angle.</p>	<p>Use ABSOLUTE X POSITION and angle.</p>
	 <p>LINE from cursor to endpoint in any direction. Defined by Y endpoint COORDINATE and absolute angle.</p>	<p>Use absolute Y position and angle.</p>

      **Table 18-17, Line Segment Endpoint Definition Tools**

 
 
 

 
 
 
Template	Purpose	Requirements
 <p>Press <b>ENTER</b> to activate these point definition templates.</p>	 <p>Defines a point in an X and Y coordinate system.</p>	<p>Use absolute X and Y position of the point.</p>
<p>Geometry elements can be used as a reference.</p>	 <p>Defines a point at X and Y increment from existing point.</p>	<p>Use incremental X and Y distance from existing point.</p>
	 <p>Defines a point at radius and angle from existing point.</p>	<p>Use distance from existing point and number of degrees from 3 o'clock position.</p>
	 <p>Identifies the center point of an existing circle.</p>	<p>Use center of existing circle.</p>
	 <p>Identifies the intersection points of any two elements in the geometry. Prompts to select a point when more than one intersecting point exists.</p>	<p>Use one intersection point between two elements.</p>
	 <p>Identifies existing points. Usually used when construction of other element requires a reference point.</p>	<p>Use existing point.</p>



### Arc Tools

Refer to **Table 18-18**. There are two types of Arcs: clockwise (Cw) and counterclockwise (Ccw). Press **ENTER** while the icon is highlighted to switch arc segment direction. Use **RIGHT ARROW** to access the definition templates. Use **UP/DOWN ARROW** to select.

**Table 18-18, Arc Segment Tools**

 
Arc Template	Arc Definition Template	Values Required
	 <p>Arc from cursor to endpoint. Endpoint and center keyed in by operator.</p>	<p>Use absolute or incremental X, Y to define endpoint. Use absolute or incremental I, J to define center.</p>
<p>Press <b>ENTER</b> to toggle BETWEEN clockwise (Cw) and COUNTERCLOCKWISE (Ccw).</p>	 <p>Arc from cursor to endpoint. Endpoint and radius keyed in by operator. Center calculated by CNC.</p>	<p>Use radius and absolute or incremental X, Y endpoint.</p>
	 <p>Arc from cursor to endpoint. Center and included angle keyed in by operator. Endpoint calculated by CNC.</p>	<p>Use absolute or incremental I, J centerpoint. Use incremental angle.</p>
	 <p>Tangent arc from cursor to endpoint. Endpoint and radius keyed in by operator. Center is calculated by CNC. Center and radius values must be correct for tangent arc.</p>	<p>Use incremental radius and absolute or incremental X, Y endpoint.</p>
	 <p>Line from cursor followed by tangent arc. Line direction defined by the angle. Arc defined by X, Y endpoint and radius. Arc starts where tangent to line from cursor.</p>	<p>Use radius and absolute or incremental X, Y endpoint. Use absolute angle.</p>
	 <p>Arc followed by tangent line from cursor to endpoint. Line is defined from cursor to X, Y endpoint. Arc from cursor to tangent intersection with line is defined by radius.</p>	<p>Use radius and absolute or incremental X, Y endpoint. Use absolute angle.</p>

## Corner Radius

The corner radius tool enables you to insert a corner radius segment in place of the sharp corner at the node between two segments.

To round a corner:

1. Move the cursor to the corner being rounded.



2. Highlight the Rounding icon, and press **ENTER**. The CNC will prompt for the blend radius.
3. Type the blend radius, and press **ENTER**. A new radius segment will be inserted in place of the original corner.

**NOTE:** Rounding can be performed only on a node located between two shape segments. The forward end or back end of a shape cannot be rounded.

## Chamfering Corners

The Chamfering tool enables you to chamfer selected corners on the shape.

To Chamfer a corner:

1. Move the cursor to the node to be chamfered.



2. Highlight the Chamfering icon, and press **ENTER**. The CNC will prompt for the chamfer distance.
3. Type the desired chamfer distance, and press **ENTER**. A new line segment chamfering the corner will be added to the shape in place of the original corner.

**NOTE:** Chamfering can be performed only on a node located between two shape segments. The start or end of a shape cannot be chamfered.

## Shape Edit Soft Keys

The following tasks are described in this topic:

- [Reversing an Arc's Direction](#)
- [Deleting a Shape](#)
- [Projecting Line Segments \(Restoring Sharp Corners\)](#)
- [Joining Line Segments](#)
- [Importing Shapes from Other Programs](#)
- [Deleting a Segment](#)
- [Changing the CAM Mode View](#)
- [Viewing a Listing of Shape Segment Details](#)

### Reversing an Arc's Direction

Occasionally, you might program an arc move in the wrong direction. Instead of deleting the segment and redrawing it, you can reverse the arc's direction. Arcs at the end of a shape or between any two segments can be reversed. To reverse an arc's direction:

1. Move the cursor to the arc's forward node and press **S-Edit (F3)**. The S-Edit Pop-Up menu is displayed.
2. Highlight **Rev Arc**, and press **ENTER**. The arc will be redrawn in the reverse direction.

### Deleting a Shape

When necessary, you can delete an entire shape. To delete an entire shape:

1. Use **Prev-S (F6)** and **Next-S (F7)** to move the cursor to occupy any node within the shape to be deleted.
2. Press **S-Edit (F3)**. The S-Edit Pop-Up menu is displayed.
3. Highlight **Delete**, and press **ENTER**. The CNC prompts to confirm the deletion.
4. Press **Yes (F1)** or **No (F2)** as required. **Yes** causes the shape to be deleted. **No** cancels the process.

### Projecting Line Segments (Restoring Sharp Corners)

Use the **Project** feature to remove blend radii and restore the sharp corners. This operation is called "projecting" because projections are added to line segments on both sides of a removed radius.

To remove a radius and remove a sharp corner:

1. Move the cursor to the forward node of the radius being removed.
2. Press **S-Edit (F3)**. The **S-Edit** Pop-Up menu is displayed.
3. Select **Project**, and press **ENTER**. The radius will be removed and line projections forming a right angle are added. The editor prompts you to join the lines.
4. Press **Yes (F1)** to join the projections. The collinear line segments are joined into a single straight-line segment.

**NOTE:** Collinear lines are end-to-end lines that lie in the same direction.

### Joining Line Segments

Sometimes, what appears to be a single line segment is more than one line segment drawn end-to-end. To detect the presence of the extra nodes within the segment, move the cursor along the segment.

Collinear segments do not affect the execution of the move. Usually, it is desirable to join collinear lines in order to keep the program and future editing session as simple as possible.

Join collinear lines as follows:

1. Position the cursor at the node between the collinear lines.
2. Press **S-Edit (F3)**. The **S-Edit** Pop-Up menu is displayed.
3. Highlight **Join**, and press **ENTER**. The unnecessary node is removed from the line.

### Importing Shapes from Other Programs

Sometimes, the same shape is used in more than one program. Instead of programming the shape more than once, you can import the shape from its original program.

To import an existing shape from another program:

1. Press **S-Edit (F3)**. The **S-Edit** Pop-Up menu is displayed.
2. Highlight **Import**, and press **ENTER**. The CNC prompts for the name of the program containing the shape to be imported.
3. Type the program name, and press **ENTER**. The CNC displays a list of the shapes contained in the source program.
4. Highlight the desired shape, and press **ENTER**. The editor prompts you to determine if the origin of the shape should be changed.
5. Press **Yes (F1)** and key in a new origin as prompted or press **No (F2)** to import the shape at its original position.

### Deleting a Segment

You can delete segments from an end or the middle of a shape. When a segment is deleted, the node marked by the cursor and the preceding segment is removed. When a segment is deleted from the middle of the shape, the segment in front of the cursor is reconnected to the preceding node.

To delete the segment at the forward end of the shape:

1. Move the cursor to the forward end of the shape.
2. Press **DelMove (F8)**, and press **ENTER**. The last shape on the segment is removed.

<p><b>NOTE:</b> Sometimes, small bits of a deleted shape remain on the screen. Press <b>R</b>, which functions as a hot key, to refresh the screen.</p>
---------------------------------------------------------------------------------------------------------------------------------------------------------

### Changing the CAM Mode View

Press **DISPLAY (F5)** to access the following display functions.

- Fit
- Window
- Half
- Double
- Scale
- Pan
- Erase

These functions perform the same operations described in the Draw Mode. Refer to "[Section 8 - Viewing Programs with Draw.](#)"

### Viewing a Listing of Shape Segment Details

To view the details of the moves in any shape:

1. Refer to **Table 18-19**.
2. Press **MISC (F6)**. The **MISC** Pop-Up Menu is displayed showing the following options:

**Table 18-19, Miscellaneous (F6) Soft Keys**

Soft Key	Description
<b>Shapes List</b>	<p>Shows selected shape's data. If more than one shape exists, select the desired shape number. The data displayed is for the lines and arcs that comprise the shape. The following data is displayed:</p> <ul style="list-style-type: none"> <li><input type="checkbox"/> Shape starting point.</li> <li><input type="checkbox"/> Lines: the X, Y endpoint and length for each line, respectively.</li> <li><input type="checkbox"/> Arcs: the direction (CW or CCW), endpoint, center point, and radius for each arc.</li> </ul> <p>Press <b>Cancel (F9)</b> or <b>ENTER</b> to return to the main CAM soft keys.</p>
<b>Geometry List</b>	<p>Shows Construction Geometry data for construction points, lines and circles that have been programmed, including:</p> <ul style="list-style-type: none"> <li><input type="checkbox"/> Points: X and Y positions, respectively.</li> <li><input type="checkbox"/> Lines: the X intersection (Xin), Y intersection (Yin) and angle for each line. The line is unbounded geometry (infinitely long). Therefore, the point at which it intersects each axis is given (Xin, Yin). If the line is parallel to an axis, it is called Vertical or Horizontal, and the X dimension or Y dimension is displayed.</li> <li><input type="checkbox"/> Circles: the center point and radius for each circle.</li> </ul> <p>Press <b>Cancel (F9)</b> or <b>ENTER</b> to return to the main CAM soft key display.</p> <p><b>NOTE:</b> The number of each geometric element is displayed in the Display Area in the order in which they were programmed.</p>

*(Continued...)*

**Table 18-19, Miscellaneous (F6) Soft Keys (Continued)**

Soft Key	Description
<b>Calc Distance</b>	Calculates and displays the shortest distance between any two elements on the tool path. Type the first and second elements at the prompt.
<b>Recover Shapes</b>	<p>Enables shapes to be recovered if the .CAM file has been deleted. In CAM Mode, while the cursor is on the (.G) filename in the directory, the CNC automatically creates special files. The .CAM extension (and file of same NAME) file holds data related to shapes, but not the shapes themselves. If the .CAM file was deleted, recovery of the actual paths is possible only via this function. Use only if the .CAM file has been deleted and you wish to recover the shapes. If no recovery is possible, a message is displayed.</p> <p>Additionally, this feature can be used to import a series of DXF shapes that were saved as CAM Shapes. Refer to "<a href="#">Section 17 - DXF Converter Feature</a>" for more details.</p>
<b>Recover Paths</b>	<p>Enables paths to be recovered if the .CAM file has been deleted. In CAM Mode, while the cursor is on the (.G) filename in the directory, the CNC automatically creates special files. The .CAM extension (and file of same NAME) file holds data related to paths, but not the paths themselves. If the .CAM file was deleted, recovery of the actual paths is possible only via this function.</p> <p>Use only if the .CAM file has been deleted and you wish to recover the paths. If no recovery is possible, a message is displayed.</p>

Press **Misc (F6)**. The **Misc** Pop-Up menu is displayed.

1. **Shapes List** is highlighted by default. Press **ENTER**. The list of the shapes available in the file is displayed.
2. Highlight the shape to be viewed, and press **ENTER**. The details of the moves in the shape are displayed in a box on the screen.

The following details are presented:

- Starting point (origin)
- Line endpoint and lengths
- Arc directions, centers, and radius

## Using Construction Geometry

Points, lines, and circles are the basic elements of all construction geometry. Use construction geometry to find path intersections not given on the blueprint. Construction geometry can also eliminate the need for many trigonometric functions.

The geometry of a shape can be constructed on the screen with geometry tools. After the tool path is solved, the intersecting segments of the geometry are chained together to form a shape.

Construction geometry is useful when you work with blueprints that contain limited information. Many combinations of geometry can be entered to help you find intersections.

## Accessing Geometry Tools

To access the Geometry tools:



1. Move the left column highlight to select the **GEOMETRY** icon.
2. Press **ENTER** to cycle through the right column's three sets of geometry icons. When the desired icons are displayed, use **RIGHT ARROW** to highlight an icon in the right column.
3. Highlight the desired tool, and press **ENTER**.

Points, lines, and circles can be defined in several ways. Each geometry tool defines a geometry element differently. A tool that requires a point position to start will prompt to select and activate an additional point definition tool.

Lines and circles are drawn on the screen with dotted lines. Points are marked by Xs. All geometry elements are numbered.

Geometry tools generally produce one of the three different elements. Review the table listings to understand Geometry tools. Some tools require that certain elements be part of the geometry. ANILAM recommends that first-time operators experiment with all of the drawing tools. The following tables are provided as a reference to the features of each tool. Look over each of the tables before you attempt the examples.







## Point Tools

Some point tools define the position of a point in the coordinate system; others allow you to select an existing point in the geometry. Refer to **Table 18-20**.

When you use tools that require a starting point, a through point, or a from/to point, the Shape Editor displays the “**Select point definition . . .**,” message. You must then activate an additional point tool and define the required point.

Tools that identify centerpoints or element intersections will prompt for necessary element numbers, highlight all possible points, and prompt you to select one.

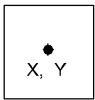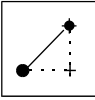 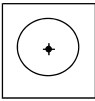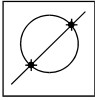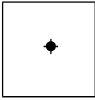**Table 18-20, Geometry Point Tools**

 
 

 
 
 
 
 
Template	Purpose	Requirements
	Defines a point in a geometry.	Must know absolute X and Y position of the point.
	Defines a point at X & Y increment from existing point.	<ul style="list-style-type: none"> <li><input type="checkbox"/> One endpoint must already be an element of the geometry.</li> <li><input type="checkbox"/> Must know incremental X and Y distance from existing point.</li> </ul>
	Defines a point at radius and angle from existing point.	<ul style="list-style-type: none"> <li><input type="checkbox"/> One endpoint must already be an element of the geometry.</li> <li><input type="checkbox"/> Must know distance from existing point.</li> <li><input type="checkbox"/> Must know number of degrees from 3 o'clock position.</li> </ul>
	Identifies the centerpoint of an existing circle.	The circle must already be an element of the geometry.
	Identifies the intersection points of any two elements in the geometry. Prompts you to select a point when more than one intersecting point exists.	Geometry must already contain an intersection of two elements.
	Identifies existing points, usually used when construction of other element requires a reference point.	Desired point must already be an element of the geometry.



### Line Tools

Some Line tools require point definition or identification to start. Refer to **Table 18-21**. The CAM Mode displays a message when this is necessary. Line tools that draw tangents to circles display all possible lines and prompt to select one.

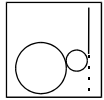
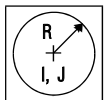
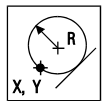

**Table 18-21, Geometry Line Tools**

Template	Purpose	Requirements
	Constructs a line parallel to Y-axis, at given X position. Prompts for X value.	Must know absolute position the line crosses the X-axis.
	Constructs a line parallel to X-axis, at given Y position. Prompts for Y value.	Must know absolute position the line crosses the Y-axis.
	Constructs a line between any two points. Prompts to select any convenient point tool when activated.	Use any method to locate the two endpoints.
	Constructs a line through a point, rotated specified number of degrees from 3 o'clock position. Prompts to select any point tool to define point.	<ul style="list-style-type: none"> <li><input type="checkbox"/> Must know angle.</li> <li><input type="checkbox"/> Use any method to locate point of rotation.</li> </ul>
	Constructs line parallel to existing line at specified (positive or negative) distance.	Line must already be an element of the geometry.
	Constructs line tangent to circle that passes through selected point. Prompts to select any point tool. Always draws tangent lines to both sides of circle, you must select one.	<ul style="list-style-type: none"> <li><input type="checkbox"/> Circle must already be an element of the geometry.</li> <li><input type="checkbox"/> Use any method to locate the point.</li> </ul>
	Constructs line tangent to any two circles. Always draws the four possible lines, you must select one.	Two circles must already be elements of the geometry.
	Constructs line rotated specified number of degrees from 3 o'clock position and tangent to existing circle.	<ul style="list-style-type: none"> <li><input type="checkbox"/> Circle must already be an element of the geometry.</li> <li><input type="checkbox"/> Must know number of degrees of rotation from 3 o'clock position.</li> </ul>

### Circle Tools

Some circle tools require point definition or identification when used. Refer to **Table 18-22**. The CAM Mode displays a message when this is necessary. Circle tools that draw circles tangent to other circles, lines, or points construct all possible circles and then prompt you to select one.

**Table 18-22, Geometry Circle Tools**

Template	Purpose	Requirements
	Constructs circle of specified radius tangent to any two points, lines or circles. Draws all possible solutions; you must select one.	Geometry must contain at least two elements.
	Constructs circle of specified radius centered at any position. Prompts to select any point tool to define circle center point.	<ul style="list-style-type: none"> <li><input type="checkbox"/> Use any method to locate center point.</li> <li><input type="checkbox"/> Must know radius.</li> </ul>
	Constructs circle of specified radius tangent to line and point. Prompts to select any point tool to define point.	Line must already be an element of the geometry.
	Constructs circle tangent to line with center at defined point. Prompts to select any point tool to define centerpoint.	<ul style="list-style-type: none"> <li><input type="checkbox"/> Line must already be an element of the geometry.</li> <li><input type="checkbox"/> Use any method to locate center point.</li> </ul>

### Notes on Geometry



Access all geometry tools with the left column geometry icon highlighted. When the template is highlighted, press **ENTER** to cycle the right column through three sets of the Geometry Tool templates.

 
Construct geometry so that each node of the required shape is an intersection of two geometry elements.

---

## Chaining Geometry Elements to Create a Shape

You must create a shape before chaining can occur. The shape starting point (origin) should be a point on an element of the construction geometry. The new shape will be chained, from the starting point, around various geometry elements.



Highlight the CHAIN  icon, and press **ENTER**. The CNC prompts to “**Select element:**”. Type a sequence of intersecting geometry elements by number, each separated by a space. Press **ENTER**. The CNC traces the new shape from intersection to intersection. Each intersection will become a node in the shape.

The path around a circular Geometry element can be either in a clockwise or counter clockwise direction.

If the intersecting Geometry element is a circle, a positive element number creates a counterclockwise path; a negative element number creates a clockwise path.

If the direction of the path around any element is incorrectly chained, the direction can always be reversed with the shape editing tools. Elements can be chained one at a time or all at once.

## Viewing a Listing of Geometry Elements

A complete listing of all the Geometry elements and relevant position information is available.

To view the Geometry list:

1. From the default soft key line press **MISC (F6)**. A pop-up menu is displayed.
2. Highlight **Geometry List**, and press **ENTER**. A listing of geometry elements and position data is displayed.

The following information is displayed:

- Element number
- Points - X and Y positions
- Lines parallel to X-axis - Y-axis position
- Lines parallel to Y-axis - X-axis position
- Lines through a point - point position and angle
- Circles - The center point and radius

## Deleting Geometry Elements

After a shape has been chained together from Construction Geometry, the geometry can be deleted, if desired. Elements can be left in the program along with the shape.

To delete geometry elements:

1. Press **DelGeom (F9)**. The CNC prompts for the number of the geometry element to be deleted.
2. Type the element number, and press **ENTER**. The element is removed from the display.

Sometimes, small bits of an element will remain on the screen after deletion. Press **R**, which functions as a hot key, to refresh the screen.

**NOTE:** Deleted geometry cannot be restored.

## Deleting All Geometry Elements

To delete all geometry elements:

1. With the **SHAPE** soft keys active, press **SHIFT** and **DelAll (F9)**. The CNC prompts to confirm deletion.
2. Press **Yes (F1)** to delete or **No (F2)** to cancel.

Sometimes, small bits of a deleted element remain on the screen after deletion. Press **R**, which functions as a hot key, to refresh the screen.

**NOTE:** Deleted geometry cannot be undeleted.

## Managing Shape Files

The CNC automatically names files created in CAM Mode. Files contain the same primary name as the G-code file with which they are associated. The CNC generates several files with the G-code file but different extensions. These file extensions are:

- FILENAME.CAM - CAM mode settings
- FILENAME.GEO - Construction Geometry
- FILENAME.1 - (or .2, .3) are Shapes
- FILENAME.\$\* - Temporary files
- FILENAME.T (number) are toolpaths backup files

### Using Shapes in G-code Programs

You can use any shapes that you create in CAM in G-code programs. Anywhere you can use a subprogram in a G-code program, you can also use a shape. For example, the W address in G169 (Area Clearance) specifies the number of the subprogram that defines the perimeter of the pocket. If you have defined shape #1 in CAM, and subprogram O1 does not exist in the G-code program, then programming W1 in G169 will use the shape defined in CAM. If subprogram O1 does exist in the G-code program, then it will be used. Similarly, you can use CAM shapes in G45, G65, G66, and M98. Any shape you can create in CAM, you can use with this method in a G-code program.

### Sample Programs


This chapter contains several programs that show typical uses for CNC CAM programming. As a rule, blueprints having vague or limited data are suitable for CAM Mode.

ANILAM suggests that you study this chapter and familiarize yourself with the CAM Mode keystrokes.

Each example begins with a drawing, and proceeds through the programming process from Create to Post. All keystrokes are detailed. If working in metric, refer to the drawings for the appropriate dimensions. It is assumed that you have already read and understood the materials in this manual that pertain to CAM Programming.

#### Example #1 Machining an Outside Profile with Contour

X0 Y0 is set at the upper left corner of the part. Refer to **Figure 18-7**. No construction geometry is required to create this shape. As you program, note the prompts that are displayed each time you press **ENTER**.

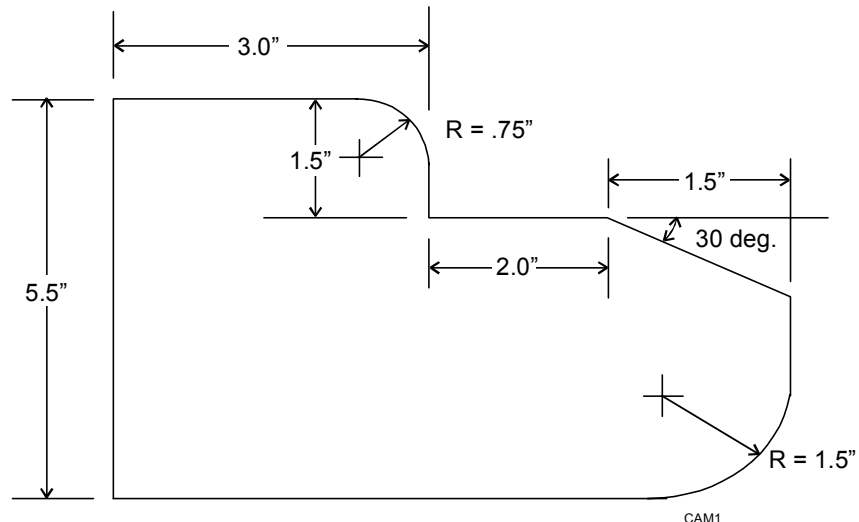

**Figure 18-7, An Outside Profile Using Contour**

## Keystrokes:

- 1 **F2 PROGRAM**
- 2 **F2 Create**
- 3 Type **CONTUR-1** press **ENTER**
- 4 **F4 CAM**
- 5 **F3 S-EDIT**
- 6 **Create**
- 7 **ENTER** (to select the current Point definition), 0 **ENTER**, 0 **ENTER**
- 8 Cursor right, **ENTER**, 3 **ENTER**
- 9 Cursor down to #2 **ENTER**, -1.5 **ENTER**
- 10 Cursor up **ENTER**, 5 **ENTER**
- 11 **F9 SETUP**, Settings, **ENTER** (change to **Incremental**), **F9** (to exit window), **F9** again.
- 12 Cursor down to #5 (Angle and X) **ENTER**, 1.5 **ENTER**, -30 **ENTER**
- 13 **F9 SETUP**, Settings, **ENTER** (switch back to **Absolute**), **F9**, **F9**
- 14 Cursor up to #2 **ENTER**, -5.5 **ENTER**
- 15 Cursor up **ENTER**, 0 **ENTER**
- 16 Cursor down to #2 **ENTER**, 0 **ENTER**
- 17 **F5 ENTER** (to **Fit** on screen)
- 18 **F2 SHAPE**
- 19 **F4** six times (Back up to put in 1st radius)
- 20 Cursor left, then down to #4 (Rnd) **ENTER**, .75 **ENTER**
- 21 **F5** four times (**Forw**, to next radius)
- 22 **ENTER** (to select **Rnd**), 1.5 **ENTER**
- 23 **F2 SHAPE (Off)**
- 24 **F5 ENTER** (to **Fit** and redraw)

The shape is now ready for machining with one of the processes of the **MOTION (F7)** key. **Contour** will be used for the example in [Table 18-23, Example 1 Settings: Contour Parameters with Outside Profile](#).

- 25 **F7 MOTION**
- 26 **Contour**
- 27 Set parameters in the Contour Menu(s):

**Table 18-23, Example 1 Settings:  
Contour Parameters with Outside Profile**

<b>Contour Parameters Menu 1 Values</b>	
<b>Parameter</b>	<b>Setting</b>
Shape number	1
Tool compensation	CAM Left
Tool diameter	0.7500
XY stepover	0.0000
Number of XY passes	1
Z step	0.0000
Approach height	0.1000
Top of contour	0.0000
Bottom of contour	-0.3750
Stepover direction	Toward
More	ENTER
<b>Contour Parameters Menu 2 Values</b>	
<b>Parameter</b>	<b>Setting</b>
Comment	N/A
Interference check	On
Tool path color	(Choose color)
Shape Reversed	No
Entry Move	N/A
Exit move	N/A
Machine setup	ENTER
<b>Contour Parameters Menu 3 Values</b>	
<b>Parameter</b>	<b>Setting</b>
Tool change	N/A
Initial move	2D
Coolant at start	On
Coolant at end	Off
Feedrate	12.0
Z Feedrate	6.0
Spindle at start	Forw
Spindle at end	Off
Spindle speed	1750


- 28 **F10, F10**
- 29 **F8 Calc**
- 30 **F1 Yes**
- 31 **F4 View**, choose **Iso**
- 32 **F8 POST**
- 33 **F10 Exit** (to Program Directory)
- 34 **F5 List**, to view G-code created, then **F10 Exit**.

After listing the G-code, go to **Draw Graphics Mode (F7)**, and view the program CAM Mode created. Press **Load (F6)** in the Program Directory to load the program. Enter the tool offsets, zero setting, dry run(s), and perform any other machine setup procedures now, before you produce any parts.



**Example #2 Machining a Slot using Contour**

In **Figure 18-8**, X0 Y0 is set at the center of the large radius. CG is required to create this shape. As you program, note the prompts that are displayed each time you press **ENTER**.

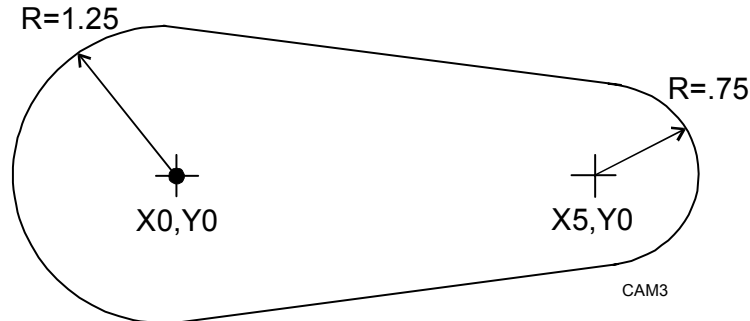

**Figure 18-8, Milling a Slot Using Contour**

Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **CONTUR-2** press **ENTER**
- 4 **F4 CAM**
- 5 **F3 S-EDIT**
- 6 **Create**
- 7 **ENTER, -1.25 ENTER, 0 ENTER**
- 8 Cursor to construction geometry, switch to **Circles**
- 9 Cursor right, then up to #2 (**Rad, Center**), **ENTER**
- 10 **1.25 ENTER, ENTER, 0 ENTER, 0 ENTER**
- 11 **ENTER (Rad, Center)** again
- 12 **.75 ENTER, ENTER, 5 ENTER, 0 ENTER(F5 ENTER to Fit on screen)**
- 13 Cursor down to #5 (**line tangent to 2 circles**), **ENTER**
- 14 **1 ENTER, 2 ENTER, 1 ENTER**
- 15 **ENTER** again
- 16 **2 ENTER, 1 ENTER, 1 ENTER**
- 17 Cursor left, then down to **Chain (#6)**, **ENTER**
- 18 **1 ENTER, 3 ENTER, 2 ENTER, 4 ENTER, 1 ENTER, F9**
- 19 Cursor up to **Arcs (#2)**, ensure direction is CW
- 20 Cursor right (to **XY end, RAD**), **ENTER**
- 21 **-1.25 ENTER, 0 ENTER, 1.25 ENTER.**

The shape is now completed. Press **SETUP (F9)**, highlight **Geometry**, press **ENTER**, and then switch **ALL** to **Off**. The CNC will turn off the Construction Geometry and the screen will contain only the shape.

22 **F5, ENTER** (to **Fit** the Shape on the screen)

23 **F7 MOTION**

24 **Contour**

Refer to **Table 18-24** to set the following parameters in the Contour menu(s):

**Table 18-24, Example 2 Settings: Milling a Slot Using Contour**

<b>Contour Parameters Menu 1 Values</b>	
<b>Parameter</b>	<b>Setting</b>
<b>Shape number</b>	1
<b>Tool compensation</b>	CAM Right
<b>Tool diameter</b>	0.7500
<b>XY stepover</b>	0.0000
<b>Number of XY passes</b>	1
<b>Z step</b>	0.0000
<b>Approach height</b>	0.1000
<b>Top of contour</b>	0.0000
<b>Bottom of contour</b>	-0.5000
<b>Stepover direction</b>	Toward
<b>More</b>	ENTER
<b>Contour Parameters Menu 2 Values</b>	
<b>Parameter</b>	<b>Setting</b>
<b>Comment</b>	N/A
<b>Interference check</b>	On
<b>Tool path color</b>	(Choose color)
<b>Shape Reversed</b>	No
<b>Entry Move</b>	N/A
<b>Exit move</b>	N/A
<b>Machine setup</b>	ENTER
<b>Machine Setup</b>	
<b>Tool change</b>	N/A
<b>Initial move</b>	2D
<b>Coolant at start</b>	On
<b>Coolant at end</b>	Off
<b>Feedrate</b>	10.0
<b>Z Feedrate</b>	5.0
<b>Spindle at start</b>	Forw
<b>Spindle at end</b>	Off
<b>Spindle speed</b>	1850

Entry move:                   CIRCULAR, Arc length = 180.0  
                                  Arc radius = .5000 (F10 to exit)


Exit move:                    CIRCULAR, Arc length = 180.0  
                                  Arc radius = .5000 (F10 to exit)

- 26    **F10, F10**
- 27    **F8 Calc**
- 28    **F1 Yes**
- 29    **F4 View**, choose **Iso**
- 30    **F8 POST**
- 31    **Exit** (to Program Directory)
- 32    **F5 List**, to view G-code created, then **F10**.

After listing the G-code go to **Draw Graphics Mode (F7)**, and view the program CAM Mode created. Press **Select (F6)** in the Program Directory to select the program. Enter the tool offsets, zero setting, dry run(s), and perform any other machine setup procedures now, before you produce any parts.

**Example #3 Machining an Outside Profile using Contour**

In **Figure 18-9**, X0 Y0 is set at the center of the large radius. As you program, note the prompts that are displayed each time you press **ENTER**.

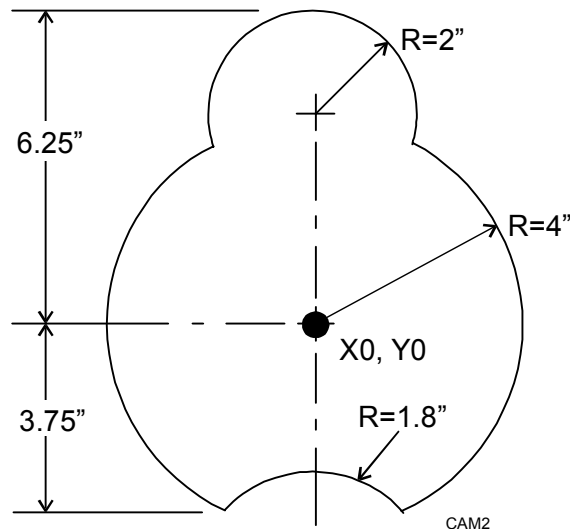

**Figure 18-9, Machining an Outside Profile Using Contour**

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **CONTUR-3** press **ENTER**
- 4 **F4 CAM**
- 5 Cursor down to **CG**, switch to circles
- 6 Cursor right, then up to #2, (**Rad, Center**) **ENTER**
- 7 4 **ENTER**, **ENTER**, 0 **ENTER**, 0 **ENTER**
- 8 **ENTER** again
- 9 2 **ENTER**, **ENTER**, 0 **ENTER**, 4.25 **ENTER** (**F5 ENTER** to Fit on screen)
- 10 Cursor left, down to **CG**, switch to **Lines**
- 11 Cursor right, up to **Y line**, **ENTER**, -3.75 **ENTER**
- 12 **F5 ENTER** (To **Fit** on screen)
- 13 Cursor left, down to **CG**, switch to **Points**
- 14 Cursor right, down to #5 (**intersection**), **ENTER**
- 15 1 **ENTER**, 3 **ENTER**, 1 **ENTER**
- 16 **ENTER** again (for **intersection**), then 1 **ENTER**, 3 **ENTER**, 2 **ENTER**
- 17 **F2 SHAPE**
- 18 **F9 DelGeom**, 3 **ENTER**
- 19 **F2 SHAPE (off)**, **F5 ENTER** (to **Fit** on screen / **redraw**)

- 20 Cursor left, up to **CG**, switch to **Circles**
- 21 Cursor right, up to #1 (**Round**), **ENTER**
- 22 1.8 **ENTER**, 4 **ENTER**, 5 **ENTER**, **F5 ENTER** (To fit)

The Construction Geometry necessary to drive the cursor to "build" the shape now exists. The next step is to create the shape and chain. That is, feed the cursor around the Construction Geometry.

- 23 **F3 S-EDIT**
- 24 **Create**
- 25 Cursor down to #6 (**CG existing point**), **ENTER**, 5 **ENTER**
- 26 Cursor left, then down to #6 (**Chain**), **ENTER**
- 27 **-3 ENTER**, 1 **ENTER**, 1 **ENTER**, 2 **ENTER**, 1 **ENTER**, 1 **ENTER**, 1 **ENTER**, 3 **ENTER**, 1 **ENTER**, **F9**

The shape now exists. Note that Construction Geometry circles are CW by default. If no minus sign was given for -3, the arc would be in the wrong direction, but **RevArc** (in **S-EDIT**) could correct it. To show this function, as well as show "multiple chains", follow these steps:

- A **F2 SHAPE**
- B **F8** four times (**DelMove**)
- C **F2 SHAPE** (Off)
- D **F5 ENTER** (to Fit)
- E **ENTER** (Chain)
- F 3 1 2 1 3 **ENTER** (The space between each element number is necessary when giving more than one element while chaining.)
- G 1 **ENTER**, 1 **ENTER**, 1 **ENTER**, 1 **ENTER** (selecting the intersections)
- H **F9**
- I **F2 SHAPE**
- J **F4 Back** .... until cursor is at end of bad arc (3 times)
- K **F3 S-EDIT**
- L **RevArc**
- M **F2 SHAPE** (Off)
- N **F5 ENTER** (Fit)

The shape is now correct!

- 28 **F9 SETUP**
- 29 **Geometry, All Off, F9, F9**

Assume that a .7500 radius must be placed in two positions, where the 2" radius meets the 4" radius. To accomplish this:

- A **F2 SHAPE**
- B **F5 Forw**
- C Cursor up to #4 (Rnd), ENTER
- D .75 ENTER
- E **F5 Forw**
- F ENTER
- G Arrow up, ENTER (arrow up recalls last value entered)
- H **F2 SHAPE** (Off)
- I **F5 ENTER (Fit / Redraw)**

The shape is now complete. Activate the **Contour** window and set the contouring parameters to create the path.

Refer to **Table 18-25** to set the following parameters in the Contour menu(s):

- 30 **F5** (Fit)
- 31 **F7** MOTION
- 32 Contour

**Table 18-25, Example 3 Settings: Machining an Outside Profile Using Contour**

<b>Contour Parameters Menu 1 Values</b>	
<b>Parameter</b>	<b>Setting</b>
Shape number	1
Tool compensation	CAM Left
Tool diameter	0.5000
XY stepover	0.0150
Number of XY passes	2
Z step	0.0000
Approach height	0.1000
Top of contour	0.0000
Bottom of contour	-0.2500
Stepover direction	Toward
More	ENTER

*(Continued...)*

**Table 18-25, Example 3 Settings:  
Machining an Outside Profile Using Contour (Continued)**


<b>Contour Parameters Menu 2 Values</b>	
<b>Parameter</b>	<b>Setting</b>
Comment	N/A
Interference check	On
Tool path color	(Choose color)
Shape Reversed	No
Entry Move	N/A
Exit move	N/A
Machine setup	ENTER
<b>Machine Setup</b>	
Tool change	N/A
Initial move	2D
Coolant at start	On
Coolant at end	Off
Feedrate	13.0
Z Feedrate	6.5
Spindle at start	Forw
Spindle at end	Off
Spindle speed	2300

- 34    **F10, F10**
- 35    **F8 Calc**
- 36    **F1 Yes**
- 37    **F5 Display, Window.** Move window to lower-right corner, **ENTER**, to see the two passes created in the path.
- 38    **F5 ENTER (to Fit)**
- 39    **F4 View**, choose **Iso**
- 40    **F8 (POST)**
- 41    Exit (to Program Directory)
- 42    **F5 List**, to view G-code created, then **F10**.

After you list the G-code, press **Draw (F7)**, to view the CAM program. Press **Load (F6)** in the Program Directory. Enter tool offsets and zero setting and perform dry run(s) and any other machine setup procedures now, before you produce any parts.

**Example #4 Machining a Contour with Many Unknown Intersections**

The contour illustrated in Figure 18-10 consists wholly of tangent arcs. The drawing shows the minimum number and types of dimensions required to construct the part. Contour will be used to machine the profile. X0 Y0 is set at the center of the large radius. As you program, note the prompts that are displayed each time you press **ENTER**.

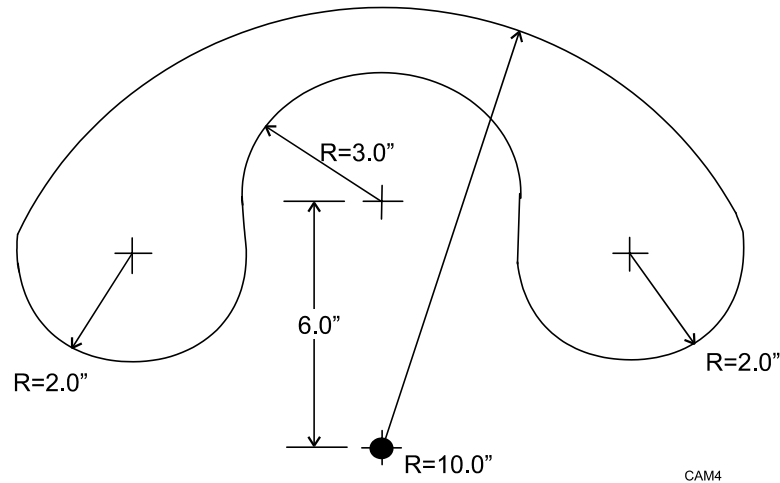

**Figure 18-10, A Contour with Many Unknown Intersections**

Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **CONTUR-4** press **ENTER**
- 4 **F4 CAM**
- 5 Cursor down to **CG**, switch to **Circles**
- 6 Cursor right, then up to #2, (**Rad, Center**) **ENTER**
- 7 10 **ENTER**, **ENTER**, 0 **ENTER**, 0 **ENTER**
- 8 **F5 ENTER (Fit)**
- 9 **ENTER** again
- 10 3 **ENTER**, **ENTER**, 0 **ENTER**, 6 **ENTER** (**F5 ENTER** to **Fit** on screen)
- 11 Cursor up to #1 **ENTER**, 2 **ENTER**, 1 **ENTER**, 2 **ENTER**, 1 **ENTER**
- 12 **ENTER** again, 2 **ENTER**, 1 **ENTER**, 2 **ENTER**, 2 **ENTER**
- 13 **F5 ENTER (Fit / Redraw)**
- 14 **F3 S-EDIT**
- 15 Create
- 16 Cursor down to #5 (**intersection**) **ENTER**
- 17 3 **ENTER** 1 **ENTER**
- 18 Cursor left, then up 1 (to place on **Chain - #6**), **ENTER**
- 19 1 **ENTER**, 4 **ENTER**, -2 **ENTER**, 3 **ENTER**, 1 **ENTER**, **F9**
- 20 **F9 SETUP, Geometry, All Off, F9, F9**
- 21 **F5 ENTER (Fit)** (2 times)



The Shape is now ready to contour.

- 22 **F7 MOTION**
- 23 **Contour**

Refer to **Table 18-26** to set the following parameters in the Contour Menu(s):

**Table 18-26, Example 4: A Contour with Many Unknown Intersections**


<b>Contour Parameters Menu 1 Values</b>	
<b>Parameter</b>	<b>Setting</b>
Shape number	1
Tool compensation	CAM Left
Tool diameter	1.0200
XY stepover	0.1250
Number of XY passes	4
Z step	0.5000
Approach height	0.1000
Top of contour	0.0000
Bottom of contour	-.2000
Stepover direction	Toward
More	ENTER
<b>Contour Parameters Menu 2 Values</b>	
<b>Parameter</b>	<b>Setting</b>
Comment	N/A
Interference check	On
Tool path color	(Choose color)
Shape Reversed	No
Entry Move	N/A
Exit move	N/A
Machine setup	ENTER
<b>Machine Setup</b>	
<b>Parameter</b>	<b>Setting</b>
Tool change	N/A
Initial move	2D
Coolant at start	On
Coolant at end	Off
Feedrate	15.0
Z Feedrate	7.5
Spindle at start	Forw
Spindle at end	Off
Spindle speed	1200

- 25 **F10, F10**
- 26 **F8 Calc**
- 27 **F1 Yes**
- 28 **F5 ENTER** (to Fit)
- 29 **F4 View**, choose Iso
- 30 **F8 (POST)**
- 31 EXIT (to Program Directory)
- 32 **F5 List**, to view G-code created, then **F10**.

After you list the G-code, go to **Draw Mode (F7)**, and view the CAM Mode program. Press **Load (F6)** in the Program Directory. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

#### Example #5 Contour with Many Unknown Intersections - All Tangent Arcs

In **Figure 18-11**, Contour will be used to machine the profile. X0 Y0 is set at the center of the part. As you program, note the prompts that are displayed each time you press **ENTER**.

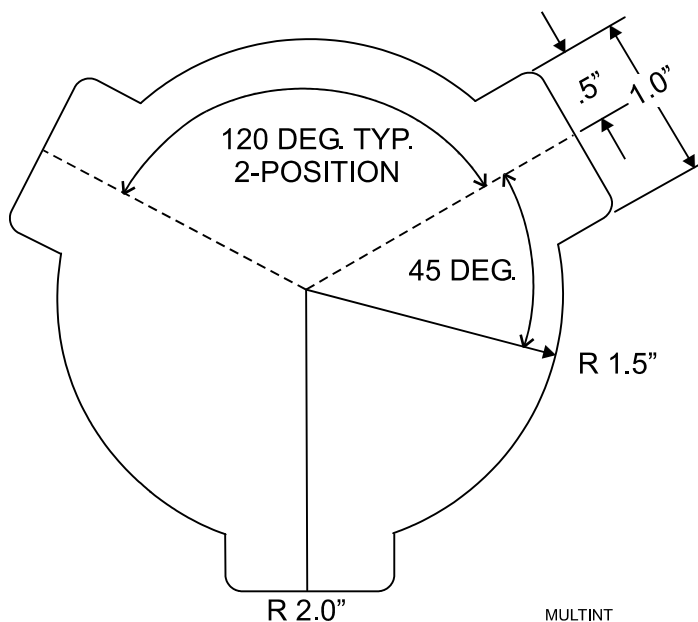

**Figure 18-11, Contour with Many Unknown Intersections - All Tangent Arcs**

## Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **CONTUR-5** press **ENTER**
- 4 **F4 CAM**
- 5 Cursor down to **CG**, switch to **circles**
- 6 Cursor right, then up to #2, (**Rad, Center**) **ENTER**
- 7 1.5 **ENTER**, **ENTER**, 0 **ENTER**, 0 **ENTER**
- 8 **F5 ENTER(Fit)**
- 9 **ENTER** again
- 10 2 **ENTER**, **ENTER**, 0 **ENTER**, 0 **ENTER**(**F5 ENTER** to **Fit** on screen)
- 11 Cursor left, down to **CG**, switch to **Lines**
- 12 Cursor right, down to #4 (**line thru point at angle**), **ENTER**
- 13 45 **ENTER**, **ENTER**, 0 **ENTER**, 0 **ENTER**
- 14 Cursor down to #5 (**line at distance from another line**), **ENTER**, 3 **ENTER**, .5 **ENTER**
- 15 **ENTER** again, 3 **ENTER**, -.5 **ENTER**
- 16 **F2 SHAPE**, **F9 DelGeom**, 3 **ENTER**
- 17 Cursor up to #4 **ENTER**, 45+120 **ENTER**, **ENTER**, 0 **ENTER**, 0 **ENTER**
- 18 Cursor down to #5 **ENTER**, 3 **ENTER**, .5 **ENTER**
- 19 **ENTER** again, 3 **ENTER**, -.5 **ENTER**
- 20 **F9 DELGeom**, 3 **ENTER**
- 21 Repeat Steps 17 - 20, except use 45+240 for Step 17
- 22 **F2 SHAPE** (Off)
- 23 **F5 ENTER (Fit)**

The Geometry necessary to feed the cursor now exists. Next, create a shape:

- 24 **F3 S-EDIT**
- 25 **Create**
- 26 **ENTER**, 1.5 **ENTER**, 0 **ENTER**
- 27 Cursor left, then down to **Chain** (#6), **ENTER**
- 28 1 9 2 8 1 7 2 6 1 5 2 4 1 (Note space between each element number), **ENTER**.

- 29 Now the CAM will prompt for intersections. Intersection #2 is needed for each prompt. Press **2 + ENTER** for each prompt (total of twelve times), then **F9**
- 30 Cursor up to #2 (**Arcs**)
- 31 Cursor right, **ENTER**, 1.5 **ENTER**, 0 **ENTER**, 1.5 **ENTER**
- 32 **F9 SETUP, Geometry, All Off, F9, F9**
- 33 **F5 ENTER (Fit)**

The basic shape now exists. Use the **Rnd** icon to blend radii at the corners and program.

- 34 **SHAPE**
- 35 Back twelve times, to reach 1st blend intersection
- 36 Cursor left, down to #4 (**Rnd**) **ENTER**, .25 **ENTER**
- 37 **F5 Forw**, **ENTER**(to select **Rnd** again), arrow up **ENTER**
- 38 Repeat Step 37 until all blends are complete (10 times)
- 39 **F2 SHAPE (Off)**
- 40 **F5 ENTER (Fit)**

The shape is now completed and ready to Contour.

- 41 **F7 MOTION**
- 42 **Contour**
- 43 Refer to **Table 18-27**. Set the following parameters in the Contour menu(s):

**Table 18-27, Example 5: Contour with Many Unknown Intersections - Tangent Arcs**

Contour Parameters Menu 1 Values	
Parameter	Setting
Shape number	1
Tool compensation	CAM Left
Tool diameter	0.4375
XY stepover	0.0000
Number of XY passes	1
Z step	0.0000
Approach height	0.1000
Top of contour	0.0000
Bottom of contour	-0.250
Stepover direction	Toward
More	Enter

(Continued...)

**Table 18-27, Example 5:**  
**Contour with Many Unknown Intersections - Tangent Arcs**  
 (Continued)

<b>Contour Parameters Menu 2 Values</b>	
<b>Comment</b>	N/A
<b>Interference check</b>	On
<b>Tool path color</b>	(Choose color)
<b>Shape Reversed</b>	Yes
<b>Entry Move</b>	N/A
<b>Exit move</b>	N/A
<b>Machine setup</b>	<b>Enter</b>
<b>Machine Setup</b>	
<b>Tool change</b>	N/A
<b>Initial move</b>	2D
<b>Coolant at start</b>	On
<b>Coolant at end</b>	Off
<b>Feedrate</b>	11.5
<b>Z Feedrate</b>	5.8
<b>Spindle at start</b>	Forw
<b>Spindle at end</b>	Off
<b>Spindle speed</b>	2200

- 44    **F10, F10**
- 45    **F8 Calc**
- 46    **F1 Yes NOTE:** Path direction is opposite of **SHAPE** direction.
- 47    **F5 ENTER (to Fit)**
- 48    **F4 View, choose Iso**
- 49    **F8 (POST)**
- 50    Exit (to Program Directory)
- 51    **F5 List, to view G-code created, then F10.**

After you list the G-code, go to **Draw Mode (F7)**, and view the program CAM created. Press **Load (F6)** in the Program Directory to load the program. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

**Example #6 Pocket Milled into Workpiece**

Refer to [Figure 18-7, An Outside Profile Using Contour](#). **Pocket** will be used to machine the pocket. X0 Y0 is set at the upper left corner of the pocket shape. No CG will be necessary. As you program, note the prompts that are displayed each time you press **ENTER**.

Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **POCKET-1** press **ENTER**
- 4 Refer to **Example #1**. Perform Steps 4 to 24, and then continue with Step 5 below.

The shape is now ready to be machined with the **Pocket** selection of the **F7 (MOTION)** key.

- 5 **F7 MOTION**
- 6 **Pocket**
- 7 Refer to **Table 18-28**. Set the following parameters in the **Pocket** menu(s):

**Table 18-28, Example 6 Settings: Pocket Milled into Workpiece**

Pocket Parameters Menu 1 Values	
Parameter	Setting
Shape number	1
Tool diameter	0.7500
XY stepover	0.4000
XY Stock	0.0150
Z step	0.0000
Approach height	0.1000
Top of pocket	0.0000
Bottom of pocket	-0.2500
Island setup	Int
More	ENTER
Pocket Parameters Menu 2 Values	
Parameter	Setting
Comment	N/A
Interference check	On
Angle of cut	Default
Direction of cut	Forw
Start point	Default
Tool path color	(Choose color)
Shape Reversed	No
Entry Move	N/A
Exit move	N/A

<b>Machine setup</b>	<b>ENTER</b>
<b>Pocket Parameters 3 Values</b>	
<b>Tool change</b>	N/A
<b>Initial move</b>	2D
<b>Coolant at start</b>	On
<b>Coolant at end</b>	Off
<b>Feedrate</b>	13.0
<b>Z Feedrate</b>	6.5
<b>Spindle at start</b>	Forw
<b>Spindle at end</b>	Off
<b>Spindle speed</b>	1750

**NOTE:** No Z stock will be programmed in the pocket examples. If required, Z stock can be programmed, then another "Pocket" should be programmed to fit the bottom of the pocket.

**NOTE:** All Pockets will require a "Contour" pass around the perimeter of the pocket, to finish the sides (see Examples 1 - 5 for Contour). Therefore, ANILAM recommends that XY stock be programmed for each Pocket.

- 8     **F10, F10**
- 9     **F8 Calc**
- 10    **F2 No**


**NOTE:** The lower area of the pocket is not completely cleared. This is due to the XY stepover programmed in the first Pocket Menu. To erase the path, select **No** when prompted to **Save path?**. To change the stepover, press **Calc** again.

- 11    **F7 MOTION**
- 12    **Pocket**
- 13    Change XY stepover to .425
- 14    **F8 Calc**
- 15    **F1 Yes**
- 16    **F5 ENTER** (to Fit)
- 17    **F4 View**, choose **Iso**
- 18    **F8 (POST)**
- 19    Exit (to Program Directory)
- 20    **F5 List**, to view G-code created, then F10.

After you list the G-code, go to **Draw Mode (F7)**, and view the program CAM created. Press **Load (F6)** in the Program Directory to load the program. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

**Example #7 Milled Pocket - X0 Y0 at Center of Radius**

Refer to **Figure 18-12**. **Pocket** will be used to machine the pocket. X0 Y0 is set at the center of the radius. As you program, note the prompts that are displayed each time you press **ENTER**.

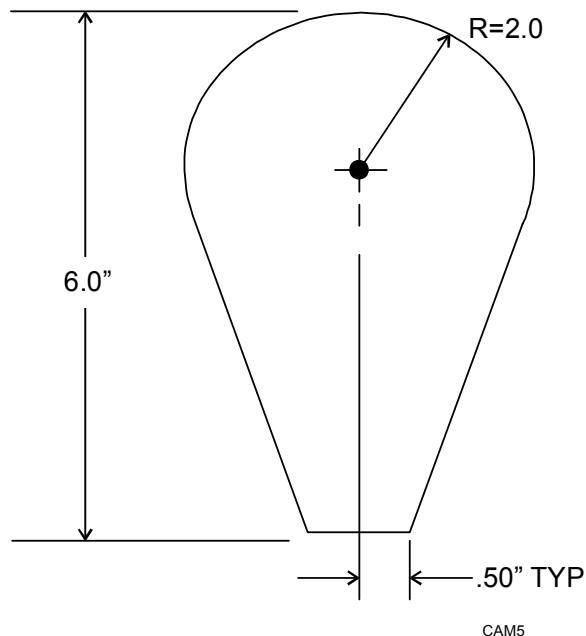

**Figure 18-12, Milled Pocket - X0 Y0 at Center of Radius**

Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **POCKET-2**, press **ENTER**
- 4 **F4 CAM**
- 5 Cursor down to **CG**, switch to **Circles**
- 6 Cursor right, then up to #2, (**Rad, Center**) **ENTER**
- 7 **2 ENTER, ENTER, 0 ENTER, 0 ENTER**
- 8 **F5 ENTER (Fit)**
- 9 Cursor left, then down to **CG**, switch to **Lines**
- 10 Cursor right, then up to Y line, **ENTER**
- 11 **-4 ENTER**
- 12 **F5 ENTER (Fit)**
- 13 Cursor down to #6 (**line tangent to circle thru point**) **ENTER**
- 14 **1 ENTER, ENTER**(to select current point def.) **.5 ENTER, -4 ENTER, 2 ENTER**
- 15 **ENTER** again
- 16 **1 ENTER, ENTER, -.5 ENTER, -4 ENTER, 1 ENTER**



The geometry necessary to feed the cursor now exists.

- 17 **F3 S-EDIT**
- 18 **Create**
- 19 Cursor down to #5 (INTERSECTION), **ENTER**
- 20 2 **ENTER**, 4 **ENTER**
- 21 Cursor left, then down to **Chain**, **ENTER**
- 22 2 **ENTER**, 3 **ENTER**, -1 **ENTER**, 4 **ENTER**, 2 **ENTER**, **F9**
- 23 **F9 SETUP, Geometry, All Off, F9, F9**
- 24 **F5 E ENTER (Fit)**

The shape now exists and is ready to **Pocket**.

- 25 **F7 MOTION**
- 26 **Pocket**
- 27 Refer to **Table 18-29**. Set the following parameters in the Pocket menu(s):

**NOTE:** With Z step set to .25 and Bottom of Pocket set to -.5000, two depth-of-cuts will occur.

**Table 18-29, Example 7:**  
**Pocket Parameters Menu 1 Values - X0 Y0 at Center of Radius**

Pocket Parameters Menu 1 Values	
Parameter	Setting
Shape number	1
Tool diameter	0.5000
XY stepover	0.3000
XY stock	0.0100
Z step	0.2500
Approach height	0.1000
Top of pocket	0.0000
Bottom of pocket	-0.5000
More	ENTER
Pocket Parameters Menu 2 Values	
Parameter	Setting
Comment	N/A
Interference check	On
Angle of cut	Default
Direction of cut	Forw
Start point	Default
Tool path color	(choose color)
Shape Reversed	No
Entry Move	N/A
Exit move	N/A
Machine setup	ENTER

**Table 18-29, Example 7:**  
**Pocket Parameters Menu 1 Values - X0 Y0 at Center of Radius**  
 (Continued)


Pocket Parameters 3 Menu Values	
Parameter	Setting
Tool change	N/A
Initial move	2D
Coolant at start	On
Coolant at end	Off
Feedrate	15.0
Z Feedrate	7.5
Spindle at start	Forw
Spindle at end	Off
Spindle speed	2550

- 28 **F10, F10**
- 29 **F8 Calc**
- 30 **F1 Yes**
- 31 **F5 ENTER** (to Fit)
- 32 **F4 View**, choose **Iso**
- 33 **F8 (POST)**
- 34 Exit (to Program Directory)
- 35 **F5 List**, to view G-code created, then **F10**.

After you list the G-code, go to **Draw Mode (F7)**, and view the program CAM created. Press **Load (F6)** in the Program Directory to load the program. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

**Example #8 Pocket Milled into Workpiece - X0 Y0 at Lower Left Corner**

Refer to **Figure 18-13**. **Pocket** will be used to machine the pocket. As you program, note the prompts that are displayed each time you press **ENTER**.

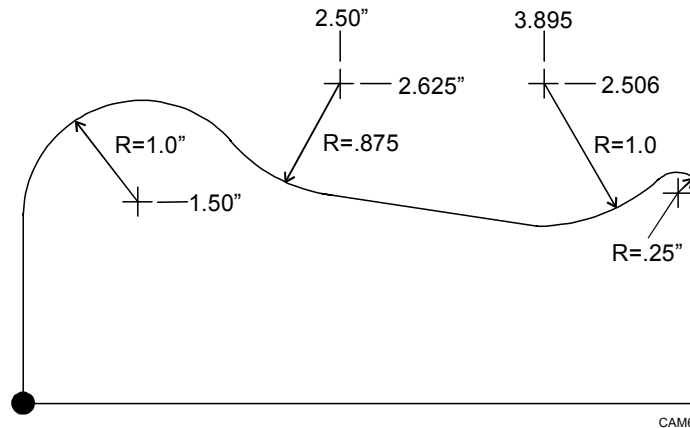

**Figure 18-13, Pocket Milled into Workpiece - X0 Y0 at Lower Left Corner**

Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **POCKET-3** press **ENTER**
- 4 **F4 CAM**
- 5 **F3 S-EDIT**
- 6 **Create**
- 7 **ENTER** (to select current point def), 0 **ENTER**, 0 **ENTER**
- 8 Cursor right, then down to Y line, **ENTER**
- 9 1.5 **ENTER**
- 10 Cursor left, then down to construction geometry, switch to **Circles**
- 11 Cursor right, then up to #2, **ENTER**, 1 **ENTER**, **ENTER**, 1 **ENTER**, 1.5 **ENTER**
- 12 **ENTER** again
- 13 .875 **ENTER**, **ENTER**, 2.5 **ENTER**, 2.625 **ENTER**
- 14 **F5 ENTER (Fit)**
- 15 **ENTER** again
- 16 1 **ENTER**, **ENTER**, 3.895 **ENTER**, 2.506 **ENTER**
- 17 Cursor down to #5 **ENTER**, 3 **ENTER**, 2 **ENTER**, 1 **ENTER**
- 18 Cursor up to #1 **ENTER**, .25 **ENTER**, 3 **ENTER**, 4 **ENTER**, 3 **ENTER**
- 19 **F5 ENTER (Fit)**
- 20 Cursor down to #6 **ENTER**, 270 **ENTER**, 5 **ENTER**, 2 **ENTER**

The necessary geometry now exists.

- 21 Cursor left, then down to **Chain**, **ENTER**
- 22 1 -2 4 -3 5 6 **ENTER**, **F9** (Note spaces)
- 23 Cursor up to #1, Cursor right, then down to #2
- 24 **ENTER**, 0 **ENTER**
- 25 Cursor up to #1 **ENTER**, 0 **ENTER**
- 26 **F9**, **Geometry**, **All Off**, **F9**, **F9**
- 27 **F5** **ENTER** (**Fit**)

The shape now is displayed in the graphics.

- 28 **F7** **MOTION**
- 29 **Pocket**
- 30 Refer to **Table 18-30**. Set the following parameters in the Pocket menu(s):

**Table 18-30, Example 8 Settings: Pocket X0 Y0 at Lower Left Corner**

<b>Pocket Parameters Menu 1 Values</b>	
<b>Parameter</b>	<b>Setting</b>
<b>Shape number</b>	1
<b>Tool diameter</b>	0.3750
<b>XY stepover</b>	0.2000
<b>XY stock</b>	0.0100
<b>Z step</b>	0.0000
<b>Approach height</b>	0.1000
<b>Top of pocket</b>	0.0000
<b>Bottom of pocket</b>	-0.1875
<b>More</b>	<b>ENTER</b>
<b>Pocket Parameters Menu 2 Values</b>	
<b>Comment</b>	N/A
<b>Interference check</b>	On
<b>Angle of cut</b>	Default
<b>Direction of cut</b>	Forw
<b>Start point</b>	Default
<b>Tool path color</b>	Yellow
<b>Shape Reversed</b>	No
<b>Entry Move</b>	N/A
<b>Exit move</b>	N/A
<b>Machine setup</b>	<b>ENTER</b>

(Continued...)

**Table 18-30, Example 8 Settings:**  
**Pocket X0 Y0 at Lower Left Corner (Continued)**

<b>Pocket Parameters 3</b>	
<b>Parameter</b>	<b>Setting</b>
<b>Tool change</b>	N/A
<b>Initial move</b>	2D
<b>Coolant at start</b>	On
<b>Coolant at end</b>	Off
<b>Feedrate</b>	11.0
<b>Z Feedrate</b>	5.5
<b>Spindle at start</b>	Forw
<b>Spindle at end</b>	Off
<b>Spindle speed</b>	2800

**NOTE:** All Pockets will require a "Contour" pass around the perimeter of the pocket, to finish the sides (Refer to **Examples 1-5** for Contour). Therefore, ANILAM recommends that you program XY stock for each Pocket. You can also program Z stock, which would require you to program a second "Pocket" (with 0 Z stock) to finish the bottom.

**NOTE:** Set color to **Yellow**.

**NOTE:** No Entry/Exit moves will be used here.

- 31 **F10, F10**
- 32 **F8 Calc**
- 33 **F1 Yes**
- 34 **F5 ENTER (to Fit)**
- 35 **F4 View, choose Iso**
- 36 **F8 (POST)**
- 37 Exit (to Program Directory)
- 38 **F5 List**, to view G-code created, then F10.

After you list the G-code, go to **Draw (F7)**, and view the program CAM created. Press **Load (F6)** in the Program Directory to load the program. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

**Example #9 Milled Pocket - X0 Y0 at the Center of the Large Radius**

**Pocket** will be used to machine the pocket. The shape will be the same as that used in Example 2. As you program, note the prompts that are displayed each time you press **ENTER**.

Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **CONTUR-2** press **ENTER**
- 4 **F4 CAM**
- 5 Refer to **Table 18-31**. Go to Example #2, and perform Steps 5 through 23, then continue with Step 6 below.

The Shape is now ready to be machined with the **Pocket** selection of the **MOTION (F7)** key.

- 6 **F7 MOTION**
- 7 **Pocket**
- 8 Refer to **Table 18-31**. Set the following parameters in the Pocket menu(s):

**Table 18-31, Example 9 Settings:  
Pocket with X0 Y0 at the Center of the Large Radius**

Pocket Parameters Menu 1 Values	
Parameter	Setting
Shape number	1
Tool diameter	0.5000
XY stepover	0.2800
XY stock	0.0150
Z step	0.0000
Z stock	0.0000
Approach height	0.1000
Top of pocket	0.0000
Bottom of pocket	-0.1250
More	N/A
Pocket Parameters Menu 2 Values	
Comment	N/A
Interference check	On
Angle of cut	60.00
Direction of cut	Forw
Start point	Default
Tool path color	(choose color)
Shape Reversed	No
Entry Move	N/A
Exit move	N/A
Machine setup	N/A

**Table 18-31, Example 9 Settings:**  
**Pocket with X0 Y0 at the Center of the Large Radius (Continued)**

Pocket Parameters 3	
Parameter	Setting
Tool change	N/A
Initial move	2D
Coolant at start	On
Coolant at end	None
Feedrate	12.0
Z Feedrate	3.0
Spindle at start	Forw
Spindle at end	none
Spindle speed	2100

**NOTE:** Pockets will require a "Contour" pass around the perimeter of the pocket, to finish the sides (Refer to **Examples 1-5** for Contour). Therefore, ANILAM recommends that you program XY stock for each Pocket. You can also program Z stock, which would require you to program a second "Pocket" (with 0 Z stock) to finish the bottom.

**NOTE:** If default angle is set, pocket will not clear correctly because the first move is an arc.


**NOTE:** No Entry/Exit moves will be used here.

- 8     **F10, F10**
- 9     **F8 Calc**
- 10    **F1 Yes**
- 11    **F5 ENTER (to Fit)**
- 12    **F4 View, choose Iso**
- 13    **F8 (POST)**
- 14    Exit (to Program Directory)
- 15    **F5 List, to view G-code created, then F10.**

After you list the G-code, go to **Draw Mode (F7)**, and view the program CAM created. Press **Load (F6)** in the Program Directory to load the program. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

**Example #10 Series of Holes using Drill**

Refer to **Figure 18-14**. No Construction Geometry will be used in this example. X0 Y0 is set at the upper left corner of the part. As you program, note the prompts that are displayed each time you press **ENTER**.

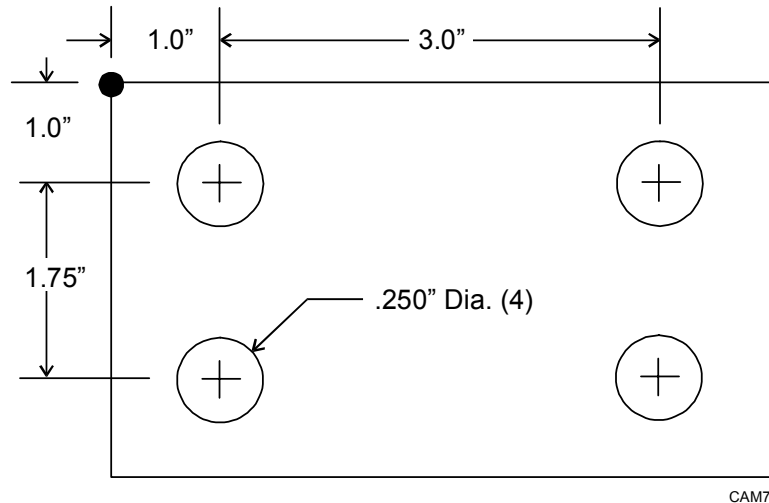

**Figure 18-14, Series of Holes Using Drill**

Keystrokes:

- 1 **F2 PROGRAM** (if necessary)
- 2 **F2 Create**
- 3 Type **DRILL-1** press **ENTER**
- 4 **F4 CAM**
- 5 **F3 S-EDIT**
- 6 **Create**
- 7 **ENTER** (to select current point def), 1 **ENTER**, -1 **ENTER**
- 8 **F9 SETUP**, **ENTER** (to switch to **Incremental**), **F9**, **F9**
- 9 Cursor right, **ENTER**, 3 **ENTER**
- 10 Cursor down **ENTER**, -1.75 **ENTER**
- 11 Cursor up **ENTER**, -3 **ENTER**
- 12 **F5 ENTER (Fit)**
- 13 **F5 (Half)**
- 14 **F7 MOTION**
- 15 **Drill**
- 16 Refer to [Table 18-32, Example 10 Settings: Series of Holes Using Drill](#). Set the following parameters in the Drill menu(s):



**Table 18-32, Example 10 Settings: Series of Holes Using Drill**

Drill Parameters Menu 1 Values	
Parameter	Setting
Shape number	1
Drill Cycle	Spot Drilling
Tool diameter	0.2500
Drill Parameters	ENTER
Tool path color	(choose color)
Machine setup	ENTER
G81 Spot Drilling Menu Values	
Hole Depth	-.2250
Starting Height	0.1000
Return Height	0.1000
Drill Parameters 2 Menu Values	
Tool change	N/A
Initial move	2D
Coolant at start	On
Coolant at end	Off
Feedrate	11.0
Spindle at start	Forw
Spindle at end	Off
Spindle speed	1800

- 17 **F10**
- 18 **F8 Calc**
- 19 **F1 Yes**
- 20 **F4 View**, choose **Iso**
- 21 **F8 (POST)**
- 22 Exit (to Program Directory)
- 23 **F5 List**, to view G-code created, then **F10**.

After you list the G-code, go to **Draw Graphics Mode (F7)**, and view the program CAM created. Press **Load (F6)** in the Program Directory to load the program. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

Drilling will occur at the intersection of every move of the chosen shape.

If more than one hole size is required, program a shape for each hole size.

Press **ENTER** with the cursor on "Drill Cycle" (Menu #1). All possible drill cycles are displayed. Place the cursor on any one to select it, and press **ENTER**. The CNC displays the appropriate drill parameters.



- 15 Cursor up two ENTER, -2.4 ENTER
- 16 Cursor down ENTER, 3 ENTER

The pocket (and contour) shape now exists.

- 17 **F3 S-EDIT**
- 18 **Create**
- 19 ENTER (to select current point def), 2 ENTER, -2.5 ENTER
- 20 Cursor down ENTER, 4 ENTER, -1 ENTER
- 21 A (for Autofit)

The drill shape now exists.

- 22 **F7 Motion**
- 23 **Pocket**
- 24 Refer to **Table 18-33**. Set the following parameters in the Pocket Menu(s):

**Table 18-33, Example 11:**  
**Pocket Parameters Menu Values - Pocket, Contour, and Drill**

Pocket Parameters Menu 1 Values	
Parameter	Setting
Shape number	1
Tool diameter	0.5000
XY stepover	0.1700
XY stock	0.0150
Z step	0.0000
Approach height	0.1000
Top of pocket	0.0000
Bottom of pocket	-0.1875
More	ENTER

*(Continued...)*

**Table 18-33, Example 11:**  
**Pocket Parameters Menu Values - Pocket, Contour, and Drill**  
 (Continued)

<b>Pocket Parameters Menu 2 Values</b>	
<b>Parameter</b>	<b>Setting</b>
<b>Comment</b>	N/A
<b>Interference check</b>	On
<b>Angle of cut</b>	Default
<b>Direction of cut</b>	Forw
<b>Start point</b>	Default
<b>Tool path color</b>	(choose color)
<b>Shape Reversed</b>	No
<b>Entry Move</b>	N/A
<b>Exit move</b>	N/A
<b>Machine setup</b>	ENTER
<b>Pocket Parameters Menu 3 Values</b>	
<b>Tool change</b>	N/A
<b>Initial move</b>	2D
<b>Coolant at start</b>	On
<b>Coolant at end</b>	None
<b>Feedrate</b>	12.0
<b>Z Feedrate</b>	3.0
<b>Spindle at start</b>	Forw
<b>Spindle at end</b>	none
<b>Spindle speed</b>	2100

25 **F10, F10**

26 **F8 Calc**

27 **F1 Yes**

28 **F7 MOTION**

29 **Contour**

30 Refer to [Table 18-34, Example 11: Contour Parameters Menu Values - Pocket, Contour, and Drill](#). Set the following parameters in the Contour menu(s):

**Table 18-34, Example 11:  
Contour Parameters Menu Values - Pocket, Contour, and Drill**

Contour Parameters Menu 1 Values	
Parameter	Setting
Shape number	1
Tool compensation	CAM Left
Tool diameter	0.5000
XY stepover	0.0150
Number of XY passes	2
Z step	0.0000
Approach height	0.1000
Top of contour	0.0000
Bottom of contour	-0.1875
Stepover direction	Toward
More	ENTER
Contour Parameters 2 Menu Values	
Comment	N/A
Interference check	On
Tool path color	Yellow
Shape Reversed	Yes
Entry Move	N/A
Exit Move	N/A
Machine setup	ENTER
Contour Parameters 3	
Tool change	N/A
Initial move	2D
Coolant at start	None
Coolant at end	Off
Feedrate	10.0
Z Feedrate	10.0
Spindle at start	None
Spindle at end	Off
Spindle speed	0

**NOTE:** All Pockets will require a Contour pass around the perimeter of the pocket, to finish the sides (Refer to **Examples 1 - 5** for Contour). Therefore, ANILAM recommends that you program XY stock for each Pocket. You can also program Z stock, which would require you to program a second "Pocket" (with 0 Z stock) to finish the bottom.

**NOTE:** Entry move; Set to: Type = LINEAR, Origin = 1.5, -1.5  
Exit move; none used here. (**F10** to exit).

- 31 **F10, F10**
- 32 **F8 Calc**

- 33 **F1 Yes**  
 34 **F7 MOTION**  
 35 **Drill**  
 36 Refer to **Table 18-35**. Set the following parameters in the Drill menu(s):

**Table 18-35, Drill Parameters Menu Values - Pocket, Contour, and Drill**

<b>Drill Parameters 1 Menu Values</b>	
<b>Parameter</b>	<b>Setting</b>
<b>Shape number</b>	2
<b>Drill Cycle</b>	Peck Drilling
<b>Tool diameter</b>	0.3750
<b>Drill Parameters</b>	N/A
<b>Tool path color</b>	Red
<b>Machine setup</b>	ENTER
<b>G83 – Peck Drilling Menu Values</b>	
<b>Hole Depth</b>	-.6500
<b>Start Height</b>	-.0875
<b>Maximum Peck</b>	0.1500
<b>Return Height</b>	0.1000
<b>Drill Parameters 2 Menu Values</b>	
<b>Tool Change</b>	N/A
<b>Initial move</b>	2D
<b>Coolant at start</b>	On
<b>Coolant at end</b>	Off
<b>Feedrate</b>	9.5
<b>Spindle at start</b>	Fwd
<b>Spindle at end</b>	Off
<b>Spindle speed</b>	1200


- 37 **F10**  
 38 **F8 Calc**  
 39 **F1 Yes**  
 40 **F4 View**, choose **Iso**  
 41 ALT-A  
 42 **F8 (POST)**  
 43 Exit (to Program Directory)  
 44 **F5 List**, to view G-code created, then **F10**.

After you list the G-code, go to **Draw Mode (F7)**, and view the program CAM created. Press **Load (F6)** in the Program Directory to load the program. Enter tool offsets, zero setting and perform dry run(s), and any other machine setup procedures now, before you produce any parts.

### Example #12 Using CAM for Pockets with Islands (G162)

Using CAM, the geometer would be entered as normal, with the island inside the main profile. The pocketing and contours would be done the same as any other CAM program.

The CAM display shows a shape with four islands in it with islands inside of islands. The shape is already done. See **Figure 18-16**.

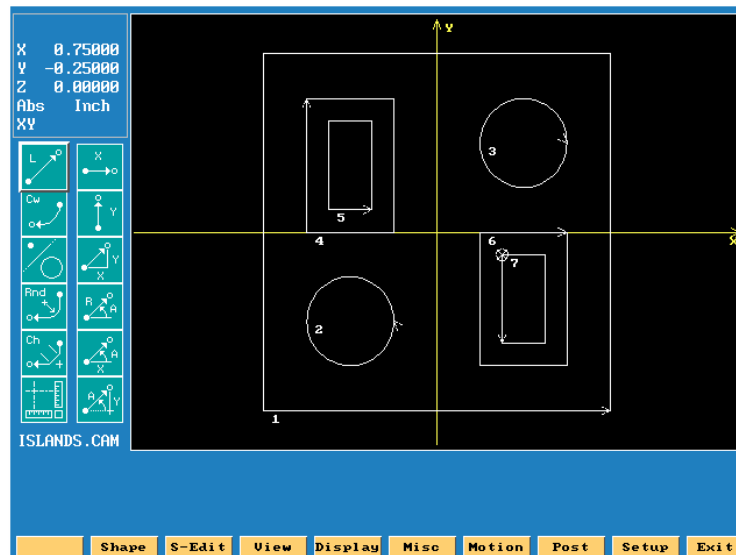


**Figure 18-16, CAM Workpiece Illustration**

1. Press **Motion (F7)**.
2. Select **Pocket**.
3. Select **Island setup** (see [Table 18-7, Pocket Parameters 1 Menu](#)), and press **ENTER** to process islands.
4. Select **Yes**. The CNC asks which islands to process.
5. A pop-up menu is displayed with options: No, Ext, and Int.

<b>No</b>	Process island
<b>Ext</b> (external)	Island is cut around the outside
<b>Int</b> (internal)	Island is cut on the inside


Refer to [Figure 18-17, CAM Workpiece Illustration with Pocket Parameters](#).

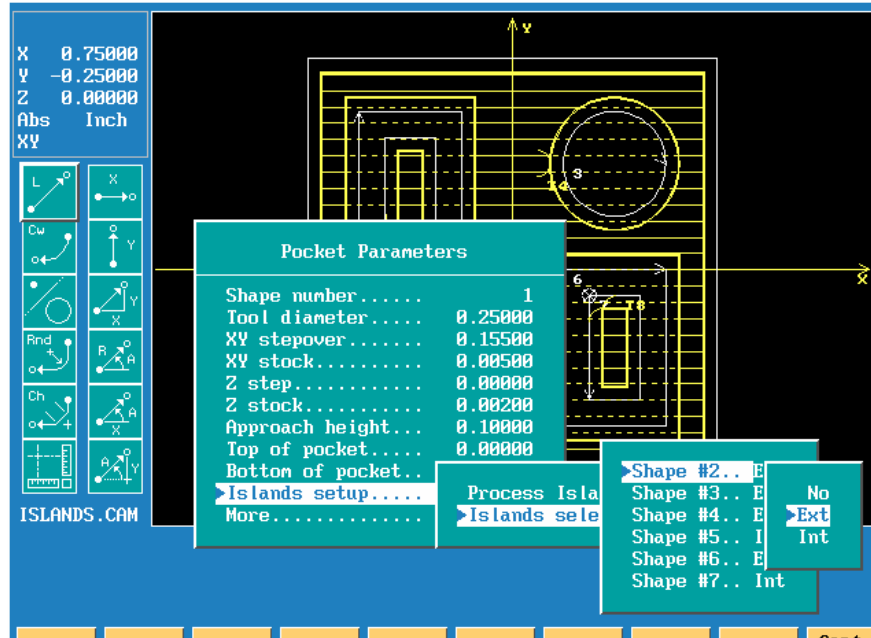

**Figure 18-17, CAM Illustration with Pocket Parameters Pop-up Menu**

After all islands are setup, press **Calc**. This clears the pocket, leaving islands standing and cutting inserts in the islands.

The islands still have to be contoured as shown in figure below. See **Figure 18-18**.

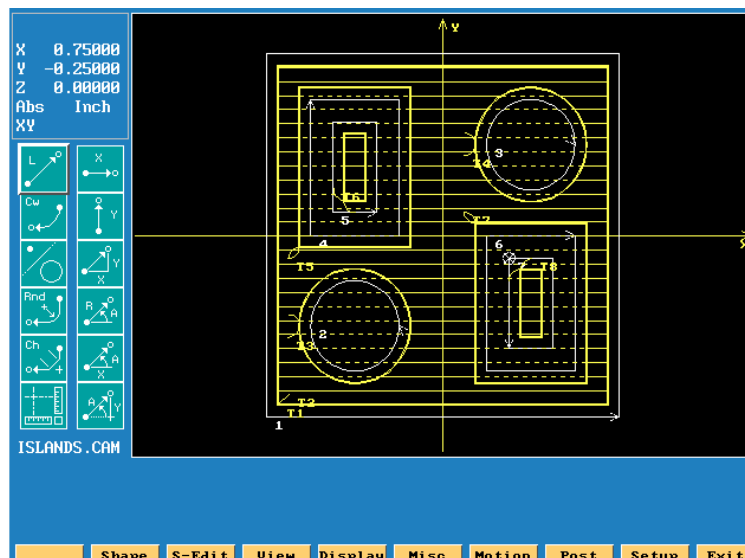


**Figure 18-18, CAM Illustration with Contours**

The CAM program is now ready to post and generate machine program.

[Figure 18-19, CAM Pockets with Islands Illustration in Draw Mode](#) shows the CAM program in Draw mode.




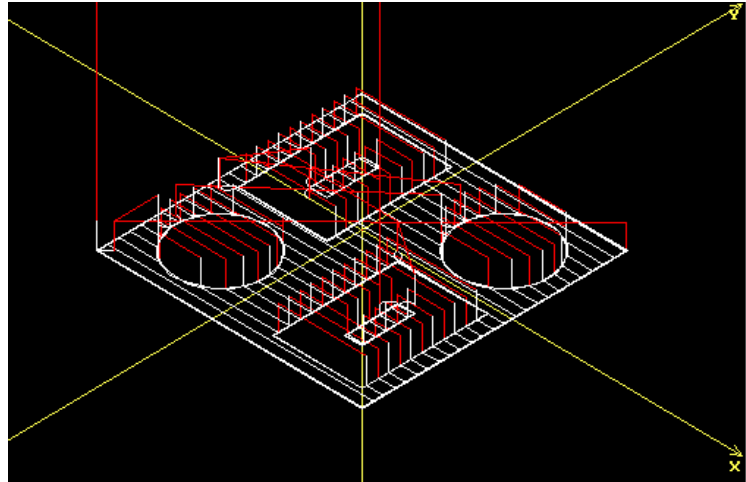


**Figure 18-19, CAM Pockets with Islands Illustration in Draw Mode**

**Additional Drawings for Practice**

Use **Figure 18-20** and **Figure 18-21** to improve your CAM programming skills:

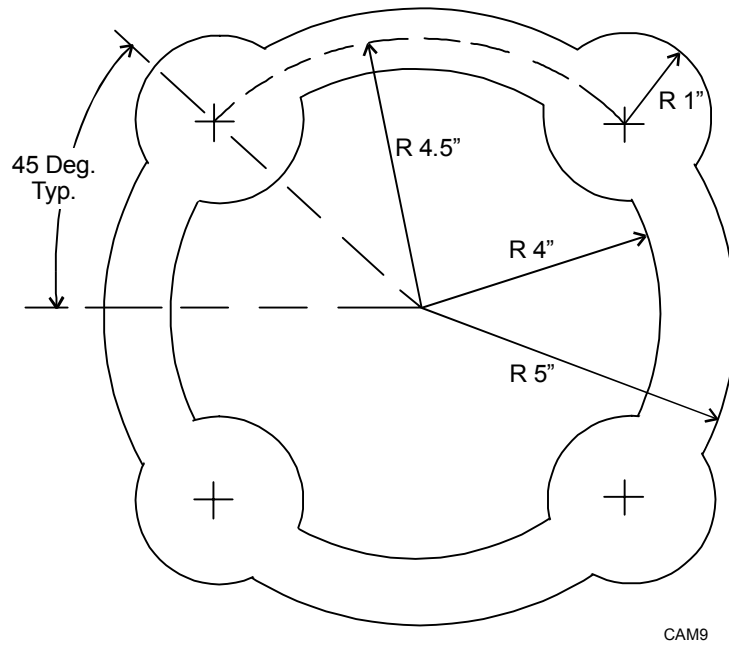

**Figure 18-20, Practice Drawing A**

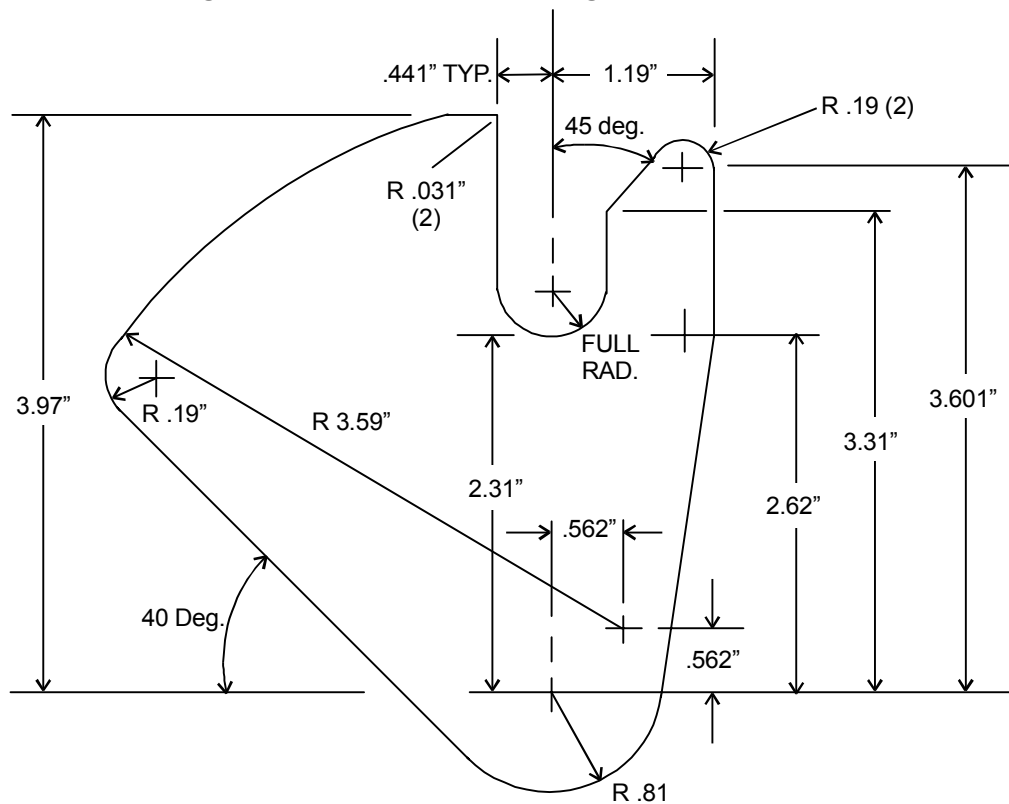

**Figure 18-21, Practice Drawing B**

## Section 19 - Advanced Programming Features

### Modifiers

Use modifiers to alter the way the CNC interprets a word address. For example, a single value in an Inch Mode program may be forced to Metric Mode, without programming **G71**. Or, arc center values (I, J, or K) may be forced to an absolute value.

The address and modifier must be accompanied by an ampersand (&). Place the ampersand (&) between the address word to be modified and the modifier. The address word is programmed first, followed by &, followed by the modifier, followed by the value.

The modifier is non-modal and is applied only to the address word it accompanies.

#### Example

```
G02 X2.0 Y1.0 I&A1.5 J&A1.0
```

The example forces the I and J center of an arc to be in Absolute Mode. I and J are incremental by default. Assume the axes are at X1 Y1.

**Table 19-1** lists the available modifiers.

**Table 19-1, Modifiers**

<b>A</b>	Force the address word to be in Absolute Mode.
<b>D</b>	Force the address word to be in Incremental Mode.
<b>E</b>	Force the address word to be in Inch Mode.
<b>M</b>	Force the address word to be in Millimeter Mode.
<b>P</b>	Force the address word to be in Absolute, Millimeter, Machine Position mode. All offsets (G53, G92, TLO) are ignored.

### Block Separators

Block separators (;) can be used to place several functions on one line of a program. This is useful in Manual Data Input (MDI) Mode because you can combine several commands on one line at the command line.

Example 1 will execute five moves on the machine when you press **START**. Each move is separated by the (;) block separator.

#### Example 1:

```
G90 G01 X0 Y0 F30 ; X3 ; Y-2 ; X0 ; Y0
```

Example 2 will move the axes linearly to X0 Y0, then CW to X1 Y1, then linearly to X2.

**Example 2:**

```
G90 G01 X0 Y0 F10 ; G02 X1 Y1 I1 J0 F8 ; G01 X2
```

In MDI Mode, you can type up to two lines of text at the command line. This makes it possible to program a number of sequential moves without beginning a new line of text.


The MDI command line will wrap around when the first line is filled, bringing the cursor down one line. When the second line is full, the limit has been reached.

The number of separate steps in a program file is limited only by the available memory.

Block separators can also be used in programs.

**Tool Offset Modification**

You can modify a tool diameter or length offset in the program without using the Tool Page. This is useful when rough-milling a profile where cutter diameter compensation requires different diameter definitions for the same tool to step the width of the cut. Tool modification can be either temporary or permanent. To make it temporary, choose not to update the Tool Page. To make it permanent, choose to update the Tool Page. Refer to **Figure 19-1**.

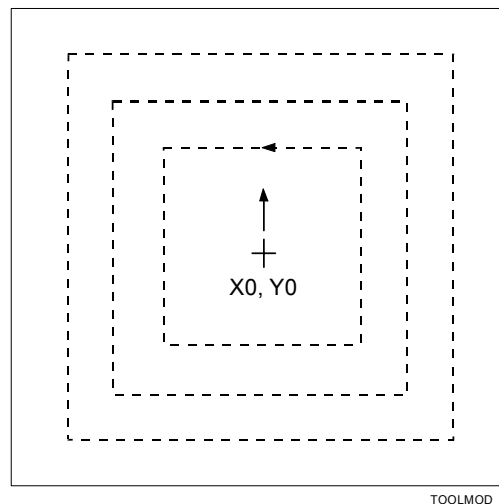

**Figure 19-1, Tool Modification Programming Example**

**Temporary Format:**

```
T1 D.5500 L-1.1000
```

Changes Tool 1 diameter offset to .5500 and length offset to -1.1000. Do not update the Tool Page for Tool 1.

**Permanent Format:**

T1 D.5500 L-1.1000 H

Changes Tool 1 diameter offset to .5500 and length offset to -1.1000.  
Updates the Tool Page for Tool 1 to entered values.

D and L values are absolute and replace the previous offsets. They are not added to existing offsets. The H command instructs the CNC to update the Tool Page offsets to the programmed values.

**Tool Modification Programming Example**

This program will mill the square shape four times. The CNC executes the first pass using the tool diameter entered in the Tool Page. Each subsequent pass will use a different, "modified" tool diameter, as programmed in Blocks 8, 10, and 12. T, D, L, and H are the only word addresses allowed on the block.

```

N1                O41 * TOOL-MOD.G
N2                G90 G70 G0 G17
N3                T0
N4                Z0
N5                X0 Y0
N6                T1 * .8000 DIA.
N7                M98 P1
N8                T1 D.6
N9                M98 P1
N10               T1 D.4
N11               M98 P1
N12               T1 D.2
N13               M98 P1
N14               T0
N15               G0 Z0
N16               M2
N17
N18               O1 * SUBPGM-1
N19               G1 Z-.25 F10
N20               G41 Y1
N21               X-1
N22               Y-1
N23               X1
N24               Y1
N25               X0
N26               G40 Y0
N27               M99

```

The main program calls the subprogram that contains the compensation on/off commands between each tool modification.

**NOTE:** When tool modifiers are activated, the CNC still applies any wear offset entered in the Tool Page.

### Expressions and Functions

You can program some values as expressions. Parentheses enclose expressions. The CNC displays an error message if the expression is incorrectly entered. Expressions follow the standard mathematics order of operations (multiplication, division, addition and subtraction).

An expression must contain an operator or use a function. Refer to **Table 19-2**.

**Table 19-2, Operators and Functions**

Ref.	Expression	Function
a)	( )	Expression function (parenthesis)
b)	* / &	Multiplication, division, modification
c)	+ -	Addition, subtraction
d)	> <	Relation greater than, less than
e)	= !=	Relation equal, not equal
f)	tomm	Convert to mm
g)	toin	Convert to inch
h)	tode	Convert to inch if inch, mm if mm
i)	tonu	Force to current modal
j)	round	Round up or down, automatically
k)	fix	Discard fraction less than 1
l)	fup	Raise fraction 1
m)	var	True if defined, false otherwise
n)	sin	Sine
o)	cos	Cosine
p)	tan	Tangent
q)	asin	Arcsine
r)	acos	Arcosine
s)	atan	Arctangent
t)	abs	Absolute value
u)	sqrt	Square root
v)	ln	Natural logarithm
w)	log	Logarithm
x)	exp	Exponential
y)	trun	Truncate
z)	! + - #	Unary logical not, positive, negative, indirection

## Examples

Ref. from Previous Table	Example
a)	G01 X(#100 + #101). All calculations must be enclosed in parentheses. This defines an expression.
b)	G00 Y&A(#102 * #103) LOOP (5 / 2 / .01) Example of multiplication, division and modification.
c)	G01 X(3 + 2) #100 = (#122 - #105). Addition and Subtraction.
d)	IF (#101 > 0) THEN .... Greater than (>), less than (<).
e)	IF (#144 = #143) GOTO ..... Equal to, not equal to (!=).
f)	TOMM (n); convert n to mm. If n's type is inch, TOMM (n) = n * 25.4.
g)	TOIN (n); convert n to inch. If n's type is mm, TOIN (n) = n / 25.4.
h)	TODE (n); convert to current (IN or MM) mode.
i)	TONU (n); force the type of (n) to the modal (inch or mm).
j)	ROUND (n) will round the value of (n) up or down, depending if its fractional part is equal or greater than .500000, or less than .500000. #100 = 1.500 ; G01 X(round(#100)) will move to X2.0000 #101 = 1.499 ; G01 X(round(#101)) will move to X1.0000
k)	FIX (n) will round the value down to the next whole number. #100 = (5/2) ; G01 X(fix(#100)) will move to X2.0000
l)	FUP (n) will round the value up to the next whole number. #100 = (5/2) ; G01 X(fup(#100)) will move to X3.0000
m)	VAR (n) is used to check if a user variable has been defined in a program. IF (var(#100)) THEN .... If #100 has been defined by the user, then true. If not, then false.
n)	SIN (n) will give the sine of (n). (n) is assumed to be in degrees. G01 X(cos(15)) Y(sin(15)) will move along the hypotenuse of a 15-degree angle with a hypotenuse of 1.
o)	COS (n) will give the cosine of (n).
p)	TAN (n) will give the tangent of (n).
q)	ASIN (n) will give the arcsine of (n).
r)	ACOS (n) will give the arccosine of (n).
s)	ATAN (n) will give the arctangent of (n).
t)	ABS (n) will give the absolute value of (n).

Ref. from Previous Table	Example
u)	SQRT (n) will give the square root of (n).
v)	LN (n) is natural logarithm.
w)	LOG (n) is logarithm.
x)	EXP (n) is exponential function.
y)	TRUN (n) will truncate the value of (n).
z)	! unary logical not, != (not equal to) ; positive, (+(#100)) means positive whatever value is in #100 ; negative, (-(#100)) means negative whatever is in #100 ; indirection. Example of indirection: N30 #200 = 51.456 N40 #201 = 200 N50 G90 G1 X ##201 F200 At Block N40 variable #201 = 200. Only when the second level of indirection is used at N50 does variable #201 contain the contents of variable #200 causing the X-axis to move to position 51.456. Up to four levels of indirection can be used.

### System Variables

Certain variables are set aside as CNC system variables. Some may be useful for you to know when programming macros. The system variables range from #1000 to #1099. Most of these variables are "read only". You cannot write information to them. There are a few exceptions to this rule. Refer to **Table 19-3** for a list of available system variables.

**Table 19-3, System Variables**

Variable	Description
#1000 to #1009	Block skip variables (read/write).
#1010 to #1015	Commanded ABS tool position (x,y,z,u,v,w)
#1016	Current G motion mode (0=rapid, 1=feed, 2=cw arc, 3=ccw arc, 5=ellipse, 6=spiral).
#1017	Current XYZ plane (17=XY, 18=XZ, 19=YZ).
#1020	Current tool diameter.
#1021	Current tool length offset.
#1022	Current feedrate.
#1023	Current rapidrate.
#1024	Current RPM.
#1030	Stock variable (R/W).

(Continued...)



**Table 19-3, System Variables (Continued)**

Variable	Description
#1031	Acute angle for rounding compensated intersections (default = 15.0).
#1032	# of look-ahead blocks for cutter comp (R/W).
#1040	Real-time tool compensation for ellipses and spirals. 0=off, 1=outside, 2=inside.
#1041	Current program tool compensation (40=off, 41=left, 42=right).
#1050 to #1055	Actual absolute position (X,Y,Z,U,V,W).
#1070	Current XYZ dimension (70=inch, 71=mm).
#1071	Current UVW dimension (70=inch, 71=mm).
#1090	Current XYZ dimension (90=abs, 91=incr).
#1091	Current UVW dimension (90=abs, 91=incr).
#1099	Last programmed Gear Range.

## User Variables

Certain variables are set aside for the programmer to use. These may be useful when programming macros. You can read from or write to these variables. They are divided into four categories:

□ Local variables: #1 to #99

These variable numbers can be used only within the body of a subprogram (or macro). The CNC generates an error message if you program these variables in the main program. Values do not hold from one subprogram to another. In this way, the same variables can be used in separate subprograms, with different values.

□ Common (global) variables: #100 to #220. (Read/Write)

These variables can be used anywhere in the program or subprogram and their value will remain.

**WARNING: OEM and machine tool builders should use #100–#150 for any custom macros. End users should use #151–#220 for your custom macros. This avoids conflicting usage of the global variables.**

□ Read only variables: #221 to #250

These variables can only be set in the main program. Once set, the variables can be used in subprograms or macros as "read only" variables.

□ Block skip variables: #1000 to #1009 (Refer to "[Block Separators](#)" in this section.)

## Variable Programming (Parametric Programming)

Variable, or parametric, programming enables you to create macros to generate geometric shapes that are not already available in a canned cycle.

Conditional loops, jumps, and GOTO commands can be used to control program execution.

### Parameters and Variable Registers

A macro is a series of instructions designed to achieve a specific result for a given set of constraints. For example, a rectangular pocket of any size always has four sides, four corner radii and a depth. Therefore, you can cut many pockets of different sizes using a similar tool path with longer or shorter moves for the tool path. If a suitable program processes the constraints of the pocket, the CNC calculates a tool path to cut a particular pocket. Such a program is called a macro. The G78 rectangular pocket cycle is an example of a macro that cannot be edited.

The constraints of the pocket, or the feature required, are its parameters. Parameters for any feature will vary as dimensions change, therefore the parameters are often called variables. The data for each parameter must be stored as an entity, known as a variable register, also called variables.

Parameters passed to a macro will be called parameters in this manual.

### Contents of Variables (PRINT)

#### Format:

PRINT xxx(variable)

#### Format:

N(Block number) PRINT xxx(variable)

You can verify the contents of a variable. This is useful when you are debugging a program. Use the PRINT command to display the contents of a variable on the screen in Manual, Single-Step and Auto Modes.

#### Example 1:

PRINT 200

Displays the contents of the variable (#200).

#### Example 2:

N180 PRINT 110

To display variable contents during program execution, use the PRINT command as part of the program. Example 2 will print the contents of variables #110 to the screen.

If commas separate the numbers, several variables can be printed simultaneously.

In Manual Mode, type **PRINT 110** then press **START** to display the contents on the screen.

The PRINT variable can be abbreviated, as follows: **JP**

In the Editor, press **Expand (F7)** to expand the first character of print into the full address. (Type **P**, then press **F7**). Refer to "[Short Form Addressing](#)" in this section.

### Setting and Transferring Variables

When using parametric programming with axis addresses and expressions (including unary minus), the complete expression needs to be in parenthesis. For example, X(-#151) is correct. X-#151 or X-(#151) are not correct.

#### Setting and Direct Transfer:

Variables are loaded or set when they appear on the left side of an equation. (That is, the left side of the equal sign.)

##### Example 1:

```
N200 #100 = 5.56
```

Variable #100 contains number 5.560000 until changed.

##### Example 2:

```
N200 #100 = 25.4m
```

Variable #100 sets variable 100 to 25.4mm. Similarly, #100 = 5i sets variable 100 to 5 inches. If neither "i" nor "m" are used when assigning a variable, then the value of the variable is modal. For example, #100 = 8 sets variable #100 to 8 (no unit).

##### Example 3:

```
N200 #100 = #20
```

Variable #100 contains the number held by #20 until changed. Equating one variable with another is called a direct transfer.

**NOTE:** When a direct transfer is requested, the variable on the right side of the equation must contain a value. Otherwise, the CNC displays an error message(#nn not defined).

#### Indirect Transfer:

You can indirectly transfer variables to a depth of four levels by introducing extra hatch marks (#) before the variable number. In an indirect transfer, a value is transferred to one variable via another.

##### Example 1:

```
N201      G90 G17 G71 G0
N202      #101 = 51.456
N203      #102 = 101
N204      X##102
```

At Block N204, the X-axis moves to 51.456. Example 1 shows single indirection. The contents of variable #101 are used by variable #102. The actual content of variable #102 is constant 101. The indirection is activated at Block N204 by the addition of the (#) symbol to variable #102.

**Example 2:**

```
N210      G90 G17 G71 G0
N211      #101 = 1
N212      #102 = 2
N213      #103 = 3
N214      #104 = 4
N215      #119 = 100
N216      LOOP 4
N217      #119 = #119 + 1
N218      #120 = 119
N219      X####120
N220      END
N221      M2
```

Example 2 contains two levels of indirection (N219) and shows how the contents from multiple variables can be assigned to a command or expression.

At Block N215, variable #119 is set to constant 100.

At Block N217 one is added to the contents of variable #119.

At Block N218 variable #120 is set to constant 119.

Block N219 moves the X-axis to the position contained in variable #120 via two levels of indirection. The first level is the content of variable #119. The second level is the content of variable #101, which is incremented in the loop at Block N217 to introduce the contents of variables #102, #103 and #104.

The X-axis will move to X1; X2; X3; and X4.

## Storing Result of Computation

When a mathematical expression is programmed, variables on the left side of an equation store the computed result.

N250 #110 = #20 + #35

N260 #120 = #18 / 2

At N250, #110 contains the sum of the contents of #20 and #35. At N260, #120 contains the result of the contents of #18 divided by 2.

Parentheses establish an order of operations or denote special functions.

**NOTE:** Multiplication operations MUST be in parentheses or the CNC treats the multiply command (\*) as a comment sign and disregards the rest of the line following the sign (\*).

N300 #140 = (#11 \* #115) / 2

N310 #141 = sin (45)

N320 #142 = (#141 \* #140) ; \* #142 is shortest side

## Variable Programming

### Example 1

This program uses common variables in the range of #50 to #149. The program mills a pocket with a three-degree draft angle on the sidewalls. The dimensions at the bottom of the pocket are:

15.5730 (X axis) x 13.8850 (Y axis). The pocket is 1.0000 in. deep.

The tool begins at the upper-left corner of the pocket and at full depth. Part Zero is set in the center of the pocket.

```
O 28 * 3-DEG. DRFT PKT
G90 G70 G0 G17
T0
Z0
X0 Y0
T1
X-7.7865 Y6.9425      * MOVE TO UP-LEFT CORNER
Z.5
G1 Z-1 F10           * FEED TO DEPTH
F40
#101 = 15.5730        * LENGTH (X) OF POCKET
#102 = 13.8850        * WIDTH OF POCKET
#103 = .0200          * DESIRED "STEP-UP" IN Z AXIS
#104 = (#103*TAN(3)) * CALCULATE "STEP-OVER" IN X-Y AXES
M98 P100             * CALL SUBPROGRAM 100
T0
G90 G0 Z0
```

X0 Y0  
M2

```

O100
LOOP((1/#103)+1);      * SET LOOP NUMBER (1 IN. DP / .02 STEP) + 1
G91                    * SET INCREMENTAL MODAL
G1 Y(-#102);           * MILL L.H. SIDE
X#101;                 * MILL BOTTOM SIDE
Y#102;                 * MILL R.H. SIDE
X(-#101);              * MILL TOP SIDE, BACK TO START POS'N
X(-#104) Y#104 Z#103;  * STEP UP/OVER IN X-Y AND Z
#101 = #101 + (#104*2); * ADD STEPOVER TIMES 2 TO LONG SIDES
#102 = #102 + (#104*2); * ADD STEPOVER TIMES 2 TO SHORT SIDES
END                    * END LOOP
M99
    
```

The pocket will be milled with a side draft angle of three degrees. Z is set to a step-up increment of .02 in. #152 can be set to a desired value, perhaps to determine the finish on the sidewalls of the pocket. In this example, the pocket will always have a depth of 1 in., and a draft angle of 3 degrees. The side lengths and Z step may be changed.

To make this program totally independent, the Z depth and draft angle can be set to variables, and the additional calculations must then be made.

### Example 2

This program requires the length and width of a rectangle, the cut per side on the rectangle, and the number of passes around the rectangle. Variables #150 to #199 are read only. They can be set only in the main program.

```

N10    O 1000
N20    G0 G17 G70 G90 F80
N30    T0
N40    Z0
N50    X0 Y0 ;* START POSITION OF RECTANGLE
N60    #151 = 3 ;* SET READ ONLY VARIABLE, X LENGTH OF
        SIDE
N70    #152 = 3 ;* SET READ ONLY VARIABLE, Y LENGTH OF
        SIDE
N80    #153 = .25 ;* SET READ ONLY VARIABLE, CUT PER SIDE
N90    #154 = 5 ;* SET READ ONLY VARIABLE, NUMBER OF
        PASSES
N100   M98 P1 ;* CALL SUBPROGRAM BODY
N110   T0
N120   Z0
    
```

```
N130  X0 Y0
N140  M2

N160  O1
N170  G91 G1 X#151 ;* MOVE X AXIS LENGTH OF SIDE
N180  Y#152 ;* MOVE Y AXIS LENGTH OF SIDE
N190  X(-#151) ;* MOVE X NEGATIVE
N200  Y(-#152) ;* MOVE Y NEGATIVE
N210  #111 = 0 ;* SET SIDE CUT INCREMENT TO 0
N220  LOOP #154 ;* LOOP #154 NUMBER OF TIMES
N230  X#153 Y#153 ;* SET SIDE CUT
N240  #111 = #111 - #153 ;* DECREMENT SIDE CUT EACH LOOP
N250  #101 = #151 + (#111 * 2) ;* CALCULATE NEW X LENGTH
N260  #102 = #152 + (#111 * 2) ;* CALCULATE NEW Y LENGTH
N270  X#101 ;* MOVE AROUND SQUARE USING NEW SIDE *
      LENGTHS
N280  Y#102
N290  X(-#101)
N300  Y(-#102)
N310  END
N320  M99
```

The read only variables are set in Blocks N60 to N90. Then, the subprogram is called. At Block N170, the first move is made along the X-axis, followed by a move along the Y-axis. At Blocks N190 and N200, the logical negative sign makes the axis move in the opposite direction. The contents of the variables remain the same.

At Block N220, a loop, which ends at Block N310, is set up. The loop runs the number of times contained in variable #154. The first move in the loop is in the X- and Y-axes to the side of cut value in #153. In Block N240, #111 decrements at each pass through the loop, by the value of the side cut. This value, in turn, is used to calculate a new length of cut for each side.

### User Macros (G65, G66, G67)

Use G66 when you want to use a modal macro subprogram. These groups of instructions can be special canned cycles made up by the user to simplify the programming of the particular part, or master programs for similar part families, programmed with variables rather than fixed dimensions.

Macros can contain automatic measuring sequences for sensors, such as a probe, for feedback to the CNC. Refer to **Table 19-4**.

**Table 19-4, Macro G-Codes**

Format	Function
<b>G65 Pn Ln</b>	Non-modal macro call. Call macro n. Execute macro, at the current position, only once. The subprogram can be looped (L).
<b>G66 Pn</b>	Modal macro call. Call macro n. Execute macro at any X and/or Y location given after the G66 code, until G67 (cancel) is called. G66 will stay active until G67 is called.
<b>G67</b>	Cancel Modal Macro Call (G66).

### Macro Body Structure

The macro body is defined in the same way as a subprogram.

**Format:** Oxxx

O identifies it as a macro.

xxx is the label number.

**Example:**

```
N200 O 201
N210 -----
```

Terminate the macro with an M99 code.

Use local variables within the body of a macro or subprogram only. You cannot use them to transfer data to other macros or subprograms. If further subprogram calls are made from the macro body, you must transfer data from the local variables to common variables. The common variables can then be referenced to transport data to the further subprogram.

```
N220 #100 = #20
N230 -----
```

Common variables range from #100 to #220.

The macro must either be part of the program from which it is called or "included" using the file inclusion code. Refer to "[File Inclusion](#)."



## Setting and Passing Parameters

You can set parameters for a macro before the subprogram call (M98 Pn). Refer to Example 1. Blocks 10 to 12 define variable values for the subprogram called in Block 13.

### Example 1

```
N10 #151 = 2
N11 #152 = 3
N12 #153 = 3.4
N13 M98 P1
N14 -----
```

It may be more convenient to use macro call G65 Pn or G66 Pn to pass variables to the subprogram by letter address. This is how a canned cycle operates. Refer to Example 2. Values are passed on for parameters A, B and C.

### Example 2

```
N20 G65 P1 A2 B3 C3.4
N21 -----
```

Macro call G65 Pn contains a loop option (Ln). Where, n is the number of repetitions of the subprogram called.

```
N20 G65 P1 A2 B3 C3.4 L3
N21 -----
```

Macro 1 will be called three times (Ln equals 3).

When parameters are passed to a macro body by letter address, the contents of the parameters are stored in local variables. Refer to **Table 19-5**.

**Table 19-5, Letter Addresses**

A = #1	B = #2	C = #3	D = #7	E = #8	F = #9,
H = #11	I = #4	J = #5	K = #6	M = #13	Q = #17,
R = #18	S = #19	T = #20	U = #21	V = #22	W = #23,
X = #24	Y = #25	Z = #26			

Letter addresses G, L, N, O, and P cannot be used for parameter passing.

**G65 Macro Programming, Main**

The following is an example of a simple macro program. In this example, the macro is a "window milling" cycle designed to mill a square or rectangular window through a part.

**Example:**

```
N1          O99 * WINDOW-MACRO-CALL
N2          G90 G70 G0 G17
N3          T0
N4          Z0
N5          X0 Y0
N6          T1 *** .5000 MILL
N7          G90 G0 X1 Y1
N8          Z.1
N9          F40
N10         G65 P3 X4 Y4 Z-.55
N11         G90 G0 Z.1
N12         T0
N13         Z0
N14         X0 Y0
N15         M30 O99
```

\* parameters passed:

\* X (#24) = length of window in X axis

\* Y (#25) = width of window in Y axis

\* Z (#26) = absolute tool depth

**G65 Macro Programming, Macro (Subprogram)**

This macro can mill any size window (L x W), at any Z depth. To change the pocket size, change the parameters on Block 10 (X,Y,Z). The CNC will execute the macro only once, at the current position. (G65 is not modal.)

**Example:**

```

N22      O3 * WINDOW-MACRO
N23      G90 G1 Z#26
N24      G91 G41 Y(#25/2)
N25      X(-#24/2)
N26      Y(-#25)
N27      X#24
N28      Y#25
N29      X(-#24/2)
N30      G40 Y(-#25/2)
N31      M99

```

**G66/G67 Macro Programming**

This example is a modal macro program to mill slots in a plate at various locations. In contrast to the G65 (single-call macro) in Example 1, G66 (modal macro call) applies the macro to all subsequent moves, until canceled by G67. Program G67 after the last slot location.

**Example:**

```

N1      O101 * SLOTCALL.G
N2      G90 G70 G0 G17
N3      T0 Z0
N4      X0 Y0
N5      T1 D.25 L-1 F30
N6      G66 P1255 X5 Y1 Z-.1 A5 B12 C5
N7      X1 Y2
N8      X2 Y4
N9      G67
N10     G90 G0 T0 Z0
N11     X0 Y0
N12     M2
N13
N14     ["SLOTMAC.G

```

This program calls SLOTMAC.G, a program in another file. The "file inclusion" block (N14) calls the program from another file in the Program Directory.

**SLOTMAC.G Program**

In the following Blocks 1260 through 1400 are comment blocks that regard the macro's structure and concept.

**Example:**

```

N1255          O1255 * SLOTMAC.G
N1260
N1270          * EXAMPLE: G65 P1255 X-3 Y1 Z-.125 A5 B12 C10
N1280          * P = SUB #
N1290          * X = X DIM OF SLOT      #24
N1300          * Y = Y DIM OF SLOT      #25
N1310          * Z = ABS DEPTH OF SLOT  #26
N1320          * A = Z FEEDRATE        #1
N1330          * B = XY FEEDRATE       #2
N1340          * C = ANGLE FROM 3 o'clock #3
N1350
N1360          * NOTES:
N1370          * 1. SLOT WILL HAVE FULL RAD.

N1380          * 2. MUST POS'N XY OVER CENTER OF L.LEFT
RAD.
N1390          * 3. PROGRAM SLOT LENGTHWISE IN X, ANGLE
C WILL ROTATE

N1400
N1410          G90 G0 Z.1
N1420          G61 Z#26 F#1
N1430          G68 C#3
N1440          G91 G41 G64 X.1 Y(#25/2) F#2
N1450          X-.1
N1460          G3 X0 Y(-#25) I0 J(-#25/2)
N1470          G1 X(ABS((ABS(#24))-(ABS(#25))))
N1480          G3 X0 Y#25 I0 J(#25/2)
N1490          G1 X(-(ABS((ABS(#24))-(ABS(#25))))))
N1500          G1 G40 Y(-#25/2)
N1510          G68
N1520          G90 G0 Z.1
N1530          M99

```

## Macro Programming (Hole Milling Macro)

Example 3 machines a CW or CCW hole. A move is made to the hole center and to the required Z depth before calling the macro. After the macro is completed, the Z-axis moves to the clearance plane. The macro contains tangential entry to and exit from the hole surface. It uses error checking and messages. When the macro is finished, machine parameters return to their previous status.

String variables (Examples: EPSI, SAVEFRT) can be set and used in place of regular variables.

### String Variables

String variables can be used to make a macro program easier to understand. They can represent a value or a variable. They can be used only in subprograms.

String variables must be set before use, in the following format:

[ TEXT value or variable

### Examples:

[ PI 3.141592654 \*PI will be read as the value given

[ TFLAG #1041 \*TFLAG will represent system variable #1040 (current tool comp)

**NOTE:** Open bracket must start line. Do not use equal signs (=) in string variables.

You can use a variable to print values.

#35= PI ;print 35 \*3.141592654 will be printed

There must be at least one space preceding and following the string variable in a program. In the following examples, PI is the variable.

#35/PI+#23 Produces error.

#35/ PI +#23 Correct format.

Once set, string variables can be used in any macro within the same program.

### Example:

```
G90 G70 G0 G17
T0 Z0
X0 Y0
T1 F30
X1.5 Y0 * MOVE TO HOLE CENTER
Z.1
G1 Z-.5 * MOVE Z TO DEPTH
```

```
G65 P76 D2.0 S.010 J35 K20
G0 Z.1 * RAISE Z TO CLEARANCE PLANE
TO Z0
X0 Y0
M2
```

```
O76 ** HOLE MILLING MACRO.
```

```
*
```

```
* D#7 = HOLE DIAMETER (+=CCW,-=CW), J#5 = ROUGH
FEEDRATE,
```

```
* S#19 = FINISH STOCK AMOUNT, K#6 = FINISH FEEDRATE.
```

```
* #1020 = TOOL DIAMETER.
```

```
*
```

```
[SAVEG90 #99 * SET STRING SAVEG90 TO VAR 99
```

```
[SAVEG00 #98 * SET STRING SAVEG00 TO VAR 98
```

```
[SAVEFRT #97 * SET STRING SAVEFRT TO VAR 97
```

```
[TDIA #96 * SET STRING TDIA TO VAR 96
```

```
[EPSI .00001 * SET STRING EPSI TO .00001
```

```
SAVEG90 = #1090 * SAVE CURRENT DIM MODE
(ABS=90,INCR=91)
```

```
SAVEG00 = #1016 * SAVE CURRENT MOVE MODE
(RAPID=0,FEED=1)
```

```
SAVEFRT = #1022 * SAVE CURRENT FEEDRATE
```

```
TDIA = ABS(#1020) * SAVE CURRENT ABSOLUTE TOOL DIA
```

```
IF(!VAR(7)) THEN
```

```
PRINT (ERROR! HOLE DIA. NOT GIVEN)
```

```
M30
```

```
ENDIF
```

```
IF(!VAR(5)) THEN; #5=#1022; ENDIF * DEFAULT ROUGH
FEEDRATE.
```

```
IF(!VAR(6)) THEN; #6=#5; ENDIF * DEFAULT FINISH FEEDRATE.
```

```
IF(!VAR(19)) THEN; #19=0.; ENDIF * DEFAULT NO FINISH
STOCK.
```

```
IF(ABS(#7/2)<ABS(#19)) THEN
```

```
PRINT (ERROR! TOOL DIA. TOO BIG)
```

```
M30
```

```
ENDIF
```

```
#33 = (ABS(#7)/2-ABS(#19)- TDIA /2); * ROUGHING PASS RADIUS.
```

```
IF(#33<0|#33=0) THEN
```

```
PRINT (ERROR! ROUGH AMOUNT TOO BIG)
```

```
M30
```

```
ENDIF
```

```
IF( #1041 > 40+ EPSI ) THEN * CHECK IF TOOL COMP IS ON
```

```
        PRINT (ERROR! TOOL COMP NOT ALLOWED)
M30
ENDIF
IF( TDIA < EPSI ) THEN
PRINT (WARNING: TOOL DIA.= 0)
M00 * DWELL UNTIL START KEY.
ENDIF
#34 = (#33/2); * INTERMEDIATE RADIUS.
#35 = (ABS(#7)/2- TDIA /2); * FINISH PASS RADIUS.
#36 = (#35/2); * INTERMEDIATE RADIUS.
G64; * CONTOURING MODE.
IF(#7>0) THEN * COUNTER-CLOCKWISE.
G91 F#5
G01 X#34 Y#34
G03 X(-#34) Y#34 I(-#34) J0
G03 X0 Y0 I0 J(-#33)
G03 X(-#34) Y(-#34) I0 J(-#34)
G01 X#34 Y(-#34)
IF((#19> EPSI ) & (#6> EPSI )) THEN * IF FINISH PASS.
G91 F#6
G01 X#36 Y#36
G03 X(-#36) Y#36 I(-#36) J0
G03 X0 Y0 I0 J(-#35)
G03 X(-#36) Y(-#36) I0 J(-#36)
G01 X#36 Y(-#36)
ENDIF
ELSE * CLOCKWISE.
G91 F#5
G01 X(-#34) Y#34
G02 X#34 Y#34 I#34 J0
G02 X0 Y0 I0 J(-#33)
G02 X#34 Y(-#34) I0 J(-#34)
G01 X(-#34) Y(-#34)
IF((#19> EPSI ) & (#6> EPSI )) THEN * IF FINISH PASS.
G91 F#6
G01 X(-#36) Y#36
G02 X#36 Y#36 I#36 J0
G02 X0 Y0 I0 J(-#35)
G02 X#36 Y(-#36) I0 J(-#36)
G01 X(-#36) Y(-#36)
ENDIF * FINISH PASS.
ENDIF * CLOCKWISE

IF( SAVEFRT > EPSI ) THEN; F( SAVEFRT ); ENDIF * RESTORE
```

```
FEEDRATE.
G SAVEG90 ; * RESTORE G90/91.
G SAVEG00 ; * RESTORE G00/01.
M99
```

### Probe Move (G31)

G31 is to be issued with an associated axis move (i.e. G31 X10). When the G31 is executed, it moves at current feedrate selected for G1 until the touch probe selected is deflected. At this point, the move is stopped, and the position where the probe touched the part is read and passed to system variables (#1060 to #1064 for X to W).

G31 is aborted if any of the following events occur:

- The primitive is issued while the probe is still deflected (touching the part).
- The ready signal is not present.
- Hardware malfunction: Trigger signal engaged, but no position is latched.
- Start pulse is issued, but probe is not ready after 2 seconds. (Only cordless probes).
- Cordless probe still in “sleeping mode.”
- Low battery signal becomes active (Only cordless probes).

M-code **M9387** is provided to select the probe **G31** will use and probe activation:

M9387X0	Selects the Tool touch probe (X13)
M9387X1	Selects the 3-D touch probe (X12) (default)
M9387Y0	Copies Tool touch probe state (deflected or not) into a system variable (#1066)
M9387Y1	Copies 3-D touch probe state (deflected or not) into a system variable (#1066)
M9387Z0	Turns off cordless probe
M9387Z1	Turns on cordless probe

Canned cycles are available for the most common probe functions. Refer to [“Section 5. Probing Cycles”](#) for details. Using the **G31** primitive, parametric programming and the M-codes listed above, it is possible to write additional cycles to perform custom probing functions.



## Conditional Statements

This subsection discusses the conditional statements IF, THEN, ELSE, GOTO, and WHILE.

### IF - THEN - ENDIF

```
N300 IF (expression) THEN
N310 -----
      ::
      ::
N360 ENDIF
N370 -----
```

If the expression in N300 is true, the program continues at N310. If the expression is false, the program continues at N370.

In place of an expression, you can use a variable that while not zero will be treated as a true expression. (Zero equals false. Any other value equals true.)

### IF - THEN - ELSE - ENDIF

```
N400 IF (expression) THEN
N410 -----
      ::
      ::
N440 ELSE
N450 -----
      ::
      ::
N470 ENDIF
N480 -----
```

If the expression is true, the program continues at N410, then to N440, where a jump is made to N480.

If the expression is false, the CNC skips Blocks N410 to N440 and executes Blocks N450 to N470. In place of an expression, you can use a variable that while not zero will be treated as a true expression. (Zero equals false. Any other value equals true.)

### IF - GOTO

```
N500 IF (expression) GOTO nnn
N510 -----
```

**NOTE:** When you program IF-GOTO statements do not precede the block number with the character "N".  
For example, IF-GOTO 487 skips to block number N487.

If the expression is true, the program jumps to the block number specified (nnn). If the expression is false, the program continues at Block N510. In place of an expression a variable can be used which while not zero will be treated as a true expression. (Zero equals false. Any other value equals true.)

**WHILE - DO - END**

```
N550 WHILE (expression) DO nnnn
N560 -----
      ::
      ::
N590 END nnnn
N600 -----
```

If the expression is true, the program repeats between N550 and N590 until the expression becomes false. Similarly, if the expression is false when Block N550 is executed, the CNC jumps to Block N600. The number after DO is a label (identifier only) and the same number must be used to identify the END of the loop.

In place of an expression, you can use a variable that while not zero will be treated as a true expression. (Zero equals false. Any other value equals true.)

**DO - END**

```
N620 DO nnnn
N630 -----
      ::
      ::
N650 IF ( expression ) GOTO 1111
N660 -----
N670 END nnnn
```

DO - END sets the program into an infinite loop that can only be ended by programming a GOTO (1111) command to another block. DO and END must be paired with labels (nnnn). When executed the program will repeat Blocks N630 to N660 until the expression at N650 becomes true and program execution continues at block (1111).

## Unconditional LOOP Repeat

Conditional statements require that a test be strictly true or false in order for a particular course of action to be taken. Unconditional statements are acted on without a logical precondition.

### LOOP - END

```
N680 LOOP nnnn
N685 -----
      ::
      ::
N695 END
```

LOOP instructs the control to execute the following blocks (N685) until it reaches an END command. The sequence is repeated nnnn times. The number of loops can be a variable assignment ( LOOP #121 ).

### GOTO

```
\N698 GOTO nnnn
N699 -----
```

GOTO is an instruction to continue program execution at the block specified (nnnn). You should not require this instruction in a user macro. It is intended for use in conjunction with the block skip symbol (\), as shown in the example. When block skip is ON, Block N698 is not executed. When block skip is OFF, Block N698 is executed and the program execution jumps to the block specified.

**NOTE:** When you program GOTO statements do not precede the block number with the character "N".  
For example, GOTO 610 skips to block number N610.

## Short Form Addressing

The appropriate abbreviation instructs the CNC to activate the corresponding command. Refer to **Table 19-6**.

**Table 19-6, Abbreviations**

Command	Abbreviation
DO	]D
END	]E
GOTO	]G
IF	]I
LOOP	]L
PRINT	]P
THEN	]T
WHILE	]W

### Logical and Comparative Terms

#### Logical Terms

All logical operations can be carried out using the following command characters or combinations of characters. Refer to **Table 19-7**.

**Table 19-7, Logical Symbols**

Statement	Symbol	True/False Table
<b>OR</b>		0-0 = False 0-1 = True 1-0 = True 1-1 = True
<b>EXCLUSIVE OR</b>	^	0-0= False 0-1= True 1-0= True 1-1 = False
<b>AND</b>	&	0-0= False 0-1= False 1-0= False True

#### Comparative Terms

You can compare variables with variables and variables with constants using equality and inequality operators.

#### Equality Operators

```
N700 IF (#120 = #125) THEN (or GOTO)
N710 -----
      ::
      ::
N740 IF (#130 = 360) THEN (or GOTO)
N750 -----
```

Block N700 compares the contents of variable #120 with the contents of variable #125. If the contents are equal, then the expression is true and the program is directed by THEN or GOTO. Otherwise, the expression is false. At Block N740, the contents of variable #130 are compared with the constant 360. The result of the comparison is identical to the first case.

## Inequality Operators

### NOT

```
N760 WHILE (#135 != #137) DO 10
N770 -----
      ::
N790 END 10
```

The exclamation mark (!) symbolizes NOT. Therefore, Block N760 instructs the CNC to continue the loop to N790 while the contents of variables #135 and #137 are not equal (condition true). When the contents of the variables become equal the expression is false and the loop terminates.

### GREATER THAN

```
N800 IF (#122 > #134) GOTO 830
N810 -----
```

The symbol (>) symbolizes GREATER THAN. Therefore, Block N800 instructs the control to go to (GOTO) or jump to Block N830 if the contents of variable #122 are greater than the contents of variable #134 (condition true). If the expression is false, execution continues to Block N810.

### LESS THAN

```
N840 IF (#123 < #135) GOTO 880
N850 -----
```

The symbol (<) symbolizes LESS THAN. The function is the opposite of GREATER THAN and the expression is true when the contents of variable #123 are less than the contents of variable #135.

**NOTE:** Greater than (>) and less than (<) expressions become false if the contents of the compared variables are equal.

## File Inclusion

### Example 1: ["FILENAME.G

File inclusion is a function that allows a subprogram that is not actually part of the file to be called from the main program, or from another subprogram in the file.

In this way, a tool change subprogram or a macro can be stored in the .G directory, and called from any other program that has the proper "file inclusion" code, which will allow the execution of the external subprogram.

Example 1 shows the syntax necessary to "include" a file into another file.

Format: open left bracket ([), then double quote character ("), then the filename and its extension. This line must appear somewhere in the program that is to call the "included" program.

**Example 2:**

```
N1 O23 * TEST.G
N2 M98 P9
N3 T1 * 1.0000 MILL
N4 G0 X-.6 Y.6
N5 Z.1
N6 .
N7 .
.
.
.
N33 M98 P9
N34 T2
N35 * .368 DRILL
N36
.
.
.
N50 M98 P9
N51 M30 O23
N52 ["TOOLCHNG.G
```

In Example 2, a program named TOOLCHNG.G can be called from the main program (or from an existing subprogram). It is made possible by line N52. The file inclusion function is programmed on N52.

In this way, the same subprogram can be used in many programs, but you do not need to type it into each program. Each program must, contain the proper "file inclusion" block.

The program to be included must be in the form of a subprogram, beginning with Onnn, and ending with the M99 code.

The format for file inclusion is: ["FILENAME.G

It is especially useful for including tool change subprograms, zero-setting subprograms and macros.

- 
- % Executing Buffer Full, 13-10
  - % Feed, machine status display, 3-6
  - % Receiving Buffer Full, 13-10
  - % RPM, machine status display, 3-6 (SHIFT + F10), Exit, 3-8
  - \*, wildcard, 10-12
  - .fxd extension, created, using DXF converter, 17-11
  - .G extension, 10-3, 10-5
    - created, using DXF converter, 17-1, 17-11
  - .M extension, created, using DXF converter, 17-1, 17-11
  - .S files, 10-4
  - ?, 10-11
  - 5000M CNC Setup Utility Manual*, P/N 70000509, referenced, 3-14, 5-71, 14-1
- A**
- abbreviating statements, 6-9
  - abbreviations, command, listed, 19-25
  - absolute mode
    - center-angle arc, illustration, 7-16
    - change to, (G90), 4-29
    - description, 1-5, 3-9
  - absolute zero
    - defined, 3-9
    - point, to set, (G92), 4-30
    - reference point, 1-5, 3-9
  - accessing, communication software, 13-2
  - accessing, DNC, 13-10
  - activate 4<sup>th</sup> (U) axis synchronization, (M900), 12-4
  - activate plane rotation at pre-set value, (M801), 12-4
  - activating
    - manual mode, feed, 3-9
    - manual mode, rapid, 3-9
    - servos, 3-2
    - test link screen, 13-6
  - active soft key, manual screen area, 3-6
  - address words, typing in, 7-35
  - adjusting
    - Draw display, 8-9
    - feedrate, 4-31
    - rapid move speed, 3-9
  - advance, block
    - beginning, 6-6
    - end of, 6-6
    - end of program, 6-6
    - first of program, 6-6
  - advanced programming features
    - block, separators, 19-1
    - modifiers, description, 19-1
    - modifiers, listed, 19-1
    - probe move (G31), 19-22
  - advanced scaling, (M701), 12-3
  - alphanumeric keys
    - description, 2-2
    - illustration, 2-2
    - listed, 2-3
  - angle of cut, parameter, 18-18
  - angle, measurement, 1-6
  - angle, references, 1-7
  - angular motion programming, example, 4-4
  - approach height, parameter, 18-11
  - arc
    - direction, illustration, 1-8, 4-11
    - feedrate override, automatic, (G62, G63), 4-20
    - programming, description, 7-15
    - reverse, direction, 18-6, 18-38
    - segment tools, illustration, 18-36
    - template, illustration, 18-36
    - tools, table, 18-36
  - ARCS Help Template Menu, parameters, table, 7-17
  - area clearance, irregular pocket milling, (G169), 5-27
  - ARROW keys, 2-5
  - arrows, parameter, 18-26
  - ASCII, data type, 13-5
  - ATC. *See* automatic tool changer
  - Auto (F6), 3-8
  - auto mode
    - program, cancel, 11-5
    - program, hold, 11-5
    - program, to run, 11-4
    - screen, illustration, 11-4
    - starting block, select
      - using arrow keys, 11-5
      - using SEARCH, 11-5
    - switch to single-step mode, 11-3
  - AUTOEXEC.BAT, DXF converter, example, 17-1
  - AUTOJOG (F1), 11-13
  - automatic
    - Draw restart, 8-7
    - feedrate override, arcs, (G62, G63), 4-20
    - mode, defined, 11-1
-

- tool changer, 5-11, 9-5
- tool changes, new tool, 18-31
- tool changes, to output, 18-30
- auxiliary
  - axis, synchronous or non-synchronous, 16-2
  - keyboard, entity information, to display, 17-7
- axes
  - approach, 5-34
  - of rotation, illustration, 5-51
  - parameter, description, 18-26
- axis
  - address, unary minus, example, 19-9
  - descriptions, 1-3
  - of motion, illustration, 1-3
  - rotation, (G68), 4-24
  - rotation, (G68), canceled by G92, 4-30
  - scaling, (G72), 4-29
  - scaling, (G72), canceled by G92, 4-30
  - select key, illustration, 3-3
  - selecting, 3-10
  - synchronization, 12-4
  - work coordinate offset, 9-26
- axis, types
  - description, 16-1
  - linear, description, 16-1
  - rotary, description, 16-1
- B**
- ball end mill
  - length offsets, using, 9-14
  - tool diameter compensation, using, 9-14
- baud rate, setting, 13-3
- BINARY, data type, 13-5
- Blk, program area label, 3-6
- block
  - copy, to program, 6-16
  - end of program, feature, 6-6
  - end of, feature, 6-6
  - go to, feature, 6-7
  - number, description, 3-6
  - selected, run Draw, 8-8
  - separators, description, 19-1
  - skip variables, description, 19-7
  - start of program, feature, 6-6
  - start of, feature, 6-6
- bolt hole circle, (G79), 5-13
- boring. *See also*, drilling
  - bi-directional, (G85), 5-9
  - canned cycles, (G81–G89), 5-5
  - counter cycle, (G82), 5-6
  - example, 5-11
  - flat bottom bi-directional, (G89), 5-11
  - unidirectional, (G86), 5-9
- bottom of contour, parameter, 18-11
- buffers, CNC, 13-10
- C**
- calc distance, soft key, 18-41
- calibrate soft keys, change fixture offset, 4-17
- calibration keys, RefProg, 9-26
- CalibX (F5), 9-26
- CalibX, description, 4-17
- CalibY (F6), 9-26
- CalibY, description, 4-17
- CalibZ (F7), 9-26
- CalibZ, description, 4-17
- CAM
  - pockets with islands
    - Draw mode, illustration, 18-83
    - pocket parameters pop-up menu, illustration, 18-83
  - pockets with islands, (G162), 18-21, 18-82
  - point, parameter, 18-19
  - post processor, automatic tool changes, to output, 18-30
  - programs, samples, 18-48
- CAM mode
  - changing, view, 18-40
  - description, 18-1
  - hot keys, listed, 18-31
  - screen displays, table, 18-1
  - screen illustration, 18-2
  - Shape Edit Menu (F3), listed, 18-4
  - soft keys
    - listed, 18-3
    - Shape (F2), listed, 18-3
    - to activate, 18-2
- CAM shapes
  - to create, 17-21
  - to view, 17-21
- cancel
  - auto mode program, 11-5
  - Draw, program, 8-3
  - drill, tap, bore cycle, (G80), 5-6
  - In-Position Mode, modal, exact stop check, (G64), 4-10
  - single-step run, execution, 11-2
- canned cycles
  - defined, 5-5



- drilling tapping, boring, (G81–G89), 5-5
- probe cycles, description, 5-71
- spindle probe, description, 5-87
- tapping, G84, 5-8
- cavity detail, illustration, 5-61
- chaining geometry elements, to create shape, 18-46
- chamfer tool, to use, 18-37
- chamfer, a corner, 18-37
- chamfering, (G59, G60), 4-18
- change word, feature, 6-8
- changing
  - CAM mode view, 18-40
  - jog mode, 3-10
  - link test link screen data display, 13-6
- character, deleting, 6-4
- chip-breaker peck-drilling cycle, (G87), 5-10
- circle tools, templates, listed, 18-45
- circular interpolation
  - absolute mode, 4-6
  - circle, example, 4-8
  - incremental mode, 4-6
  - parameters, 4-5
  - partial arc, example, 4-7
  - partial arcs, example, 4-6
- circular pocket milling, (G77), 5-23
- circular profile cycle, (G171), 5-36
- CLEAR key, 2-5
- clear, (M9351), 12-4
- clear, (X302), 12-4
- clearing
  - a halted program, 11-5
  - entries, 2-6
  - messages, 2-8
  - receive area, 13-7
  - transmit area, 13-7
- clockwise motion (G2), description, 4-5
- CNC
  - DXF converter, description, 17-3
  - DXF converter, file creation, 17-1
  - DXF converter, files created, 17-11
  - enlarged motion display, to set, 11-7
  - parts counter, description, 11-11
  - software, tracks tools, 9-5
  - timer, description, 11-11
- codes, order of execution, 12-4
- colinear lines
  - defined, 18-6, 18-38
  - join, 18-7, 18-39
- COM1, 13-3
- COM2, 13-3
- Comm Port, selecting, 13-3
- command line, manual screen area, 3-5
- command, abbreviations, listed, 19-25
- COMMAND, program area label, 3-6
- commands, multiple move command, 7-21
- Comment, parameter, 18-11
- comments, include in program listing, 6-17
- common (global) variables, description, 19-7
- communication
  - description, 13-1
  - parameters, setting, 13-3
  - port, to select, 13-3
  - screen layout, description, 13-2
  - screen, illustration, 13-2
  - software, accessing, 13-2
- comparative term, description, 19-26
- compensated move, ramping, 9-12
- compensation
  - help graphic templates, listed, 7-11
  - left-hand, 9-10
  - right-hand, 9-10
- COMPENSATION Help Graphic Template
  - Screen, parameters, table, 7-11
- completed program, 3-6
- computation, storing result, 19-11
- conditional statements, description, 19-23
- conical elbow details, illustration, 5-62
- console, illustration, 2-1
- construction geometry, using, 18-42
- continuous
  - downloading (DNC), 13-9
  - jog, 3-7
  - jog, Feed mode, 3-10
  - jog, Rapid mode, 3-10
  - move, execute, 3-11
  - path, override, 12-4
- continuous path mode. See also, contouring mode
- contour
  - bottom of, parameter, 18-11
  - description, 18-8
  - Parameters 1 Menu, parameter, description, 18-10
  - Parameters 2 Menu, parameter, description, 18-11
  - Parameters Menu, illustration, 18-9
  - screen, soft keys, listed, 18-14
  - top of, parameter, 18-11
  - with many unknown intersections
    - all tangent arcs, machining, 18-61
    - machining, 18-59

- contouring mode, G64, 4-21
- control M-codes
  - description, 12-2
  - functions, table, 12-2
- conventional jog, 3-7
- conventional jog mode, 3-10
- conversion formula
  - minutes to decimal, 16-1
  - seconds to degrees, 16-1
- COOL ON (F7), 11-14
- coolant
  - at start, parameter, 18-13
  - off, (M9), 12-2
  - on, (M8), 12-2
  - ready, 3-4
- COOLOFF (F8), 11-14
- copy
  - entire program, 6-16
  - program blocks, 6-11
  - programs, other directories, 10-12
  - programs, to floppy disk, 10-9
  - shape, 18-5
- core detail, illustration, 5-61
- corner radius tool, to use, 18-37
- corner rounding/chamfering, (G59, G60), 4-18
- counter bore cycle, G82, 5-6
- counterclockwise motion (G3), description, 4-5
- create
  - new programs, 10-3
  - shape, 18-4
  - subdirectory, 10-14
- Create (F2), 10-3
- current, operating mode, 3-6
- cursor
  - edit screen, location, 6-2
  - tool page, description, 2-7
- cutting cavity, more than one pass, illustration, 5-52
- cutting direction, 5-34
- cutting mode. See also, contouring mode
- D**
- data bits, to set, 13-4
- data control codes
  - function, table, 13-8
  - receive mode, to use, 13-9
  - send mode, to use, 13-9
  - to use, 13-8
- data link, testing, 13-5
- data type, to set, 13-5
- date and time, 10-2
- DE-9, 13-1
- deactivate
  - 4<sup>th</sup> (U) axis synchronization, (M901), 12-4
  - advanced scaling, (M700), 12-3
  - plane rotation and set angle, (M800), 12-4
- decimal points, 7-10
- Del (F4), 2-7
- DelAll (F9), 18-47
- delete
  - all geometry elements, 18-47
  - character, 6-4
  - geometry elements, 18-47
  - groups of programs, 10-8
  - program block, 6-4
  - program on another drive, 10-14
  - segment, forward end of shape, 18-39
  - shape, 18-6, 18-38
  - text, 2-7
- Delete (F3), 10-5
- Delete (F7), 3-8
- Delete, CAM mode, description, 18-24
- DelGeom (F9), 18-47
- DelMove (F8), description, 18-8
- DIA, machine status display, 3-6
- diameter of tool probe gauge, 5-73
- diameter offset, tool page, 9-9
- dimensions, parameter, 18-25
- direct numeric control. See DNC
- direct transfer, variables, 19-9
- direction of cut, parameter, 18-19
- disable dry-run, (M107), 12-3
- disable feed hold, (M20), 12-2
- disabled, features, off-line, 15-3
- disclaimer, iii
- disengage, servos, 3-1
- disk optimizer, to access, 10-15
- display
  - Draw adjusting, 8-9
  - Draw, fit window, 8-10
  - Draw, scale, 8-10
  - erase, 8-8, 8-13
  - system information, illustration, 10-10
  - zoom, 8-11
- display size
  - change, 8-12
  - half, 8-12
- DISPLAY, description, 8-1
- DNC
  - mode, for CNC, 13-11
  - running, 13-9

- screen, illustration, 13-10
  - to access, 13-10
- Double, display function, 18-40
- draft angle pocket cycle, (G73), 5-17
- Draw
  - Auto mode, 8-6
  - CAM, pockets with islands, illustration, 18-83
  - CNC code, view tool paths, 17-3
  - display
    - adjusting, 8-9
    - erase, 8-13
    - fit window, 8-10
    - size, double, 8-12
    - size, half, 8-12
    - size, scale, 8-10
  - end at, specific block, 8-9
  - erase display, 8-8
  - grid parameter, to set, 8-6
  - grid size, to set, 8-6
  - Motion mode, 8-6
  - parameters, viewing, 8-4
  - rapid moves, description, 8-5
  - real-time mode, description, 8-1
  - restart, 8-7
  - run, selected block:, 8-8
  - S.Step mode, 8-6
  - simulation mode
    - cancel, program, 8-3
    - description, 8-1
    - execution options, listed, 8-6
    - operation mode, 8-2
    - screen, illustration, 8-2
    - status items, listed, 8-3
    - to activate, 8-2
    - to pause, 8-3
  - start at, specific block, 8-8
  - starting, 8-1
  - tool compensation, description, 8-5
  - Tool Off, description, 8-4
  - Tool On, description, 8-4
  - using while running programs, 11-6
  - window, zoom, 8-11
- Drawing Exchange File. See DXF converter
- drill (sync-off), programming examples, 16-4
- drill cycle, parameter, 18-23
- drill function, description, 18-21
- Drill Parameter Menus, illustration, 18-22
- Drill Parameters 1 Menu, parameters, listed, 18-23
- DRILL/TAP Help Template Menu,
  - parameters, table, 7-29
- drilling. See also, boring
- drilling, tapping, boring canned cycles, (G81–G89), 5-5
- drives, log on, 10-6
- dry-run
  - all axes, (M105), 12-3
  - disable, (M107), 12-3
  - NO Z-axis, (M106), 12-3
  - OFF (M107), 12-3
- dwell, 5-8
- dwell (G4), description, 4-9
- DWELL, machine status display, 3-6
- DXF converter
  - CNC code, description, 17-3
  - contours and drill holes, 17-1
  - contours, description, 17-3
  - convert polyline, description, 17-9
  - create, conversational file, 17-1
  - create, G-code file, 17-1
  - display menu, descriptions, 17-9
  - drilling, description, 17-3
  - edited
    - conversational program, listing, 17-15
    - G-code program, listing, 17-17
    - G-code tool path, illustration, 17-16
  - entities supported, table, 17-10
  - entities, not supported, 17-10
  - entity endpoints, toggle, 17-5
  - example, 17-11
  - examples, 17-11
  - exit (F10), description, 17-7
  - feature, description, 17-1
  - files, created, 17-11
  - hot keys, table, 17-5
  - mouse operations, table, 17-4
  - output format, pop-up menu, 17-18
  - output menu, descriptions, 17-8
  - output menu, example, 17-12
  - pockets with islands (G162)
    - description, 17-18
    - program example, 17-20
  - program listing, pop-menu, 17-19
  - requirements
    - machine software, 17-1
    - off-line software, 17-1
  - shapes, creating, 17-2
  - shapes, types, listed, 17-2
  - shift X, shift Y, descriptions, 17-8
  - soft keys, descriptions, 17-6

- to open, 17-2
- troubleshooting, 17-5
- unedited, conversational program listing, 17-13
- unedited, g-code program listing, 17-14

**E**

- edge finding, G141, 5-90
- edit
  - canceling unsaved, 6-4
  - function, description, 18-24
  - keys, illustration, 2-2
  - program in another directory, 10-15
  - program, feature, 6-15
  - saving, 6-4
  - screen, description, 6-2
  - shape, soft keys, 18-37
- Edit (F3), 3-8
- edit help
  - description, 7-1
  - M-code listing, 7-34
  - screens, illustration, 7-1, 7-2
  - soft keys, listed, 7-7
- Edit Help G-Code Menu, table, 7-33
- edited marker, description, 6-2
- editing
  - keys, listed, 2-5
  - soft keys, description, 6-2
  - tools, selecting, 18-32
- effectivity notation, 1-1
- elbow cavity & core, illustration, 5-59
- elbow milling cycle
  - details, illustration, 5-60
  - G49, description, 5-58
  - moves, illustration, 5-59
- ellipse, G5, 5-1
- ELSE, conditional statement, 19-23
- emergency stop, reset, 3-1
- enable feed hold, (M21), 12-2
- End N#, parameter, 8-8
- end of block, feature, 6-6
- end of program, feature, 6-6
- end of subprogram, (M99), 5-67
- end user, common (global) variables, macro numbers, 19-7
- enlarged motion display, set the CNC, 11-7
- entity information
  - DXF miscellaneous menu (F6), description, 17-7
  - off-line, to display, 17-7

- to display, DXF miscellaneous menu (F6), 17-7
- entries, clearing, 2-6
- entry / exit moves, parameter, 18-12
- entry field types, listed, 7-10
- equality operators, description, 19-26
- erase, display, 8-13
- Erase, display function, 18-40
- Erase, parameter, 8-8
- error messages, displayed, 2-8
- E-STOP
  - emergency stop, 3-1
  - key, illustration, 3-4
  - no keyboard equivalent, 14-2
- exact stop check
  - G61, In-Position Mode, modal, 4-20
  - G64, cancel (G61), 4-20
  - G9, In-Position Mode, non-modal, 4-20
  - G-Code, formats, 4-10
  - non-modal, G9, 4-10
- examples
  - jog/return, 11-15
  - practice, 18-85
- EXIT (F10), 3-8
- exit (F10), description, 18-31
- exit (F10), DXF converter, 17-7
- Exit (Shift + F10), 3-8
- exit, shut down, 3-1
- exiting, off-line software, 15-1
- expand key, feature, 6-9
- expressions
  - description, 19-4
  - examples, 19-5
  - listed, functions, 19-4
  - unary minus, example, 19-9

**F**

- F1 (AUTOJOG), 11-13
- F1, Help, 3-8
- F1, Message, 3-8
- F1, Offsets, 9-26
- F1, RefProg, 9-26
- F1, toggle select mode, DXF converter, 17-6
- F10, Exit, 3-8
- F10, exit, DXF converter, 17-7
- F10, Handwheel, 3-8
- F2, Program, 3-8
- F3 (ZHOME), 11-13
- F3, Edit, 3-8
- F3, layers menu, DXF converter, 17-6
- F4 (MANUAL), 11-13

F4, Manual, 3-8  
F4, view menu, DXF converter, 17-6  
F5, CalibX, 9-26  
F5, display menu, DXF converter, 17-6  
F5, S.Step, 3-8  
F5, Teach, 3-8  
F6 (RETURN), 11-14  
F6, Auto, 3-8  
F6, CalibY, 9-26  
F6, miscellaneous menu, DXF converter, 17-6, 17-7  
F7 (COOL ON), 11-14  
F7, CalibZ, 9-26  
F7, Delete, 3-8  
F7, Home, 3-8  
F8 (COOLOFF), 11-14  
F8, Insert, 3-8  
F8, save, DXF converter, 17-6  
F9 (TOOL), 11-14  
F9, setup, DXF converter, 17-6  
F9, Tool, 3-8, 9-26  
face cycle tool approach, illustration, 5-34  
facing cycles, (G170), 5-34  
features, disabled, off-line, 15-3  
feed per revolution, (G95), 4-30  
FEED, machine status display, 3-6  
Feed, move, 3-10  
feedrate  
    adjustment, 4-31  
    in IPM, (G94), 4-30  
    override switch, adjusting, 4-31  
    parameter, 18-13  
FEEDRATE OVERRIDE  
    adjusting, 3-9  
    setting, 3-6  
    switch, illustration, 3-3  
file inclusion, description, 19-27  
find text, feature, 6-6  
find word, feature, 6-6  
first block, 1-2  
Fit, display function, 18-40  
five-axis programming, description, 16-1  
fixture offset table  
    description, 4-16  
    to activate, 4-16  
    to adjust, 4-17  
    to change, 4-17  
    to change, using calibrate soft keys, 4-17  
fixture offsets, (G53)  
    description, 4-16  
    examples, 4-17

fixture offsets, pop-up menu, RefProg, 9-26  
FIXTURE, machine status display, 3-6  
flat bottom bi-directional boring, (G89), 5-11  
floppy disk  
    checking for lost data, 10-10  
    copy programs, to, 10-9  
    display, 10-6  
    rename programs, 10-13  
four-axis programming, description, 16-1  
frame pocket milling, (G75), 5-19  
functions  
    description, 19-4  
    listed, operators, 19-4

## G

G, machine status display, 3-6  
G0, 4-1  
G0, rapid traverse, description, 4-2  
G1, 4-1  
G1, linear interpolation, description, 4-3  
G140, spindle probe calibration cycle  
    defined, 5-86  
    description, 5-88  
G141, single surface measure/edge find  
    defined, 5-86  
    description, 5-90  
G142, outside part corner find  
    defined, 5-86  
    description, 5-91  
G143, inside part corner find  
    defined, 5-86  
    description, 5-93  
G144, inside or outside hole or boss center find  
    defined, 5-87  
    description, 5-95  
G145, inside or outside web or slot center find  
    defined, 5-87  
    description, 5-97  
G146, protected positioning move  
    defined, 5-87  
    description, 5-99  
G147, skew error or angle find  
    defined, 5-87  
    description, 5-100  
G150, tool probe calibration cycle  
    defined, 5-72  
    description, 5-73  
G151, tool length and diameter offset preset  
    defined, 5-72  
    description, 5-75

- G152, manual tool-length offset preset
  - defined, 5-72
  - description, 5-80
- G153, manual tool diameter preset
  - defined, 5-72
  - description, 5-82
- G154, tool breakage, length and diameter wear detection
  - defined, 5-72
  - description, 5-84
- G162, pockets with islands, 5-29
- G169, 4-2
- G169, irregular pocket milling, 5-27
- G169, programming example, 5-32, 5-33
- G17, 4-8, 4-10, 4-27, 5-47
- G17, G18, G19 - plane selection, 4-10
- G17, plane selection, 5-86
- G170, 4-2
- G170, facing cycle, 5-34
- G171, 4-2
- G171, circular profile cycle, 5-36
- G172, 4-2
- G172, rectangular profile cycle, 5-38
- G177, 4-2, 5-46
- G177, plunge circular pocket milling, 5-44
- G178, 4-2, 5-16
- G178, plunge rectangular pocket milling, 5-46
- G179, 4-2, 5-14
- G179, programming example, 5-15
- G18, 4-10, 5-47
- G181, 4-2
- G181, thread mill cycle, 5-40
- G19, 4-10, 5-47
- G2, 4-1
- G2, clockwise motion, description, 4-5
- G22, 4-1, 4-12, 4-13
- G22, set software limits, 4-12
- G28, 4-1
- G28, machine home, return to, 4-14
- G29, 4-1
- G29, machine home, return from, 4-15
- G3, 4-1
- G3, counterclockwise motion, description, 4-5
- G31, 4-1
- G31, probe move, 4-15, 5-71, 19-22
- G4, 4-1
- G4, dwell, description, 4-9
- G40, 4-1, 4-18, 5-3
- G40, to cancel
  - G41, 4-18
  - G42, 4-18
- G40, tool compensation, cancel mode, 9-14
- G41, 4-1, 4-18, 5-2, 5-16
- G41, canceled by, G40, 4-18
- G41, G42, tool path compensation, 9-10
- G41, programming example, 9-22
- G42, 4-1, 4-18, 5-2, 5-3, 5-16
- G42, canceled by, G40, 4-18
- G42, programming example, 9-23
- G45, 4-1
- G45, mold rotation, 5-47
- G45, programming example, 5-56, 5-57
- G49, 4-1
- G49, elbow milling cycle, 5-58
- G49, programming example, 5-62
- G5, 4-1, 5-2
- G5, ellipse, 5-1
- G53, 4-1, 4-16
- G53, fixture offsets
  - description, 4-16
  - examples, 4-17
- G59, 4-1
- G6, spiral, 5-3
- G60, 4-1, 4-18
- G61, 4-1, 4-20, 4-21
- G61, In-Position Mode, modal, exact stop check, 4-10, 4-20
- G62, 4-1
- G62, G63, arc, automatic feedrate override, 4-20
- G63, 4-1
- G64, 4-1
- G64, cancel (G61), 4-20
- G64, cancel, In-Position Mode, modal, exact stop check, 4-10
- G64, contouring mode, 4-21
- G65, 4-1, 4-22
- G65 macro program, example, 19-16
- G65 macro subprogram, example, 19-17
- G65, G66, G67, user macros, 4-21
- G65, G66, G67, user macros, description, 19-14
- G65, non-modal, 4-22
- G66, 4-1, 4-22
- G66, modal, 4-22
- G66/G67 macro program, example, 19-17
- G67, 4-1
- G68, 4-1, 4-16, 4-25, 4-26
- G68, axis rotation, 4-24
- G68, axis rotation, canceled by G92, 4-30
- G68, hole pattern, 5-14

- 
- G70, 4-1, 4-28, 4-30
  - G70, inch mode format, 4-28
  - G71, 4-1, 4-28, 4-30
  - G71, mm mode format, 4-28
  - G72, 4-1, 4-16, 12-3
  - G72, axis scaling, 4-29
  - G72, axis scaling, canceled by G92, 4-30
  - G73, 4-1
  - G73, draft angle pocket cycle, 5-17
  - G73, programming example, 5-18
  - G75, 4-1
  - G75, frame pocket milling, 5-19
  - G75, programming example, 5-20
  - G76, 4-1
  - G76, hole milling cycle, 5-21
  - G76, programming example, 5-22
  - G77, 4-1
  - G77, circular pocket milling, 5-23
  - G77, programming example, 5-24
  - G78, 4-1, 5-16, 5-17
  - G78, programming example, 5-26
  - G78, rectangular pocket milling, 5-25
  - G79, 4-1, 5-13
  - G79, bolt hole circle, 5-13
  - G80, 4-1
  - G80, cancel drill, tap, bore cycle, 5-6
  - G81, 4-2, 5-13
  - G81, spot drilling cycle, 5-6
  - G81–G89, drilling, tapping, boring canned cycles, 5-5
  - G82, 4-2
  - G82, counter bore cycle, 5-6
  - G83, 4-2
  - G83, peck drilling cycle, 5-7
  - G84, 4-2, 5-5
  - G84, tapping canned cycle, 5-8
  - G85, 4-2
  - G85, boring, bi-directional, 5-9
  - G86, 4-2
  - G86, boring, unidirectional, 5-9
  - G87, 4-2
  - G87, chip-breaker peck-drilling cycle, 5-10
  - G89, 4-2, 5-13
  - G89, flat bottom bi-directional boring, 5-11
  - G9, 4-1, 4-21
  - G9, exact stop check, non-modal, 4-10
  - G9, In-Position Mode, non-modal, exact stop check, 4-10, 4-20
  - G90, 4-1
  - G90, absolute mode, change to, 4-29
  - G91, 4-1, 4-27, 5-3
  - G91, incremental mode, change to, 4-29
  - G92, 4-2
  - G92, absolute zero point, to set, 4-30
  - G92, to cancel
    - G68, axis rotation, 4-30
    - G72, axis scaling, 4-30
    - M100, mirror image, 4-30
  - G94, 4-2
  - G94, feedrate in IPM, 4-30
  - G95, 4-2
  - G95, feed per revolution, 4-30
  - G-code
    - defined, 4-1
    - directly to, Help Graphic Screen, 7-1
    - entering, 7-32
    - entering, example, 7-35
    - entry fields, 7-33
    - exact stop check, formats, 4-10
    - filename, parameter, 18-29
    - in-position mode, formats, 4-20
    - listed, table, 4-1
    - listing, table, 7-32
    - macros, description, 4-22
    - macros, listed, 19-14
    - modal box, illustration, 7-31
    - output, repeat, 18-29
    - output, suppress, 18-29
    - programs, using shapes, 18-48
    - spindle probe cycles, listed, 5-86
    - tool probe cycles, listed, 5-72
  - geometry
    - chaining elements, to create shape, 18-46
    - circle tools, templates, listed, 18-45
    - construction, using, 18-42
    - delete, all elements, 18-47
    - delete, elements, 18-47
    - elements listing, viewing, 18-46
    - line tools, templates, listed, 18-44
    - list, soft key, 18-40
    - list, to view, 18-46
    - notes, 18-45
    - options, listed, 18-27
    - point tools, templates, listed, 18-43
    - setting, description, 18-27
    - tools, to access, 18-42
  - getting started, 1-2
  - go to block, feature, 6-7
  - GOTO, conditional statement, 19-23
  - GREATER THAN operator, description, 19-27
  - grid
-

parameter, 18-26  
parameter, to set, 8-6  
size, parameter, 18-26  
size, to set, 8-6

**H**

Half, display function, 18-40  
halted program, clearing, 11-5  
HALTED/\*HALTED/RUNING, program area label, 3-6  
handle mold core, illustration, 5-56  
handshaking, 13-4  
handwheel  
  jog mode setting, table, 3-14  
  key, illustration, 3-3  
  to operate, 3-13  
  to select, 3-12  
Handwheel (F10), 3-8  
hard drive, optimize, 10-15  
helical interpolation  
  description, 4-8  
  example, 4-8  
Help (F1), 3-8  
Help Graphic Screen  
  directly to, without menus, 7-1  
  features, description, 7-9  
  illustration, 7-6  
  use to enter program blocks, 7-10  
Help Graphic Template Screen  
  COMPENSATION, 7-11  
Help Template Menu  
  ARCS, 7-17  
  DRILL/TAP, 7-29  
  features, description, 7-8  
  illustration, 7-4  
  LINES, 7-14, 7-15  
  MULTIPLE, 7-22  
  PATHS, 7-28  
  PLUNGE POCKETING, 7-27  
  POCKETING, 7-26  
  RAD/CHAMFER, 7-20  
  template, description, 7-5  
highlight bar, 2-6  
hold  
  auto mode program, 11-5  
  Draw, description, 8-3  
  single-step run, execution, 11-2  
Hold (F1), 13-8  
HOLD key, illustration, 3-4  
holding, transmission / receiving operations, 13-8

hole milling cycle, (G76), 5-21  
hole pattern, (G68), 5-14  
Home (F7), 3-8  
HOME Z, 18-30  
HOME Z, description, 18-30  
hot keys  
  CAM mode, listed, 18-31  
  DXF converter, table, 17-5  
  R, 18-47  
  R, refresh screen, 18-39

**I**

IF, conditional statement, 19-23  
import, shape from another program, 18-39  
import, shapes, 18-7  
inch mode format, (G70), 4-28  
incremental  
  jog mode, 3-10  
  mode  
    center-angle arc, illustration, 7-17  
    change to, (G91), 4-29  
    move, execute, 3-11  
    positioning, 1-6  
inequality operators, description, 19-27  
initial move, parameter, 18-13  
In-Position Mode  
  G64, cancel (G61), 4-20  
  modal, exact stop check, (G61), 4-10, 4-20  
  non-modal, exact stop check, (G9), 4-10, 4-20  
IN-POST, program area label, 3-6  
input units, parameter, 18-26  
Ins (F3), 2-7  
Insert (F8), 3-8  
insert line, feature, 6-9  
insert mode, 2-7  
insert text  
  no overwrite, 6-5  
  overwrite, 6-6  
inserted characters, 2-7  
inside corner finding, G143, 5-93  
inside or outside hole or boss center find, G144  
  defined, 5-87  
  description, 5-95  
inside or outside web or slot center find, G145  
  defined, 5-87  
  description, 5-97  
inside part corner find, G143  
  defined, 5-86



description, 5-93  
 inside profile, cutting, 5-38  
 inside profile, ramp moves, illustration, 5-38  
 inside/outside boss/hole finding, G144, 5-95  
 inside/outside web finding, G145, 5-97  
 inspecting, programmed moves, 8-1  
 install  
   keyboard, 14-2  
   machine software, 14-1  
   printer, 14-2  
   RS-232 cable, 13-1  
   Software Option Kit, 14-1  
 interface check, parameter, 18-12  
 introduction, 1-1  
 IPM, defined, 4-30  
 irregular pocket  
   (M9367) correct tool diameter, from a  
     subprogram, 5-28  
   milling, (G169), 5-27

**J**

jog  
   :1, mode, 3-10  
   :10, mode, 3-10  
   :100, mode, 3-10  
   continuous, 3-7  
   continuous move, execute, 3-11  
   conventional, 3-7  
   incremental move, execute, 3-11  
   mode  
     changing, 3-10  
     handwheel, to select, 3-13  
     listed, table, 3-10  
     moves, description, 3-10  
     moves, listed, table, 3-10  
 JOG - key, illustration, 3-4  
 JOG + key, illustration, 3-4  
 jog and return. *See* jog/return  
 JOG key, illustration, 3-3  
 jog/return  
   description, 11-12  
   examples, 11-15  
   soft keys, listed, 11-13  
 join, colinear lines, 18-7, 18-39

**K**

keyboard  
   auxiliary, to display entity information,  
     17-7  
   description, 2-5  
   equivalent keypad keys, table, 14-2

external, 2-5  
   to install, 14-2  
 keypad  
   equivalent keyboard keys, table, 14-2  
   illustration, 2-2  
 keystrokes, retrieve, recorded, 6-12

**L**

labels, parameter, 18-26  
 LCD, defined, 2-1  
 LENG, machine status display, 3-6  
 length offsets, ball end mill, using, 9-14  
 length offsets, to measure, 9-7  
 LESS THAN operator, description, 19-27  
 limit switch, 3-2  
 line segment  
   endpoint definition tools, illustration,  
     18-35  
   tools, illustration, 18-34  
 line tools  
   description, 18-33  
   templates, listed, 18-44  
 linear interpolation (G1)  
   description, 4-3  
   illustration, 4-3  
 LINES Help Template Menu, parameters,  
   table, 7-14, 7-15  
 link or new shape, DXF miscellaneous menu  
   (F6), description, 17-7  
 link test screen data display, to change, 13-6  
 link, testing, 13-7  
 list, program in another source, 10-14  
 loaded program, name, 3-6  
 loading program, 10-3  
 local variables, description, 19-7  
 logical terms, listed, 19-26  
 logical, symbols, listed, 19-26  
 loop  
   counter, 3-6  
   function, 5-68  
   programming, example, illustration, 5-68  
 LOOP - END, description, 19-25  
 LOOP, machine status display, 3-6

**M**

M, machine status display, 3-6  
 M00, program stop, 12-2  
 M01, optional program, 12-2  
 M02, 12-4  
 M02, program end, 12-2  
 M100, 4-16

- 
- M100, mirror image, 12-3
  - M100, mirror image, canceled by G92, 4-30
  - M1000, override, continuous path parameter, 12-4
  - M105, dry-run, all axes, 12-3
  - M106, dry-run, NO Z-axis, 12-3
  - M107, 12-3
  - M107, disable, dry-run, 12-3
  - M107, dry-run OFF, 12-3
  - M19, 5-9
  - M19, spindle orientation, 12-2
  - M2, program end, 12-2
  - M20, disable feed hold, 12-2
  - M21, enable feed hold, 12-2
  - M3, spindle on forward, 12-2
  - M30, program end, 12-2
  - M4, spindle on reverse, 12-2
  - M40, 12-1
  - M41, 12-1
  - M42, 12-1
  - M43, 12-1
  - M44, 12-1
  - M5, spindle off, 12-2
  - M700, deactivate advanced scaling, 12-3
  - M700, set advanced scaling, 12-3
  - M701, advanced scaling, 12-3
  - M8, coolant on, 12-2
  - M800, deactivate plane rotation and set angle, 12-4
  - M801, activate plane rotation at pre-set value, 12-4
  - M9, coolant off, 12-2
  - M900, activate 4<sup>th</sup> (U) axis synchronization, 12-4
  - M901, deactivate 4<sup>th</sup> (U) axis synchronization, 12-4
  - M9244, servo shut-off code, 12-4
  - M9247, readout axis preset, 12-4
  - M9351, clear, 12-4
  - M9367, correct tool diameter, irregular pocket milling, 5-28
  - M9387, M-code, probe select, 19-22
  - M98, subprogram call, 12-2
  - M99, 4-23
  - M99, end subprogram, 5-67
  - M99, return from subprogram, 12-3
  - machine
    - home, return from, (G29), 4-15
    - home, return to, (G28), 4-14
    - position display, manual screen area, 3-5
    - setup, 3-1
    - setup, parameter, 18-13
    - software, DXF converter, 17-1
    - software, to install, 14-1
    - status display area, manual screen area, 3-5
    - status display, area labels, listed, 3-6
  - machining
    - contour, with many unknown intersections, 18-59
    - contour, with many unknown intersections, all tangent arcs, 18-61
    - milled pocket
      - X0 Y0 at center of radius, 18-67
      - X0 Y0 at the center of the large radius, 18-73
    - outside profile using contour, 18-55
    - outside profile with contour, 18-48
    - pocket
      - milled into workpiece, 18-65
      - milled into workpiece – X0 Y0 at lower-left corner, illustration, 18-70
      - using Pocket, Contour, and Drill, 18-77
    - series of holes, using Drill, 18-75
    - slot using contour, 18-52
  - macro
    - body structure, description, 19-14
    - defined, 19-8
    - G65 program, example, 19-16
    - G65 subprogram, example, 19-17
    - G66/G67 program, example, 19-17
    - letter addresses, listed, 19-15
    - passing, parameters, 19-15
    - programming (hole milling macro, example, 19-19
    - setting, parameters, 19-15
    - SLOTMAC.G program, example, 19-18
    - string variables, description, 19-19
  - Main Edit Help Menu
    - description, 7-3
    - illustration, 7-4
  - managing, shape files, 18-47
  - Manual (F4), 3-8
  - MANUAL (F4), 11-13
  - Manual Data Input. See MDI
  - manual machines, tool changes, to output, 18-31
  - manual mode
    - feed, activating, 3-9
    - jog, continuous move, 3-11
    - jog, incremental move, 3-11
    - move types, 3-7
-

- 
- rapid, activating, 3-9
  - screen, illustration, 3-5
  - settings, 3-7
  - soft keys, illustration, 3-8
  - manual operation, 3-1
  - manual panel
    - illustration, 3-2
    - keys, listed, 3-3
    - LEDs, 3-4
  - manual screen, 3-5
  - manual tool diameter
    - measure for special tools, G153, 5-82
    - preset, G153
      - defined, 5-72
      - description, 5-82
  - manual tool-length measure for special tools, G152, 5-80
  - manual tool-length offset preset, G152
    - defined, 5-72
    - description, 5-80
  - MANUAL/AUTO/S.STEP, program area label, 3-6
  - mark
    - all programs, 10-7
    - program, 10-6
  - marked block, description, 6-2
  - marking, program blocks, 6-3
  - maximize, program storage, 10-4
  - maximum, memory allocated
    - description, 15-2
    - to change, 15-2
  - M-code
    - description, 12-1
    - entering, 7-35
    - functions, table, 12-2
    - listing, 7-34
    - M9387, probe select, 19-22
    - type in, manual, 7-36
  - MDI
    - defined, 3-11, 11-1
    - manual mode, 3-7
    - to use, 3-12
  - measure, length offsets, 9-7
  - memory, maximum allocated
    - description, 15-2
    - to change, 15-2
  - menus
    - ARCS Help Template Menu, 7-17
    - Block Operations, pop-up, 6-13
    - Contour Parameters Menu, 18-9
    - Display, pop-up, 8-9
    - Draw parameters, pop-up, 8-4
    - Drill Parameter Menus, illustration, 18-22
    - DRILL/TAP Help Template Menu, 7-29
    - Edit Help G-Code, 7-33
    - End N#, pop-up, 8-9
    - Help Template Menu, 7-8
    - Help Template Menu, illustration, 7-4
    - LINES Help Template Menu, 7-14, 7-15
    - Main Edit Help Menu, illustration, 7-4
    - MULTIPLE Help Template Menu, 7-22
    - PATHS Help Template Menu, 7-28
    - PLUNGE POCKETING Help Template Menu, 7-27
    - Pocket Parameter Menus, illustration, 18-15
    - POCKETING Help Template Menu, 7-26
    - pop-up, description, 2-6
    - POST Menu, illustration, 18-28
    - RAD/CHAMFER Help Template Menu, 7-20
    - Setup, 14-1
    - Shape Edit Menu, 18-4
    - Software Options Menu, 3-1
    - Start N#, pop-up, 8-8
  - message
    - displayed, 2-8
    - error, displayed, 2-8
    - line, manual screen area, 3-5
    - priority, 2-8
    - storage, 2-8
  - Message (F1), 3-8
  - mill (sync-on), programming examples, 16-5, 16-6
  - milled pocket
    - X0 Y0 at center of radius, machining, 18-67
    - X0 Y0 at the center of the large radius, 18-73
  - milling cavities, 5-47
  - milling cores, 5-47
  - minus sign, address, example, 19-9
  - minutes to decimal, conversion formula, 16-1
  - mirror image, (M100), 12-3
  - mirror image, (M100), canceled by G92, 4-30
  - miscellaneous (F6) soft keys, listed, 18-40
  - miscellaneous codes. See M-codes
  - miscellaneous menu, DXF converter, F6, 17-6, 17-7
  - mm mode format, (G71), 4-28
  - modal corner rounding/chamfering, (G59, G60), 4-18
-

- modal function, 3-7
- modal G-codes
  - defined, 4-1
  - listed, table, 4-1
- modifiers
  - description, 19-1
  - listed, 19-1
- mold rotation, (G45), 5-47
- MOTION (F7), description, 18-8
- motion display area, manual screen area, 3-5
- motion mode
  - defined, 11-1
  - switch to single-step mode, 11-2
- move, shape, 18-5
- moves, with unknown endpoints, programming, 7-13
- MULTIPLE Help Template Menu
  - description, 7-21
  - parameters, table, 7-22
- multiple move
  - commands, 7-21
  - using Edit Help Menu, 7-22
- N**
- negative radius value, 7-16
- negative signs, 7-10
- nesting subprograms, 5-64
- new
  - program, creating, 10-3
  - shape, DXF miscellaneous menu (F6), description, 17-7
- nominal probe stylus diameter, 5-74
- non-modal G-codes
  - defined, 4-1
  - listed, table, 4-1
- non-synchronous rotary, description, 16-2
- NOT operator, description, 19-27
- notes, on geometry, 18-45
- number of parts, counter, 11-11
- number, program block:, 6-13
- O**
- OEM, common (global) variables, macro numbers, 19-7
- off-line
  - entity information, to display, 17-7
  - passwords, listed, 15-1
  - software
    - DXF converter, 17-1
    - installation, 15-1
    - to exit, 15-1
    - Windows, to install, 15-2
    - Windows, to run, 15-2
- offset mode, direction change, 9-20
- offsets
  - activate, via program, 9-25
  - tool page, entering, 9-7
- Offsets (F1), 9-26
- one shot moves, 3-11
- operating mode, current, 3-6
- operator, prompts, 2-7
- operators, listed, functions, 19-4
- optimize, hard drive, 10-15
- optional entry fields, description, 7-10
- optional program stop, (M01), 12-2
- order of execution, codes, 12-4
- order of operations, 19-11
- Other, list programs, 10-6
- output format pop-up menu, illustration, 17-18
- outside corner finding, G142, 5-91
- outside part corner find, G142
  - defined, 5-86
  - description, 5-91
- outside profile
  - cutting, 5-36
  - ramp moves, illustration, 5-38
  - using contour, machining, 18-55
  - with contour, machining, 18-48
- override, continuous path parameter, (M1000), 12-4
- OVERRIDE, machine status display, 3-6
- P**
- P/N 70000509, *5000M CNC Setup Utility Manual*, referenced, 3-14, 5-71, 14-1
- page down, feature, 6-9
- page up, feature, 6-9
- Pan, command, 8-12
- Pan, display function, 18-40
- parameter register, description, 19-8
- parameters
  - description, 19-8
  - protected, to access, 15-1
  - viewing, 8-4
- parametric programming
  - description, 19-8
  - parenthesis, example, 19-9
- parenthesis, example, 19-9
- parity, to set, 13-3
- Parms (F9), 8-9
- Parms, description, 8-1

- part programs, display, 10-6
- part zero
  - location, 1-2
  - setting, 1-5
  - to set, (G92), 4-30
  - Z-axis, 9-6
- parts counter, CNC, description, 11-11
- PARTS, machine status display, 3-6
- passing, macro parameters, 19-15
- passwords, off-line, listed, 15-1
- path number, 18-27
- PATHS Help Template Menu, parameters, table, 7-28
- paths, option, description, 18-27
- pattern drill cycles, 5-13
- P-code, M99, end subprogram, 5-67
- peck drilling cycle, (G83), 5-7
- pending, messages, 2-8
- pick program, feature, 6-15
- plane
  - illustration, 1-7
  - selection, 1-7
- plane selection
  - (G17, G18, G19), 4-10
  - description, 1-7
  - illustration, 4-11
- plane selection, XY G17, 5-86
- play keys, feature, 6-12
- plunge circular pocket milling, (G177), 5-44
- PLUNGE POCKETING Help Template Menu, parameters, table, 7-27
- plunge rectangular pocket milling, (G178), 5-46
- pocket
  - cycles, description, 5-16
  - description, 18-15
  - machining, using Pocket, Contour, and Drill, 18-77
  - menus soft keys, listed, 18-21
  - milled in workpiece
    - machining, 18-65
    - X0Y0 at lower-left corner, illustration, 18-70
  - Parameter Menus, illustration, 18-15
  - Parameters 1 Menu, parameters, listed, 18-16
  - Parameters 2 Menu, parameters, listed, 18-17
  - with islands (G162)
    - CAM, pocket parameters pop-up menu, 18-83
    - description, 5-29
    - DXF, program example, 17-20
    - subroutines, example, 5-29
    - using CAM, 18-21, 18-82
    - using DXF, 17-18
- POCKETING Help Template Menu, parameters, table, 7-26
- point tools, templates, listed, 18-43
- polar coordinates, description, 1-5
- pop-up menus
  - Block Operation, 6-13
  - CAM, pocket parameters, 18-83
  - description, 2-6
  - Misc, 18-41
  - miscellaneous menu, DXF converter, F6, 17-6, 17-7
  - output format, 17-18
  - program listing, 17-19
  - RefProg, fixture offsets, illustration, 9-26
  - S-EDIT, 18-6
- position
  - defining, 1-4
  - display modes, listed, 11-4
  - display, Z-axis, 9-6
  - locating, illustration, 1-4
- positive radius value, 7-16
- positive value, assumed, 7-10
- POST (F8), description, 18-25, 18-27
- POST Menu
  - illustration, 18-28
  - parameters, listed, 18-29
  - saving, parameter settings, 18-30
- post processor, automatic tool changes, to output, 18-30
- powering
  - off, 3-1
  - on, 3-1
- practice, examples, 18-85
- precautions, general, 9-21
- Print ?, 10-13
- print program, feature, 6-14
- PRINT variable, description, 19-8
- print, portion of program, 6-14
- printer, installation, 14-2
- printing
  - programs, 10-9
  - programs, from another source, 10-13
- probe
  - cycles, description, 5-71
  - diameter of tool probe gauge, 5-73
  - M9387, M-code, probe select, 19-22

- move, (G31), 4-15, 5-71, 19-22
- nominal probe stylus diameter, 5-74
- orientation, 5-74
- orientation, description, 5-74
- RPM for calibration and tool measurement, 5-74
- spindle cycles
  - description, 5-86
  - G-code designations, 5-86
  - listed, 5-87
- spindle, canned cycle, settings, 5-87
- to calibrate, description, 5-73
- tool cycles
  - description, 5-71, 5-72
  - tool probe G-code cycle designations, 5-72
- tool-length offset, description, 5-71
- XY retract amount, 5-74
- Z first pick, FAST feedrate, 5-76
- Z first pick, MEDIUM feedrate, 5-74
- Z first pick, SLOW feedrate, 5-76
- Z rapid to start position from home, 5-77
- Z retract amount, 5-74
- profile, cut, use Contour, 18-8
- program
  - access, most recent used, 6-15
  - area, labels, 3-6
  - area, manual screen area, 3-5
  - block
    - displaying, 10-5
    - Help Graphic Screens, use, 7-10
  - blocks, copy, 6-16
  - cancel, Draw, 8-3
  - copy, other directories, 10-12
  - copy, to floppy disk, 10-9
  - create, new program, 10-3
  - definition, 1-3
  - delete, 10-5
  - delete, groups, 10-8
  - delete, on another drive, 10-14
  - display, soft keys listed, 10-5
  - edit, in another directory, 10-15
  - editor
    - activating, 6-1
    - activating, from Draw Graphics, 6-1
    - activating, from Manual Screen, 6-1
    - activating, from Program Directory, 6-1
  - end, M02, 12-2
  - end, M2, 12-2
  - end, M30, 12-2
  - formats, list all, 10-2
  - fragment, checking disk, 10-10
  - getting started, 1-2
  - halted, clearing, 11-5
  - list, in another source, 10-14
  - listing
    - pop-up menu, illustration, 17-19
  - loading, 10-3
  - management, 10-1
  - mark, 10-6
  - mark all, 10-7
  - multiple move, using Edit Help Menu, 7-22
  - name, 3-6
  - name, description, 6-2
  - names, choosing, 10-3
  - offsets, activate, 9-25
  - parameters pop-up menu, illustration, 18-83
  - parts counter, description, 11-11
  - parts counter, illustration, 11-11
  - print, 6-14
  - print, portion, 6-14
  - printing, 10-9
  - printing, from another source, 10-13
  - program, copy, 6-16
  - rename, 10-9, 10-13
  - restore, 10-8
  - running, 11-1
  - running, one step at a time, 11-1
  - run-time timer, description, 11-11
  - scroll, feature, 6-9
  - select, for editing, 10-3
  - stop, (M00), 12-2
  - storage, maximize, 10-4
  - T-code, tool page offset, 9-9
  - timer, description, 11-11
  - timer, illustration, 11-11
  - tool path, general precautions, 9-21
  - undelete, 10-8
  - unmark, 10-7
  - unmark all, 10-7
  - using real time Draw, while running programs, 11-6
  - viewing, 8-1
  - wildcards, using, 10-11
- Program (F2), 3-8
- program, block
  - cancel edits, 6-5
  - copy and delete, 6-11
  - copying, 6-11
  - deleting, 6-4

- 
- mark and save, 6-11
  - marking, 6-3
  - number, 6-13
  - paste, within program, 6-12
  - renumber, 6-13
  - unmarking, 6-3
  - program, directory
    - access, CNC programs, 10-2
    - description, 10-1
    - display, changing, 10-2
    - illustration, 10-1
  - program, listing
    - description, 6-2
    - include comments, 6-17
    - open program, 6-15
  - PROGRAM, program area label, 3-6
  - programmed, hold, 3-6
  - programming
    - angular motion, example, 4-4
    - arcs, description, 7-15
    - axis rotation, examples, 4-25
    - block separators, description, 19-1
    - circular profile cycle, 5-36
    - concepts, 1-3
    - conventions, rotary axis, 16-2
    - corner rounding/chamfering, example, 4-19
    - elbow milling cycle, 5-58
    - exact stop check, non-modal, G9, 4-10
    - examples
      - description, 16-3
      - drill (sync-off), 16-4
      - mill (sync-on), 16-5, 16-6
    - expressions, description, 19-4
    - expressions, examples, 19-5
    - expressions, listed, 19-4
    - facing cycles, 5-34
    - five-axis, description, 16-1
    - four-axis, description, 16-1
    - functions, description, 19-4
    - functions, listed, 19-4
    - G41, example, 9-22
    - G42, example, 9-23
    - G-code, from listing, 7-32
    - modifiers, listed, 19-1
    - moves, with unknown endpoints, 7-13
    - parametric, description, 19-8
    - part's edge, 9-10
    - rectangular profile cycle, 5-38
    - single moves, 3-11
    - subprogram, example, 5-66
    - subprogram, multiple parts, 5-67
    - thread mill cycle, 5-40
    - tool offset modification, example, 19-3
    - user variables
      - block skip, description, 19-7
      - common (global), description, 19-7
      - description, 19-7
      - local, description, 19-7
      - read only, description, 19-7
      - variable, description, 19-8
  - programs
    - block separators, description, 19-1
    - receiving, 13-7
    - sending, description, 13-7
  - project feature
    - description, 18-6
    - remove, a radius, 18-38
    - restore, sharp corner, 18-38
  - projecting, line segments, 18-6
  - prompts, 3-5
  - prompts, operator, 2-7
  - protected parameters, to access, 15-1
  - protected positioning move, G146
    - defined, 5-87
    - description, 5-99
  - protected probe positioning, G146, 5-99
  - protocol, to set, 13-4
- Q**
- quill position, Z0, 9-6
  - Quit (SHIFT+F10), description, 18-31
- R**
- R, hot key, 18-39, 18-47
  - RAD/CHAMFER Help Template Menu,
    - parameters, table, 7-20
  - radius, large mold rotation, illustration, 5-53
  - radius, remove, 18-6
  - ramp move, 9-11
  - ramp position, inside & outside profile,
    - illustration, 5-36
  - rapid move
    - speed, adjusting, 3-9
    - viewing, 8-5
  - rapid traverse (G0)
    - description, 4-2
    - illustration, 4-2
    - program blocks, 4-3
  - Rapid, mode, 3-10
  - read only variables, description, 19-7
  - readout axis preset, (M9247), 12-4
-

- real time Draw, using while running programs, 11-6
  - real time mode, Draw screen, 11-6
  - receive, 13-1
  - receive area, to clear, 13-7
  - receive mode, data control codes, to use, 13-9
  - receiving
    - display, to set, 13-8
    - operations, to hold, 13-8
    - program, 13-7
  - record keys, feature, 6-12
  - recover paths, soft key, 18-41
  - recover shapes, soft key, 18-41
  - rectangular pocket milling, (G78), 5-25
  - rectangular profile cycle, (G172), 5-38
  - reference point
    - return from, (G29), 4-15
    - return to, G28, 4-14
  - RefProg
    - fixture offsets, pop-up menu, 9-26
    - offset, description, 9-26
  - RefProg (F1), 9-26
  - remaining, seconds, 3-6
  - remove
    - a radius, 18-38
    - radius, 18-6
  - rename
    - program, 10-9
    - programs, 10-13
  - renumber, program block, 6-13
  - repeat command, feature, 6-13
  - repeat function, 5-68
  - repeat, G-code output, 18-29
  - required entry fields, description, 7-10
  - Reset Rotary at 360, parameter, 16-2
  - reset, after stop, 3-1
  - resetting, the servos, 3-2
  - restart, Draw, 8-7
  - restarting, program on hold, 11-2
  - restore
    - block, feature, 6-5
    - deleted blocks
      - description, 6-5
      - using editing pop-up menu, 6-5
      - using SHIFT soft key menu, 6-5
    - programs, 10-8
    - sharp corner, 18-38
    - sharp corners, 18-6
  - Resume (F2), 13-8
  - retrieve, recorded keystrokes, 6-12
  - RETURN (F6), 11-14
  - return from subprogram, (M99), 12-3
  - reverse, arc direction, 18-6, 18-38
  - reviewing, messages, 2-8
  - rotary
    - non-synchronous, description, 16-2
    - synchronous, description, 16-2
  - rotary axis
    - programming conventions, 16-2
    - programming, in absolute, 16-2
    - programming, in incremental, 16-2
  - rotating XY mold around Z, illustration, 5-52
  - rotation
    - around X and Y axes
      - large radius, 5-53
      - small radius, 5-49
    - around Z-axis, 5-54
  - round, a corner, 18-37
  - RPM for calibration and tool measurement, 5-74
  - RPM, machine status display, 3-6
  - RS-232 cable, 13-1
  - Run, parameter, 8-7
  - running
    - DNC, 13-9
    - program, one step at a time, 11-1
    - programs, 11-1
  - RUNNING, program area label, 3-6
- ## S
- S.Step (F5), 3-8
  - sample, CAM programs, 18-48
  - saving, edits, 6-4
  - saving, POST parameter settings, 18-30
  - Scale, display function, 18-40
  - scale, Draw, display size, 8-10
  - Scaling (G72) Help Graphic Screen, to access, 7-1
  - S-code, description, 12-1
  - screen clutter, eliminate, 8-5
  - screen saver, 2-6
  - screens
    - Auto, illustration, 11-4
    - communication, 13-2
    - COMPENSATION Help Graphic Template Screen, 7-11
    - DNC, 13-10
    - Draw (real time mode), 11-6
    - Draw simulation mode, 8-2
    - edit, illustration, 6-2



- 
- Enlarged Position Display, illustration, 11-7
  - Help Graphic Screen, 7-6
  - manual mode, 3-5
  - Scaling (G72) Help Graphic Screen, 7-1
  - Single-Step/Motion, illustration, 11-2
  - system information, 10-4, 10-10
  - Test Link, 13-6
  - scroll, feature, 6-9
  - search
    - for text, 6-6
    - for word, 6-6
  - SEARCH
    - to select, auto mode, starting block, 11-5
    - using to select, single-step mode, starting block, 11-3
  - secondary soft keys, listed, 9-4
  - seconds to degrees, conversion formula, 16-1
  - seconds, remaining, 3-6
  - S-EDIT (F3), description, 18-4
  - segment, delete, at forward end of shape, 18-39
  - selecting
    - axis, 3-10
    - communication, 13-3
    - program for editing, 10-3
    - program for utilities, 10-3
  - send mode, data control codes, to use, 13-9
  - sending, program, 13-7
  - series of holes, using Drill, machining, 18-75
  - SERVO RESET key, illustration, 3-3
  - servos
    - activating, 3-2
    - disengage, 3-1
    - reset, 3-2
    - shut-off code, (M9244), 12-4
  - set advanced scaling, (M700), 12-3
  - set shift, DXF miscellaneous menu (F6), description, 17-7
  - set software limits, (G22), 4-12
  - setting
    - baud rate, 13-3
    - data bits, 13-4
    - data type, 13-5
    - macro parameters, 19-15
    - parity, 13-3
    - part zero, 1-5
    - protocol, 13-4
    - receiving display, 13-8
    - software, 13-4
    - stop bits, 13-4
    - test link display modes, 13-6
    - transmission display, 13-8
    - variables, 19-9
  - SETUP (F9), description, 18-25
  - Setup Menu, 14-1
  - shape
    - (F2), CAM mode, soft keys, listed, 18-3
    - CAM
      - extension, 17-11
      - to create, 17-21
      - to view, 17-21
    - chaining geometry elements, to create, 18-46
    - corner, restore, 18-6
    - cursor, using, 18-32
    - delete, 18-38
    - delete, a move, 18-8
    - delete, segment at forward end, 18-39
    - details, view listing, 18-40
    - Edit Menu, description, 18-4
    - edit, soft keys, 18-37
    - editing tools, illustration, 18-33
    - files, managing, 18-47
    - import, 18-7
    - import, from another program, 18-39
    - in G-code programs, 18-48
    - join, colinear lines, 18-7
    - list, soft key, 18-40
    - number, 18-26
    - number, parameter, 18-10
    - option, description, 18-26
    - pocket, description, 18-15
    - reversed, parameter, 18-12, 18-19
    - segment details, to view, 18-40
    - to cope, 18-5
    - to create, 18-4
    - to delete, 17-3, 18-6
    - to move, 18-5
  - short form addressing, table, 19-25
  - shutting down, CNC, 3-1
  - simulating, programs, 8-1
  - simulation size
    - change, 8-12
    - double, 8-12
    - half, 8-12
  - single surface measure/edge find, G141
    - defined, 5-86
    - description, 5-90
  - single-step mode
    - auto mode, switch to, 11-3
    - defined, 11-1
-

- MOTION mode, 11-1
- motion mode, switch to, 11-2
- program, to run, 11-1
- S.STEP mode, 11-1
- starting block, select
  - using arrows, 11-3
  - using SEARCH, 11-3
- single-step run, hold execution, 11-2
- single-step/motion screen, 11-2
- skew error find, G147, 5-100
- skew error or angle find, G147
  - defined, 5-87
  - description, 5-100
- slot using contour, machining, 18-52
- SLOTMAC.G macro program, example, 19-18
- soft key labels, description, 6-2
- soft key labels, highlighted, active mode, 3-6
- soft keys
  - calc distance, description, 18-41
  - calibrate keys, change fixture offset, 4-17
  - CAM mode, listed, 18-3
  - CAM mode, Shape (F2) listed, 18-3
  - CAM mode, to activate, 18-2
  - contour screen, listed, 18-14
  - display program, listed, 10-5
  - DXF converter, descriptions, 17-6
  - edit help, listed, 7-7
  - editing keys, description, 6-2
  - geometry list, description, 18-40
  - jog/return, listed, 11-13
  - labels, description, 2-6
  - manual mode, illustration, 3-8
  - miscellaneous (F6), listed, 18-40
  - pocket menus, listed, 18-21
  - recover paths, description, 18-41
  - recover shapes, description, 18-41
  - secondary, tool page, listed, 9-4
  - shapes list, description, 18-40
  - teach mode, listed, 11-8
  - tool page, listed, 9-4
- software
  - basics, description, 2-6
  - exiting, off-line, 15-1
  - limits, envelope parameters, illustration, 4-12
  - parameters, 13-1
  - setting, 13-4
- Software Option Kit, installation, 14-1
- Software Options Menu, 3-1
- spindle
  - at end, parameter, 18-14
  - at start, parameter, 18-14
  - off, (M5), 12-2
  - on forward, (M3), 12-2
  - on reverse, (M4), 12-2
  - orientation, (M19), 12-2
  - override, setting, 3-6
  - probe calibration cycle, G140
    - defined, 5-86
    - description, 5-88
  - probe cycles
    - description, 5-86
    - G-code, description, 5-86
    - listed, 5-87
  - probe, canned cycle, settings, 5-87
  - speed, 3-6
  - speed control, description, 12-1
  - speed, parameter, 18-14
  - sync, 5-8
- SPINDLE FORWARD key, illustration, 3-3
- SPINDLE OFF key, illustration, 3-3
- SPINDLE OVERRIDE switch, illustration, 3-3
- SPINDLE REVERSE key, illustration, 3-3
- spiral, (G6), 5-3
- spot drilling cycle, (G81), 5-6
- START key, illustration, 3-4
- Start N#, parameter, 8-8
- start of block, feature, 6-6
- start of program, feature, 6-6
- starting block, select
  - auto mode, using SEARCH, 11-5
  - single-step mode, using SEARCH, 11-3
  - using arrow keys, 11-5
  - using arrows, 11-3
- Starting Draw, 8-1
- starting point
  - effects on size, illustration, 5-61
  - orientation, illustration, 5-60
- status items, listed, 8-3
- stepover
  - approach, 5-34
  - direction, 5-34
  - direction, parameter, 18-11
  - parameter, 18-10
  - value, 5-35
- stop bits, to set, 13-4
- stop, emergency, 3-1
- storing, result of computation, 19-11
- string variables, description, 19-19
- Sub Dir, 10-14

- subdirectory, creating, 10-14
- subprogram
  - addresses, 5-63
  - call, (M98), 12-2
  - description, 5-63
  - file inclusion, description, 19-27
  - loop, repetition, 5-64
  - M9367, correct tool diameter, irregular pocket milling, 5-28
  - nesting, 5-64
  - orientation, illustration, 5-49
  - P-code, M99, end subprogram, 5-67
  - programming
    - example, 5-66
    - example, illustration, 5-65
    - multiple parts, 5-67
    - specifics, illustration, 5-50
  - subroutines, pockets with islands, example, 5-29
  - suppress, G-code output, 18-29
  - synchronous rotary, description, 16-2
  - system
    - information screen, illustration, 10-4
    - information, displaying, 10-10
- T**
- tapping canned cycle, (G84), 5-8
- T-code, description, 9-5
- T-code, tool page offset, 9-9
- Teach (F5), 3-8
- teach mode, 3-10
  - data, inputting, 11-9
  - description, 11-7
  - soft keys, listed, 11-8
  - to exit, 11-10
  - to start, 11-8
  - using, 11-10
- template lettering conventions, listed, 18-32
- templates
  - arc, illustration, 18-36
  - circle tools, listed, 18-45
  - compensation help graphic, listed, 7-11
  - line segment endpoint definition, illustration, 18-35
  - line segment, illustration, 18-34
  - line tools, listed, 18-44
  - point tools, listed, 18-43
- test link display modes, to set, 13-6
- test link screen, to activate, 13-6
- testing, data link, 13-5
- testing, link, 13-7
- text, deleting, 2-7
- THEN, conditional statement, 19-23
- thread mill cycle, (G181), 5-40
- thread mill cycle, (G181), sample program, 5-42
- timer, CNC, description, 11-11
- TIMER, machine status display, 3-6
- TLO. See tool-length offset, See tool-length offset
- TLO, defined, 5-71
- toggle endpoints, DXF miscellaneous menu (F6), description, 17-7
- Tool (F9), 3-8, 9-26
- TOOL (F9), 11-14
- tool breakage, length and diameter wear detection, G154
  - defined, 5-72
  - description, 5-84
- tool center, 9-10
- tool change, parameter, 18-13
- tool compensation
  - acute angles, around, 9-19
  - cancel mode, (G40), 9-14
  - direction, change, 9-15
  - Draw, description, 8-5
  - tool motion, 9-17
- Tool Compensation, parameter, 18-10
- tool definition block, defined, 9-5
- tool diameter
  - compensation
    - ball end mill, using, 9-14
    - left-hand, (G41), 9-10
    - plane you select, 1-7
    - right-hand, (G42), 9-11
  - correct for irregular pocket milling, M9367, 5-28
  - temporary change, 9-16
  - to measure, 5-83
- Tool diameter, parameter, 18-10
- tool edge, 9-10
- tool length and diameter offset preset, G151
  - defined, 5-72
  - description, 5-75
- tool management, 9-1
- tool motion, tool compensation, 9-17
- tool number, to find, 9-3
- Tool Off, Draw, description, 8-4
- tool offset, modification
  - permanent, description, 19-2
  - permanent, format, 19-3
  - programming, example, 19-3

- temporary, description, 19-2
  - temporary, format, 19-2
  - Tool On, Draw, description, 8-4
  - tool page
    - cursor, description, 2-7
    - definition, 9-1
    - diameter offset, 9-9
    - features, listed, 9-2
    - offsets, entering, 9-7
    - row, to clear, 9-3
    - single value, to adjust, 9-4
    - single value, to clear, 9-3
    - soft keys, listed, 9-4
    - soft keys, secondary, listed, 9-4
    - specific tool number, to find, 9-3
    - to activate, 9-1
    - tool-length offset, 9-6
    - using, 9-2
    - values, changing, 9-3
  - tool path
    - color, parameter, 18-12, 18-19
    - compensation, (G41, G42), 9-10
    - to change, 18-8
    - to delete, 18-8
    - to generate, 18-8
  - tool probe calibration cycle, G150
    - defined, 5-72
    - description, 5-73
  - tool probe cycles
    - description, 5-71, 5-72
    - tool probe G-code cycle designations, 5-72
  - tool, activation, 9-5
  - TOOL, machine status display, 3-6
  - tool-length offset
    - description, 9-6
    - probe, description, 5-71
    - setting, 9-8
  - top of contour, parameter, 18-11
  - top of pocket, parameter, 18-16
  - Total Blks Rec, 13-10
  - total free user space, 10-4
  - total space, available, system, 10-4
  - TPI/Lead, 5-8
  - transferring, variables, 19-9
  - transmission display, to set, 13-8
  - transmission operations, to hold, 13-8
  - transmit, 13-1
  - transmit area, to clear, 13-7
  - troubleshooting, DXF converter, 17-5
  - typeover mode, 2-7
  - typing in, address words, 7-35
- ## U
- U-axis
    - M900, example, 12-4
    - M901, example, 12-4
    - programming conventions, 16-2
    - programming, in absolute, 16-2
    - programming, in incremental, 16-2
  - unary minus, example, 19-9
  - unconditional LOOP repeat, description, 19-25
  - undelete, programs, 10-8
  - unmark
    - a program, 10-7
    - all programs, 10-7
    - program blocks, 6-3
  - unsaved edits, canceling, 6-4
  - USER listing, 10-1
  - user macro G-codes, listed, 19-14
  - user macros (G65, G66, G67), description, 19-14
  - user macros, (G65, G66, G67), 4-21
  - user variables
    - block skip, description, 19-7
    - common (global), description, 19-7
    - description, 19-7
    - local, description, 19-7
    - read only, description, 19-7
  - using, data control codes, 13-8
- ## V
- variable
    - direct transfer, 19-9
    - indirect transfer, 19-9
    - programming
      - description, 19-8
      - example 1, 19-11
      - example 2, 19-12
    - register, description, 19-8
    - setting, 19-9
  - view
    - listing of geometry elements, 18-46
    - listing of shape segment details, 18-40
  - View (F4) function, description, 18-7
  - viewing, programs, 8-1
- ## W
- warranty, iii
  - WHILE, conditional statement, 19-23

WHILE-DO-END, conditional statement,  
19-24

wildcard, (\*), 10-12

wildcards, using, 10-11

Window, display function, 18-40

window, sized, 8-11

Windows, off-line software

to install, 15-2

to run, 15-2

work coordinate offset, axis, 9-26

work offset, Z-axis, 9-27

## X

X302, clear, 12-4

X-axis, description, 1-3

Xoff, 13-4

Xon, 13-4

XY G17, plane selection, 5-86

XY location, defined, 18-30

XY passes, number of, parameter, 18-10

XY retract amount, 5-74

XY stepover, parameter, 18-10

XY-axis mold rotation, illustration, 5-48

## Y

Y-axis, description, 1-4

## Z

Z feedrate, parameter, 18-14

Z first pick

FAST feedrate, 5-76

MEDIUM feedrate, 5-74

SLOW feedrate, 5-76

Z Location, description, 18-30

Z position, enter, manually, 9-9

Z rapid to start position from home, 5-77

Z retract amount, 5-74

Z step, parameter, 18-11

Z0, quill position, 9-6

Z-axis

description, 1-4

M801, example, 12-4

mold rotation, illustration, 5-54

move startup, 9-15

part zero, 9-6

position display, 9-6

rotation start, end angles, illustration,  
5-55

rotation subprogram details, illustration,  
5-55

work offset, 9-27

zero degree reference, 1-6

Zero fill, description, 18-30

ZHOME (F3), 11-13

zoom, display, 8-11

zoom, Draw window, 8-11

# ANILAM

## U.S.A.

ANILAM

One Precision Way  
Jamestown, NY 14701

☎ (716) 661-1899

☎ (FAX) (716) 661-1884

✉ anilaminc@anilam.com

## ANILAM, CA

16312 Garfield Ave., Unit B  
Paramount, CA 90723

☎ (562) 408-3334

☎ (FAX) (562) 634-5459

✉ anilamla@anilam.com

**Dial "011" before each number when calling  
from the U.S.A.**

## France

ANILAM S.A.R.L.

2 Ave de la Cristallerie  
B.P. 68-92316

Serves Cedex, France

☎ +33-1-46290061

☎ (FAX) +33-1-45072402

✉ courrier@acu-rite.fr

## Germany

ANILAM GmbH

Fraunhoferstrasse 1  
D-83301 Traunreut

Germany

☎ +49 8669 856110

☎ (FAX) +49 8669 850930

✉ info@anilam.de

## Italy

ANILAM Elettronica s.r.l.

10043 Orbassano

Strada Borgaretto 38  
Torino, Italy

☎ +39 011 900 2606

☎ (FAX) +39 011 900 2466

✉ info@anilam.it

## Taiwan

ANILAM, TW

No. 246 Chau-Fu Road  
Taichung City 407

Taiwan, ROC

☎ +886-4 225 87222

☎ (FAX) +886-4 225 87260

✉ anilamtw@anilam.com

## United Kingdom

ACI (UK) Limited

16 Plover Close, Interchange Park  
Newport Pagnell

Buckinghamshire, MK16 9PS

England

☎ +44 (0) 1908 514 500

☎ (FAX) +44 (0) 1908 610 111

✉ sales@aciuk.co.uk

## China

Acu-Rite Companies Inc.(Shanghai Representative Office)

Room 1986, Tower B

City Center of Shanghai

No. 100 Zunyi Lu Road

Chang Ning District

200051 Shanghai P.R.C.

☎ +86 21 62370398

☎ (FAX) +86 21 62372320

✉ china@anilam.com